

# Progressive Car Care Pte Ltd

Blk 3022A Ubi Road 1 #01-45/46 Singapore 408716

TEL: 6741 5336 FAX: 6741 7208

Email: claims@procarcare.com.sg

GST REG NO: 201006949C Company Reg No: 201006949C

**MS FIRST CAPITAL INSURANCE LIMITED**

6 Raffles Quay

#21-00

Singapore 048580

Tel: 62222311

Fax: 62223547

Attn: Motor Claim Department \ FIRST CAPITAL

Your Ref No: TP 1124-8376

Claim Type: Third Party

Accident Date: 28 November 2024

TP Veh Reg No: SHD7237Y

*not authorized  
near  
3/11/24  
1/3 @ 5250  
alph...  
4 days*

**Estimate No:**

**EST1512095**

Date:

29 Nov 2024

Policy No:

P10708124R02

Veh Reg No:

SMJ5532S

Make/Model:

MITSUBISHI

Chassis No:

OUTLANDER 2.0 CVT

Engine No:

GF7W0600635

Reg. Date:

12 Mar 2019

**Estimate Repair Cost to Vehicle No: SMJ5532S**

Description	Unit Price	Quantity	List Price SGD	Amount SGD
<i>Nett</i> <b>List Price</b>				
1 REAR BUMPER WITH LOWER BLACK	<i>D.S</i> 1,400.00	1 PC	1,400.00	✓
2 REAR BUMPER SIDE RETAINER - LH/RH	<i>o/s part</i> 25.00	2 PC	50.00	✓
3 REAR BUMPER CLIPS	<i>net</i> 10.00	10 PC	100.00	✓
4 REAR BUMPER LOWER, SILVER	<i>D.S</i> 490.00	1 PC	490.00	✓
5 REAR BUMPER LAMP - RH	<i>one</i> 130.00	1 PC	130.00	✓
6 REAR BUMPER REINFORCEMENT BRACKET - LH/RH	<i>o/s part</i> 88.00	2 PC	176.00	✓
7 REAR BUMPER SIDE ARCH GARNISH - RH	<i>D.S</i> 130.00	1 PC	130.00	✓
8 TAILGATE	<i>o/s part</i> 1,200.00	1 PC	1,200.00	✓
9 TAILGATE GLASS MOULDING	<i>net</i> 210.00	1 set	210.00	✓
10 TAILGATE REFLECTOR - RH-	<i>17</i> 490.00	1 PC	490.00	X
11 TAILGATE OUTLANDER WORDINGS	<i>net</i> 110.00	1 PC	110.00	✓
12 TAILGATE MIVEC LOGO	<i>net</i> 105.00	1 PC	105.00	✓
13 TAILGATE WEATHERSTRIP-	<i>17</i> 250.00	1 PC	250.00	X
14 TAILGATE LOCK	<i>17</i> 430.00	1 PC	430.00	X
15 TAILGATE LOWER INNER TRIM	<i>17</i> 340.00	1 PC	340.00	X
16 REAR END PANEL	<i>o/s</i> 350.00	1 PC	350.00	✓
17 REAR END PANEL TOP GARNISH	<i>17</i> 160.00	1 PC	160.00	X
18 REAR END PANEL BUZZER	<i>17</i> 130.00	1 PC	130.00	X
19 TAIL LAMP - RH	<i>17</i> 590.00	1 PC	590.00	X
20 TAIL LAMP CLIPS - RH-	<i>17</i> 11.00	4 PC	44.00	X
21 TAIL LAMP PANEL (UPPER) - RH-	<i>17</i> 350.00	1 PC	350.00	X
22 TAIL LAMP PANEL (LOWER) - RH-	<i>17</i> 140.00	1 PC	140.00	X
23 REAR FENDER COWLING (REAR) - RH	<i>17</i> 48.00	1 PC	48.00	X
24 REAR FENDER COWLING CLIPS - RH	<i>17</i> 7.00	10 PC	70.00	X
25 REAR EXHAUST SILENCER	<i>o/s part</i> 650.00	1 PC	650.00	X
26 REAR EXHAUST SILENCER TOP HEAT SHIELD	<i>net</i> 190.00	1 PC	190.00	X
27 REAR EXHAUST SILENCER TOP MOUNTING	<i>net</i> 42.00	1 PC	42.00	✓
28 REAR CENTER EXHAUST	<i>net</i> 2,100.00	1 PC	2,100.00	X
			10,475.00	
		Less 10%	-1,047.50	9,427.50

*5030  
1170  
4860*

**Special Net**

29 REAR BUMPER SENSOR	<i>malfunction</i> 200.00	<i>1 PC / car</i>	200.00	✓
30 SEALANT <i>rear windscreen</i>	<i>net</i> 20.00	2 PC	40.00	✓
31 SPONGE TAPE <i>rear windscreen</i>	<i>net</i> 20.00	1 PC	20.00	✓

260.00

**Labour**

# Progressive Car Care Pte Ltd

Blk 3022A Ubi Road 1 #01-45/46 Singapore 408716

TEL: 6741 5336 FAX: 6741 7208

Email: claims@procarcare.com.sg

GST REG NO: 201006949C Company Reg No: 201006949C

32	TO KNOCK OUT DENTS ON REAR RH CHASSIS MEMBER, FLOOR PANEL, CUT/WELD END PANEL, TAILLAMP PANEL RH, REMOVE, REPLACE ACCIDENT PORTIONS	1,100.00	1 PC	1,100.00	600
33	TO RESPRAY PAINT ON ACCIDENT PORTIONS	1,200.00	1 PC	1,200.00	800
34	TO CHECK WIRING	50.00	1 PC	50.00	20
35	TO REMOVE, REPLACE REAR BUMPER SENSOR	80.00	1 PC	80.00	30
36	TO REMOVE, REFIT GARNISH TO FACILITATE REPAIR	150.00	1 PC	150.00	60
37	TO ANTI RUST	80.00	1 PC	80.00	50
38	TO TRANSFER TAILGATE FITTINGS	100.00	1 PC	100.00	60
39	TO REMOVE, REFIT REAR GLASS	150.00	1 PC	150.00	120
40	TO REMOVE, REPLACE REAR EXHAUST SILENCER & CENTER EXHAUST	200.00	1 PC	200.00	60
					3,110.00

Total	12,797.50
Add GST @ 9%	1,151.78
Total Amount Payable SGD	13,949.28

**SINGAPORE DOLLAR THIRTEEN THOUSAND NINE HUNDRED FORTY NINE AND CENTS TWENTY EIGHT ONLY**


6881  
200  
5269

LKK Auto Consultants hence notify the Repairer of the following:

- To survey before/after spray painting
- To display damaged part(s) for survey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

For Progressive Car Care Pte Ltd

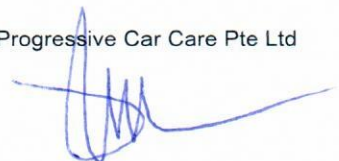

AUTHORISED SIGNATURE