

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/LPC 24/20038/UVH3**ASSIGNMENT**

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SLR 2060B

at Workshop m/s

VAC Aulsby

of

Insured:

GBM 5666M

Policy No.

Claims No. 24/24/24/VP05/030267

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: **The veh had commenced its repair at the time of inspection.**

N/S	O/S

Bal. or Market Value:

\$ 40k

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

5

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

502d

Date:

Person Contacted:

LTA 22450

Vehicle: IN / OUT

Veh No:

SLR 2060B

Yr Regn:

03/08/17Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA

Make:

Honda HRV 1.5 DX c.c 1496

Colour

Blue

A/C: Insured / Std / NI / NA

Sp. Reading

147019

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JHMRU18106X 202363Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

matrox

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

02/12/24

D.O.I.

3/12/24

Survey held at

Des. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop or215 Frnt 2The U/C Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Dep 13k.

24/12/24 heedy 2070.63
a/s @ 6400 inbound MR L.M (red 7521.04, 54%)

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 5

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS, \$

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	502D
Vehicle Details	
Vehicle No.:	SLR2060B
Vehicle to be Exported:	No
Intended Deregistration Date:	03 Dec 2024
Vehicle Make:	HONDA
Vehicle Model:	HRV 1.5 DX CVT
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	L15B4532362
Chassis No.:	JHMRU1810GX202363
Maximum Power Output:	96.0 kW (128 bhp)
Open Market Value:	\$19,728.00
Original Registration Date:	03 Aug 2017
First Registration Date:	03 Aug 2017
Transfer Count:	0
Actual ARF Paid:	\$14,728.00 7364
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	02 Aug 2027
PARF Rebate Amount:	\$8,836.00
Intended COE Rebate Details	
COE Expiry Date:	02 Aug 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$51,106.00
COE Rebate Amount:	\$13,614.00
Total Rebate Amount:	\$22,450.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 03 Dec 2024

OK



Honda HR-V 1.5A **\$41,000** \$12,790 /yr 19-Jul-2017 (2yrs 7mths COE left) 110,000 km 1,496 cc
DX Instl. \$1,016 /mth 2 Owners

Pristine showroom condition, agent unit. 1 year comprehensive warranty provided!
\$0 driveaway available from our own in house loan, instant same day loan approval!
High trade in valuation for your car!

Posted 01-Dec-2024

☐ Compare

Honda HR-V 1.5A **\$40,888** \$12,890 /yr 05-Jul-2017 (2yrs 7mths COE left) 110,000 km 1,496 cc
DX Instl. \$1,013 /mth 4 Owners

This is one of the most affordable SUV for many families due to its versatility, space, efficiency and reliability! Definitely the choice for short term drive and daily commute usage! STA/workshops welcome. Flexible finance with high approval rates. High evaluation trade in quotes! Warranty and servicing available! Contact our Now!


Posted 01-Dec-2024

☐ Compare

★ StarAd View All

Honda Odyssey 2.4A Sunroof COE till 02/2029 \$43800.

Lowest price in the market, 2 yrs warranty & 4 free servicing, acciden... Boss Motoring

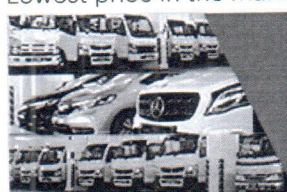

THE DEALER WITH
A DIFFERENCE

>> FIND OUT MORE <<



HIN LUNG AUTO PTE LT

One Stop Car Hub

Finance, Insurance, Workshop New and



Honda HR-V 1.5A **\$40,888** \$12,980 /yr 24-May-2017 (2yrs 5mths COE left) 119,000 km 1,496 cc
LX Instl. \$1,081 /mth 1 Owner

Agent unit! Well maintained! Genuine mileage! No repair needed! Additional 2 year warranty + 2 free servicing available! Consignment Unit, Viewing Strictly Via Appointments!

The Car Exchange Pte Ltd|Posted 30-Nov-2024

☐ Compare

Honda HR-V 1.5A **\$38,800** \$12,950 /yr 20-Feb-2017 (2yrs 2mths COE left) 114,000 km 1,496 cc
LX Instl. \$1,143 /mth 1 Owner

1 Owner Only, Service By KAH Motor, Free Servicing Available, Tip-Top Condition, Full Loan With Immediate Drive Away, Call For Viewing Now!

Posted 30-Nov-2024

☐ Compare

Compare

COMPUTERISED 4 WHEEL ALIGNMENT HUNTER DSP700

VIN:
Date

SLR 2060 B
2.12.24 16:33



SLR 2060 B

Factory Japan 2021.0.1 : Honda : Vezel : RU1

Front : Left

Actual	Before	Specified Range
-0°19'	-0°19'	-1°00' 1°00'
4°56'	4°56'	4°00' 6°00'
-0°09'	-0°10'	-0°08' 0°08'
		11°30' 13°30'
		10°30' 14°30'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1°58'	-1°59'	-1°00' 1°00'
5°00'	5°00'	4°00' 6°00'
-0°15'	-0°15'	-0°08' 0°08'
		11°30' 13°30'
		10°30' 14°30'

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
1°39'	1°39'	-0°45' 0°45'
-0°04'	-0°04'	
-7°38'	-7°38'	
-0°24'	-0°24'	-0°15' 0°15'

Rear : Left

Actual	Before	Specified Range
-1°28'	-1°28'	-2°30' -0°30'
0°05'	0°05'	0°00' 0°15'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-1°10'	-1°10'	-2°30' -0°30'
0°14'	0°14'	0°00' 0°15'

Rear

Cross Camber
Total Toe
Thrust Angle
Axle Offset

Actual	Before	Specified Range
-0°18'	-0°17'	-0°45' 0°45'
0°19'	0°18'	0°00' 0°31'
-0°05'	-0°05'	
0mm	0mm	

COMPUTERISED 4 WHEEL ALIGNMENT HUNTER DSP700

VIN:
Date

SLR 2060 B
5.12.24 15:26



SLR 2060 B

Factory Japan 2021.0.1 : Honda : Vezel : RU1

Front : Left

Actual	Before	Specified Range
-0°11'	-0°11'	-1°00' 1°00'
5°20'	5°20'	4°00' 6°00'
0°00'	0°00'	-0°08' 0°08'
		11°30' 13°30'
		10°30' 14°30'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
0°20'	0°20'	-1°00' 1°00'
5°17'	5°17'	4°00' 6°00'
-0°02'	-0°02'	-0°08' 0°08'
		11°30' 13°30'
		10°30' 14°30'

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
-0°30'	-0°30'	-0°45' 0°45'
0°03'	0°03'	
-3°30'	-3°30'	
-0°01'	-0°01'	-0°15' 0°15'

Rear : Left

Actual	Before	Specified Range
-1°45'	-1°45'	-2°30' -0°30'
0°06'	0°06'	0°00' 0°15'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-1°11'	-1°10'	-2°30' -0°30'
0°13'	0°13'	0°00' 0°15'

Rear

Cross Camber
Total Toe
Thrust Angle
Axle Offset

Actual	Before	Specified Range
-0°35'	-0°35'	-0°45' 0°45'
0°18'	0°18'	0°00' 0°31'
-0°04'	-0°04'	
0mm	0mm	

Not Authorized
for
MOTORS
3/12/24

5 days

2/5 \$ 6400

Value plus Akhary

Regn No : SLR2060B

Vehicle Make & Model : Honda HRV

ITEM NO	DESCRIPTION OF ITEMS	QUANTITY (Piece/Set)	UNIT PRICE (S\$)	AMOUNT (S\$)
List Items:				
1	Front bonnet ^1	1	\$ 892.50	\$ 892.50 X
2	Front bonnet lock ^1	1	\$ 118.50	\$ 118.50 X
3	Front bonnet lock cable ^1	1	\$ 86.90	\$ 86.90 X
4	Front bonnet seal - centre ^1	1	\$ 46.60	\$ 46.60 X
5	Front bonnet seals - L/R @ S\$48.20 ^1	2	\$ 48.20	\$ 96.40 X
6	Front bonnet insulator ^1	1	\$ 122.30	\$ 122.30 X
7	Front bonnet insulator clips @ S\$4.50 ^1	10	\$ 4.50	\$ 45.00 X
8	Front bonnet hinge RH ^1	1	\$ 55.10	\$ 55.10 X
9	Front bumper DIS	1	\$ 861.70	\$ 861.70
10	Front bumper tow cover ^1	1	\$ 24.60	\$ 24.60 X
11	Front bumper centre grille ^1	1	\$ 185.70	\$ 185.70 X
12	Front bumper lower spoiler DIS	1	\$ 381.70	\$ 381.70
13	Front bumper fog lamp RH one	1	\$ 308.50	\$ 308.50
14	Front bumper fog lamp grille RH 1w/	1	\$ 38.20	\$ 38.20
15	Front bumper fog lamp wire harness ^1	1	\$ 360.50	\$ 360.50 X
16	Front bumper undercover RH ^1	1	\$ 70.80	\$ 70.80 X
17	Front bumper reinforcement ^1	1	\$ 381.90	\$ 381.90 X
18	Front bumper side retainers one/bent	2	\$ 42.20	\$ 84.40
19	Front support panel R	1	\$ 576.20	\$ 576.20 X
20	Front support side garnish RH ^1	1	\$ 41.20	\$ 41.20 X
21	Front grille base one	1	\$ 381.90	\$ 381.90
22	Front grille chrome moulding ^1	1	\$ 480.90	\$ 480.90 X
23	Front grille logo ^1	1	\$ 58.80	\$ 58.80 X
24	Front grille bracket ^1	1	\$ 65.50	\$ 65.50 X
25	Front grille top garnish ^1	1	\$ 121.30	\$ 121.30 X
26	Front grille top holder @ S\$34.30 ^1	2	\$ 34.30	\$ 68.60 X
27	Front headlamp RH one	1	\$ 1,920.50	\$ 1,920.50
28	Front headlamp chrome moulding RH ^1	1	\$ 89.90	\$ 89.90 X
29	Front headlamp side garnish RH bracket RH one	1	\$ 48.20	\$ 48.20
30	Front headlamp top cover RH ^1	1	\$ 48.20	\$ 48.20 X
31	Front fender RH DIS/bent	1	\$ 583.60	\$ 583.60
32	Front fender side retainer LH/RH 20/20	2	\$ 20.00	\$ 40.00 X
33	Front fender arch garnish LH/RH DE/Torn	2	\$ 241.20	\$ 482.40
34	Front fender splashshield RH Torn	1	\$ 131.60	\$ 131.60
35	Front fender wheel housing RH R	1	\$ 650.90	\$ 650.90 X
36	Front fender wheel housing extension RH R	1	\$ 441.50	\$ 441.50 X
37	Front fender inner panel RH R	1	\$ 365.60	\$ 365.60 X
38	Front door RH R	1	\$ 131.60	\$ 131.60 X
39	Front washer tank ^1	1	\$ 181.90	\$ 181.90
40	Front wheel bearing RH 2u	1	\$ 215.00	\$ 215.00 X
41	Front driver shaft RH ^1	1	\$ 411.50	\$ 411.50
42	Front knuckle arm RH Bent	1	\$ 420.20	\$ 420.20
43	Front lower arm RH Bent	1	\$ 420.20	\$ 420.20
			Sub-total	\$ 12,118.30
			20%	\$ 2,423.66
			Total	\$ 9,694.64

headlamp LH

holder one

1920.50

Less
List Items

Regn No : SLR2060B

Vehicle Make & Model : Honda HRV

ITEM NO	DESCRIPTION OF ITEMS	QUANTITY (Piece/Set)	UNIT PRICE (S\$)	AMOUNT (S\$)
Special Nett Items:				
1	Front wheel sports rim RH <i>noted</i>	1	\$ 200.00	\$ 200.00 ✓
2	Front wheel tyre RH <i>sc</i>	1	\$ 145.00	\$ 145.00 X
3	Front number plate with casing <i>n1</i>	1	\$ 80.00	\$ 80.00 X
4	Front bumper clip <i>sc</i>	1	\$ 45.00	\$ 45.00 30
5	Front fender clip LH/RH <i>n1</i>	2	\$ 40.00	\$ 80.00 X
		S/Nett items	Total	\$ 550.00
Labour Charge Items:				
1	To check front electrical wiring & reinstall wire harness		\$	100.00 20
2	To Dismantle & re placed front under carriage		\$	120.00 ✓
3	To do computerised 4 wheel alignment		\$	120.00 80
4	To respray undercoating		\$	150.00 30
5	To respray painting and etc		\$	850.00 800
6	Panel beating, cut, weld, remove and replacing above parts		\$	800.00 350
		Labour Charge	Total	\$ 2,140.00
Estimate Parts & Labour			Grand total	\$ 12,384.64

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

2-7775-50
202
6220.72
230
1600
8050.72
202
6640