

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:
Repairer Reference: 070863
Date calculated: 11/06/2024 6:09 PM



Full Report
Registration: SLT1730Y
Printed: 11/06/2024 6:09 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	06/06/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	E-CLASS (W213)
Sub Model:	E 200
Model Sheet Number:	03 FE 42
Registration:	SLT1730Y
VIN number:	
Odometer:	189160

*Not Notified
1/1/24 @
Recovery After Pain
Ex @ 2000h
14 days*

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

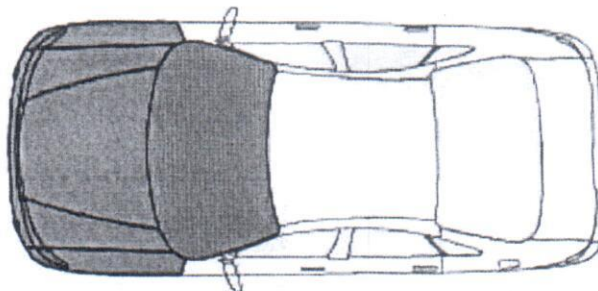

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Time Base 10 WU/h

Price = 42.00 SGD/h
WU Price SGD

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h WU Price SGD
1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY	3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	3.0	12.60
54-0650 01	MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)	1.0	4.20
61-1069 01	R + R COMPL LWR ENGINE COMPARTMENT COVER	3.0	12.60
88-2532 01	REPAIR OF FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WINGS AND FRONT LAMP UNITS, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	44.0	184.80
88-2657 01	R + R BOTH BONNET HINGE	4.0	16.80
88-2620 01	R + R FRONT BONNET CABLE	3.0	12.60

Code	Description	WU	Price SGD
60-1331 01	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE FRONT MODULE INCLUDES: R + R ALL ATTACHED PARTS IN THE REPAIR SECTION	15.0	63.00
62-1266 01	R + R OR RENEW FRONT CROSSMEMBER AND COMPLETE TRUSSING BETWEEN WHEELHOUSES INCLUDES: R + R CENTRE TRUSSING, RENEW IF NECESSARY	15.0	63.00
62-1440 01	RENEW L/F SIDE MEMBER END SECTION	21.0	88.20
62-1441 01	RENEW R/F SIDE MEMBER END SECTION	21.0	88.20
67-1700 01	RENEW FRONT SCREEN INCLUDES: INTERIOR MIRROR, RAIN SENSOR, BOTH WIPER ARMS, COVER WATER BOX, COVER MOULDINGS AND ALL TRIMS REMOVE AND REFIT	26.0	109.20
68-4605 01	R + R INSTRUMENT PANEL	27.0	113.40
68-4635 01	RENEW INSTRUMENT PANEL (REMOVED)	4.0	16.80
7681 01	R + R INDICATOR SWITCH	7.0	29.40
75-5070 02	RENEW ALTERNATOR	15.0	63.00
20-3865 01)	R + R RADIATOR	7.0	29.40
20-5410 02	R + R OVERFLOW TANK	8.0	33.60
09-6935 03)	R + R LOW-TEMPERATURE COOLER (ADD)	3.0	12.60
83-6543 01	R + R AIR CONDITIONING CONDENSER	14.0	58.80
83-7351 04)	R + R AIR CONDITIONING COMPRESSOR	4.0	16.80
83-7383 01	RENEW COMPRESSOR AIR CONDITION REMOVED	3.0	12.60
83-7805 ZAX	REMOVE AND REFIT WATER PIPE A	4.0	16.80
83-7810 ZAX	REMOVE AND REFIT WATER PIPE B	4.0	16.80
83-7820 ZAX	REMOVE AND REFIT WATER PIPE D	4.0	16.80
33-1050 01	R + R FRONT AXLE CARRIER	40.0	168.00
33-1252 ZAX	RENEW FRONT AXLE SUPPORT (REMOVED)	1.0	4.20
33-1427 02	R + R LEFT FRONT CONTROL ARM	7.0	29.40
33-1428 02	R + R RIGHT FRONT CONTROL ARM	7.0	29.40
33-1411 01)	REMOVE AND REFIT L/F CONTROL ARM	5.0	21.00
33-1411 01)	REMOVE AND REFIT R/F CONTROL ARM	5.0	21.00
20-1190 01	ADDITION TO COOLING SYSTEM DRAIN /REFILL (VEHICLE WITH SEPARATE LOW TEMPERATURE-WATER CYCLE)	3.0	12.60
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	6.0	25.20
83-0640 01	CHECK AIR COND	1.0	4.20
82-1110 01	ADJUST HEADLAMPS	3.0	12.60
40-6500 01	ALIGN VEHICLE INCLUDES: ALIGN FRONT AND REAR TOE AND CAMBER, CHECK FRONT AND REAR VEHICLE LEVEL	8.0	33.60

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	34.10	341.0	1,432.20
Alignment			
Measuring Work	0.80	8.0	33.60
Total of Labour			1,465.80

Paint

Paint Work

Time Basis 10 WU/h

Code	Description - MF	WU	Price SGD
98-1731 01	FRONT BUMPER TRIM PAINTING	8.0	33.60
98-2805 01	BONNET PAINTING STAGE I-M	26.0	109.20
98-2005 ZAX	L/BONNET HINGE PAINTING STAGE I-J	3.0	12.60
98-2005 ZAX	R/BONNET HINGE PAINTING STAGE I-J	3.0	12.60
98-2415 01	L/F WING PAINTING STAGE I-M	7.0	29.40
98-2615 01	R/F WING PAINTING STAGE I-M	7.0	29.40
LE 1211	L/F SIDE MEMBER END PAINTING STAGE I-J	6.0	25.20
LE 1212	R/F SIDE MEMBER END PAINTING STAGE I-J	6.0	25.20
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS	14.0	58.80

Total Paint

Hrs 8.00 WU 80.0 Price SGD 336.00

Material Cost - Paint

Inner Part Painting	Price SGD 7.48
New Part Painting (Bold)	171.57
Material-constant Metal	13.47
Total	192.52

Spare Parts

prices as at 2015-06-01

Code	Description	Part Number	Part Source	Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	30.00
0260	FRT NO PLATE BRKT	213 880 0044	Original	110.00
0283	FRONT BUMPER TRIM	213 885	Original	1,650.00
		0038649999		
0291	FRT UPP BUMPER SEAL	205 628 1300	Original	75.00
0299	TOWING EYE COVER	213 885 0222 9999	Original	140.00
0303	L/F BUMP LWR GRILLE	213 885 0922	Original	145.00
0304	R/F BUMP LWR GRILLE	213 885 1022	Original	145.00
0305	FRT CT BUMP GRILLE	213 885 0622	Original	180.00
0317	FRT LWR BUMPER MLDG	213 885 0100	Original	175.00
0335	FRT CTR BUMPER CARR	213 885 1265	Original	185.00
0343	L/F BUMPER CARRIER	213 885 0865	Original	185.00
0344	R/F BUMPER CARRIER	213 885 1065	Original	185.00
0349	FRT/CTR IMPACT DAMP	213 885 0237	Original	280.00
0381	OUTER TEMP SENSOR	007 542 1318	Original	180.00
0390	CTR FRT BUMPER MLDG	213 885 7401	Original	160.00
0405	GRILLE	213 880 8602	Original	1,050.00
0415	L/F AIR GUIDE GRILLE	213 505 1130	Original	120.00
0416	R/F AIR GUIDE GRILLE	213 505 1230	Original	120.00
0432	FRONT MANUFACT	221 880 0086	Original	120.00
	BADGE			
0471	BONNET	213 880 0357	Original	2,450.00
0475	L/BONNET HINGE	213 880 0128	Original	320.00
0476	R/BONNET HINGE	213 880 0228	Original	320.00

Code	Description	Part Number	Part Source	Price SGD
0481	CTR BONNET INSULAT	213 682 0026	Original	Reform 480.00 ✓
0485	L/F SUSPN BUFFER	000 998 7340	Original	Sm 20.00 7x ✓
0486	R/F SUSPN BUFFER	000 998 7340	Original	Sm 20.00 7x ✓
0494	BONNET CATCH	218 880 0064	Original	Ry 120.00 ✓
0495	L/ACCELERATION SENS	213 905 1300	Original	Sm 180.00 7x ✓
0496	R/ACCELERATION SENS	213 905 1300	Original	Sm 180.00 7x ✓
0497	L/F BONNET STRUT	213 980 0164	Original	Sm 145.00 X
0498	R/F BONNET STRUT	213 980 0264	Original	Sm 145.00 X
0500	BONNET CABLE	257 880 2304	Original	Ad 95.00 7x ✓
0503	L/UPP LOCK	213 880 0060	Original	Ry 115.00 ✓
0504	R/UPPER LOCK	213 880 0060	Original	Ry 115.00 ✓
0507	L/SPRING ELEMENT	205 880 0027	Original	M7 55.00 7x ✓
0508	R/SPRING ELEMENT	205 880 0027	Original	M7 55.00 7x ✓
0515	L/LID LOCKING	204 880 0260	Original	D7 55.00 ✓
0516	R/LID LOCKING	204 880 0260	Original	D7 55.00 ✓
0521	L/LWR HEADLAMP BRKT	213 620 2800	Original	R0 45.00 ✓
0522	R/LWR HEADLAMP BRKT	213 620 2900	Original	R0 45.00 ✓
0561	LEFT HEADLAMP ASSY	213 820 2361	Original	R0 3,600.00 ✓
0562	RIGHT HEADLAMP ASSY	213 820 2461	Original	R0 3,600.00 ✓
0541	L/F WING	213 880 0118	Original	Ry 1,150.00 ✓
0542	R/F WING	213 880 0018	Original	Sm 1,150.00 X ✓
0839	L/F W-HOUSE FRT CVR	238 690 1303	Original	CM 170.00 ✓
0840	R/F W-HOUSE FRT CVR	238 690 1403	Original	CM 170.00 ✓
0841	L/F W-HOUSE RR COVER	238 691 1700	Original	Sm 295.00 X
0842	R/F W-HOUSE RR COVER	238 691 1000	Original	CM 295.00 7x ✓
0930	FRONT MODULE CPL	213 620 6300	Original	Ad 1,150.00 7x ✓
0935	UPP FRT PANEL COVER	213 620 1701	Original	CM 290.00 ✓
0955	L/F C-MEMBER STRUT	213 620 2700	Original	Ry 85.00 ✓
0956	R/F C-MEMBER STRUT	213 620 2700	Original	Ry 85.00 ✓
0989	FRONT CTR RETAINER	213 898 0100	Original	CM 110.00 ✓
1001	FRT LWR CROSSMEMBER	213 620 0130	Original	Sm 580.00 7x ✓
1187	L/F LWR BUMP FRT ABS	213 620 0400	Original	Sm 140.00 7x ✓
1188	R/F LWR BUMP FRT ABS	213 620 0400	Original	Sm 140.00 7x ✓
1189	L/F STRUT	253 620 1600	Original	Sm 85.00 7x ✓
1190	R/F STRUT	253 620 0700	Original	Sm 85.00 7x ✓
1191	L/F UPP BUMP FRT ABS	213 620 0195	Original	Ry 210.00 ✓
1192	R/F UPP BUMP FRT ABS	213 620 0295	Original	Ry 240.00 ✓
1211	L/F SIDE MEMBER END	213 620 8900	Original	R 1,750.00 7x ✓
1212	R/F SIDE MEMBER END	213 620 9000	Original	R 1,750.00 7x ✓
1301	WINDSCREEN	213 670 8002	Original	CM 1,050.00 ✓
1411	WINDSCREEN REP KIT	000 989 4905 11		0.00
1413	FRT SCREEN MNTG KIT	USE SINGLE PARTS		
1416	WINDSCREEN SEAL	000 987 4866	Original	Ry 120.00 ✓
1441	WASHER JET COVERS	205 869 0007	Original	M7 450.00 ✓
4325	PASSENGER AIRBAG	213 860 0202	Original	Reform 1,980.00 ✓
4331	INSTRUMENT PANEL	213 680 9504	Original	T1 5,500.00 ✓
		9K00		
4455	AIR CON COMPRESSOR	000 830 3002	Original	Sm 3,350.00 7x ✓
4465	AIR CON CONDENSER	099 500 0454	Original	Ry 1,780.00 ✓
4469	L/RADIATOR SUPP FRAM	099 504 1800	Original	Ry 120.00 ✓
4470	R/RADIATOR SUPP FRAM	099 504 2000	Original	Ry 120.00 ✓
4481	PUMP/DRYER PIPE	213 830 1502	Original	Sm 135.00 X
4482	CONT/EXP VALVE PIPE	213 830 5100	Original	Sm 220.00 X
4483	COMPRESSOR PIPE	205 830 6201	Original	Sm 150.00 X
7011	FRONT AXLE SUPPORT	205 628 0057	Original	Sm 2,850.00 X
7047	L/F TENSION ROD	205 330 1305	Original	Sm 390.00

Code	Description	Part Number	Part Source	Price SGD
7048	R/F TENSION ROD	205 330 1405	Original	390.00 X
7071	L/F CONTROL ARM	205 330 6510	Original	680.00 X
7072	R/F CONTROL ARM	205 330 6610	Original	680.00 X
7261	FRONT STABILIZER	205 323 2700	Original	380.00 X
7415	COMBI SWITCH MODULE	213 900 7010	9051 Original	350.00 7X
7445	DRIVER AIRBAG	000 860 1002	9116 Original	2,900.00 ✓
7751	FRONT INTAKE CHANNEL	213 500 0055	Original	195.00 ✓
7752	LOWER AIR GUIDE	213 505 0130	Original	205.00 ✓
7753	RADIATOR AIR GUIDE	213 505 0030	Original	195.00 ✓
7761	RADIATOR	099 500 2203	Original	1,450.00 ✓
7762	LOW TEMP RADIATOR	099 500 2003	Original	1,350.00 7X
7765	L/LWR RADIATOR BRKT	213 501 0620	Original	150.00 7X
7766	R/LWR RADIATOR BRKT	213 501 0720	Original	150.00 7X
7773	R/RADIATOR HOSE	253 501 9382	Original	85.00 7X
7776	L/RADIATOR HOSE	253 501 9182	Original	85.00 7X
7787	EXPANSION TANK	205 500 0049	Original	215.00 X
7789	FAN UNIT	099 906 1800	Original	1,950.00 7X
8249	WASHER BOTTLE	274 200 0385	Original	185.00 X
8383	AIR SUCTION TUBE	274 090 0029	Original	225.00 7X
8285	AIR INTAKE HOSE	274 090 1800	Original	165.00 7X
8391	AIR FILTER	274 090 1701 64	Original	550.00 X
8411	ALTERNATOR	000 906 0922	Original	3,350.00 X
8775	L/F LOWER COVER	213 520 5600	Original	105.00 ✓
8776	R/F LOWER COVER	213 520 5800	Original	105.00 ✓
8779	FRT ENGINE COVER	213 520 0000	Original	350.00 7X
8780	CTR LWR ENGINE CVR	213 524 2700	Original	850.00 7X
9645	L/HORN	213 542 4400	Original	200.00 7X
9646	R/HORN	213 542 4300	Original	200.00 7X
9684	L/F CONTACT SWITCH	204 870 3158	Original	80.00 7X
9685	R/F CONTACT SWITCH	204 870 4458	Original	80.00 7X
1000	BONNET ACTUATOR RH	ACTUATOR	Original	250.00 X
1001	BONNET ACTUATOR LH	ACTUATOR	Original	250.00 X
1002	FRT PARKING SENSOR	SENSOR(X4)	Original	760.00 ✓
1003	PARKING SENSOR SIDE	SENSOR(X2)	Original	380.00 7X
1004	F/SENSOR HARNESS	SENSOR HARNESS	Original	590.00 7X
1005	FRT RADAR SENSOR	RADAR	Original	1,650.00 7X
1006	RADAR SENSOR	RADAR	Original	55.00 7X
907	BRACKET			
907	FRT GRILLE CAMERA	CAMERA	Original	1,800.00 7X
908	KNEE AIRBAG RH	AIRBAG	Original	1,350.00 ✓
1009	KNEE AIRBAG COVER RH	COVER	Original	250.00 ✓
1010	AIRBAG ECU CPL	ECU	Original	1,150.00 ✓
1011	SEAT BELT FRT RH	SEAT BELT	Original	1,590.00 ✓
1012	SEAT BELT FRT LH	SEAT BELT	Original	1,590.00 ✓
1013	SEAT BELT BUCKLE RH	BUCKLE FRONT	Original	180.00 7X
1014	SEAT BELT BUCKLE LH	BUCKLE FRONT	Original	180.00 7X
1015	SEAT BELT REAR RH	SEAT BELT	Original	590.00 ✓
1016	SEAT BELT REAR LH	SEAT BELT	Original	590.00 ✓
1017	SEAT BELT BUCKLE RH	BUCKLE REAR	Original	220.00 7X
1018	SEAT BELT BUCKLE LH	BUCKLE REAR	Original	220.00 7X

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal
Total

LKK Auto Consultants hence notify the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey

0.00
77,095.00
77,095.00

• Parts prices are subject to confirmation
• Third party survey is on a "Without Prejudice" basis
• No illegal modification(s) is allowed
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Final Calculation

	SGD	SGD
Parts	77,095.00	
Total Parts		77,095.00
Labour Time Base 10 WU/h		
Total 341.0 WU X 42.00 SGD/h	1,432.20	
Alignment		
Measuring Work	33.60	
Total of Labour		1,465.80
Paint Work Time Base 10 WU/h		
Labour Cost 80.0 WU X 42.00 SGD/h	336.00	
Material Cost	192.52	
Total Paint Including Material		528.52
Repair Cost Excludes GST		79,089.32
GST (+9.00%)		7,118.04
Repair Cost Included GST		86,207.36

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.