

**Ding Auto Pte Ltd**  
**Sin Ming Industrial Est. Sec C, Blk**  
**10,#01-20**  
**575645**



**Insurer Reference:**  
**Repairer Reference: 070863**  
**Date calculated: 14/08/2024 4:49 PM**

**Full Report**  
**Registration: SLT1730Y**  
**Printed: 14/08/2024 4:49 PM**

## Summary Information

---

### Claim

|                        |                |                   |                                                |
|------------------------|----------------|-------------------|------------------------------------------------|
| Location:              | Singapore (SG) | Work Provider:    | China Taiping Insurance<br>(Singapore) Pte Ltd |
| Printed by:            | Ding Auto      | Currency:         | SGD                                            |
| Claim Reference:       |                | Date of Incident: | 06/06/24                                       |
| Estimated Repair Time: |                | Hire Car Start:   |                                                |
| Actual Repair Days:    |                | Hire Car End:     |                                                |

## Vehicle Details

---

### Vehicle

|                     |                |
|---------------------|----------------|
| Manufacturer:       | MERCEDES-BENZ  |
| Model:              | E-CLASS (W213) |
| Sub Model:          | E 200          |
| Model Sheet Number: | 03 FE 42       |
| Registration:       | SLT1730Y       |
| VIN number:         |                |
| Odometer:           | 189160         |


Vehicle Condition

Vehicle Status

Pre-Accident Damage:  
Date of Inspection:

Damage Areas

All ☐  
Underbody ☐

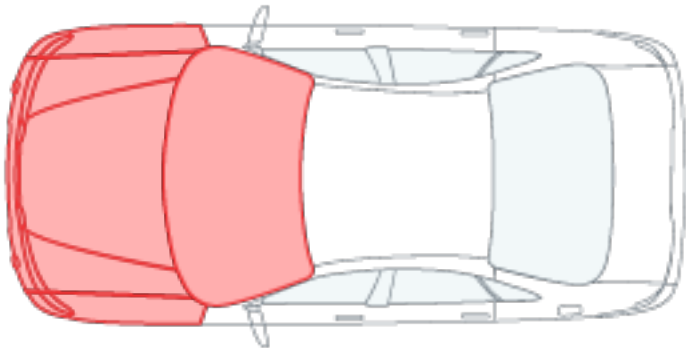

Tyres Condition

| Tyre Brand | Tread (Left Middle),<br>mm | Tread (Left Outer),<br>mm | Tread (Left Inner),<br>mm | Tread (Right Inner),<br>mm | Tread (Right Outer),<br>mm | Tread (Right Middle),<br>mm | Condition |
|------------|----------------------------|---------------------------|---------------------------|----------------------------|----------------------------|-----------------------------|-----------|
|------------|----------------------------|---------------------------|---------------------------|----------------------------|----------------------------|-----------------------------|-----------|

| Spare Tyre Brand | Tread (Spare), mm |
|------------------|-------------------|
|------------------|-------------------|

Labour

| Code       | Description                                                                                                                                                         | Time Base 10 WU/h | Price = 42.00 SGD/h |           |
|------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|---------------------|-----------|
|            |                                                                                                                                                                     |                   | WU                  | Price SGD |
| 54-1011 01 | SHORT TEST<br>INCLUDES: CONNECT + DISCONNECT STAR<br>DIAGNOSIS,<br>PRINT DATA,<br>DELETE ERROR MEMORY                                                               |                   | 3.0                 | 12.60     |
| 54-7989 01 | R + R BATTERY EARTH CABLE<br>(WHEN DISCONNECTING ELECTRIC PLUG AND<br>SOCKET CONNECTIONS)                                                                           |                   | 3.0                 | 12.60     |
| 54-0650 01 | MAIN BOARD MAINTAINED<br>(FOR CHECK AND DIAGNOSIS WORK)                                                                                                             |                   | 1.0                 | 4.20      |
| 61-1086 01 | R + R FRONT AND CENTRE ENGINE<br>COMPARTMENT COVERING                                                                                                               |                   | 3.0                 | 12.60     |
| 88-2532 01 | REPAIR OF FRONT-END DAMAGE<br>INCLUDES: RENEW BUMPER, BONNET, RADIATOR<br>COVER, FRONT WINGS AND FRONT LAMP UNITS,<br>CONVERT ATTACHED PARTS, RENEW IF<br>NECESSARY |                   | 44.0                | 184.80    |
| 88-4702 01 | R + R L/F WHEELHOUSE LINER FRONT                                                                                                                                    |                   | 3.0                 | 12.60     |

| Code                             | Description                                                                                                                                             | WU           | Price SGD     |
|----------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|--------------|---------------|
| 88-4704 01                       | R + R R/F WHEELHOUSE LINER FRONT                                                                                                                        | 3.0          | 12.60         |
| 88-2657 01                       | R + R BOTH BONNET HINGE                                                                                                                                 | 4.0          | 16.80         |
| 88-2620 01                       | R + R FRONT BONNET CABLE                                                                                                                                | 3.0          | 12.60         |
| 60-1302 01                       | R + R ATTACHED PARTS OF THE ENG COMP                                                                                                                    | 9.0          | 37.80         |
| 60-1332 01                       | R + R FOR RENEWAL FRONT CROSSMEMBER<br>ATTACHED PARTS IN ENGINE BAY TO RENEW<br>THE FRONT CENTRE STIFFENING R + R                                       | 7.0          | 29.40         |
| 62-1263 01                       | R + R FRONT CROSSMEMBER CPL<br>(BUMPER REMOVED)                                                                                                         | 7.0          | 29.40         |
| 62-1320 01                       | R + R FRONT MODULE                                                                                                                                      | 11.0         | 46.20         |
| 62-1234 01                       | RENEW BOTH FRONT CRASHBOXES<br>(CROSSMEMBER REMOVED)                                                                                                    | 1.0          | 4.20          |
| 67-1700 01                       | RENEW FRONT SCREEN<br>INCLUDES: INTERIOR MIRROR, RAIN SENSOR,<br>BOTH WIPER ARMS, COVER<br>WATER BOX, COVER MOULDINGS AND<br>ALL TRIMS REMOVE AND REFIT | 26.0         | 109.20        |
| 68-4605 01                       | R + R INSTRUMENT PANEL                                                                                                                                  | 27.0         | 113.40        |
| 68-4635 01                       | RENEW INSTRUMENT PANEL (REMOVED)                                                                                                                        | 4.0          | 16.80         |
| 20-3865 01)                      | R + R RADIATOR                                                                                                                                          | 7.0          | 29.40         |
| 09-6935 03)                      | R + R LOW-TEMPERATURE COOLER (ADD)                                                                                                                      | 3.0          | 12.60         |
| 83-6543 01                       | R + R AIR CONDITIONING CONDENSER                                                                                                                        | 14.0         | 58.80         |
| 20-1190 01                       | ADDITION TO COOLING SYSTEM DRAIN /REFILL<br>(VEHICLE WITH SEPARATE LOW TEMPERATURE-<br>WATER CYCLE)                                                     | 3.0          | 12.60         |
| 83-1762 01                       | AIR-CONDITIONING SYSTEM DRAIN FLUID,<br>EXHAUST, REFILL, PRESSURE TEST<br>(FOR ALL WORK ON THE SYSTEM)                                                  | 6.0          | 25.20         |
| 83-0640 01                       | CHECK AIR COND                                                                                                                                          | 1.0          | 4.20          |
| 82-1110 01                       | ADJUST HEADLAMPS                                                                                                                                        | 3.0          | 12.60         |
| <b>Labour Cost</b>               |                                                                                                                                                         | <b>Hrs</b>   | <b>WU</b>     |
| <b>Panel / Mechanical Labour</b> |                                                                                                                                                         | <b>19.60</b> | <b>196.0</b>  |
| <b>Total of Labour</b>           |                                                                                                                                                         |              | <b>823.20</b> |

## Paint

| Paint Work         |                                                                | Time Basis 10 WU/h        |                                   |
|--------------------|----------------------------------------------------------------|---------------------------|-----------------------------------|
| Code               | Description - MF                                               | WU                        | Price SGD                         |
| 98-1731 01         | FRONT BUMPER TRIM PAINTING                                     | 8.0                       | 33.60                             |
| 98-2805 01         | BONNET PAINTING STAGE I-M                                      | 26.0                      | 109.20                            |
| 98-2005 ZAX        | L/BONNET HINGE PAINTING STAGE I-J                              | 3.0                       | 12.60                             |
| 98-2005 ZAX        | R/BONNET HINGE PAINTING STAGE I-J                              | 3.0                       | 12.60                             |
| 98-2415 01         | L/F WING PAINTING STAGE I-M                                    | 7.0                       | 29.40                             |
| 98-2615 01         | R/F WING PAINTING STAGE I-M                                    | 7.0                       | 29.40                             |
| 98-1340 01         | PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY<br>PARTS | 14.0                      | 58.80                             |
| <b>Total Paint</b> |                                                                | <b>Hrs</b><br><b>6.80</b> | <b>WU</b><br><b>68.0</b>          |
|                    |                                                                |                           | <b>Price SGD</b><br><b>285.60</b> |

**Material Cost - Paint**  
 Inner Part Painting  
 New Part Painting (Bold)  
 Material-constant Metal  
**Total**

**Price SGD**  
**0.44**  
**171.57**  
**13.47**  
**185.48**

## Spare Parts

|      |                      |                   |             | prices as at 2015-06-01 |
|------|----------------------|-------------------|-------------|-------------------------|
| Code | Description          | Part Number       | Part Source | Price SGD               |
| 0257 | FRONT NUMBER PLATE   | KNPL3             | Original    | 30.00                   |
| 0260 | FRT NO PLATE BRKT    | 213 880 0044      | Original    | 110.00                  |
| 0283 | FRONT BUMPER TRIM    | 213 885           | Original    | 1,650.00                |
|      |                      | 0038649999        |             |                         |
| 0291 | FRT UPP BUMPER SEAL  | 205 628 1300      | Original    | 75.00                   |
| 0299 | TOWING EYE COVER     | 213 885 0222 9999 | Original    | 140.00                  |
| 0303 | L/F BUMP LWR GRILLE  | 213 885 0922      | Original    | 145.00                  |
| 0304 | R/F BUMP LWR GRILLE  | 213 885 1022      | Original    | 145.00                  |
| 0305 | FRT CT BUMP GRILLE   | 213 885 0622      | Original    | 180.00                  |
| 0317 | FRT LWR BUMPER MLDG  | 213 885 0100      | Original    | 175.00                  |
| 0335 | FRT CTR BUMPER CARR  | 213 885 1265      | Original    | 185.00                  |
| 0343 | L/F BUMPER CARRIER   | 213 885 0865      | Original    | 185.00                  |
| 0344 | R/F BUMPER CARRIER   | 213 885 1065      | Original    | 185.00                  |
| 0349 | FRT/CTR IMPACT DAMP  | 213 885 0237      | Original    | 280.00                  |
| 0381 | OUTER TEMP SENSOR    | 007 542 1318      | Original    | 180.00                  |
| 0390 | CTR FRT BUMPER MLDG  | 213 885 7401      | Original    | 160.00                  |
| 0405 | GRILLE               | 213 880 8602      | Original    | 1,050.00                |
| 0415 | L/F AIR GUIDE GRILLE | 213 505 1130      | Original    | 120.00                  |
| 0416 | R/F AIR GUIDE GRILLE | 213 505 1230      | Original    | 120.00                  |
| 0432 | FRONT MANUFACT       | 221 880 0086      | Original    | 120.00                  |
|      | BADGE                |                   |             |                         |
| 0471 | BONNET               | 213 880 0357      | Original    | 2,450.00                |
| 0475 | L/BONNET HINGE       | 213 880 0128      | Original    | 320.00                  |
| 0476 | R/BONNET HINGE       | 213 880 0228      | Original    | 320.00                  |
| 0481 | CTR BONNET INSULAT   | 213 682 0026      | Original    | 480.00                  |
| 0494 | BONNET CATCH         | 218 880 0064      | Original    | 120.00                  |
| 0500 | BONNET CABLE         | 257 880 2304      | Original    | 95.00                   |
| 0503 | L/UPP LOCK           | 213 880 0060      | Original    | 115.00                  |
| 0504 | R/UPPER LOCK         | 213 880 0060      | Original    | 115.00                  |
| 0507 | L/SPRING ELEMENT     | 205 880 0027      | Original    | 55.00                   |
| 0508 | R/SPRING ELEMENT     | 205 880 0027      | Original    | 55.00                   |
| 0515 | L/LID LOCKING        | 204 880 0260      | Original    | 55.00                   |
| 0516 | R/LID LOCKING        | 204 880 0260      | Original    | 55.00                   |
| 0521 | L/LWR HEADLAMP BRKT  | 213 620 2800      | Original    | 45.00                   |
| 0522 | R/LWR HEADLAMP BRKT  | 213 620 2900      | Original    | 45.00                   |
| 0561 | LEFT HEADLAMP ASSY   | 213 820 2361      | Original    | 3,600.00                |
| 0562 | RIGHT HEADLAMP ASSY  | 213 820 2461      | Original    | 3,600.00                |
| 0741 | L/F WING             | 213 880 0118      | Original    | 1,150.00                |
| 0742 | R/F WING             | 213 880 0018      | Original    | 1,150.00                |
| 0839 | L/F W-HOUSE FRT CVR  | 238 690 1303      | Original    | 170.00                  |
| 0840 | R/F W-HOUSE FRT CVR  | 238 690 1403      | Original    | 170.00                  |
| 0930 | FRONT MODULE CPL     | 213 620 6300      | Original    | 1,150.00                |
| 0935 | UPP FRT PANEL COVER  | 213 620 1701      | Original    | 290.00                  |
| 0955 | L/F C-MEMBER STRUT   | 213 620 2700      | Original    | 85.00                   |
| 0956 | R/F C-MEMBER STRUT   | 213 620 2700      | Original    | 85.00                   |
| 0989 | FRONT CTR RETAINER   | 213 898 0100      | Original    | 110.00                  |
| 1191 | L/F UPP BUMP FRT ABS | 213 620 0195      | Original    | 210.00                  |

| Code | Description          | Part Number       | Part Source   | Price SGD |
|------|----------------------|-------------------|---------------|-----------|
| 1192 | R/F UPP BUMP FRT ABS | 213 620 0295      | Original      | 240.00    |
| 1401 | WINDSCREEN           | 213 670 8002      | Original      | 1,050.00  |
| 1411 | WINDSCREEN REP KIT   | 000 989 4905 11   |               | 0.00      |
| 1413 | FRT SCREEN MNTG KIT  | USE SINGLE PARTS  |               |           |
| 1416 | WINDSCREEN SEAL      | 000 987 4866      | Original      | 120.00    |
| 1441 | WASHER JET COVERS    | 205 869 0007      | Original      | 450.00    |
| 4325 | PASSENGER AIRBAG     | 213 860 0202      | Original      | 1,980.00  |
| 4331 | INSTRUMENT PANEL     | 213 680 9504      | Original      | 5,500.00  |
|      |                      | 9K00              |               |           |
| 4465 | AIR CON CONDENSER    | 099 500 0454      | Original      | 1,780.00  |
| 4469 | L/RADIATOR SUPP FRAM | 099 504 1800      | Original      | 120.00    |
| 4470 | R/RADIATOR SUPP FRAM | 099 504 2000      | Original      | 120.00    |
| 7445 | DRIVER AIRBAG        | 000 860 1002 9116 | Original      | 2,900.00  |
| 7751 | FRONT INTAKE CHANNEL | 213 500 0055      | Original      | 195.00    |
| 7752 | LOWER AIR GUIDE      | 213 505 0130      | Original      | 205.00    |
| 7753 | RADIATOR AIR GUIDE   | 213 505 0030      | Original      | 195.00    |
| 7761 | RADIATOR             | 099 500 2203      | Original      | 1,450.00  |
| 7762 | LOW TEMP RADIATOR    | 099 500 2003      | Original      | 1,350.00  |
| 7789 | FAN UNIT             | 099 906 1800      | Original      | 1,950.00  |
| 8775 | L/F LOWER COVER      | 213 520 5600      | Original      | 105.00    |
| 8776 | R/F LOWER COVER      | 213 520 5800      | Original      | 105.00    |
| 8780 | CTR LWR ENGINE CVR   | 213 524 2700      | Original      | 850.00    |
| 9645 | L/HORN               | 213 542 4400      | Original      | 200.00    |
| 9646 | R/HORN               | 213 542 4300      | Original      | 200.00    |
| 9684 | L/F CONTACT SWITCH   | 204 870 3158      | Original      | 80.00     |
| 9685 | R/F CONTACT SWITCH   | 204 870 4458      | Original      | 80.00     |
| 1002 | FRT PARKING SENSOR   | SENSOR(X4)        | Original      | 760.00    |
| 1003 | PARKING SENSOR SIDE  | SENSOR(X2)        | Original      | 380.00    |
| 1004 | F/SENSOR HARNESS     | SENSOR HARNESS    | Original      | 590.00    |
| 1005 | FRT RADAR SENSOR     | RADAR             | Original      | 1,650.00  |
| 1006 | RADAR SENSOR         | RADAR             | Original      | 55.00     |
|      | BRACKET              |                   |               |           |
| 1007 | FRT GRILLE CAMERA    | CAMERA            | Original      | 1,800.00  |
| 1008 | KNEE AIRBAG RH       | AIRBAG            | Original      | 1,350.00  |
| 1009 | KNEE AIRBAG COVER RH | COVER             | Original      | 250.00    |
| 1010 | AIRBAG ECU CPL       | ECU               | Original      | 1,150.00  |
| 1011 | SEAT BELT FRT RH     | SEAT BELT         | Original      | 1,590.00  |
| 1012 | SEAT BELT FRT LH     | SEAT BELT         | Original      | 1,590.00  |
| 1015 | SEAT BELT REAR RH    | SEAT BELT         | Original      | 590.00    |
| 1016 | SEAT BELT REAR LH    | SEAT BELT         | Original      | 590.00    |
| 1017 | ENGINE PULLEY        | PULLEY            | Supplementary | 680.00    |
| 1018 | ENGINE FAN BELT      | BELT              | Supplementary | 120.00    |
| 1019 | ENGINE BLEEDING HOSE | HOSE              | Supplementary | 140.00    |
| 1020 | ELEC.WATER PUMP HOSE | HOSE              | Supplementary | 180.00    |
| 1021 | FRONT CAMERA         | HARNESS           | Supplementary | 450.00    |
|      | HARNESS              |                   |               |           |

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

|                 |                  |
|-----------------|------------------|
| <b>Savings</b>  | <b>0.00</b>      |
| <b>Subtotal</b> | <b>56,470.00</b> |
| <b>Total</b>    | <b>56,470.00</b> |

Final Calculation

|                                   | SGD       | SGD       |
|-----------------------------------|-----------|-----------|
| Parts                             | 56,470.00 |           |
| Total Parts                       |           | 56,470.00 |
| Labour Time Base 10 WU/h          |           |           |
| Total 196.0 WU X 42.00 SGD/h      | 823.20    |           |
| Total of Labour                   |           | 823.20    |
| Paint Work Time Base 10 WU/h      |           |           |
| Labour Cost 68.0 WU X 42.00 SGD/h | 285.60    |           |
| Material Cost                     | 185.48    |           |
| Total Paint Including Material    |           | 471.08    |
| Repair Cost Excludes GST          |           | 57,764.28 |
| GST (+9.00%)                      |           | 5,198.79  |
| Repair Cost Included GST          |           | 62,963.07 |

Comments

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.