

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD (TP / WS / TP RES / OD RES / EVA / INV / MV)

To Inspect Vehicle No: SMC 1932J

at Workshop m/s PORRERO MOTOR

of 2, PANDAN CRESCENT

Insured: SMR

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

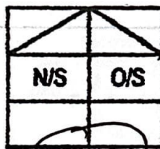

Bal. or Market Value: 72K

IDAC Accident Rpt: _____

Consistent?: Yes or No

GIA / PR Seen: _____

Consistent?: Yes or No

Est. Repairs: _____

days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____

Person Contacted: _____

Veh No: SMC 1932J

Yr Regn: 2018 / Jun

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRIUS PLUS A

c.c 1758

Colour: BLUE

AAC: Insured / Std / NI / NA

Sp. Reading: 631551

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTDZS3EU803028363

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rip / STD A/Rim or

Tyre Size: P. 205/60R16

R: _____

BS (DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 31/07/24

D.O.I. 02/08/24

Survey held at PANDAN G.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMIT - 42K

We will be advising our principal a cost of repair P/P-\$29,318.35/- with 11 days of repair (red, \$5539.88, 16%)

Date/Time, File Pass to?



: Prel. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 11

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee:



: Site Insp (\$ _____)



: Interview (\$ _____)



: Tech. Invs (\$ _____)



: Weekend (\$ _____)

) \$ + RS \$

) Photos

) Others

TOTAL

Report Format: _____

Lump Sum / I.B.I. (\$) _____



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details	Account No.	Customer Details
MS First Capital Insurance Ltd 16 Raffles Quay #42-01 Hong Leong Building Singapore 048581 Attn: Motor Claims Dept	S1000005 / ICFIC1	M/S Grab Rentals Pte. Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925
	Document No. 0	
	Document Date 01/08/2024	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW Q2	27/06/2018	SMC1932J	0	31991	67/TP/SMC1932J
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZS3EU80J028363	2ZR0B89973	60	Sam San Joi	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
1	Z	BP-GRAB-DS SUNDRIES - FLASH ARRIVE: DD/MM/YY 0000HR TP-SHF92H ACC DATE:31/07/2024 DRIVE IN:01/08/2024 DATE-IN:01/08/2024 DATE SURVEY: NO OF REPAIR DAYS: BY: AUTHORIZED ON:				50 100.00
2	S	BP-SUBLET REAR NUMBER PLATE				80.00
3	S	BP-SUBLET PHV STICKER				20.80
4	B	BP-LAB2 DRILL HOLE & INSTALL REAR REVERSE SENSOR				198.00
5	B	BP-LAB2 CHECK LIGHTING & CONDUCT WATER LEAK TEST				198.00
6	B	BP-LAB2 TRANSFER & INSTALL COMPONENTS TO NEW TAILGATE				594.00
7	B	BP-LAB2 REPLACE & INSTALL REAR TAILGATE GLASS				594.00
8	Z	BP-SLANT SUPPLY SEALANT (NETT)				200.00
9	B	BP-LAB2 REMOVE & INSTALL REAR COMPARTMENT CARPET ,GARNISH AND TRIMMING TO ASSIST REPAIR				396.00
10	B	BP-ECU2 TO RESET ECU AND REPROGRAMME				198.00
11	B	BP-LAB2 REPLACE REAR ACCIDENT DAMAGED PARTS STRAIGHTEN & ALIGN REAR ACCIDENT AFFECTED AREAS				2376 3960.00

For & on behalf of	Customer's Signature	Charge Summary	Total
Borneo Motors (Singapore) Pte Ltd	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due

Customer Copy



Inchcape

Co. Reg No. : 196700086Z

GST Reg No. : MR-8500000-9

No. 2 PANDAN CRESCENT

SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details			Account No.		Customer Details		
MS First Capital Insurance Ltd 16 Raffles Quay #42-01 Hong Leong Building Singapore 048581 Attn: Motor Claims Dept			S1000005 / ICFIC1		M/S Grab Rentals Pte. Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925		
			Document No.				
			0				
			Document Date				
			01/08/2024				
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW Q2	27/06/2018	SMC1932J	0	31991	67/TP/SMC1932J
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On
JTDZS3EU80J028363		2ZR0B89973	60	Sam San Joi	--/--/----		0.00 --/--/---- 0.00
L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount	
12	B	BP-RES2 RESPRAY JOB ON REAR ACCIDENT AFFECTED AR EAS				2624	3280.00
13	1	TREVSE-47006 24 BACK SENSOR 1G3 GREY ME MIS	1.00	101.05			101.05
14	2	U52159-47912 COVER, RR BUMPER	1.00	855.40			855.40
15	3	U52576-47030 RETAINER, RR BUMPER	1.00	89.90			89.90
16	4	U52156-47010 SUPPORT, RR BUMPER	1.00	217.70			217.70
17	5	U52575-47030 RETAINER, RR BUMPER	1.00	89.90			89.90
18	6	U52155-47010 SUPPORT, RR BUMPER	1.00	217.70			217.70
19	7	K52161-0K040 PIECE, RR BUMPER	10.00	5.80			58.00
20	8	U52023-12240 REINFORCEMENT	1.00	334.00			334.00
21	9	U52016-47060 ARM SUB-ASSY, RR	1.00	243.00			243.00
22	0	U52015-47080 ARM SUB-ASSY, RR	1.00	243.00			243.00
23	1	U52023-12240 REINFORCEMENT	1.00	334.00			334.00
24	2	U52016-47060 ARM SUB-ASSY, RR	1.00	243.00			243.00
25	3	U52015-47080 ARM SUB-ASSY, RR	1.00	243.00			243.00
26	4	U76891-47040 SPOILER, RR NO.1	1.00	1175.80			1175.80
27	5	U75392-35220 RETAINER, OUTSIDE	10.00	5.60			56.00
28	6	U81910-47010 REFLECTOR ASSY, com	1.00	83.40			83.40
29	7	U52591-47030 SEAL, RR BUMPER	1.00	124.60			124.60
30	8	U58307-47080 PANEL SUB-ASSY, BODY	1.00	1058.90			1058.90
For & on behalf of			Customer's Signature		Charge Summary		Total
Borneo Motors (Singapore) Pte Ltd			Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less Amount Due

Customer Copy



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z

GST Reg No. : MR-8500000-9

No. 2 PANDAN CRESCENT

SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details	Account No.	Customer Details
MS First Capital Insurance Ltd 16 Raffles Quay #42-01 Hong Leong Building Singapore 048581 Attn: Motor Claims Dept	S1000005 / ICFIC1	M/S Grab Rentals Pte. Ltd
	Document No. 0	3 Media Close #01-03/06 Singapore 138498
	Document Date 01/08/2024	Work: 65703925

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW Q2	27/06/2018	SMC1932J	0	31991	67/TP/SMC1932J
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZS3EU80J028363	2ZR0B89973	60	Sam San Joi	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
31	9	U58308-47030 COVER SUB-ASSY, RR ?	1.00	757.90		757.90
32	0	U67935-47010 C0 PLATE, BACK DOOR ?	1.00	251.40		251.40
33	1	U67005-47460 PANEL SUB-ASSY, BACK ?	1.00	1692.80		1692.80
34	2	U67881-47030 WEATHERSTRIP, BACK cut	1.00	463.80		463.80
35	3	U68105-47170 GLASS SUB-ASSY, BACK ne / photo	1.00	1675.30		1675.30
36	4	U56117-50140 DAM, WINDOW GLASS ne	1.00	40.10		40.10
37	5	T69350-28151 LOCK ASSY, BACK DOOR ?	1.00	571.50		571.50
38	6	U75310-47020 EMBLEM ASSY, ne	1.00	87.90		87.90
39	7	U75442-47080 PLATE, BACK DOOR ne	1.00	87.90		87.90
40	8	U75441-47130 PLATE, LUGGAGE COMPT ne	1.00	75.70		75.70
41	9	U81561-47252 LENS & BODY, RR X	1.00	1022.70		1022.70
42	0	U81551-47262 LENS & BODY, RR X	1.00	1069.50		1069.50
43	1	U81551-47262 LENS & BODY, RR X	1.00	1069.50		1069.50
44	2	T81496-21010 GUIDE, RR ne	2.00	5.00		10.00
45	3	U89997-30070 ANTENNA, ELECTRICAL ?	1.00	266.20		266.20
46	4	T21000-20 SIKI 182010 SIKI TACK GO! (BLA ne	2.00	108.00		216.00
47	5	T21000-22 SIKI 207. G+P ADHESIVE PRIMER ne	1.00	200.00		200.00

For & on behalf of Borneo Motors	LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company	Customer's Signature	Charge Summary	Total	25,145.35
		Please acknowledge receipt of vehicle	Parts 15,326.55 Labour 9,718.00 Sublet 100.80 Lubrication/Fluid 0.00 Others 0.00	GST 9.00%	2,263.08
				Less	0.00
				Amount Due	27,408.43

Acknowledged by Repairer

Signature:

Date:

Customer Copy

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	200G
Vehicle Details	
Vehicle No.:	SMC1932J
Vehicle to be Exported:	No
Intended Deregistration Date:	04 Aug 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS PLUS (AUTO)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	2ZR0B89973
Chassis No.:	JTDZS3EU80J028363
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$27,507.00
Original Registration Date:	27 Jun 2018
First Registration Date:	27 Jun 2018
Transfer Count:	0
Actual ARF Paid:	\$20,510.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Jun 2028
PARF Rebate Amount:	\$13,331.00
Intended COE Rebate Details	
COE Expiry Date:	26 Jun 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$42,661.00
COE Rebate Amount:	\$16,614.00
Total Rebate Amount:	\$29,945.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 04 Aug 2024

OK