

22/03/2002

ASS. REC. BY:

REF:

CS/CTU7011182/Rlgbsv

Special Instruction:

Survivor:

Ragui

ASSIGNMENT (Office)

Munmen

From (Person):

Angie Foo

of

CTL

Date/Time:

02062017 1009am

Estimated Cost:

Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

GBE 9623T

Insured:

at Workshop m/s

Cheng Auto

Tel:

6631 0909

of

1 Soon Lee St #06-41

Policy No:

DMCVSN1627421701

Claim No:

SHM17D0306201

Sum Insured:

Excess:

\$ 3600.00

Make of Veh:

D.O.A. 23052017

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time: 02062017 1022am

Person Contacted:

Michael

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

GBE 9623T - X

9/6/17

Revert by merimen

15/6/17

Mandate approved by Alfred. - company name sticker not allowed.

15/6/17

@ 10.30am spoke to Michael, CA, EX: 3600 - sticker not allowed.

28/12/17

confirmed P/P \$ 14314.60 with mun. (Red: 3916.60, 21%).



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD		Ref : CS/CTI17011182/R1gb		
3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909		Date : 08-06-2017		
		Code : CTI		
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.	Veh. Inspected		GBE 9623T	
Policy No.	DMCVSN1627421701	Coverage (\$)	0.00	
Claim No.	SNM17D03062C01	Excess (\$)	3,600.00	
Assign From	MERIMEN (ANGIE FOO)	Assign Date	08/06/2017	
2. Vehicle Particulars & Condition				
Make & Model	c.c		0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	23/05/2017	Inspection Date	08/06/2017	
Survey held at	CHENG AUTO BODYWORKS 1 SOON LEE STREET #06-41 PIONEER CENTRE SINGAPORE 627605			
5a. Remarks				
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.				

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	06 Jun 2017 Sendback Est	06 Jun 2017 19:32 S\$18,231.20	08 Jun 2017 10:09 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

Insured: LONGSHOT TRANSPORT PTE LTD, Co. Reg. No.: 201531342H

Vehicle Reg. No.: GBE9623T **Date of Loss:** 23/05/2017 08:00 - :59

Claim Type: OD / SNM17D03062C01 **Policy/Cover Note No.:** DMCVSN1627421701 (Comprehensive)

Excess: S\$3,600.00

Repairer: Cheng Auto Bodyworks (HQ) 1 Soon Lee Street, #06-41, Pioneer Centre, 627605 Pioneer - Tel: 6631 0707

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Angie Foo - 6389 6186]

Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 19/06/2017]

Driver/Custodian: LI HAITAO (56 / Male), NRIC: G3271440X

Adj Asg. Remarks: PLEASE SURVEY, REVERT, CHECK CONSISTENCY OF THE DAMAGES, WHETHER IT IS ECONOMICAL TO REPAIR. EXCESS \$3,600/- IS APPLICABLE ON OWN DAMAGED CLAIM - DRIVING LICENSE 9 MONTHS

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Ai Phing (LKKAUTO)

From: Claims Dept of CTI <claimsdept@sg.cntaiping.com>
Sent: Thursday, 15 June, 2017 10:21 AM
To: SUR; Ai Phing (LKKAUTO); Denise Tay (LKKAUTO); claims@chengauto.com; Veron Chen (LKKAUTO)
Cc: Alfred Toh; Hwang Shiang Yi; Chee So Chow; Susan Teo; KKLau; Olivia Lau (LKKAUTO); Angie Foo; SG Yusoff Tawffiek (Tawffiek.Yusoff@audatex.com); SG Chong Daniel (Daniel.Chong@audatex.com)
Subject: Alert: Im. Report (GBE9623T) - SNM17D03062C01/3
Attachments: 15062017101447.pdf; 15062017101457.pdf

Dear Ms Ai Ping

We refer to the above matter.

We are of the opinion the "Company Name Sticker" should not be allowed in the claim.

Please assist to check with attending surveyor for clarification.

Meanwhile, please proceed to authorize repairs at \$13,612.52 Less Excess of \$3,600.00.

Regards

Alfred Toh
Senior Executive
Claims Department
China Taiping Insurance (Singapore) Pte Ltd
3 Anson Road
#15-00 Springleaf Tower
Singapore 079909
Co. Reg. No. 200208384E
DID : +65 6389 6183
FAX: +65 6224 7175/6224 7478
Email: claimsdept@sg.cntaiping.com
alfred.toh@sg.cntaiping.com
Website: www.sg.cntaiping.com

Disclaimer :

This message is confidential; its contents do not constitute a commitment by China Taiping Insurance (Singapore) Pte. Ltd. except where provided for in a written agreement between you and China Taiping Insurance (Singapore) Pte. Ltd. Any unauthorized disclosure, use or dissemination, either in whole or partial, is prohibited. If you are not the intended recipient of the message, please notify the sender immediately.

From: Do-Not-Reply [mailto:do-not-reply@merimen.com]
Sent: Thursday, June 15, 2017 9:20 AM
To: Angie Foo <angie.foo@sg.cntaiping.com>
Cc: Alfred Toh <alfred.toh@sg.cntaiping.com>
Subject: Re: Fw: Alert: Im. Report (GBE9623T)

This mail is associated with :
GBE9623T (SNM17D03062C01)
OD
May 23 2017 8:00AM
[LONGSHOT TRANSPORT PTE LTD]
Cheng Auto Bodyworks

Dear Angie,

Please assist authorise approval urgently as repairer chasing.

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	06 Jun 2017 18:13	Cim Veh Model Changed	(204913) MITSUBISHI CANTER 3.0 D FEA01BR2SDEB (CBU) (M).	[R] Murugesan
2	06 Jun 2017 18:13	Cim Created	Reg No: GBE9623T. Policy No: DMCVSN1627421701. Acct Date: 2017/05/23. Claim Type: OD. Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ). Workshop: Cheng Auto Bodyworks (HQ). Created from SAS:MCAB17067564-01	[R] Murugesan
3	06 Jun 2017 19:32	Cim Submitted	18231.20.	[R] Murugesan
4	08 Jun 2017 10:09	Cim Registration Modified	Excess: -> 3600.00.	[I] Angie Foo
5	08 Jun 2017 10:09	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):PLEASE SURVEY, REVERT, CHECK CONSISTENCY OF THE DAMAGES, WHETHER IT IS ECONOMICAL TO REPAIR. EXCESS \$3,600/- IS APPLICABLE ON OWN DAMAGED CLAIM - DRIVING LICENSE 9 MONTHS	[I] Angie Foo
6	08 Jun 2017 10:09	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/06/19	[I] Angie Foo
7	08 Jun 2017 10:09	Adj Mandate Set	Approved:0.00.	[I] Angie Foo
8	08 Jun 2017 10:10	Assignment 1st Accessed		[A] CATHERINE CHONG KAI LING
9	08 Jun 2017 15:04	Adj Adjuster Assigned	[None] -> MOHD RASUL	[A] CATHERINE CHONG KAI LING
10	09 Jun 2017 12:47	Adj Rpt Initiated		[A] VERON CHEN
11	09 Jun 2017 12:53	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/06/19	[A] VERON CHEN
12	09 Jun 2017 12:55	Adj Mandate Request	Cur Req:13855.02:Damages Consistent Repair Cost Economical	[A] VERON CHEN
13	15 Jun 2017 10:24	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/06/19. Mandate Remarks: Please proceed to authorize repairs at \$13,612.52 BEFORE Excess of \$3,600.00. RE-INSPECTION required.	[I] Alfred Toh
14	15 Jun 2017 10:24	Adj Mandate Set	Approved:13612.52:Please proceed to authorize repairs at \$13,612.52 BEFORE Excess of \$3,600.00. RE-INSPECTION required.Reinsp:Adj decides.	[I] Alfred Toh
15	16 Jun 2017 14:53	Cim Supp Created (S:606296)		[R] Murugesan
16	16 Jun 2017 15:18	Cim Submitted (S:606296)	577.50.	[R] Murugesan
17	16 Jun 2017 15:18	Adj Co Assigned (S:606296)	LKK Auto Consultants Pte Ltd (HQ):	[I] Merimen Administrator
18	23 Aug 2017 10:13	Supp Combined (S:606296)		[A] LOW AI PHING
19	12 Dec 2017 11:57	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/06/19	[A] LOW AI PHING
20	12 Dec 2017 11:58	Adj Mandate Request	Cur Req:14314.60:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL.	[A] LOW AI PHING
21	13 Dec 2017 10:59	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2017/06/19. Mandate Remarks: SUPP MANDATE REQUESTED OF 14314.60 DOES NOT TALLY WITH AUDATEX 10592.80. PLS ADVISE.	[I] Chong Boon Sen
22	13 Dec 2017 10:59	Adj Mandate Set	Maintained:SUPP MANDATE REQUESTED OF 14314.60 DOES NOT TALLY WITH AUDATEX 10592.80. PLS ADVISE.	[I] Chong Boon Sen
23	15 Dec 2017 14:04	Adj Mandate Request	Cur Req:14314.60:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. AS SPOKEN, AUDATEX MARKING UPLOADED.	[A] LOW AI PHING
24	27 Dec 2017 14:23	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2017/06/19. Mandate Remarks: SUPP MANDATE REQUESTED OF 14314.60 DOES NOT TALLY WITH AUDATEX 10592.80. PLS ADVISE.	[I] Susan Teo
25	27 Dec 2017 14:23	Adj Mandate Set	Approved:14314.60:SUPP MANDATE REQUESTED OF 14314.60 DOES NOT TALLY WITH AUDATEX 10592.80. PLS ADVISE.	[I] Susan Teo

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1486765	06/06/2017 18:13	Motor	Cheng Auto Bodyworks (HQ)	Cheng Auto Bodyworks (HQ)	GBE9623T		xx.xx
1489896	09/06/2017 12:47	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	GBE9623T		10.70

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	06 Jun 2017 18:13	Clim Veh Model Changed	(204913) MITSUBISHI CANTER 3.0 D FEA01BR2SDEB (CBU) (M).	[R] Murugesan
2	06 Jun 2017 18:13	Clim Created	Reg No: GBE9623T, Policy No: DMCVSN1627421701. Acct Date: 2017/05/23. Claim Type: OD. Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ). Workshop: Cheng Auto Bodyworks (HQ). Created from SAS:MCAB17067564-01	[R] Murugesan
3	06 Jun 2017 19:32	Clim Submitted	18231.20.	[R] Murugesan
4	08 Jun 2017 10:09	Clim Registration Modified	Excess: -> 3600.00.	[I] Angie Foo
5	08 Jun 2017 10:09	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):PLEASE SURVEY, REVERT, CHECK CONSISTENCY OF THE DAMAGES, WHETHER IT IS ECONOMICAL TO REPAIR. EXCESS \$3,600/- IS APPLICABLE ON OWN DAMAGED CLAIM - DRIVING LICENSE 9 MONTHS	[I] Angie Foo
6	08 Jun 2017 10:09	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/06/19	[I] Angie Foo
7	08 Jun 2017 10:09	Adj Mandate Set	Approved:0.00.	[I] Angie Foo
8	08 Jun 2017 10:10	Assignment 1st Accessed		[A] CATHERINE CHONG KAI LING
9	08 Jun 2017 15:04	Adj Adjuster Assigned	[None] -> MOHD RASUL	[A] CATHERINE CHONG KAI LING
10	09 Jun 2017 12:47	Adj Rpt Initiated		[A] VERON CHEN
11	09 Jun 2017 12:53	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2017/06/19	[A] VERON CHEN
12	09 Jun 2017 12:55	Adj Mandate Request	Cur.Req:13855.02:Damages Consistent Repair Cost Economical	[A] VERON CHEN
13	15 Jun 2017 10:24	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2017/06/19. Mandate Remarks: Please proceed to authorize repairs at \$13,612.52 BEFORE Excess of \$3,600.00. RE-INSPECTION required.	[I] Alfred Toh
14	15 Jun 2017 10:24	Adj Mandate Set	Approved:13612.52:Please proceed to authorize repairs at \$13,612.52 BEFORE Excess of \$3,600.00. RE-INSPECTION required.Reinsp:Adj decides.	[I] Alfred Toh

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
1486765	06/06/2017 18:13	Motor	Cheng Auto Bodyworks (HQ)	Cheng Auto Bodyworks (HQ)	GBE9623T		xx.xx
1489896	09/06/2017 12:47	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	GBE9623T		10.70

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Angie Foo

Date: 12 Dec 2017

Preliminary Advice

Vehicle No	: GBE9623T	Accident Date	: 23/05/2017
Make	: MITSUBISHI CANTER	Policy No.	: DMCVSN1627421701
Assignment Date	: 08/06/2017	Excess	: S\$3,600.00
Date of Inspection	: 08/06/2017	Est. Duration of Repair	: 8.00
Inspection At	: CHENG AUTO BODYWORKS (HQ) 1 SOON LEE STREET, #06-41, PIONEER CENTRE SINGAPORE 627605		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	18,808.70 (with Supplementary \$577.50)
Revised Amount	:S\$	14,314.60 (with Supplementary \$577.50)
Check Items (Estimated)	:S\$	-
Total	:S\$	14,314.60
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	74,000.00
COE / PARF Rebate	:S\$	36,348.00
Salvage Value	:S\$	
Margin for Repair	:S\$	37,652.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Please assist supplementary approval.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Angie Foo

Date: 09 Jun 2017

Preliminary Advice

Vehicle No	: GBE9623T	Accident Date	: 23/05/2017
Make	: MITSUBISHI CANTER	Policy No.	: DMCVSN1627421701
Assignment Date	: 08/06/2017	Excess	: S\$3,600.00
Date of Inspection	: 08/06/2017	Est. Duration of Repair	: 8.00
Inspection At	: CHENG AUTO BODYWORKS (HQ) 1 SOON LEE STREET, #06-41, PIONEER CENTRE SINGAPORE 627605		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	17,620.52
Revised Amount	:S\$	8,184.97
Check Items (Estimated)	:S\$	5,670.05
Total	:S\$	13,855.02

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	74,000.00
COE / PARF Rebate	:S\$	36,348.00
Salvage Value	:S\$	
Margin for Repair	:S\$	37,652.00

Remarks

(X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

() The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

() Other comments :

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 23/05/2017 13:41
Date Of Accident 23/05/2017 08:55
Exact Location Of Accident ALONG TOH GUAN RD
Country/State Of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBE9623T
Insured/Policyholder
Name Of Registered Owner LONGSHOT TRANSPORT PTE LTD
Co Reg No 201531342H
Email Address LONGSHOT_TPT@YAHOO.COM.SG
Mobile Phone No
Alternative Phone No OFFICE-93873710

Vehicle Particulars

Manufacturer MITSUBISHI
Model CANTER-3.0 D FEA01BR2SDEB (CBU) (M)
Exact Purpose for which vehicle was being used at time of accident
Are you claiming under your own insurance policy for repair to your vehicle? NO
If No, Please state action to be taken REPORTING ONLY
Vehicle Category COMMERCIAL VEHICLE

Insurance Company

Name of Insurance Company CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage COMPREHENSIVE
Fleet Policy NO
Policy Number DMCVSN1627421701
Cover Note Number

Driver

Name of Driver LI HAITAO
NRIC No G3271440X
Date Of Birth 01/01/1961
Occupation OUTDOOR
Date Of Driving Pass 17/08/2016
Driving Experience 0 YEAR AND 9 MONTH
Gender MALE
Mobile Number
Fax Number
Contact Number
EMail Address NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company YES

If No, Relationship of the Driver with the Insured

Vehicle Registration Number of Driver's Own Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

Type Of Accident COLLISION- HEAD ON COLLISION
Weather Conditions CLEAR
Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
Was any body injured in the Accident? NO
Was any other material or property damaged? YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
If Yes, Please state which Police Station
Was notice of intended Prosecution given? NO
If Yes, against whom?

Circumstances of Accident

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBD5255D
Vehicle Make/Model/Colour
Details Of Properties
Name of Driver
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Details of Witness

Name
Phone Number
Email Address

Accident Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. The Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to revoke policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

3. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' law firms/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of privileged mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").

(b) all insurer(s) who have insured vehicle(s) involved in the accident and the insurers' law firms/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and

(c) my Personal Information may be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their law firms/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time

Sketch Plan


Driver's Signature (If driver is not the policyholder) / Date & Time



Witness Signature / Date & Time
Personnel



A: G8E 9623T

B: G8D5255D



LONGSHOT TRANSPORT PTE. LTD.
2 SIRAT ROAD
SINGAPORE 545750
TEL: 6387 3710 / 6387 6907
FAX: 6387 3828
Email: longshot_tpt@yahoo.com.sg
Reg No. 201531342H

Accident Sketch Plan

Describe Circumstances of the Accident

On the 23/05/2017 at 0855 hrs, I was travelling along Foh Guan Rd. As I was about to make a right turn. As there was a huge lorry in front of me, I couldn't see the vehicle on my left. As only the head of my vehicle came out, Vehicle B (G8D6255D) appeared and collided onto the left front of my vehicle.

Declaration

We declare the foregoing particulars are true in every respect.

- ☐ Own Damage Claim
☐ Third Party Claim
☐ OD/TP Claim at another workshop
☒ Reporting Only


 Policyholder's Signature / Date & Time


 Driver's Signature (If driver is not the policyholder) / Date & Time


 Witnessed by Approved Centre Personnel



LONGSHOT TRANSPORT PTE. LTD.
 2 SIRAT ROAD
 SINGAPORE 545750
 TEL: 6387 3710 / 6387 6907
 FAX: 6387 3829
 Email: longshot_tpt@yahoo.com.sg
 Reg No. 201531342H

Text size + -

Enquire PARF/COE Rebate for Registered Vehicle**Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 1342H

Vehicle Details

Vehicle No.: GBE9623T

Vehicle to be Exported: No

Intended De-registration
Date: 09 Jun 2017

Vehicle Make: MITSUBISHI

Vehicle Model: CANTER FEA01BR2SDEB (CBU)

Primary Colour: White

Manufacturing Year: 2016

Engine No.: 4P10C08932

Chassis No.: FEA01BA20120

Maximum Power Output:-

Open Market Value: \$28,212.00

Original Registration
Date: 05 May 2016

First Registration Date: 05 May 2016

Transfer Count: 0

Actual ARF Paid: \$1,411.00

Intended PARF Rebate Details

PARF Eligibility: No

PARF Eligibility Expiry
Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 04 May 2026

COE Category: C - Goods Vehicle & Bus

COE Period(Years): 10

PQP Paid: \$40,830.00

COE Rebate Amount: \$36,348.00

Total Rebate Amount: \$36,348.00

The information contained herein is correct as at 09 Jun 2017

OK

Land Transport Authority

Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 8.0 SP3 and above, 1024 X 768 resolution

Copyright © 2017 LTA. | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)

Last updated on 28 May 2017 at 12:58 AM

Certificate of Insurance



中国太平保险(新加坡)有限公司
CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
G-1, 10th Floor, 100 Robinson Road, Singapore 068902

10/01/2017
R 15
10010760
10010760

Motor (Commercial Vehicle)

CERTIFICATE OF INSURANCE

Motor Vehicle (Third-Party Risk and Compensation) Act (Chapter 189)
Motor Vehicle (Third-Party Risk and Compensation) (Regulation 189)
Road Transport Act, 1987 (Malaysia)
Motor Vehicle (Third-Party Risk and Compensation) Act (Chapter 189)

ORIGINAL

CERTIFICATE NO:	00000000000000000000	Engine No:	00000000000000000000
1. Policy Start and Expiry Date (Term of Insurance)	01/01/2017	Chassis No:	00000000000000000000
2. Name of Policyholder	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.		
3. Effective Date of the Commencement of Insurance for the purpose of the Singapore Insurance Act	01/01/2017	Sum Insured	50000.00
4. Date of Expiry of Insurance	01/01/2018	Excess	5000.00
5. Person in Charge of Person Motor Vehicle	(1) whilst the vehicle is being used in connection with the policyholder's business the person provided for is in the policyholder's employ and is driving on their order or with their permission. (2) whilst the vehicle is being used for social, domestic or pleasure purposes the person who is driving on the policyholder's order or with their permission. Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the motor vehicle or has been so permitted and is not disqualified by order of a court of law or by reason of any enactment or regulation to that behalf from driving the motor vehicle.		
6. Conditions of Insurance	(1) use in connection with the policyholder's business (2) use for the carriage of passengers (other than for hire or reward) in connection with the policyholder's business (3) use for social, domestic or pleasure purposes (4) use for racing, speed-making, reliability trial or speed-testing (5) use whilst towing a trailer except the towing of any one detached mechanically propelled vehicle (6) use for the carriage of passengers for hire or reward		

I/We hereby Certify

that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicle (Third-Party Risk and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Please see reverse



Issued By: Authorized Officer

CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.

Authorized Signatory

3, Bras Basah Road #15-00 Springhill Tower Singapore 079902 Tel: 6359 6111 Fax: 6225 3582 Website: www.icongroup.com

CHENG AUTO BODYWORKS
5 Soon Lee Street #01-62
Pioneer Point
Singapore
627607

Claim Reference:
Assessment Number: GR000065
Version: CHENGABS/1
Date Calculated: 06/06/2017 10:14

Full Report - V1
Registration: GBE9623T
Printed: 06/06/2017 17:14

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Cheng Auto Admin 4	Date of Incident:	23/05/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	DMCVSN1627421701	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MITSUBISHI
Model:	Fuso Canter
Sub Model:	BASE MODEL
Model Sheet Number:	G67 01
Registration:	GBE9623T
Registration Month:	May
Registration Year:	2016
VIN Number:	FEA01BA20120
Manufacture Year:	2016
Odometer:	Not Known
Colour:	
Engine Number:	4P10C08932
Fuel Level:	%

Model Specs

FROM 11/2010	AIR CONDITIONING
3.0 LTR 81KW	GWR 3.5T
SINGLE CAB COMFORT	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	02/06/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

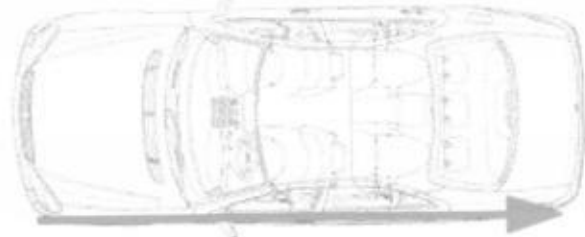
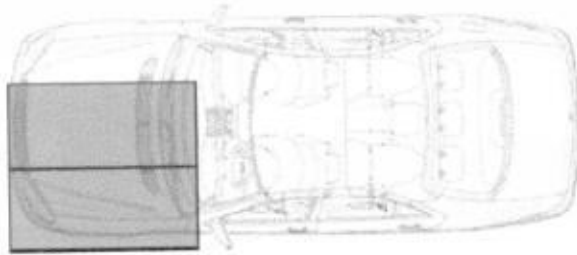
Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

**Addresses****Cost Summary**

Total Labour	\$1,959.60
Total Paint/Material	\$165.67
Total Parts	\$15,308.25
Total of Additional Costs	\$187.00
Excess:	TBA
Grand Total Exc GST:	\$17,620.52
0 % GST:	\$0.00
Grand Total Inc GST:	\$17,620.52

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /**Guide Number Repair Details**

	WU	Cost Price (\$)
NO NUMBER RENEW FRONT PANEL (FRONT SCREEN AND INSTRUMENT PANEL REMOVED) INCLUDES: R + R FRONT GRILLE, HEADLAMPS AND CORNER PANEL	62.0	285.20
421010 00 R + R CAB	37.0	170.20
NO NUMBER RENEW BUMPER REINFORCEMENT	4.0	18.40
411011 10) R + R FRONT BUMPER	2.0	9.20
411011 10) RENEW FRONT BUMPER (REMOVED)	2.0	9.20
423121 10 R + R WINDSCREEN	15.0	69.00
NO NUMBER RENEW L/KNEE PIECE INCLUDES: R + R SILL LINING AND COVERING	34.0	156.40
424111 10 RENEW L/DOOR BODY INCLUDES: R + R ATTACHED PARTS OF THE DOOR, ALIGN + ADJUST DOOR	20.0	92.00
424132 10 R + R LEFT DOOR EDGE PROTECTION	5.0	23.00
521110 10 R + R L/SEAT	3.0	13.80
523112 10ZAX R + R INSTRUMENT PANEL CPL INCLUDES: R + R COMBINATION INSTRUMENT	35.0	161.00
551110 10) R + R COMPLETE HEATER (INSTRUMENT PANEL AND FRONT GRILLE REMOVED)	13.0	59.80
427160 10) R + R FRONT CAB CROSSMEMBER (CAB REMOVED) INCLUDES: R + R TORSION BAR SPRING AND	56.0	257.60

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

427211 10)	STEERING GEAR	1.0	4.60
427211 10)	R + R L/F CAB HINGE (CAB AND CROSSMEMBER REMOVED)	1.0	4.60
427211 10)	R + R R/F CAB HINGE (CAB AND CROSSMEMBER REMOVED)	5.0	23.00
NO NUMBER	DRAIN + REFILL AIR CONDITIONING	10.0	46.00
553210 10ZAX	R + R CONDENSER	5.0	23.00
555011 10)	RENEW CONDENSER-/COMPRESSOR HOSE	5.0	23.00
555011 10)	R + R EVAPORATOR/CONDENSER PIPE		

LABOUR COST

Total Work Units	315.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	31.5HRS	\$1,449.00
Paint Labour	11.1HRS	\$510.60
Total Labour	42.6HRS	\$1,959.60

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
281	FRONT BUMPER NEW PART PAINTING	11.0	
340	R/INN IMPACT DAMPER SURFACE PAINT	5.0	
887	L/F CORNER PANEL NEW PART PAINTING	6.0	
900	FRONT PANEL NEW PART PAINTING	30.0	
1481	LEFT FRONT DOOR NEW PART PAINTING	16.0	
4235	L/F WHEELARCH PANEL NEW PART PAINTING	11.0	
410	FRONT GRILLE NEW PART PAINT K1R	4.0	
1482 *	RIGHT FRONT DOOR SURFACE PAINT	8.0	

LABOUR COST - PAINT

TIME(PAINT)	91.0	
Preparation Main Work Metal	17.0	
Preparation Comp. Work Plastic	3.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	111.0	
Total Paintwork Labour	11.1HRS	\$510.60

MATERIAL COST - PAINT

New Part Painting	\$111.50
New Part Painting - Plastic K1R	\$4.89
Surface-/Blend Paint	\$22.18
Material-Const Main Work Metal	\$18.10
Material-Const Comp. Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$165.67
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$165.67

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
281	1	FRONT BUMPER	MK616888		0%	650.00*
340	1	FRONT IMPACT DAMPER	MK547540		0%	250.00*
410	1	FRONT GRILLE	MK614811		0%	380.00*
561	1	LEFT HEADLAMP ASSY	MK486503		0%	420.00*
562	1	RIGHT HEADLAMP ASSY	MK486504		0%	420.00*
677	1	L/F INDICATOR	MK486509		0%	210.00*

Price Valid: 01/06/2015

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

678	1	R/F INDICATOR	MK486510
887	1	L/F CORNER PANEL	MK997197
900	1	FRONT PANEL	MK997156
1392	1	FRONT PANEL TRIM	MK487204
1395	1	L/UPPER TRIM	MK487208
1481	1	LEFT FRONT DOOR	MK702714
1505	1	L/F DOOR CHECK	MK484242
1509	1	L/F DOOR FRAME SEAL	MK403141
1737	1	L/MIRROR HEAD	MK486109
1741	1	L/DOOR MIRROR COVER	MK547648
2205	1	L/F STEP	MK488279
2811	1	FRONT TORSION BAR	MK622055
2813	1	L/CAB ATTACHMENT	MK622157
2816	1	R/OUT TORS BAR ATTM	MK396863
4235	1	L/F WHEELARCH PANEL	MK702700
4465	1	CONDENSER	ME733766
4499	1	AIR INTAKE HOSE	MK512843
4500	1	RETURN HOSE	MK512842
7797	1	AIR CON BLOWER MOTOR	ME733628
431	1	* FRONT MANUFACT BADGE	Renew
432	1	* BADGE	Renew
1000	1	FRT BUMPER BRACKET	Renew
1000	1	H TWIN PIPE	Renew
1000	1	FRT IMPACT DAMPER LH	Renew
1000	1	FUSO BADGE	Renew
1000	1	ROUND MIRROR L/H	Renew
1000	1	MIRR STND GRNISH LH	Renew
1000	1	DOOR HING LH	Renew
1000	1	DOOR HING RH	Renew

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Sub Total
Mark Up From Cost (5 %)
Sundry Parts (Fixed)
Total Parts

0%	sc	X	210.00*	X
0%	sc	X	360.00*	X
0%	R	X	750.00*	X
0%	R	X	420.00*	X
0%	R	X	360.00*	X
0%	pm	-	1,450.00*	-
0%	sc	X	60.00*	X
0%	sc	-	270.00*	-
0%	sc	-	85.00*	-
0%	X	sc	18.00*	X
0%	pt	-	260.00*	-
0%	pt	-	750.00*	-
0%	pt	-	800.00*	-
0%	pt	-	800.00*	-
0%	pt	-	450.00*	-
0%	pt	-	1,050.00*	-
0%	pt	-	463.25*	-
0%	pt	-	505.85*	-
0%	pt	-	1,950.00*	-
0%	sc	-	58.00*	-
0%	sc	-	58.00*	-
0%	pt	-	110.00*	-
0%	pt	-	130.95*	-
0%	pt	-	250.00*	-
0%	sc	-	95.00*	-
0%	pt	-	150.00*	-
0%	pt	-	30.00*	-
0%	pt	-	130.00*	-
0%	X	sc	130.00*	X
			\$14,484.05	
			\$724.20	
			\$100.00	
			\$15,308.25	

Rasul
HP 90010068

8 days

P/P

02/06/17 @ 1530

EXCHG: 3,600

REVERT

email: rasul@lkkauto.com

16/6/17

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
FRT NO PLATE W CVR SPECIALIST	0%	sc \$35.00
AUDATEX FEES SPECIALIST		\$42.00
COOLANT SPECIALIST	0%	\$30.00
AIRCON GAS SPECIALIST		\$50.00
COMPANY NAME SPECIALIST	0%	\$30.00
STICKER		
Total Extras		\$187.00

Final Calculation

Total Parts

Labour

Total Panel/Mechanical

Total Paintwork

Total Labour

Additional Costs

Corr Prot Materials External

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Audatex System Using Manufacturer Times

\$15,308.25

\$1,449.00

\$510.60

\$1,959.60

\$0.00

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

Corr Prot Materials Internal		\$0.00
Cost of Specialist	157	\$187.00
Total of Additional Costs		\$187.00
Total Paint/Material Costs		\$165.67 123.25
Grand Total Excludes GST		\$17,620.52
GST @ 0 %		\$0.00
Grand Total Includes GST		\$17,620.52

Assessment Notes

Summary Information

Vehicle

Manufacturer & Model: MITSUBISHI Fuso Canter Registration: GBE9623T
VIN Number: FEA01BA20120 Type: G67 01
Build Date: 2016

Software

Calculation Date: 06/06/2017 AudaDirect Version: 337
Software Version: Model Sheet Version:
Valid Part Price Date: 01/06/2015

Model Specification

B8 FROM 11/2010
F1 AIR CONDITIONING
N1 3.0 LTR 81KW
T2 GWR 3.5T
W2 SINGLE CAB COMFORT

Guide Numbers

Invalid Guide Numbers

431 F :

432 F :

***** THIS ASSESSMENT CONTAINS INVALID GUIDE NUMBERS - PLEASE CHECK *****

Eliminated Guide Numbers

Details

E	431	EL	Eliminated	Renew
E	432	EL	Eliminated	Renew
E	1487	EL	Eliminated	Renew
E	1495	EL	Eliminated	Renew

Input Details

Positions Input: 52

Input Data Details

Repair Type	Guide Number	WU	Bet %	Price	Adj
-------------	--------------	----	-------	-------	-----

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

E	432	0	0	\$0.00	Renew
E	431	0	0	\$0.00	Renew
E	2205	0	0	\$0.00	
LE	281	0	0	\$0.00	
E	281	0	0	\$0.00	
LE	340	0	0	\$0.00	
E	340	0	0	\$0.00	
E	431	0	0	\$0.00	
E	432	0	0	\$0.00	
LE	410	0	0	\$0.00	
E	410	0	0	\$0.00	
E	561	0	0	\$0.00	
LE	887	0	0	\$0.00	
E	887	0	0	\$0.00	
E	1487	0	0	\$0.00	
E	1495	0	0	\$0.00	
E	1505	0	0	\$0.00	
E	2811	0	0	\$0.00	
E	2813	0	0	\$0.00	
E	2816	0	0	\$0.00	
E	4465	0	0	\$0.00	
E	677	0	0	\$0.00	
E	1741	0	0	\$0.00	
E	7797	0	0	\$0.00	
E	4499	0	0	\$0.00	
E	4500	0	0	\$0.00	
E	1737	0	0	\$0.00	
E	1392	0	0	\$0.00	
LE	4235	0	0	\$0.00	
E	4235	0	0	\$0.00	
E	1509	0	0	\$0.00	
LE	900	0	0	\$0.00	
E	900	0	0	\$0.00	
L	1482	0	0	\$0.00	
E	1395	0	0	\$0.00	
E	1481	0	0	\$0.00	
LE	1481	0	0	\$0.00	
E	562	0	0	\$0.00	
E	678	0	0	\$0.00	
S	1000	0	0	\$0.00	Specialist FRT NO PLATE W CVR
E	1000	0	0	\$0.00	Renew FRT BUMPER BRACKET
E	1000	0	0	\$0.00	Renew H TWIN PIPE
S	1000	0	0	\$0.00	Specialist AUDATEX FEES
S	1000	0	0	\$0.00	Specialist COOLANT
S	1000	0	0	\$0.00	Specialist AIRCON GAS

CHENG AUTO BODYWORKS

Claim Reference:

Assessment Number: GR000065

Version: CHENGABS/1

Date Calculated: 06/06/2017 10:14

Full Report - V1

Registration: GBE9623T

Printed: 06/06/2017 17:14

E	1000	0	0	\$0.00	Renew FRT IMPACT DAMPER LH
E	1000	0	0	\$0.00	Renew FUSO BADGE
E	1000	0	0	\$0.00	Renew ROUND MIRROR L/H
E	1000	0	0	\$0.00	Renew MIRR STND GRNISH LH
S	1000	0	0	\$0.00	Specialist COMPANY NAME STICKER
E	1000	0	0	\$0.00	Renew DOOR HING LH
E	1000	0	0	\$0.00	Renew DOOR HING RH

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: 3 SNM17D03062C01

Assessment Number: GR000065

Version: CHINATAI/2

Date Calculated: 09/06/2017 05:23

Full Report - V1

Registration: GBE9623T

Printed: 09/06/2017 12:23

E	1000	0	0	\$0.00	Renew FRT IMPACT DAMPER LH
E	1000	0	0	\$0.00	Renew FUSO BADGE
E	1000	0	0	\$0.00	Renew ROUND MIRROR L/H
E	1000	0	0	\$0.00	Renew MIRR STND GRNISH LH
S	1000	0	0	\$0.00	Specialist COMPANY NAME STICKER
E	1000	0	0	\$0.00	Renew DOOR HING LH
P	1000	0	0	\$0.00	Check DOOR HING RH

**CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER**

079909

Claim Reference: 3 SNM17D03062C01
Assessment Number: GR000065
Version: CHINATAI/2
Date Calculated: 09/06/2017 05:23

Full Report - V1
Registration: GBE9623T
Printed: 09/06/2017 12:23

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Mr K.K Lau	Date of Incident:	23/05/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	3 SNM17D03062C01	Estimated Repair Time:	
Policy Number:	DMCVSN1627421701	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MITSUBISHI
Model:	Fuso Canter
Sub Model:	BASE MODEL
Model Sheet Number:	G67 01
Registration:	GBE9623T
Registration Month:	May
Registration Year:	2016
VIN Number:	FEA01BA20120
Manufacture Year:	2016
Odometer:	Not Known
Colour:	
Engine Number:	4P10C08932
Fuel Level:	%

Model Specs

FROM 11/2010	AIR CONDITIONING
3.0 LTR 81KW	GWR 3.5T
SINGLE CAB COMFORT	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	02/06/2017
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

CHINA TAIPING INSURANCE (S) PTE LTD

Claim Reference: 3 SNM17D03062C01

Assessment Number: GR000065

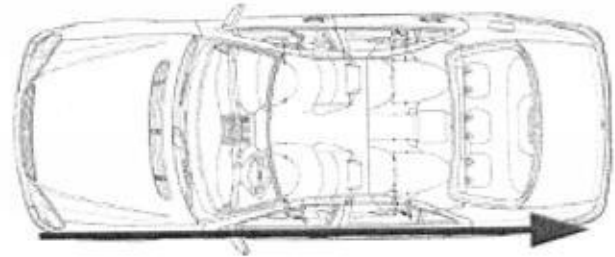
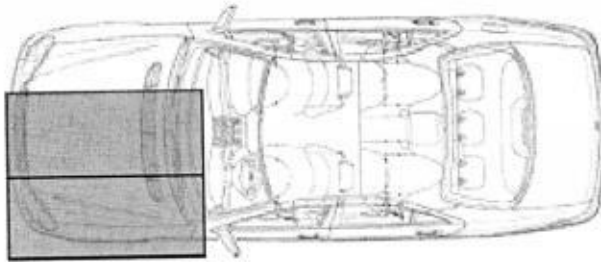
Version: CHINATAI/2

Date Calculated: 09/06/2017 05:23

Full Report - V1

Registration: GBE9623T

Printed: 09/06/2017 12:23

**Addresses****Cost Summary**

Total Labour	\$943.00
Total Paint/Material	\$165.67
Total Parts	\$6,889.30
Total of Additional Costs	\$187.00
Repair Cost Exc GST:	\$8,184.97
Overall Discount (0.0%):	- \$0.00
Excess:	-\$3,600.00
After Deduction -	
Grand Total Exc GST:	\$4,584.97
0 % GST:	\$0.00
Grand Total Inc GST:	\$4,584.97

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
516118 90	R + R RADIATOR GRILLE TRIM INCLUDES: R + R RADIATOR GRILLE	6.0	27.60
411011 10)	R + R FRONT BUMPER	2.0	9.20
411011 10)	RENEW FRONT BUMPER (REMOVED)	2.0	9.20
541010 10)	R + R R/MAIN HEADLAMP (FRONT GRILLE REMOVED)	1.0	4.60
515041 10	R + R L/F CORNER PART	3.0	13.80
541030 10	R + R R/F REPEATER LAMP	3.0	13.80
NO NUMBER	RENEW L/KNEE PIECE INCLUDES: R + R SILL LINING AND COVERING	34.0	156.40
424111 10	RENEW L/DOOR BODY INCLUDES: R + R ATTACHED PARTS OF THE DOOR, ALIGN + ADJUST DOOR	20.0	92.00
424132 10	R + R LEFT DOOR EDGE PROTECTION	5.0	23.00
521110 10	R + R L/SEAT	3.0	13.80
NO NUMBER	DRAIN + REFILL AIR CONDITIONING	5.0	23.00
553210 10ZAX	R + R CONDENSER	10.0	46.00
0340	CHECK FRONT IMPACT DAMPER	*	
0561	CHECK LEFT HEADLAMP ASSY	*	
0677	CHECK L/F INDICATOR	*	
1505	CHECK L/F DOOR CHECK	*	
1741	CHECK L/DOOR MIRROR COVER	*	
2811	CHECK FRONT TORSION BAR	*	