

REF:

CC3 / AUG17014400 / A1602

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: 40

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 67K.68k

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 198k days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SKA74311 Yr Regn: 2011, MarchType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Adi A4 cc 1798Colour: Grey A/C: Insured / Std / NI / NA

Sp. Reading: _____ T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAU2228KXA18467Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/55R16R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. _____ D.O.I. 25/07/17Survey held at PremiumDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop orReas o/s.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

00 A16SKA 74311 - CC3 / AUG1700677 / A1601DUN 26031428/7 - Report via maximen31/7 - authorise repair more than 22k1/8 - email to premium authorise repair excess \$0 not more than 82k

RECEIVED 0 0 MAR 2018

RECEIVED 31 AUG 2018

repair sum \$22,000/- (Red: 22139.50 : 47%)

Date/Time: File Pass to?



Prel. Report

Days Of Repair: 19

11/3/18 Typist



Final Report

Resurvey No. of Trip: _____

Date/Time: File Return to?

2)

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Report Format: ODLump Sum / I.E.I: (\$ 22,000/-)Survey Fee: 200

Transportation:

S + RS: 31

Photos

Others

TOTAL

210



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AIG ASIA PACIFIC INSURANCE PTE LTD		Ref : CC3/AIG17014405/Atb	
78 SHENTON WAY #08-16 CHARTIS BUILDING SINGAPORE 079120		Date : 26-07-2017	
Code : AIG			
1. Policy Particulars :- OWN DAMAGE			
Insured Veh.	Veh. Inspected	SKA 7431H	
Policy No. 2100254127	Coverage (\$)	0.00	
Claim No.	Excess (\$)	0.00	
Assign From	Assign Date	25/07/2017	
2. Vehicle Particulars & Condition			
Make & Model	c.c	0	
Engine No. HIDDEN	Year of Reg.		
Chassis No.	Colour		
Odometer -	Steering		
Brakes	Modification		
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	24/07/2017	Inspection Date	26/07/2017
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1. SINGAPORE 408699		
5a. Remarks			
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.			

Note: This document has not been finalised.
LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 26 Jul 2017

Preliminary Advice

Vehicle No	: SKA7431H	Accident Date	: 24/07/2017
Make	: AUDI A4	Policy No.	: 2100254127-06000
Assignment Date	: 26/07/2017	Excess	: S\$0.00
Date of Inspection	: 25/07/2017	Est. Duration of Repair	: 16.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (HQ) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	39,443.00
Revised Amount	:S\$	20,608.50
Check Items (Estimated)	:S\$	2,956.00
Total	:S\$	23,564.45

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	68,000.00
COE / PARF Rebate	:S\$	45,968.00
Salvage Value	:S\$	
Margin for Repair	:S\$	22,032.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Text size + -

Enquire PARF/COE Rebate for Registered Vehicle**Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC

Owner ID: 6028Z

Vehicle Details

Vehicle No.: SKA7431H

Vehicle to be Exported: No

Intended De-registration
Date: 26 Jul 2017

Vehicle Make: AUDI

Vehicle Model: A4 1.8 TFSI MU

Primary Colour: Grey

Manufacturing Year: 2010

Engine No.: CDH097055

Chassis No.: WAUZZZ8KXAA184167

Maximum Power
Output: 118.0 kW (158 bhp)

Open Market Value: \$38,519.00

Original Registration
Date: 29 Mar 2011

First Registration Date: 29 Mar 2011

Transfer Count: 0

Actual ARF Paid: \$38,519.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry
Date: 28 Mar 2021

PARF Rebate Amount: \$25,037.00

Intended COE Rebate Details

COE Expiry Date: 28 Mar 2021

COE Category: B - Car (1601cc & above)

COE Period(Years): 10

QP Paid: \$57,002.00

COE Rebate Amount: \$20,931.00

Total Rebate Amount: \$45,968.00

The information contained herein is correct as at 26 Jul 2017



Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above, 1024 X 768 resolution

Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)

Last updated on 16 Jul 2017 at 12:47 AM

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Tuesday, 1 August, 2017 10:14 AM
To: Claims; SUR
Subject: RE: SKA 7431 H Own Damage Claims

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SKA 7431H (Excess \$0/-). NOT MORE THAN \$22K PART BY PART.**

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk S1, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims [<mailto:claims@premiumauto.com.sg>]
Sent: Thursday, 27 July, 2017 6:08 PM
To: Denise Tay (LKKAuto) <denisetay@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: SKA 7431 H Own Damage Claims

Dear Denise,

My workshop accept part by park basic S\$22k.

Thank you and Have a nice day ahead!

Best Regards,
Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 19902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

View Received Message

This mail is associated with :

***SKA7431H (12255709495G)**

OD

Jul 24 2017 9:20AM

[WU XIAO LU]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on **31/07/2017 15:04 PM**.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$20608.50) - SKA7431H - Claim Handler: Chan, Kian Meng

Approved:20608.50:Repair limit not exceeding \$22,000.00. Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

*SKA7431H (1225570949SG)

OD

Jul 24 2017 9:20AM

[WU XIAO LU]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 13/03/2018 13:51 PM.

To LKK_HQ

Subject Alert - Adj Mandate Maintained - SKA7431H - Claim Handler: Chan, Kian Meng

Maintained:upload damage photos of Convenience lock control unit, battery. Why is it necessary to spray LHS rear fender?

(A3-S1)

✓
Refer to photo 21.

DOCUMENTS SUMMARY

There are no documents.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	24/07/2017 15:11
Date Of Accident	24/07/2017 09:20
Exact Location Of Accident	1030 ECP SINGAPORE 449893
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKA7431H
Insured/Policyholder	
Name Of Registered Owner	WU XIAO LU
NRIC No	S7666028Z
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-91017277
Alternative Phone No	OTHERS-91017277

Vehicle Particulars

Manufacturer	AUDI
Model	A4-1.8 TFSI MU (B8) (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken.

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100254127-06000
Cover Note Number	

Driver

Name of Driver	WU XIAO LU
NRIC No	S7666028Z
Date Of Birth	17/08/1976
Occupation	INDOOR
Date Of Driving Pass	19/07/2011
Driving Experience	6 YEARS AND 0 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-91017277
Fax Number	
Contact Number	OTHERS-91017277
Email Address	NOEMAIL

Address	3 LEEDON HEIGHTS #28-04
Postcode	267951
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

ON 24TH JULY AROUND 920 AM, I WAS DRIVING ON ECP FROM CITY TOWARDS CHANGI AIRPORT DIRECTION. IN FRONT OF ME, ABOUT 100 METRES AWAY, A CAR WAS SLOWING DOWN. I WAS SLOWING DOWN TOO AND SUDDENLY A TAXI (NO SHA5988S), HIT INTO MY CAR FROM THE BACK. MY CAR WAS DAMAGED IN THE REAR RIGHT BADLY. THE TAXI DRIVER, MR LIM YONG SHENG (DRIVING LICENSE S1418695) ADMITTED IT WAS HIS FAULT COULDN'T STOP HIS CAR IN TIME. LTA OFFICER TURNED OUT AND ADVISED ME TO DRIVE THE CAR OFF THE HIGHWAY FOR FOLLOW UP PROCEDURES. I DROVE AND PARKED THE CAR AT CAR PARK, 52 MARINE TERRACE TO CONTACT INSURANCE COMPANY. ONCE I TRIED TO IGNITE THE CAR AND FOUND THE CAR COULDN'T BE STARTED. I CALLED TOW TO TOW AWAY THE CAR TO AUDI WORKSHOP AT UBI. REPORTED BY: TF, SUBMITTED BY: MAS.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHA5988S
Vehicle Make/Model/Colour	
Details Of Properties	
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Details of Witness

Name	
------	--

Phone Number

Email Address

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims, including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages), and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes");
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Wong 24/07/2017
Policyholder's Signature / Date & Time

Wong 24/07/2017
Driver's Signature (if driver is not the policyholder) / Date & Time

Ed
Witnessed by Reporting Centre Personnel

Sketch Plan

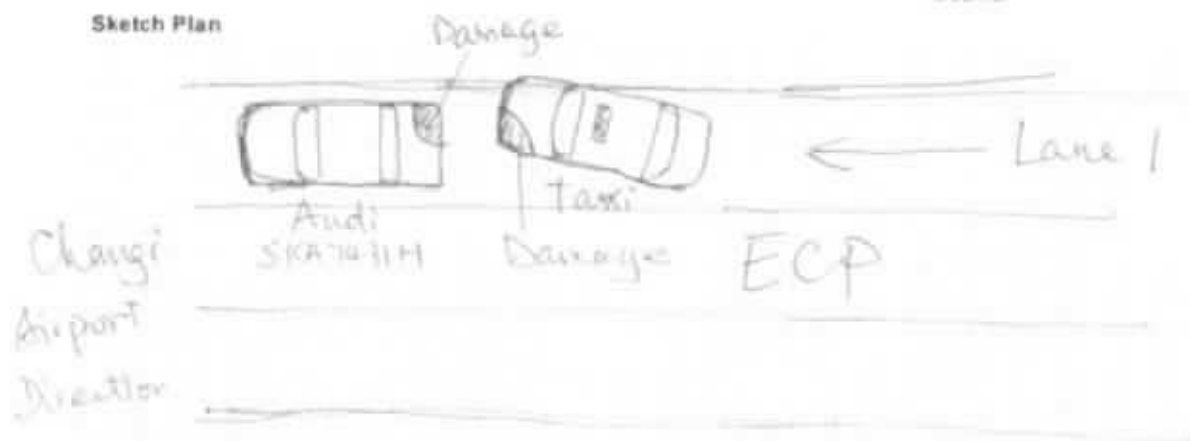

Sketch Plan #2

Describe Circumstances of the Accident

On 24th July 2017, around 9:20, I was driving from ECP from city towards Changi Airport direction. In front of me, about 100 meters away, a car was slowing down. I was slowing down too and suddenly a taxi (No. SHA5988S) hit into my car from back. My car was damaged in the rear right badly. The taxi driver, Mr. Lim Yong Seng (Driving license S1418695) admitted it was his fault & couldn't stop his car in time. LTA officer turned out and advised me to drive the car off the highway for follow-up procedures. I drove I drove and parked the car at car park at 52 Marine Terrace to contact insurance company. Once I tried to ignite the car and found the car couldn't be started. I called tow to tow away the car to Audi workshop at 11bi.

Declaration

(We declare the foregoing particulars are true in every respect)

Vial 24/07/2017
 Policyholder's Signature / Date & Time

Vial 24/07/2017
 Driver's Signature (If driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel



MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1967 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

MXI

OWN DAMAGE EXCESS	\$5800.00 (1)
WINDSCREEN EXCESS	\$5100.00

WINDSCREEN EXCESS
(the policy with effect from 1st November 2002)

SUM INSURED	Market Value
WITH COE/PARE	Yes

INSURING WITH COE/PARF

SKA7431H

© 2004 Blackwell Publishing Ltd

29 Mar 2017

DRIVE *

at The Insured

h) Any other person who is driving on the Insured's order or with his permission

A Young and/or Inexperienced Driver Excess ("YIDR") of \$53,000.00, in addition to the

Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

Use only for social, domestic and pleasure purposes and for the insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

L. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 6366 2323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDeigo Engrg - 205 Braddell Rd (Tel: 63837118) 3. DP5 Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ethor - 30 Bukit Batok Cres (Tel: 66547777) 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kai Fook Sing Motor - 61 Defu Lane 12 (Tel: 67479560) 7. Lay Huat (Meng Kee) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Moya Automotive - 1008 Bukit Merah Lane 3 (Tel: 62723892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SME Motor - 1 Kaki Bukit Ave 6 Blk D (Tel: 67476106)

LOSS OF USE Loss Of Use 1.5 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER Zhao Song

HIRE PURCHASE COMPANY / EMPLOYER'S LOAN DBS BANK LTD

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia) are not to be included under these headings.

I / We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1967 (Malaysia).

Issued At Singapore 3 Mar 2017

AIG Asia Pacific Insurance Pte. Ltd.

904125-200
PREMIUM LEASING - AP
261 ALEXANDRA ROAD
AUTH CUSTOMER SERVICE CENTRE
SINGAPORE 159938

Paday

AUTHORISED REPRESENTATIVE

ORIGINAL

SERVICE

Journal of Management Inquiry

1000

10

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S7666028Z



Name

WU XIAOLU

吴晓鹭

Race

CHINESE

Date of birth

17-08-1976

Country of birth

CHINA

Sex

F

S7666028Z

REPUBLIC OF SINGAPORE DRIVING LICENCE



Licence Number S7666028Z

Name

WU XIAOLU

Birth Date 17 Aug 1976

Issue Date 19 Jul 2011



4826654

NRIC No. S7666028Z



Date of issue

21-01-2013

3 LEEDON HEIGHTS #28-04
SINGAPORE 267951

NRIC No: S7666028Z

Date: 19/04/2017

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 3 Motor Cars < 3000kg with < 7 passengers, exclusive of the driver; and other motor vehicles < 2500kg 19 Jul 2011



Licence No: S7666028Z

NP 428A

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo




Accident Photo



Accident Photo



Accident Photo

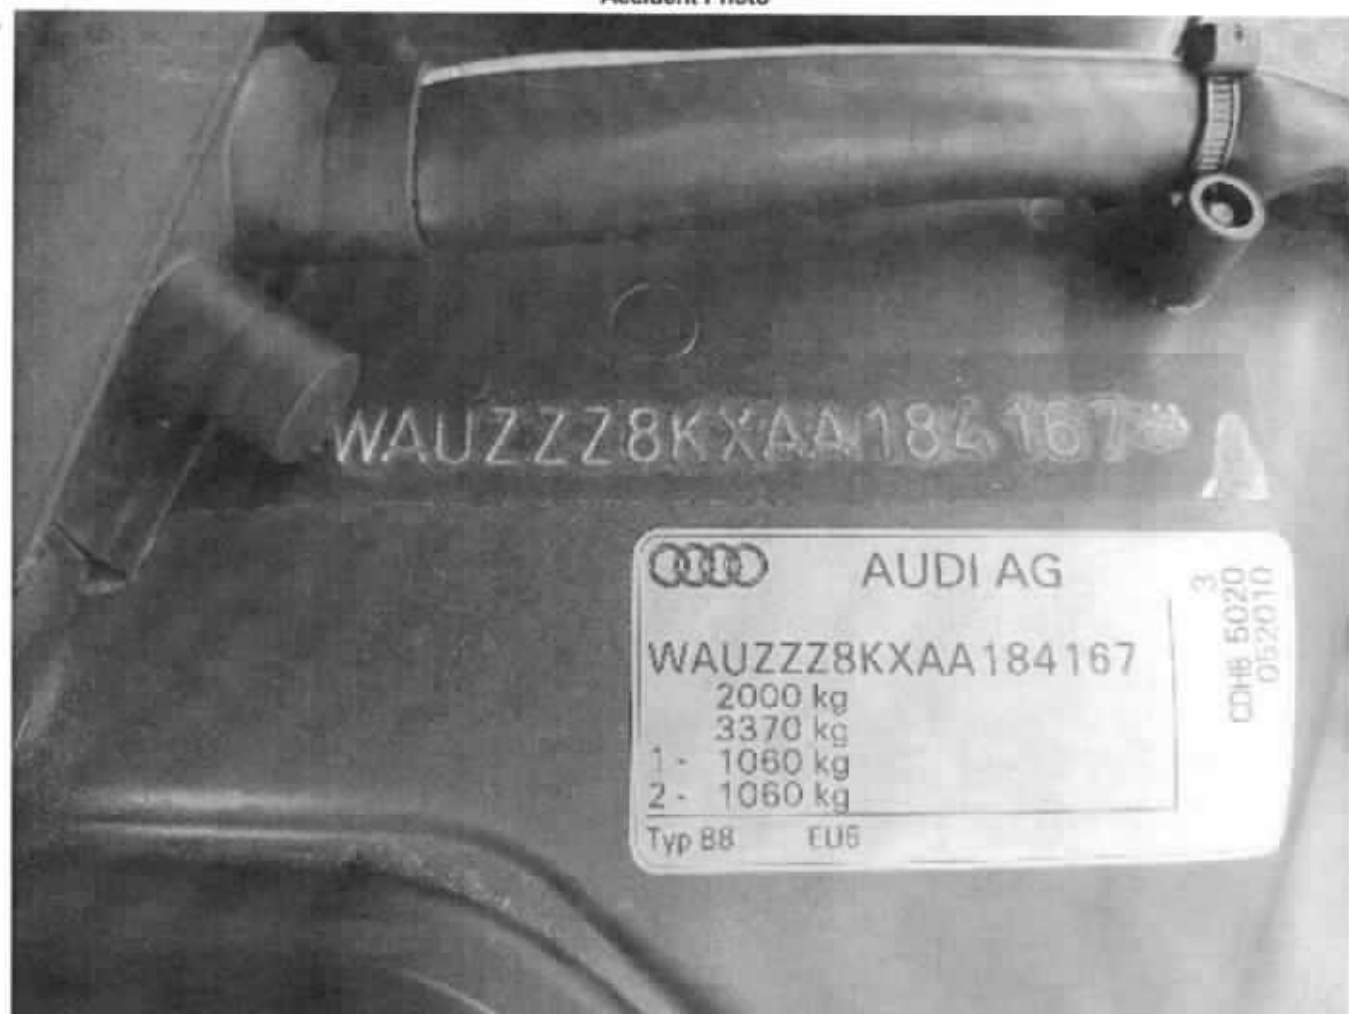



Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 00282

Vehicle Details

Vehicle No.: SKA7431H

Vehicle to be Exported: Yes

Intended De-registration Date: 25 Jul 2017

Vehicle Make: AUDI

Vehicle Model: A4 1.8 TFSI MU

Primary Colour: Grey

Manufacturing Year: 2010

Engine No.: CDH097005

Chassis No.: WAUZZZ8KAA184167

Maximum Power Output: 118.0 kW (158 bhp)

Open Market Value: \$38,519.00

Original Registration Date: 29 Mar 2011

First Registration Date: 29 Mar 2011

Transfer Count: 0

Actual ARP Paid: \$38,519.00

Intended PARF Rebate Details

PARF Eligible: Yes

PARF Eligible Expiry Date: 28 Mar 2021

PARF Rebate Amount: \$28,037.00

Intended COE Rebate Details

COE Expiry Date: 28 Mar 2021

COE Category: B - Car (1601cc & above)

COE Period/Years: 10

QP Paid: \$57,802.00

COE Rebate Amount: \$20,848.00

Total Rebate Amount: \$48,885.00

The information contained herein is correct as at 25 Jul 2017


INVESTFAIR

 5th - 6th August 2017 | 10am - 7pm
 Suntec Singapore Hall 401 & 402

**INVESTING AT EVERY
STAGE OF YOUR LIFE**


Username / Email Add

password



Connect

[Sign Up New Account](#)
[Forgot Password](#)
Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!
[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

Super Low Mileage And Tip Top Condition S23i In Market.


 N/A - Mileage With Last Servicing
 Record, View And Believe The
 Immaculate Condition!
 Direct Owner: [Shirley](#)

PRIME MOTOR & LEASING

With over 200 units of vehicles to choose from, ranging from all European to Japanese Makes.

Browse by Category

[Back](#) (1 2) [Next](#)

 Sort by Oldest Reg. Date [20 results](#)

23 vehicles

Audi A4

	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	
Search Selection	Audi A4	Any	Any	2011	Any	Any	Any	A
	Audi A4 1.8A TFSI MU	\$60,800	\$12,370 /yr	07-Jan-2011	1,798 cc	99,315 km	Luxury	A
\$7k Down Payment! Flexible Financing Options! Low Mileage And Well Maintained By Previous Owner. Cheapest Depre In The Market. Immaculate Condition, Call Now To View! Posted: 20-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
	Audi A4 2.0A TFSI Quattro S-tronic	\$68,800	\$13,510 /yr	28-Jan-2011	1,984 cc	115,000 km	Luxury	Available
\$16,800 Down Payment, \$958 Monthly Can Be Arranged. Sporty Design With A Good Performance Engine. Spacious Boot To Fit Frams And Golf Bags. Call Us Now For Enquiries. San Hup Bee Motoring Posted: 21-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
	Audi A4 2.0A TFSI Quattro S-Line	\$73,151	\$14,470 /yr	22-Feb-2011	1,984 cc	98,000 km	Luxury	Available
High/Flexible Loan Available! S-Tronic! Road Tax Till August 17, Pristine Condition! Accident Free Unit And Drive Away With No Repair Needed, High Loan And Trade In Available! Contact Us For Viewing N... Posted: 21-Jun-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
	Audi A4 1.8A TFSI MU Attraction	\$66,800	\$13,560 /yr	28-Feb-2011	1,798 cc	90,000 km	Luxury	Available
Attraction Model, Agent Unit, Pearl White, Nice Carplate, Very Well Maintain, Regularly Serviced, Sporty Design With A Good Performance Engine, Low Milg Done, Call Our Friendly Staff To Enquire More. Posted: 24-Jun-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
Car Buying Car Selling Car Aftermarket Car Ownership On The Move Lifestyle								
	Audi A4 1.8A TFSI MU S-Line	\$70,800	\$14,150 /yr	16-Mar-2011	1,798 cc	68,000 km	Luxury	Available
Full Agent Servicing And Maintenance Records. Purchased As Audi Management Car And Single Ownership. Excellent Condition. Low Mileage. Reserved Sheltered Parking Always. Family 3rd Car To Ferry Primar... Posted: 18-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
	Audi A4 1.8A TFSI MU S-Line	\$76,800	\$15,620 /yr	01-Apr-2011	1,798 cc	96,518 km	Luxury	Available
S-Line Model With Many Wear And Tear Parts Replaced For Peace Of Mind. Receipts All Available For Reference. Selling Due To Upgrade. Posted: 22-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								
	Audi A4 1.8A TFSI MU	-	N/A	07-Apr-2011	1,798 cc	82,700 km	Luxury	Available
Agent Unit, Superior Conditions, Complete Agent Service Record, COE Till Apr 2011. Posted: 06-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi								

**Audi A4 1.8A TFSI MU****\$69,900****\$13,800 /yr****25-Apr-2011****1,798 cc****76,000 km****Luxury****Available**

A Very Beautiful And Extremely Well Kept Metallic Grey Audi A4 1.8A TFSI MU In It's Original Flawless Low Mileage Condition Owned By Private Family Man Owner Selling Due To Upgrading. Always Parked Un...

Posted: 09-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU****\$69,800****\$13,730 /yr****30-Apr-2011****1,798 cc****95,000 km****Luxury****Available**

Beautiful And Extremely Well Keep. Always Parked Under Shelter And Solely Serviced At Premium Automobiles. 100% Accident Free And Original Nice Paintwork Condition.

Posted: 18-Jun-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU S-Line****\$75,800****\$14,890 /yr****12-May-2011****1,798 cc****65,000 km****Luxury****Available**

S-Line Model With Many Wear And Tear Parts Replaced For Peace Of Mind. Excellent Condition. Low Mileage. Well Taken Care By Professional Owner, Private Sheltered Parking. Ultimate Finance Packages Ava...

Posted: 22-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 2.0A TFSI Quattro S-Line****\$67,800****\$13,500 /yr****12-May-2011****1,984 cc****82,331 km****Luxury****A**

Up To 95% Loan Package Available. High Approval Rate. Balloon Scheme To Lessen Your Monthly Installment Burden. All Vehicles Are Inspected By Our Professional Team For Highest Quality. Extended Warrant...

Avant Automobile Pte Ltd

Posted: 14-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU S-Line****\$67,888****\$12,690 /yr****25-May-2011****1,798 cc****117,000 km****Luxury****A**

Full PA Agent Serviced, 18000km Done Yearly Only. 1 Of The Great Condition, Highest OMV Value Of \$38k Around. Lowest Depreciation, Superbly Well Maintained By 1 Audi-Lover Owner, Be Stunned By It Cond...

Posted: 19-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU S-Line****\$77,999****\$15,320 /yr****26-May-2011****1,798 cc****81,000 km****Luxury****Available**

Ambition Model With S-Line! High Spec 18" Rims, Premium 110 Point Check, Agent Service, 1 Owner, Low Mileage, Trade In, Flexible Financing Package Available. Low Downpayment, Kindly Call/ SMS 96916971 ...

Premium Automobiles

Posted: 14-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 2.0A TFSI Quattro S-tronic****\$76,800****\$14,390 /yr****30-May-2011****1,984 cc****93,188 km****Luxury****Available**

Lowest Depreciation With Loads Of Goodies And Freebies Included! Thoroughly Inspected With No Mechanical Defects, All Wear And Tear Parts Replaced With Receipts! Previous Owner Took Great Pains To Mal...

Posted: 07-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 Avant 2.0A TFSI S-Line****\$80,888****\$14,940 /yr****17-Jun-2011****1,984 cc****85,000 km****Stationwagon****Available**

1 Owner Only. Cheapest In The Market. coated With 3M Coating S-Line Sports Package. High Grade Model. Upgraded To Mtm Stage 1 With Lte Approval. Low Mileage Done At 14000km Per Year. High OMV Of \$45394...

Posted: 19-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 2.0A TFSI Quattro S-tronic****\$77,800****\$14,430 /yr****21-Jun-2011****1,984 cc****-****Luxury****Available**

Luxury And Sleek Audi A4 2.0A S-Line Model! Maintained By Agent. Pristine Condition. With Audi's Legendary Quattro, Mated To A Fast Shifting 7-Speed S-Tronic, Believe Me, You Will Enjoy The Exhilarat!

Posted: 15-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU****\$69,800****\$13,730 /yr****30-Jun-2011****1,798 cc****80,000 km****Luxury****Available**

Nice Number Going Off Together With Car! Zero Repairs Needed And 100% Accident Free. Please Call Our Friendly Sales Person For More Enquiry.

Posted: 23-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 2.0A TFSI Quattro S-tronic****\$74,800****\$13,370 /yr****21-Jul-2011****1,984 cc****90,000 km****Luxury****Available**

Lowest Price! S-Line Bodykits! Don't Miss! Phantom Black Beauty With Excellent Condition! Like Brand New Condition! Great Price With High OMV! Come View And Be Amazed By The Condition! Flexible! High ...

Posted: 30-May-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)
**Audi A4 1.8A TFSI MU S-Line****\$79,800****\$14,600 /yr****15-Sep-2011****1,798 cc****131,000 km****Luxury****Available**

Down Payment \$8K And Only \$1428 Monthly x 51 Months. New Set Of Front And Rear Brake Pads, New Set Of Pirelli P Zero Tyres, Well Maintain Unit, Accident Free, Evaluation Welcome, High Loan Available, ...

Posted: 21-Jul-2017 Tags: 2011 Audi A4, Audi A4, Audi, A4, Used Audi

[Details](#)

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0727/2017/JT
Date	:	25-Jul-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Ms. Wu Xiao Lu
Address	:	3 Leedon Heights #28-04 Singapore 267951
Telephone	:	HP +65 9101 7277
Type of Claim	:	Own Damage Claims
Policy No.	:	2100254127-06000
Vehicle No	:	SKA 7431 H
Model Code	:	Audi A4 1.8 TFSI Mu
Model / Year	:	Mar-11
Engine No	:	CDH 097055
Chassis No	:	WAUZZZ8KXAA184167
Mileage	:	
Date In	:	24-Jul-17
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	24-Jul-17
Place of Accident	:	1030 ECP Singapore 449893

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKA 7431 H.

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid. Check function and renew according to damages.	S/N S	280.00	✓ /
2	To renew RHS 1/4 glass and rear windscreen to facilitate fender renewal.	S/N S	600.00	✗ / ✓ /
3	To renew RHS 1/4 glass and rear windscreen to facilitate fender renewal.	S/N S	480.00	✗ ✗
4	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damages and renew where necessary.	S/N S	1,400.00	/ /
5	To remove and reinstall rear seats, back rest, hat trays, ABCD pillar trims, luggage compartment trims and seat belts. Dislodge roof liner and disengage curtain airbags, etc	S/N S	1,400.00	/ /
6	To remove and reinstall rear suspension assy, including rear exhaust silencer assy.	S/N S	2,800.00	✗ ✓ 2800
7	To place vehicle on cellette bench.	S/N S	1,800.00	✗ ✓ 1800
SUB TOTAL LABOUR CHARGES		:	<u>\$ 8,760.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKA 7431 H.

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
8	To dismantle rear bumper and rear lid. Repair and align both rear chassis frame to specification of origin. Cut out and weld rear end panelling, RHS rear fender, connecting plates, drain panel, tail lamp panel and outer wheel house. Renew rear bumper and rear lid. Align to position. Reinstall all parts removed.	\$ 8,400.00	4000 ✓
9	To respray rear bumper, rear lid, RHS rear fender, inner panels, RHS sill panel, door entrance, drain panel, roof channel, and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 5,800.00	2750 ✓
10	To carry out wheel alignment.	S/N \$ 240.00	✓ 240
11	To carry out diagnostic checks.	S/N \$ 384.00	✓ 384
TOTAL LABOUR CHARGES		: \$ 23,584.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	REAR BUMPER <i>3 Distorted</i>	\$ 1,495.00	✓ 1196
2	REAR BUMPER SPOILER	\$ 313.00	✓ 250
3	REAR SPOILER TRIM <i>not on</i>	\$ 210.00	+ X
4	REAR REINFORCEMENT BEAM <i>Not New</i>	\$ 541.00	? X
5	REINFORCEMENT BEAM BOLTS <i>Not New</i>	8 \$ 65.00	? X
6	REINFORCEMENT BEAM HOLDER - LHS/RHS <i>Not New</i>	\$ 364.00	? X
7	REAR BUMPER GUIDE - INNER RHS <i>Not New</i>	\$ 37.00	✓ 28.99
8	REAR BUMPER GUIDE - UPPER RHS <i>Not New</i>	\$ 18.00	✓ 14
9	PARKING AID SENSOR <i>1 piece damaged</i>	2 \$ 387.00	133.50 154.80
10	PARKING AID WIRING SET <i>per on</i>	\$ 446.00	+
11	UNDERBODY TRIM - RHS <i>Not on</i>	\$ 154.00	✓ 122.80
12	REAR LID <i>Not New</i>	\$ 1,849.00	✓ 1479.20
13	REAR LID HINGE - LHS/RHS <i>Not on</i>	\$ 526.00	+ X
14	REAR LID BALL STUD <i>Not New</i>	\$ 18.00	✓ X
15	REAR LID WEATHER STRIP <i>Not on</i>	\$ 167.00	+ X
16	REAR LID STOPPER <i>Not on</i>	2 \$ 16.00	+ X
17	REAR LID LOCK <i>2</i>	\$ 183.00	+ X
18	REAR LID LOCK COVER <i>Not New</i>	\$ 17.00	+ X
19	LID LOCK STRIKER	\$ 42.00	+ X
20	REAR LID PACKING <i>Not on</i>	\$ 29.00	✓ 22.64
SUB-TOTAL SPARE PARTS		\$ 6,877.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved. Remarks (X) = Not approved
Spare parts are Special Net.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	AUDI EMBLEM	\$ 105.00	84
22	"1.8T" EMBLEM	\$ 81.00	64.72
23	"A4" EMBLEM	\$ 81.00	64.72
24	OUTER LED TAIL LIGHT - RHS	\$ 855.00	684
25	INNER LED TAIL LIGHT - RHS	\$ 710.00	567.60
26	REAR LID TRIM	\$ 332.00	X
27	REAR FENDER - RHS	\$ 2,142.00	1713.60
28	BOLT STUD	4 \$ 32.00	25.28
29	REAR FENDER REINFORMENT - RHS	\$ 174.00	139.20
30	REAR FENDER CONNECTING PLATE - RHS	\$ 287.00	229.60
31	REAR FENDER BOTTOM PLATE - RHS	\$ 366.00	292.40
32	REAR WHEEL HOUSE LINER - RHS	\$ 192.00	153.60
33	WHEEL HOUSE LINER ATTACHEMENT - RHS	\$ 38.00	29.68
34	QUARTER GLASS - RHS	\$ 194.00	154.20
35	REAR WINDSCREEN	\$ 976.00	X
36	PRIMER	\$ 36.00	28.64
37	REAR WHEEL HOUSE - RHS	\$ 538.00	X
38	FUEL LID LOCK CABLE	\$ 88.00	X
39	FUEL LID ACTUATOR	\$ 75.00	X
40	ACRYLIC SEALER	S/N \$ 180.00	180
SUB-TOTAL SPARE PARTS		\$ 7,482.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	CAVITY WAX	S/N \$ 140.00	✓
42	STONE CHIP	S/N \$ 180.00	✓
43	QUARTER GLASS SEALENT	S/N \$ 100.00	✓
44	REAR WINDSCREEN SEALENT	S/N \$ 200.00	✓
45	METAL FILLER POWDER	S/N \$ 280.00	✓
46	SUNDRIES	\$ 600.00	7696
TOTAL SPARE PARTS CHARGES		\$ 15,859.00	
TOTAL LABOUR CHARGES		\$ 23,584.00	
GRAND TOTAL		\$ 39,443.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

61779.88

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian King
Surveyed Date : 25/07/17
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 16 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0727/2017/JT 2-Aug-17 Jeffery Tan 1 SKA 7431 H Audi A4 1.8 TFSI Mu	
Quantity	Description	Unit Price	Amount	
<u>Parts</u>				
1		\$ -		
<u>LABORS</u>				
1	To respray LHS rear fender.	\$ 900.00	\$	550.00
TOTAL		\$ 900.00	\$	550.00

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0727/2017/JT 14-Aug-17 Jeffery Tan 1 SKA 7431 H Audi A4 1.8 TFSI Mu	
Quantity	Description	Unit Price	Amount	
<u>Parts</u>				
1	Battery <i>Not Working</i>	\$ 356.50	\$	285.20
		\$ 356.50	\$	285.20
<u>LABORS</u>				
	TOTAL	\$ 356.50	\$	285.20

For Premium Automobiles Pte Ltd

Adrian Ling
SL-S

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 2

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0727/2017/JT 7-Aug-17 CHANG 1 SKA 7431 H Audi A4 1.8 TFSI Mu
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	CONTROL UNIT RETAINER <i>2 used</i>	\$ 50.00	\$ 39.92
2	FUSE HOLDER RELAY PLATE - RH <i>2 used</i>	\$ 35.00	\$ 27.76
3	FUSE RELAY <i>2 used</i>	\$ 44.00	\$ 35.20
4	CONVENIENCE LOCK CONTROL UNIT <i>2 used</i>	\$ 1,311.00	\$ 1,048.80
GRAND TOTAL		\$ 1,440.00	\$ 1,151.68

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0727/2017/JT
Date : 25-Jul-17

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Hi Adrian

yopu recommended 16 days
We took 19 days exclude 3 Sundays
and 1 PH - car on c/bench -
jb- 14/9

Owner's Name : Ms. Wu Xiao Lu
Address : 3 Leedon Heights
#28-04
Singapore 267951
Telephone : HP +65 9101 7277
Type of Claim : Own Damage Claims
Policy No. : 2100254127-06000
Vehicle No : **SKA 7431 H**
Model Code : Audi A4 1.8 TFSI Mu
Model / Year : Mar-11
Engine No : CDH 097055
Chassis No : WAUZZZ8KXAA184167
Mileage :
Date In : 24-Jul-17
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 24-Jul-17
Place of Accident : 1030 ECP Singapore 449893

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKA 7431 H.

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid. Check function and renew according to damages.	S/N \$	280.00	\$ 280.00
2	To renew RHS 1/4 glass and rear windscreen to facilitate fender renewal.	S/N \$	600.00	\$ 600.00
3	To renew RHS 1/4 glass and rear windscreen to facilitate fender renewal.	S/N \$	480.00	
4	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damages and renew where necessary.	S/N \$	1,400.00	\$ 1,400.00
5	To remove and reinstall rear seats, back rest, hat trays, ABCD pillar trims, luggage compartment trims and seat belts. Dislodge roof liner and disengage curtain airbags, etc	S/N \$	1,400.00	\$ 1,400.00
6	To remove and reinstall rear suspension assy, including rear exhaust silencer assy.	S/N \$	2,800.00	\$ 2,800.00
7	To place vehicle on cellette bench.	S/N \$	1,800.00	\$ 1,200.00
SUB TOTAL LABOUR CHARGES		:	\$ 8,760.00	\$ 7,680.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKA 7431 H.

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
	<i>cf</i>		\$ 7,680.00
8	To dismantle rear bumper and rear lid. Repair and align both rear chassis frame to specification of origin. Cut out and weld rear end panelling, RHS rear fender, connecting plates, drain panel, tail lamp panel and outer wheel house. Renew rear bumper and rear lid. Align to position. Reinstall all parts removed.	\$ 8,400.00	\$ 4,000.00
9	To respray rear bumper, rear lid, RHS rear fender, inner panels, RHS sill panel, door entrance, drain panel, roof channel, and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 5,800.00	\$ 2,750.00
10	To carry out wheel alignment.	S/N \$ 240.00	\$ 240.00
11	Supplementary	\$ 900.00	\$ 550.00
12	To carry out diagnostic checks.	S/N \$ 384.00	\$ 384.00
TOTAL LABOUR CHARGES		: \$ 24,484.00	\$ 15,604.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	REAR BUMPER	\$ 1,495.00	\$ 1,196.00
2	REAR BUMPER SPOILER	\$ 313.00	\$ 250.00
3	REAR SPOILER TRIM	\$ 210.00	
4	REAR REINFORCEMENT BEAM	\$ 541.00	
5	REINFORCEMENT BEAM BOLTS	8 \$ 65.00	
6	REINFORCEMENT BEAM HOLDER - LHS/RHS	\$ 364.00	
7	REAR BUMPER GUIDE - INNER RHS	\$ 37.00	\$ 28.99
8	REAR BUMPER GUIDE - UPPER RHS	\$ 18.00	\$ 14.00
9	PARKING AID SENSOR	2 \$ 387.00	\$ 154.80
10	PARKING AID WIRING SET	\$ 446.00	
11	UNDERBODY TRIM - RHS	\$ 154.00	\$ 122.80
12	REAR LID	\$ 1,849.00	\$ 1,479.20
13	REAR LID HINGE - LHS/RHS	\$ 526.00	
14	REAR LID BALL STUD	\$ 18.00	
15	REAR LID WEATHER STRIP	\$ 167.00	
16	REAR LID STOPPER	2 \$ 16.00	
17	REAR LID LOCK	\$ 183.00	
18	REAR LID LOCK COVER	\$ 17.00	
19	LID LOCK STRIKER	\$ 42.00	
20	REAR LID PACKING	\$ 29.00	\$ 22.64
SUB-TOTAL SPARE PARTS		\$ 6,877.00	\$ 3,268.43

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
	<i>cf</i>	\$	3,268.43
21	AUDI EMBLEM	\$ 105.00	\$ 84.00
22	"1.8T" EMBLEM	\$ 81.00	\$ 64.72
23	"A4" EMBLEM	\$ 81.00	\$ 64.72
24	OUTER LED TAIL LIGHT - RHS	\$ 855.00	\$ 684.00
25	INNER LED TAIL LIGHT - RHS	\$ 710.00	\$ 567.60
26	REAR LID TRIM	\$ 332.00	
27	REAR FENDER - RHS	\$ 2,142.00	\$ 1,713.60
28	BOLT STUD	4 \$ 32.00	\$ 25.28
29	REAR FENDER REINFORMENT - RHS	\$ 174.00	\$ 139.20
30	REAR FENDER CONNECTING PLATE - RHS	\$ 287.00	\$ 229.60
31	REAR FENDER BOTTOM PLATE - RHS	\$ 366.00	\$ 292.40
32	REAR WHEEL HOUSE LINER - RHS	\$ 192.00	\$ 153.60
33	WHEEL HOUSE LINER ATTACHEMENT - RHS	\$ 38.00	\$ 29.68
34	QUARTER GLASS - RHS	\$ 194.00	\$ 154.80
35	REAR WINDSCREEN	\$ 976.00	
36	PRIMER	\$ 36.00	\$ 28.64
37	REAR WHEEL HOUSE - RHS	\$ 538.00	
38	FUEL LID LOCK CABLE	\$ 88.00	
39	FUEL LID ACTUATOR	\$ 75.00	
40	ACRYLIC SEALER	S/N \$ 180.00	\$ 180.00
	SUB-TOTAL SPARE PARTS	\$ 7,482.00	\$ 7,680.27

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
			\$ 7,680.27
41	CAVITY WAX	S/N \$ 140.00	\$ 140.00
42	STONE CHIP	S/N \$ 180.00	\$ 180.00
43	QUARTER GLASS SEALANT	S/N \$ 100.00	\$ 100.00
44	REAR WINDSCREEN SEALANT	S/N \$ 200.00	\$ 200.00
45	METAL FILLER POWDER	S/N \$ 280.00	\$ 280.00
46	SUPPLEMENTARY	\$ 356.50	\$ 285.20
47	SUPPLEMENTARY	\$ 1,440.00	\$ 1,151.68
48	SUNDRIES	\$ 600.00	\$ 76.96
	TOTAL SPARE PARTS CHARGES	\$ 17,655.50	\$ 10,094.11
	TOTAL LABOUR CHARGES	\$ 24,484.00	\$ 15,604.00
	GRAND TOTAL	\$ 42,139.50	\$ 25,698.11

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

X keep reference

9/2 17

by 12/2/04

Material List for Accident Vehicle Regn No. SKA 7431 H.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	AUDI EMBLEM	\$ 105.00	✓
22	"1.8T" EMBLEM	\$ 81.00	✓
23	"A4" EMBLEM	\$ 81.00	✓
24	OUTER LED TAIL LIGHT - RHS	\$ 855.00	✓
25	INNER LED TAIL LIGHT - RHS	\$ 710.00	✓
26	REAR LID TRIM	\$ 332.00	+
27	REAR FENDER - RHS	\$ 2,142.00	✓
28	BOLT STUD	4 \$ 32.00	?
29	REAR FENDER REINFORMENT - RHS	\$ 174.00	✓
30	REAR FENDER CONNECTING PLATE - RHS	\$ 287.00	h✓
31	REAR FENDER BOTTOM PLATE - RHS	\$ 366.00	b✓
32	REAR WHEEL HOUSE LINER - RHS	\$ 192.00	✓
33	WHEEL HOUSE LINER ATTACHEMENT - RHS	\$ 38.00	✓
34	QUARTER GLASS - RHS	\$ 194.00	✓
35	REAR WINDSCREEN	\$ 976.00	+
36	PRIMER	\$ 36.00	✓
37	REAR WHEEL HOUSE - RHS	\$ 538.00	?
38	FUEL LID LOCK CABLE	\$ 88.00	?
39	FUEL LID ACTUATOR	\$ 75.00	?
40	ACRYLIC SEALER	S/N \$ 180.00	✓
SUB-TOTAL SPARE PARTS		\$ 7,482.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 2

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

PA/OD/0727/2017/JT

Date

7-Aug-17

Service Advisor

CHANG

Pages

1

Regn No

SKA 7431 H

Model No

Audi A4 1.8 TFSI Mu

Quantity

Description

Unit Price

Amount

Parts

- | Quantity | Description | Unit Price | Amount |
|-------------|------------------------------|------------|--------|
| 1 | CONTROL UNIT RETAINER | \$ 50.00 | |
| 2 | FUSE HOLDER RELAY PLATE - RH | \$ 35.00 | |
| GRAND TOTAL | | \$ 85.00 | |

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SKA 7431 H

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0727/2017/MAS

30 Aug 2018

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

total pages

RE: INSURANCE CLAIM FOR SKA 7431 H, Audi A4 1.8T FSI Mu

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

With reference to the above-mentioned vehicle, no. **SKA 7431 H**, claimant, **Ms. Wu XiaoLu**, please find the related document per attached.

1. A copy of the Original invoice no. 85012876 – S\$23,540.00
2. A copy of the Discharge Voucher duly signed by client.

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SKA 7431 H



Premium Automobiles Pte Ltd

Audi Centre Singapore
251 Alexandra Road
Singapore 159938
Main Telephone: 6836 2223
Main Telefax: 6471 8735

Alexandra Service Centre
251 Alexandra Road
Singapore 159938
Telephone: 6888 2223
Telefax: 6475 1823

Ubi Service Centre
15 Ubi Road 1
Singapore 408720
Telephone: 6888 2223
Telefax: 6475 1823

Customer Service
Service Appointment
15 Ubi Road 1
Singapore 408720
Telephone: 6888 2223
Telefax: 6475 1823
customers.care@premiumaudis.com.sg

INS TAX INVOICE
Company Reg No. 199902271W
GST Reg. No. 199902271W

Page 1 15:20

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012876 Date: 27/08/2018 Order: SKA7431H Term: 30	Account : A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	---

Regn No: SKA7431H Regn Date: 29/03/2011 Mileage: 60786 WIP NO: 32250

Model: A4 1.8T FSI MU Chassis: WAUZZZ8KXAA184167 Engine: CDH097055 Dept: U

VSF No:

You have been assisted by:- UB-Jiayee (33)

		Details	Qty	Unit Price	Amount
S	SUBLET	To carry out contractual LIMIT repair basis as agreed	22,000.00	1.00	22,000.00

Parts 0.00
Labour 0.00
Sublet 22,000.00
Menus 0.00
Lubricant 0.00

Sub-Total 22,000.00

7% GST 1,540.00

Grand Total 23,540.00



28/8

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Customer

Premium Automobiles

Telefax

to AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SKA 7431 H

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0727/2017/JT
25 August 2017

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE : CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A4 1.8 TFSI Mu
Vehicle Chassis No. : WAUZZZ8KXAA184167
Vehicle Regn No. : SKA 7431 H
Vehicle Mileage : 58,154 km
Vehicle Owner : Ms. Wu Xiao Lu
Certificate No : 2100254127-06000
Policy Excess : NIL
Accident Date : 24th July 2017
Place : 1030 ECP Singapore 449893
Repair Cost : S 23,540.00
WIP No. : 32250
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : _____
Date : 25/08/2017

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S7666028Z



Name

WU XIAOLU

吴晓鹭

Race

CHINESE

Date of birth

17-06-1976

Country of birth

CHINA

Sex

F

S7666028Z

REPUBLIC OF SINGAPORE DRIVING LICENCE



Licence Number S7666028Z

Name

WU XIAOLU


Birth Date 17 Aug 1976

Issue Date 19 Jul 2011



4925654

NRIC No: S7666028Z

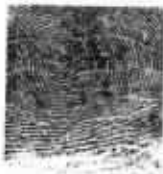

Date of issue

21-01-2013

3 LEEDON HEIGHTS #28-04
SINGAPORE 287951

NRIC No: S7666028Z

Date: 19/04/2017

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 3 Motor Cars <= 3000kg with <= 47 passengers, exclusive of the driver; and other motor vehicles <= 2500kg 19 Jul 2011



NP 428A



HOTLINE TEL: (65) 6419 3000
FAX: (65) 6415-3723

CERTIFICATE OF INSURANCE

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

M.X.1

AUDI AUTO PROTECTOR

CERTIFICATE NO. 2100254127-06000

OWN DAMAGE EXCESS S\$800.00 (1)

WINDSCREEN EXCESS S\$100.00

(for policies with effect from 1st November 2002)

SUM INSURED Market Value

INSURING WITH COE/PAIF Yes

1) VEHICLE REGISTRATION NO.

SKA7431H

2) NAME OF INSURED

Wu Xiao Lu

3) EFFECTIVE DATE OF THE COMMENCEMENT
OF INSURANCE FOR THE PURPOSES OF THE ACT

29 Mar 2017

4) DATE OF EXPIRY OF INSURANCE

28 Mar 2018

5) PERSON OR CLASSES OF PERSONS ENTITLED TO DRIVE *
SUBJECT TO AGE CONDITION :35 years old and above

a) The Insured.

b) Any other person who is driving on the Insured's order or with his permission.

A Young and/or Inexperienced Driver Excess ("YIDR") of S\$3,000.00, in addition to the Policy Excess, applies to You and any Authorised Driver (named or unnamed) if You are or the said Authorised Driver is below the age of 23 and/or has less than 2 years' driving experience.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

6) LIMITATION AS TO USE *

Use only for social, domestic and pleasure purposes and for the Insured's business.

The Policy does not cover use for hire or rewards, tuition, driving test, racing, pace-making, reliability trial speed-testing the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

APPROVED REPORTING CENTRES / AUDI AUTHORISED REPAIRERS

1. Audi Customer Service Center - 55 Ubi Road 1 (Tel: 63662323)

APPROVED REPORTING CENTRES / AIG AUTHORISED REPAIRERS (FOR CLAIMS-RELATED REPAIRS)

2. ComfortDelgro Engrg - 205 Braddell Rd (Tel: 63837118) 3. DPS Body & Paint Workshop - 209 Pandan Gardens (Tel: 65684501)

4. Ethos - 30 Bukit Batok Cres (Tel: 66547777) 5. Glass-Fix - 52 Ubi Ave 3 (Tel: 62780887) - For windscreen only

6. Kan Fook Sing Motor - 61 Defu Lane 12 (Tel: 67479560) 7. Lai Huat (Meng Kee) Motor - 21 Sin Ming Ind (Tel: 64538110)

8. Mova Automotive - 1008 Bukit Merah Lane 3 (Tel: 62725892) 9. Progressive Automotive - 3022A Ubi Rd 1 (Tel: 67415336)

10. SME Motor - 1 Kaki Bukit Ave 6 Bld D (Tel: 67476106)

LOSS OF USE Loss Of Use 15 days Replacement Car only for repairs at Audi Customer Service Centre

NAMED DRIVER Zhao Song

HIRE PURCHASE COMPANY / EMPLOYER'S LOAN DBS BANK LTD

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

I / We hereby Certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Issued At Singapore 3 Mar 2017

AIG Asia Pacific Insurance Pte. Ltd.

304123-200
PREMIUM LEASING - AP
281 ALEXANDRA ROAD
AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

AUTHORISED REPRESENTATIVE

ORIGINAL

SACFKJ

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	26 Jul 2017 11:29		26 Jul 2017 10:02 Edit Adj Rpt	S\$22,000.00 Edit Estimates	S\$22,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: WU XIAO LU , ID: S7666028Z, Tel: +6591017277, Email: NOEMAIL									
Vehicle Reg. No.: SKA7431H		Date of Loss: 24/07/2017 09:00 - :59 [75 Months and 25 Days From LTA Reg Date (Man Yr)]							
Claim Type: OD / 1225570949SG		Policy/Cover Note No.: 2100254127-06000 (Comprehensive)							
		Excess: S\$0.00							
Repairer: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911									
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Chan, Kian Meng] kianmeng.chan@aig.com									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 04/08/2017]									
Driver/Custodian: WU XIAO LU (40 / Female), NRIC: S7666028Z, Tel: +6591017277									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (20/08/2018): Alert - Adj Mandate Approved (S\$22000.00) - SKA7431H - Claim Handler: Chan, Kian... - AIG_SG (13/03/2018): Alert - Adj Mandate Maintained - SKA7431H - Claim Handler: Chan, Kian Meng - AIG_SG (31/07/2017): Alert - Adj Mandate Approved (S\$20608.50) - SKA7431H - Claim Handler: Chan, Kian... - AIG_SG (27/07/2017): SKA7431H / OD / 24/07/2017 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SKA7431H (1225570949SG)
OD
Jul 24 2017 9:20AM
[WU XIAO LU]
Premium Automobiles Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View View in Browser	
Assessment Reports			1 per page ☐ ☒	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	28/07/17 09:00	Adjuster Immediate Advice	 Load HTML	☐
Photos/Images			3 per page ☐ ☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	26/07/17 11:00	General View	 Load JPG	☒
2	26/07/17 11:00	General View	 Load JPG	☒
3	26/07/17 11:00	General View	 Load JPG	☒
4	26/07/17 11:00	General View	 Load JPG	☒
5	26/07/17 11:00	General View	 Load JPG	☒
6	26/07/17 11:00	General View	 Load JPG	☒
7	26/07/17 11:00	General View	 Load JPG	☒
8	26/07/17 11:00	General View	 Load JPG	☒
9	26/07/17 11:00	General View	 Load JPG	☒
10	26/07/17 11:00	General View	 Load JPG	☒
11	26/07/17 11:00	General View	 Load JPG	☒
12	26/07/17 11:00	General View	 Load JPG	☒
13	26/07/17 11:00	General View	 Load JPG	☒
14	26/07/17 11:00	General View	 Load JPG	☒
15	26/07/17 11:00	General View	 Load JPG	☒
16	26/07/17 11:00	General View	 Load JPG	☒
17	26/07/17 11:00	General View	 Load JPG	☒
18	26/07/17 11:00	General View	 Load JPG	☒
19	26/07/17 11:00	General View	 Load JPG	☒
20	26/07/17 11:00	General View	 Load JPG	☒
21	26/07/17 11:00	General View	 Load JPG	☒
22	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
23	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
24	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
25	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
26	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
27	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
28	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
29	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
30	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
31	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
32	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
33	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
34	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
35	08/03/18 11:14	Reinspection Photo	 Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
36	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
37	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
38	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
39	08/03/18 11:14	Reinspection Photo	 Load JPG	☒
40	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
41	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
42	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
43	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
44	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
45	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
46	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
47	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
48	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
49	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
50	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
51	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
52	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
53	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
54	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
55	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
56	17/08/18 17:04	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	26/07/17 10:58	Singapore Accident Statement	 Load PDF	
2	26/07/17 10:58	Marked estimate	 Load PDF	
3	26/07/17 10:58	Driver's Driving License	 Load PDF	
4	26/07/17 10:58	Certificate of Insurance	 Load PDF	
5	20/02/18 16:51	ESTIMATE 1	 Load PDF	
6	20/02/18 16:54	SUPPLEMENTARY	 Load PDF	
7	08/03/18 11:00	SUPPLEMENTARY 2	 Load PDF	
8	03/09/18 08:40	Workshop Invoice	 Load PDF	
9	03/09/18 08:40	Discharge Voucher	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	24/07/17 16:19	Accident Statement	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	24/07/17 16:14	Accident Photo	 Load JPG	☒
2	24/07/17 16:14	Accident Photo	 Load JPG	☒
3	24/07/17 16:14	Accident Photo	 Load JPG	☒
4	24/07/17 16:14	Accident Photo	 Load JPG	☒
5	24/07/17 16:14	Accident Photo	 Load JPG	☒
6	24/07/17 16:14	Accident Photo	 Load JPG	☒
7	24/07/17 16:14	Accident Photo	 Load JPG	☒
8	24/07/17 16:14	Accident Photo	 Load JPG	☒
9	24/07/17 16:14	Accident Photo	 Load JPG	☒
10	24/07/17 16:14	Accident Photo	 Load JPG	

Assessment Reports				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
					☒
Documentation				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	24/07/17 15:34	Sketch Plan		Load JPG	☒
2	24/07/17 15:34	Sketch Plan #2		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC3/AIG17014405/ATBE2

Date: 03/09/2018

REFERENCE

Insured/Claimant: WU XIAO LU Policy No: 2100254127-06000
Date of Loss: 24/07/2017 Nature of Claim: OD Claim No: 1225570949SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKA7431H
Make & Model: AUDI A4, 1.8 TFSI MU (B8) (A) Engine No: CDH097055
Reg. Date: 29/03/2011 (Man. Year: 2010) Chassis No: WAUZZZ8KXAA184167
Colour: Grey Odometer: 0 km
Engine Capacity: 1798 cc
Market Value/New Car Price: S\$68,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	17,295.88	10,094.11	7,201.77	41.64
Miscellaneous Items	0.00	0.00	0.00	
Labour	24,484.00	15,604.00	8,880.00	36.27
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	41,779.88	25,698.11	16,081.77	38.49
Approved Total (Overridden) (S\$)		22,000.00		
(S\$)	41,779.88	22,000.00	19,779.88	47.34
+ GST 7.00/7.00% (S\$)	2,924.59	1,540.00	1,384.59	47.34
Nett Amount (S\$)	44,704.47	23,540.00	21,164.47	47.34

INSPECTION

Date of Assignment: 26/07/2017
Date Inspected: 25/07/2017 Inspected At: Premium Automobiles Pte Ltd (HQ)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 19.0 days

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	1,495.00 FS	*1,196.00 FS
2	1		*REAR BUMPER SPOILER	Distorted	313.00 FS	*250.00 FS
3	1		*REAR SPOILER TRIM	Not Necessary	210.00 FS	*- FS
4	1		*REAR REINFORCEMENT BEAM	Not Necessary	541.00 FS	*- FS
5	8		*REINFORCEMENT BEAM BOLTS	Not Necessary	65.00 FS	*- FS
6	1		*REINFORCEMENT BEAM HOLDER - LHS/RHS	Not Necessary	364.00 FS	*- FS
7	1		*REAR BUMPER GUIDE - INNER RHS	Damaged	37.00 FS	*28.99 FS
8	1		*REAR BUMPER GUIDE - UPPER RHS	Damaged	18.00 FS	*14.00 FS
9	1		*PARKING AID SENSOR (2PCS)	Damaged - 1pc only	387.00 FS	*154.80 FS
10	1		*SET PARKING AID WIRING	Not Necessary	446.00 FS	*- FS
11	1		*UNDERBODY TRIM - RHS	Torn	154.00 FS	*122.80 FS
12	1		*REAR LID	Dented	1,849.00 FS	*1,479.20 FS
13	1		*REAR LID HINGE - LHS/RHS	Not Necessary	526.00 FS	*- FS
14	1		*REAR LID BALL STUD	Not Necessary	18.00 FS	*- FS
15	1		*REAR LID WEATHER STRIP	Not Necessary	167.00 FS	*- FS
16	2		*REAR LID STOPPER	Not Necessary	16.00 FS	*- FS
17	1		*REAR LID LOCK	Not Necessary	183.00 FS	*- FS
18	1		*REAR LID LOCK COVER	Not Necessary	17.00 FS	*- FS
19	1		*LID LOCK STRIKER	Not Necessary	42.00 FS	*- FS
20	1		*AUDI EMBLEM	Necessary	105.00 FS	*84.00 FS
21	1		*1.8T EMBLEM	Necessary	81.00 FS	*64.72 FS
22	1		*A4 EMBLEM	Necessary	81.00 FS	*64.72 FS
23	1		*OUTER LED TAIL LIGHT - RHS	Cracked	855.00 FS	*684.00 FS
24	1		*INNER LED TAIL LIGHT - RHS	Cracked	710.00 FS	*567.60 FS
25	1		*REAR LID TRIM	Not Necessary	332.00 FS	*- FS
26	1		*REAR FENDER - RHS	Distorted	2,142.00 FS	*1,713.60 FS
27	4		*BOLT STUD	Necessary	32.00 FS	*25.28 FS
28	1		*REAR FENDER REINFORCEMENT - RHS	Distorted	174.00 FS	*139.20 FS
29	1		*REAR FENDER CONNECTING PLATE - RHS	Bent	287.00 FS	*229.60 FS
30	1		*REAR FENDER BOTTOM PLATE - RHS	Bent	366.00 FS	*292.40 FS
31	1		*REAR WHEEL HOUSE LINER - RHS	Torn	192.00 FS	*153.60 FS
32	1		*WHEEL HOUSE LINER ATTACHMENT - RHS	Torn	38.00 FS	*29.68 FS
33	1		*QUARTER GLASS - RHS	Necessary	194.00 FS	*154.80 FS
34	1		*REAR WINDSCREEN	Not Necessary	976.00 FS	*- FS
35	1		*PRIMER	Necessary	36.00 FS	*28.64 FS
36	1		*REAR WHEEL HOUSE - RHS	Repair	538.00 FS	*- FS
37	1		*FUEL LID LOCK CABLE	Not Necessary	88.00 FS	*- FS
38	1		*FUEL LID ACTUATOR	Not Necessary	75.00 FS	*- FS
39	1		*ACRYLIC SEALER	Necessary	180.00 FS	*180.00 FS
40	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
41	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
42	1		*QUARTER GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
43	1		*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
44	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
45	1		*SUNDRIES	Necessary	600.00 FS	*76.96 FS
46	1		*BATTERY	Not Working	285.20 FS	*285.20 FS
47	1		*CONTROL UNIT RETAINER	Cracked	39.92 FS	*39.92 FS
48	1		*FUSE HOLDER RELAY PLATE - RH	Cracked	27.76 FS	*27.76 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
49	1		*FUSE RELAY	Damaged	35.20 FS	*35.20 FS
50	1		*CONVENIENCE LOCK CONTROL UNIT	Damaged	1,048.80 FS	*1,048.80 FS
51	1		*REAR LID PACKING	Necessary	29.00 FS	*22.64 FS
F=Franchise part. S=SpcNett.						
Total Parts (S\$)					17,295.88	10,094.11

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION AND RENEW ACCORDING TO DAMAGES	New	280.00	280.00
2	TO RENEW RHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE FENDER RENEWAL	New	600.00	600.00
3	TO RENEW RHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE FENDER RENEWAL	New	480.00	0.00
4	TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR TAIL LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGES AND RENEW WHERE NECESSARY	New	1,400.00	1,400.00
5	TO REMOVE AND REINSTALL REAR SEATS, BACK REST, HAT TRAYS, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS AND SEAT BELTS. DISLodge ROOF LINER AND DISENGAGE CURTAIN AIRBAGS, ETC	New	1,400.00	1,400.00
6	TO REMOVE AND REINSTALL REAR SUSPENSION ASSY, INCLUDING REAR EXHAUST SILENCER ASSY	New	2,800.00	2,800.00
7	TO PLACE VEHICLE ON CELLETTE BENCH	New	1,800.00	1,200.00
8	TO DISMANTLE REAR BUMPER AND REAR LID. REPAIR AND ALIGN BOTH REAR CHASSIS FRAME TO SPECIFICATIONS OF ORIGIN. CUT OUT AND WELD REAR END PANELLING, RHS REAR FENDER, CONNECTING PLATES, DRAIN PANEL, TAIL LAMP PANEL AND OUTER WHEEL HOUSE. RENEW REAR BUMPER AND REAR LID. ALIGN TO POSITION. REINSTALL ALL PARTS REMOVED	New	8,400.00	4,000.00
9	TO RESPRAY REAR BUMPER, REAR LID, RHS REAR FENDER, INNER PANELS, RHS SILL PANEL, DOOR ENTRANCE, DRAIN PANEL, ROOF CHANNEL, AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	5,800.00	2,750.00
10	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	240.00
11	TO CARRY OUT DIAGNOSTIC CHECKS	New	384.00	384.00
12	TO RESPRAY LHS REAR FENDER	New	900.00	550.00
Gross Labour Cost (\$\$)			24,484.00	15,604.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >