

REF:

CS/TP17024082/Aqbnz

ASSIGNMENT

17/05/11

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

Veh No: SKC6833C Yr Regn: 2011 May  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: Audi A5 c.c. 1984  
 Colour: Black A/C: Insured / Std / NI / NA  
 Sp. Reading: 91462 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: WAU2Z2870BA009176  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_  
 Tyre Size: F: 245/35R19  
 R: 245/35R19  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or \_\_\_\_\_  
 Front \_\_\_\_\_ Rear \_\_\_\_\_  
 R/Bal. 06 mm R/Bal. 03 mm  
 L/Bal. 06 mm L/Bal. 06 mm  
 D.O.A. \_\_\_\_\_ D.O.I. 19/02/17  
 Survey held at T.K.  
 Des. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or \_\_\_\_\_  
 The U/C / Chassis frame / Body Structure affected due to collision

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No  
 Est. Repairs: 21 days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Date / Time Action / Instruction  
TPAXA Independent

MV: 78K  
PV: 51K  
Net: 27K.

SKC 6833C - (CS/msh/17024082/Vd3)  
by \$30000, 21 days (Red \$27739, 48%)

DCA: 141217

RECEIVED 18 MAY 2011

Date/Time, File Pass to?  : Preli. Report  
 : Final Report  
11/8/5 TPAXA

Days Of Repair: 21  
 Resurvey No. of Trip: 2

Survey Fee: \_\_\_\_\_  
Transportation: \_\_\_\_\_

47XIS=705
170+705
50
50+50
317
80
1422

Add Fee:  : Site Insp (\$ \_\_\_\_\_)  
 : Interview (\$ \_\_\_\_\_)  
 : Tech. Invs (\$ \_\_\_\_\_)  
 : Weekend (\$ \_\_\_\_\_)

Report Format: TP  
 Lump Sum / I.B.F. (\$) 30000

18/5/11

## Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	1808D
Vehicle Details	
Vehicle No.:	SKC6833C
Vehicle to be Exported:	Yes
Intended De-registration Date:	19 Dec 2017
Vehicle Make:	AUDI
Vehicle Model:	A5 2.0 QUATTRO A
Primary Colour:	Black
Manufacturing Year:	2010
Engine No.:	CDN139309
Chassis No.:	WAUZZZ8T0BA009176
Maximum Power Output:	155.0 kW (207 bhp)
Open Market Value:	\$49,163.00
Original Registration Date:	17 May 2011
First Registration Date:	17 May 2011
Transfer Count:	0
Actual ARF Paid:	\$49,163.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	16 May 2021
PARF Rebate Amount:	\$31,955.00
Intended COE Rebate Details	
COE Expiry Date:	16 May 2021
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$56,011.00
COE Rebate Amount:	\$19,082.00
<b>Total Rebate Amount:</b>	<b>\$51,037.00</b>

The information contained herein is correct as at 19 Dec 2017

**FairPriceOnline** www.fairprice.com.sg  
For new sign-ups, enjoy \$10 off with a min Promo Code: **TEN**

Username / Email Add  
password  
Connect Sign Up New Account Forgot Password

**Post an Advertisement**  
Sell it yourself! Advertise it at just **\$58 until it's SOLD!**

Mitsubishi Fuso Super Great FV51S.



Very Low Mileage, Well Maintained. Please Come For Viewing If Interested. Direct Owner - StarAd

Free VICOM evaluation  
Free grooming and 8 months maintenance  
In-house workshop ensures quality service  
Member of SVTA and hire purchase association  
100% deposit refund for unapproved loan  
**YONG LEE SENG MOTOR PTE LTD**

Post an Ad Advertiser Login Ways of Selling

Browse by Category

Sort by Date Posted 20 results/page

17 vehicles

audi a5

Advanced Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
<b>Search Selection</b>	audi a5		Any	Any	2011	Any	Any	Any	Available
	Audi A5 Sportback 2.0A TFSI Quattro		\$65,500	\$14,570 /yr	11-Jan-2011	1,984 cc	91,300 km	Luxury	Available PREMIUM AD
Down Payment \$10k Only! Definitely The Best Condition In Town! Guarantee Accident Free. 100% Quality Buy! STA And Vicom Evaluation Welcome. Vehicle In Showroom. Elegant Black With Beige Interior. Lowe...									
Posted: 13-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
	Audi A5 Sportback 2.0A TFSI Quattro		\$67,500	\$13,760 /yr	22-Feb-2011	1,984 cc	88,500 km	Luxury	Available PREMIUM AD
\$13,000 Downpayment. From Premium Automobile And Fully Maintained By PA. Accident Free And Low Depreciation. High OMV Of \$47561. Regular Polishing And Park Under Shade. 1 Owner (Transfer Count Due To ...									
Posted: 27-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
	Audi A5 Cabriolet 2.0A TFSI Quattro		\$86,800	\$17,520 /yr	14-Apr-2011	1,984 cc	120,000 km	Sports	Available PREMIUM AD
The Most Elegant And Practical Cabriolet At An Affordable Price Tag. Black With Brown Leather Interior, Regularly Groomed, Agent Maintained Excellent Condition, View To Believe. Call Now For Inquiries									
Posted: 25-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
	Audi A5 Coupe 2.0A TFSI Quattro		\$80,000	\$16,620 /yr	18-Apr-2011	1,984 cc	59,000 km	Sports	Available DIRECT OWNER
One Lady Owner With Extremely Low Mileage. Serviced And Maintained Regularly With Agent And Specialist Audi Workshop. White Exterior With Sporty Brown Seats. Never Been Modded, Totally Stock Condition...									
Posted: 10-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
Car Buying	Car Selling	Car Aftermarket							
Car Ownership	On The Move	Lifestyle	Buy Tyres Online! Latest Special Offers from Tyrexpert						
	Audi A5 Cabriolet 2.0A TFSI Quattro		\$79,000	\$15,010 /yr	27-Apr-2011	1,984 cc	79,000 km	Sports	Available
Flawless A5 Cabriolet With Loads Of Upgrades! Approved Supersprint Catback Exhaust, Upper And Lower K&N Filter, RS Front Grille, Strut Bars, Ap Front And Rear BBK, BBS Wheels, CF GT Wing, Reverse Cam,...									
Posted: 03-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
	Audi A5 Sportback 1.8A TFSI MU		\$67,000	\$13,270 /yr	12-May-2011	1,798 cc	-	Luxury	Available PREMIUM AD
In Tip Top Condition. Servicing Just Done Dec 17, New Tyres, New Suspension, Road Tax Till Jun 2018. Excellent Continental Car For Audi Lovers. Viewings And Test Drives Are Strictly By Appointment Onl...									
Monster Motors Pte Ltd Posted: 21-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									
	Audi A5 Coupe 3.2A FSI Quattro S-Line		\$74,800	\$13,920 /yr	30-May-2011	3,197 cc	49,000 km	Sports	Available PREMIUM AD
Cheapest Price In Town For This Super Low Mileage Audi A5 Coupe 3.2L, Only 49,000km! Beautiful Pearl White With Black S-Line Interior! High OMV \$53,737! Road Tax Till May 2018! Well Maintained By Prev...									
Posted: 10-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, Audi A5, Used Audi									

Posted: 29-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi



**Audi A5 3.0A TDI Quattro** **\$79,800** **\$14,610 /yr** **12-Jul-2011** **2,967 cc** **56,000 km** **Sports** **Available**

**Fuel Type:** Diesel (Euro 5 Engine and Above)  
 Very Low Mileage! Agent Unit! Full Agent Service! 240Bhp. 500Nm. Experience Driving With The TDI, And Discover Why It Gives So Much More. In House Loan Available 10% Downpayment Drive Away. Call Now!

Hui Hua Credit Pte Ltd

Posted: 30-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

[Details](#)



**Audi A5 Sportback 2.0A TFSI Quattro** **\$75,800** **\$14,470 /yr** **21-Jul-2011** **1,984 cc** **90,000 km** **Luxury** **Available**

Timely Maintained At Reputable Workshop. Kept In Neat And Tidy Condition, No Visible/Major Flaws. Non-smoker Owner. Lots Of Wear And Tears Has Been Replaced. Spacious With Ample Leg Space, Seats Full ...

Posted: 09-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**GREAT OWNER**

[Details](#)



**Audi A5 Coupe 2.0A TFSI Quattro** **\$76,900** **\$14,370 /yr** **29-Jul-2011** **1,984 cc** **71,500 km** **Sports** **Available**

Only 2 Owner. Low Mileage. Serviced And Maintain By Audi Specialist Workshop (Servo Autowerkz). Very Well Maintain. Mint Condition. Price Nego. Call Us For A Discussion.

Posted: 14-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

[Details](#)



**Audi A5 Sportback 2.0A TFSI Quattro** **\$79,900** **\$14,670 /yr** **20-Sep-2011** **1,984 cc** **120,000 km** **Luxury** **Available**

From Its Head-turning Design To Heart-racing Performance, Everyday Functionality To Characteristic Sportiness, Your Wildest Dreams Have Been Brought To Life. Give In To Desire. One Owner. Fully Servic...

Posted: 15-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**DIRECT OWNER**

[Details](#)



**Audi A5 Sportback 2.0A TFSI Quattro S-Line** **\$89,888** **\$17,450 /yr** **11-Nov-2011** **1,984 cc** **-** **Luxury** **Available**

Not The Typical A5s You See On The Road, S-Line Sports Seats With Full Original S5 Conversion, Brembo BBK, APR Carbonio Air Intake (Carbon Fibre), Eurocode HFC, Downpipe, Forge Diverter Valve, Eurocod...

Posted: 01-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**PREMIUM AD**

[Details](#)



**Audi A5 Sportback 2.0A TFSI Quattro** **\$81,800** **\$14,830 /yr** **17-Nov-2011** **1,984 cc** **80,000 km** **Luxury** **Available**

Perfect Solution If You Are Looking For A Family Car With A Sporty Blend. Drive Away With Down Payment Of \$8588 Only! Audi Agent Unit With APR Stage 1 Tuning! Owner's Spare Car. Call Us For A Viewing ...

Cars 88 Pte Ltd

Posted: 15-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**PREMIUM AD**

[Details](#)



**Audi A5 Coupe 2.0A TFSI Quattro** **\$80,000** **\$14,690 /yr** **18-Nov-2011** **1,984 cc** **-** **Sports** **Available**

Well Maintained, Engine Overhaul With Piston Ring, Engine Mounting All Replaced, Gearbox Replaced, New Clutch, Wear And Tear Replaced, Rotor And Brake Replaced, Service At Reputable Workshop. All Come...

Posted: 06-Nov-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**DIRECT OWNER**

[Details](#)



**Audi A5 Coupe 2.0A TFSI Quattro** **\$81,800** **\$14,470 /yr** **30-Nov-2011** **1,984 cc** **65,000 km** **Sports** **Available**

Promo Interest Rate At 1.99% Till Dec End Only! \$9k Down Payment! Extended 1 Year Warranty From QBE Insurance! Agent Unit In Showroom Condition! STA Welcome. Roadtax Till May 2018! Among The Most Styl...

Dynamic Motoring

Posted: 16-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

[Details](#)



**Audi A5 Sportback 2.0A TFSI Quattro** **\$90,999** **\$17,020 /yr** **30-Nov-2011** **1,984 cc** **84,000 km** **Luxury** **Available**

Premium Pre Owned 110 Points Check, Flexible Finance And Trade In Can Be Arranged. Kindly SMS For Further Enquiries Or Appointment For Viewing. Thank You.

Premium Automobiles

Posted: 15-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

**PREMIUM AD**

[Details](#)

Compare



**Audi A5 Sportback 2.0A TFSI Quattro S-Line** **\$79,800** **\$14,190 /yr** **30-Nov-2011** **1,984 cc** **140,000 km** **Luxury** **Available**

In Showroom Condition. Beautiful Interior & Exterior An Excellent Choice For The Audi Lovers. Seeing Is Believing The Condition Of The Vehicle. With In-house Loan (10%) Available, Why Not Flaunt This ...

Hua Yang Credit Pte Ltd

Posted: 03-Dec-2017 Tags: 2011 Audi A5, 2011 Audi A5, Audi A5, Audi A5, Audi A5, A5, Used Audi

[Details](#)

Save this search criteria, to get email alerts whenever a match is found.

<b>Price</b>	\$80,000
<b>Depreciation</b>	ⓘ \$16,610 / year
<b>Reg. Date</b>	18-Apr-2011 (3yrs 3mths 30days COE left)
<b>Manufactured</b>	ⓘ 2011
<b>Mileage</b>	59,000 km (8.8k / year)
<b>Transmission</b>	Auto
<b>Engine Cap</b>	1,984 cc
<b>Road Tax</b>	ⓘ \$1,194 / year
<b>Power</b>	155.0 kW (207 bhp) View specs of the Audi A5 Coup (2008-2012)
<b>Curb Weight</b>	ⓘ 1,550 kg
<b>COE</b>	ⓘ \$53,400
<b>OMV</b>	ⓘ \$49,342
<b>ARF</b>	ⓘ \$49,342
<b>Dereg Value</b>	ⓘ \$49,863 as of today
<b>No. of Owners</b>	ⓘ 1

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type: Singapore NRIC  
Owner ID: 1808D

### Vehicle Details

Vehicle No.: SKC6833C  
Vehicle to be Exported: No  
Intended De-registration Date: 18 Dec 2017  
Vehicle Make: AUDI  
Vehicle Model: A5 2.0 QUATTRO A  
Primary Colour: Black  
Manufacturing Year: 2010  
Engine No.: CDN139309  
Chassis No.: WAUZZZ8T0BA009176  
Maximum Power Output: 155.0 kW (207 bhp)  
Open Market Value: \$49,163.00  
Original Registration Date: 17 May 2011  
First Registration Date: 17 May 2011  
Transfer Count: 0  
Actual ARF Paid: \$49,163.00

### Intended PARF Rebate Details

PARF Eligibility: Yes  
PARF Eligibility Expiry Date: 16 May 2021  
PARF Rebate Amount: \$31,955.00

### Intended COE Rebate Details

COE Expiry Date: 16 May 2021  
COE Category: B - Car (1601cc & above)  
COE Period(Years): 10

## Enquire Transfer Fee

## Vehicle Details

Vehicle No.:	SKC6833C
Vehicle Type:	P10 - Passenger Motor Car
Vehicle Attachment 1:	With Sun Roof
Vehicle Scheme:	Normal
Vehicle Make:	AUDI
Vehicle Model:	A5 2.0 QUATTRO A
Chassis No.:	WAUZZZ8T0BA009176
Propellant:	Petrol
Engine No.:	CDN139309
Engine Capacity:	1984 cc
Maximum Power Output:	155.0 kW (207 bhp)
Maximum Laden Weight:	2050 kg
Unladen Weight:	1550 kg
Year Of Manufacture:	2010
Original Registration Date:	17 May 2011
Lifespan Expiry Date:	-
COE Category:	B - Car (1601cc & above)
Quota Premium:	\$56,011.00
COE Expiry Date:	16 May 2021
Road Tax Expiry Date:	16 May 2018
PARF Eligibility Expiry Date:	16 May 2021
Inspection Due Date:	16 May 2018
Intended Transfer Date:	18 Dec 2017
CO2 Emission:	-

M/SME17165223 / SME Motor Pte Ltd - Kaki Bukit  
 ENTRY DATE & TIME: 15/12/2017 17:27

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	15/12/2017 17:27
Date Of Accident	14/12/2017 19:40
Exact Location Of Accident	ECP TOWARDS CHANGI AIRPORT AFTER STILL RD SOUTH.
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKC6833C
<b>Insured/Policyholder</b>	
Name Of Registered Owner	LEE LAY KHIM CYNTHIA
NRIC No	S7721808D
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96194763
Alternative Phone No	OFFICE-96194763

### Vehicle Particulars

Manufacturer	AUDI
Model	A5
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	P27912077DMA
Cover Note Number	

### Driver

Name of Driver	LEE LAY KHIM CYNTHIA
NRIC No	S7721808D
Date Of Birth	05/08/1977
Occupation	INDOOR
Date Of Driving Pass	25/10/2005
Driving Experience	12 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-96194763
Fax Number	
Contact Number	OFFICE-96194763
E-Mail Address	NOEMAIL



Address BLK 62 NEW UPPER CHANGI ROAD #13-1188  
 Postcode 461062  
 Was driver an employee of the Insured's Company NO  
 If No, Relationship of the Driver with the Insured OWNER  
 Vehicle Registration Number of Driver's Own Vehicle -  
 -  
 -  
 Insurance Company of Driver's Own Vehicle -  
 -  
 -

**General Information of the Accident**

Type Of Accident CHAIN COLLISION  
 Weather Conditions AFTER RAIN  
 Road Surface WET

**Other Information**

Was any foreign vehicle involved in this accident? NO  
 Was any body injured in the Accident? YES  
 Was any other material or property damaged? YES  
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO  
 Number of Passengers (Including Driver) 1

**Details of Police Action**

Was the accident reported to the police? NO  
 If Yes, Please state which Police Station  
 Was notice of intended Prosecution given? NO  
 If Yes, against whom?

**Circumstances of Accident**

PLS REFER TO THE ATTACHED.

**Attachment(s)**

Are accident photos available for attachment? YES  
 Was there any video captured by Car Camera? NO  
 Was there any audio recorded? NO

**DETAILS OF OTHER VEHICLE PROPERTY 1**

Vehicle Registration Number SLA5800C  
 Vehicle Make/Model/Colour  
 Details Of Properties VEHICLE B  
 Name of Driver CELESTE LAMB  
 NRIC/Passport Number S8844101Z  
 Contact Number 92731029  
 Address  
 Postcode  
 Insurance Company Name  
 Nature Of Damage  
 No. Of Passenger (Including Driver)

**Details of Witness**

Name  
 Phone Number  
 Email Address

**DETAILS OF OTHER VEHICLE PROPERTY 2**

Vehicle Registration Number SJA5879P  
 Vehicle Make/Model/Colour

Details Of Properties

VEH C

Name of Driver

POK SAI SUAN

NRIC/Passport Number

S7536980H

Contact Number

97711480

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

**Details of Witness**

Name

Phone Number

Email Address

**DETAILS OF INJURED PERSON 1**

Name

LEE LAY KHIM CYNTHIA

Approximate Age

Injuries Sustain

Injured person in which vehicle?

SKC6833C

Were seat belts worn?

Was injured conveyed to hospital by ambulance?

Address


Postcode

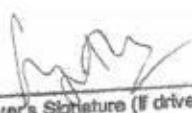
Accident Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)  
I understand, acknowledge, agree and consent that :  
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :  
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;  
(ii) investigating the accident and/or my claims;  
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;  
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or  
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.  
(collectively the "Purposes")  
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and  
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

*15/12/17*  
  
 Policyholder's Signature / Date & Time

  
 Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan



- (A) SKC 6833C
- (B) SLA 5800 T
- (C) SJV 3879P



ECP Toward Changi Airport

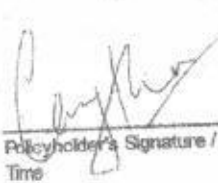
Accident Sketch Plan Pg. 1

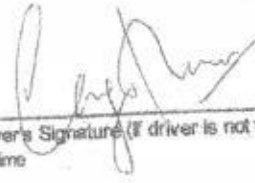
Describe Circumstances of the Accident

On 14/12/2017 At about 19:40 hrs. I was travelling on the 1st lane along ECP toward Changi Airport after still road south. The traffic volume was heavy and the road surface was wet. In front of me vehicle C stop, so I follow suit. Suddenly I felt a loud bang from vehicle B who drove into the rear of my vehicle A and my vehicle A then was pushed forward and hit onto vehicle C. After the accident I felt some pain on my neck & back. My vehicle A then couldn't start ~~at~~ after the accident happen.

Declaration

We declare the foregoing particulars are true in every respect.

  
 Policyholder's Signature / Date & Time

  
 Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Insurance Co. MSIG Insurance  
 Vehicle NO. SKC 6833C Date Of Accident 14, 12, 2017  
 Reporting Only  
 Own Damage Claim  
 Third Party Claim

F.Kr

SKC 6833 C. 2011 May.  
Audi A5 1984cc  
WAUZZZ8T0BA009176.

Rear Number Plate	Best	30(SN) /
Rear Number Plate Holder	deformed	30(SN) /
Rear Number Plate Lamp	x 02	38 x 2 = 76 xmm
Rear Bumper	Distorted.	1602 /
Rear Bumper Clips.	new	30 /
Rear Bumper Side Holder	x 02 new	70 x 2 = 140 /
Rear Bumper Lower Spoiler	Distorted	239 /
Rear Bumper Inner Garnish.	cracked	145 /
Rear Bumper Reinforcement	Best	563 /
Rear Bumper Reinforcement Bracket	Best	191 x 2 = 382 /
Rear Bumper Tow Cover.	Distorted	41 /
Reverse Sensor	x 04 Damaged	240 x 4 = 960. /
Reverse Sensor Wire Harness	x 02 or	458 x
Rear End Panel Outer	Distorted	775 /
Rear End Panel Reinforcement		922 /
Rear End Panel Top Garnish	deformed	146 /
Taillamp	x 02 Cracked.	1092 x 2 = 2184 /
Taillamp Side Cover	x 02	

8723

SKC 6833C

Taillamp Panel x02	Buckled.	212 x 2 = 424
Bootlid	Disturbed	1880
Bootlid Lock	changed	190
Bootlid Weatherstripe.	lit	176
Bootlid Lamp x02	cracked	360 x 2 = 720
Bootlid Hinge x02	best	224 x 2 = 448
Bootlid Inner Trim	deformed	273
Bootlid Inner Trim Clips.	new	30
Audi logo	} new	108
A5 Wording		83
2.0T Wording		83
Quattro Emblem.		95
Rear Fender x02	RH Buckled	2341 x 2 = 4682
Rear Fender Inner Trim x02	deformed	397 x 2 = 794
Rear Fender Inner Trim Clips.	new	60
Rear Windscreen	lit	959
Rear Windscreen Moulding.	new	87
Rear Windscreen Sealant.	new	60 (SN)

11152

SKC 6833C

252

Spare Tyre Panel. Repair	2523 X
Spare Tyre Panel Top Cover	Delat 618 /
Spare Tyre Panel Battery Lock Screw	Crack 42 /
Rear Exhaust Pipe. Bert	883 /
Rear Exhaust Mounting. Hen	50 X
Rear Exhaust Bracket Bert	28 /
<del>Rear</del> Centre Exhaust Pipe. Bert	923 /
Rear RH Chassis Sub Member. Repair	1650 X
Rear Camera. Dargd	680(SN) 480(SN)

7399

SKC6833C

Front Number Plate	Bent	30(SN)	/
Front Number Plate Holder	Deformed	30(SN)	/
Front Bumper	Deformed	1438	/
Front Bumper Clips	m	50	/
Front Bumper Side Holder	x02	33 x 2 = 66	/
Front Bumper Bracket	x02 Damaged	167 x 2 = 334	/
Front Bumper Support	x02	21 x 2 = 42	/
Front Bumper Top Cover	Deformed	97.	/
Front Bumper Top Cover Clips	m	20	/
Front Bumper Inner Air Guide	x02 <sup>M4</sup> <sub>nut</sub>	22 x 2 = 44	x
Front Bumper Sponge	Deformed	98	/
Front Bumper Reinforcement	Bent	707	/
<del>Front Bumper Reinforcement Bracket</del>	<del>x02</del>	<del>201 x 2 = 402</del>	/
Front Bumper Fog Lamp	x02 Cracked	105 x 2 = 210	/
Front Bumper Fog Lamp Cover	x02 Deformed	238 x 2 = 476	x
Front Bumper Nozzle Pump	x02 m	32 x 2 = 64	x
Front Bumper Nozzle Pump Cover	x02 m	540	/
Front Grille	smashed	25	/
Front Grille Clips	m	842 x 2 = 1684	x
Front Fenders	x02 Repair		

6357



SKC 6833C

Headlamp	x 02	Wt	2024 x 2 = 4048 ✓
Headlamp Bracket	x 02	HP m	62 x 2 = 124 x
Headlamp Mounting	x 02	Calcd	29 x 2 = 198 ✓
Bonnet		Buckled	1499 ✓
Bonnet Hinge	x 02	Not m	66 x 2 = 132 x
Bonnet Lock		Dangd	165 ✓
Bonnet Edge Protection.	x 02	m	22 x 2 = 44 ✓
Bonnet Damper		HP m	94 x
Front Support Panel		Calcd	861 ✓
Front Support Panel Brace	x 02	HP m	35 x 2 = 70 x
Front Support Panel Security Plate	x 02	Wt	26 x 2 = 52 ✓
Intercooler		HP m	434 x
Oil Cooler		Dented	483 ✓
Air Con Condenser.		Bent	622 ✓
Air Con Discharge Pipe		HP m	278 x
Air Con Suction Pipe		HP m	461 x
Radiator		Bent	1094 ✓
Radiator Support	x 02	HP m	30 x 2 = 60 ✓
Radiator Top Hox.		HP m	38 x
Radiator Spare Tank		HP m	52 x
Radiator Twin Fan Cooling.		Calcd	207 ✓

SKC6833C

Radiator Fan Assy. }  
Air Con Fan Assy. }  
Fan Control Unit. }

685 x

595 x

654 x

882 x 2 = 1764 ✓

Front Seat Belt x 02 Activated

3698

SKC 6833C

Panel Beating	<del>3800</del> 2600
Spray Painting.	<del>3000</del> 2000
Wiring	<del>180</del> 60
To undersent	<del>280</del> 100
To remove reverse sensor and rear camera.	<del>300</del> 120
To transfer bootlid fittings.	<del>180</del> 100
To remove upholstery and rear seat	<del>380</del> 120
To remove rear windscreen.	<del>180</del> 150
To remove rear and centre exhaust pipes.	<del>360</del> 200
To remove fuel tank.	<del>150</del> 100
To remove condenser, radiator and to reg-cls.	<del>180</del> 150
To perform diagnostic test	<del>200</del> 150
To remove front seat belt	<del>280</del> 150

Inst: 37592  
 Len 5%: 3572.40  
 S/N: 660

Labour 6000  
 total: 42372.40

H/S: 30K

30K

21 Days

9470

57815

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:  
 Sign:



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

T K MOTOR WORKSHOP

Ref : CS/TP17024082/Aqbn2

BLK 1 KAKI BUKIT AVE 6  
#02-56 SINGAPORE 417883

Date : 21-05-2018



ON BEHALF OF LEE LAY KHIM CYNTHIA

Code : TP179

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SKC 6833C
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	19/12/2017

## 2. Vehicle Particulars & Condition

Make & Model	AUDI A5	c.c	1984
Engine No.	HIDDEN	Year of Reg.	2011
Chassis No.	WAUZZZ8T0BA009176	Colour	BLACK
Odometer	91462	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	245/35 R19	TOYO	6 mm
L/H Front Tyre	245/35 R19	TOYO	6 mm
R/H Rear Tyre	245/35 R19	TOYO	6 mm
L/H Rear Tyre	245/35 R19	TOYO	6 mm

## 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION.  
DAMAGES SEE DETAILS.

## 5. General Information

Accident Date	14/12/2017	Inspection Date	19/12/2017
Survey held at	T K MOTOR WORKSHOP BLK 1 KAKI BUKIT AVE 6 #02-56 SINGAPORE 417883		

## 5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.  
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

## 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **21 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKC 6833C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
2	REAR NUMBER PLATE LAMP @\$38.00	NOT NECESSARY	76.00	-
1	REAR BUMPER	DISTORTED	1,602.00	1,602.00
1	REAR BUMPER CLIPS	NECESSARY	30.00	30.00
2	REAR BUMPER SIDE HOLDER @\$70.00	NECESSARY	140.00	140.00
1	REAR BUMPER LOWER SPOILER	DISTORTED	239.00	239.00
1	REAR BUMPER INNER GARNISH	CRACKED	145.00	145.00
1	REAR BUMPER REINFORCEMENT	BENT	563.00	563.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$191.00	BENT	382.00	382.00
1	REAR BUMPER TOW COVER	DISTORTED	41.00	41.00
4	REVERSE SENSOR @\$240.00	DAMAGED	960.00	960.00
1	REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	458.00	-
1	REAR END PANEL OUTER	DISTORTED	775.00	775.00
1	REAR END PANEL REINFORCEMENT	DISTORTED	922.00	922.00
1	REAR END PANEL TOP GARNISH	DEFORMED	146.00	146.00
2	TAILLAMP @\$1092.00	CRACKED	2,184.00	2,184.00
2	TAILLAMP PANEL @\$212.00	BUCKLED	424.00	424.00
1	BOOTLID	DISTORTED	1,880.00	1,880.00
1	BOOTLID LOCK	DAMAGED	190.00	190.00
1	BOOTLID WEATHERSTRIPE	CUT	176.00	176.00
2	BOOTLID LAMP @\$360.00	CRACKED	720.00	720.00
2	BOOTLID HINGE @\$2240.00	BENT	448.00	448.00
1	BOOTLID INNER TRIM	DEFORMED	273.00	273.00
1	BOOTLID INNER TRIM CLIPS	NECESSARY	30.00	30.00
1	AUDI LOGO	NECESSARY	108.00	108.00
1	A5 WORDING	NECESSARY	83.00	83.00
1	2.0T WORDING	NECESSARY	83.00	83.00
1	QUATTRO EMBLEM	NECESSARY	95.00	95.00
2	REAR FENDER @\$2341.00	O/S BUCKLED	4,682.00	2,341.00
2	REAR FENDER INNER TRIM @\$397.00	DEFORMED	794.00	794.00
1	REAR FENDER INNER TRIM CLIPS	NECESSARY	60.00	60.00
1	REAR WINDSCREEN	CUT	959.00	959.00
1	REAR WINDSCREEN MOULDING	NECESSARY	87.00	87.00
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	2,525.00	-

Report Ref No. CS/TP17024082/Aqbn2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SPARE TYRE PANEL TOP COVER	DEFORMED	618.00	618.00
1	SPARE TYRE PANEL BATTERY LOCK SCREW	CRACKED	42.00	42.00
1	REAR EXHAUST PIPE	BENT	883.00	883.00
1	REAR EXHAUST MOUNTING	NOT NECESSARY	50.00	-
1	REAR EXHAUST BRACKET	BENT	28.00	28.00
1	CENTRE EXHAUST PIPE	BENT	923.00	923.00
1	REAR RH CHASSIS SUB MEMBER	TO REPAIR SEE LABOUR	1,650.00	-
1	FRONT BUMPER	DEFORMED	1,438.00	1,438.00
1	FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
2	FRONT BUMPER SIDE HOLDER @\$33.00	NECESSARY	66.00	66.00
2	FRONT BUMPER BRACKET @\$167.00	DAMAGED	334.00	334.00
2	FRONT BUMPER SUPPORT @\$21.00	DAMAGED	42.00	42.00
1	FRONT BUMPER TOP COVER	DEFORMED	97.00	97.00
1	FRONT BUMPER TOP COVER CLIPS	NECESSARY	20.00	20.00
2	FRONT BUMPER INNER AIR GUIDE @\$22.00	NOT NECESSARY	44.00	-
1	FRONT BUMPER SPONGE	DEFORMED	98.00	98.00
1	FRONT BUMPER REINFORCEMENT	BENT	707.00	707.00
2	FRONT BUMPER FOG LAMP @\$201.00	CRACKED	402.00	402.00
2	FRONT BUMPER FOG LAMP COVER @\$105.00	DEFORMED	210.00	210.00
2	FRONT BUMPER NOZZLE PUMP @\$238.00	NOT NECESSARY	476.00	-
2	FRONT BUMPER NOZZLE PUMP COVER @\$32.00	NOT NECESSARY	64.00	-
1	FRONT GRILLE	SMASHED	540.00	540.00
1	FRONT GRILLE CLIPS	NECESSARY	25.00	25.00
2	FRONT FENDER @\$842.00	TO REPAIR SEE LABOUR	1,684.00	-
2	HEADLAMP @\$2024.00	CUT	4,048.00	4,048.00
2	HEADLAMP BRACKET @\$62.00	NOT NECESSARY	124.00	-
2	HEADLAMP MOUNTING @\$99.00	CRACKED	198.00	198.00
1	BONNET	BUCKLED	1,499.00	1,499.00
2	BONNET HINGE @\$66.00	NOT NECESSARY	132.00	-
1	BONNET LOCK	DAMAGED	165.00	165.00
2	BONNET EDGE PROTECTION @\$22.00	NECESSARY	44.00	44.00
1	BONNET DAMPER	NOT NECESSARY	94.00	-
1	FRONT SUPPORT PANEL	CRACKED	861.00	861.00
2	FRONT SUPPORT PANEL BRACE @\$35.00	NOT NECESSARY	70.00	-
2	FRONT SUPPORT PANEL SECURING PLATE @\$26.00	NECESSARY	52.00	52.00

Report Ref No. CS/TP17024082/Aqbn2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	INTERCOOLER	NOT NECESSARY	434.00	-
1	OIL COOLER	DENTED	483.00	483.00
1	AIR CON CONDENSER	BENT	622.00	622.00
1	AIR CON DISCHARGE PIPE	NOT NECESSARY	278.00	-
1	AIR CON SUCTION PIPE	NOT NECESSARY	461.00	-
1	RADIATOR	BENT	1,094.00	1,094.00
2	RADIATOR SUPPORT @\$30.00	NECESSARY	60.00	60.00
1	RADIATOR TOP HOSE	NOT NECESSARY	38.00	-
1	RADIATOR SPARE TANK	NOT NECESSARY	52.00	-
1	RADIATOR TWIN FAN COWLING	CRACKED	207.00	207.00
1	RADIATOR FAN ASSY	NOT NECESSARY	685.00	-
1	AIR CON FAN ASSY	NOT NECESSARY	595.00	-
1	FAN CONTROL UNIT	NOT NECESSARY	654.00	-
2	FRONT SEAT BELT @\$882.00	ACTIVATED	1,764.00	1,764.00
	LESS 5% DISCOUNT		-	-1,725.00
			<b>47,485.00</b>	<b>32,775.00</b>
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR NUMBER PLATE (SN)	BENT	30.00	30.00
1	REAR NUMBER PLATE HOLDER (SN)	DEFORMED	30.00	30.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR CAMERA (SN)	DAMAGED	680.00	480.00
1	FRONT NUMBER PLATE (SN)	BENT	30.00	30.00
1	FRONT NUMBER PLATE HOLDER (SN)	DEFORMED	30.00	30.00
			<b>860.00</b>	<b>660.00</b>
	<b><u>LABOUR</u></b>			
	PANEL BEATING. INCLUSIVE OF THE REPAIR OF SPARE TYRE PANEL, REAR RH CHASSIS SUB MEMBER AND FRONT FENDER.		3,800.00	2,600.00
	SPRAY PAINTING.		3,000.00	2,000.00
	WIRING.		180.00	60.00
	TO UNDERSEAL.		280.00	100.00
	TO REMOVE REVERSE SENSOR AND REAR CAMERA.		300.00	120.00
	TO TRANSFER BOOTLID FITTINGS.		180.00	100.00
	TO REMOVE UPHOLSTERY AND REAR SEAT.		380.00	120.00
	TO REMOVE REAR WINDSCREEN.		180.00	150.00
	TO REMOVE REAR AND CENTRE EXHAUST PIPES.		360.00	200.00

Report Ref No. CS/TP17024082/Aqbn2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE FUEL TANK.		150.00	100.00
	TO REMOVE CONDENSER,RADIATOR AND TO RE-GAS.		180.00	150.00
	TO PERFORM DIANOGSTIC TEST.		200.00	150.00
	TO REMOVE FRONT SEAT BELT.		280.00	150.00
			9,470.00	6,000.00
	<b>GRAND TOTAL</b>		<b>57,815.00</b>	<b>39,435.00</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>30,000.00</b>

Report Ref No. CS/TP17024082/Aqbn2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.