


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4259J
Ref. No : TAX/01/18/2006
Reg. Date : 22/11/2013
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : THIYAGARAJAN S/O K MUNIYANDI
Type of Accident : HEAD TO REAR
Date / Time of Accident : 02/01/2018 11:34:00 AM
Accident Reported Date / Time : 02/01/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024093882
Special Instruction to ARC,if any :
GBG4233H - AXA
Prepared Date : 02/01/2018 01:03:01 PM

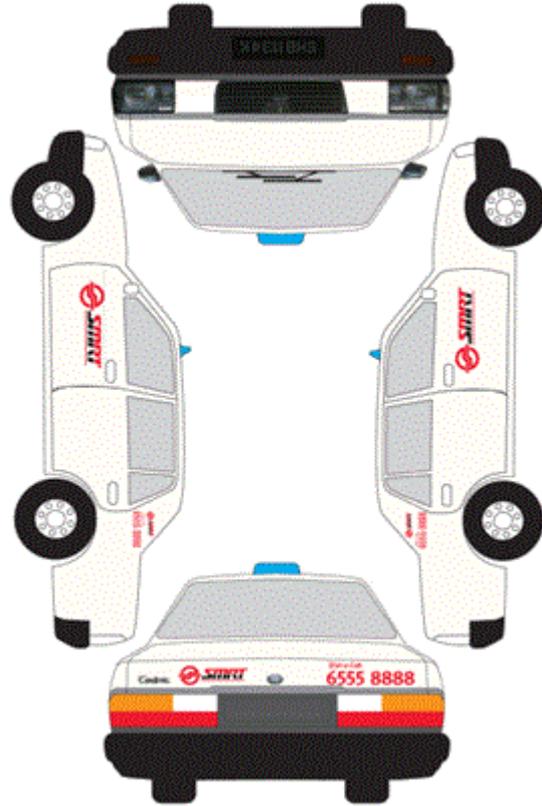

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U60-5705359 Mileage : 0

Work Shop : Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	845.00	0.00
Total Spray Painting Charges :	1,116.00	0.00
Total Material Charges :	1,994.98	2,599.71
Other Charges :	480.00	0.00
TOTAL :	4,435.98	0.00
Lum Sum Total :	4,450.00	0.00
No. of Repair Days :	5.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	02/01/2018 02:32:59 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 02/01/2018 02:30:52 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : Invoice No :

Quotation Date : Invoice Date :

Invoice Amount : Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	845.00	0.00
Total Labour	845.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00
TO RESPRAY BUMPER BEAM	180.00	0.00
TO RESPRAY TAIL GATE	378.00	0.00
TO RESPRAY REAR PANEL	180.00	0.00
Total Spray Painting & Panel Beating	1,116.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00
Total Other Costs	480.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No
76088-47020		6505617	BUMPER LIP COVER RR/LH	1	72.20	25.00	54.15	Replace	Replace	No
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.93	Repair	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
81551-47180		6505462	TAIL LAMP RH	1	557.80	10.00	502.02	Replace	Replace	No
TOTAL MATERIALS							2,493.75	3,249.65		
TOTAL MATERIALS(Discounted)							1,994.98	2,599.71		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									