

REF:

013 / ALH 18000654 / Albez

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m.s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: **\$300**

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: **110K.**

IDAC Accident Rport: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: **04 884** days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No. **SDP2117** Yr Regn. **2016 Dec**

Type: **M.Car** M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **Audi A3 Sedan** cc **999**

Colour: **Blue** A.C. Insured / Std / NI / NA

Sp. Reading: **18804** T.Radio: Insured / Std / NI / NA

Eng No: _____

C/No: **WAU 2228UGH1026722**

Gen. Cond: **Good** / Fair / Poor / Burnt

Steering: **In order** / Jammed / Leaked / Burnt or

Brake: **In order** / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / **STD A/Rim** or

Tyre Size: F: **205/SSR16**

R: **205/SSR16**

BS / DUN / EXNOVA / **GY** FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. **06** mm R/Bal. **06** mm

L/Bal. **06** mm L/Bal. **06** mm

D.O.A. _____ D.O.I. **10/01/18**

Survey held at **Premium**

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front o/s.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

07 AUG.

SDP 2117 - x

11/17 - Port via menmen

17/1 @ 14:32 - authorise repair by victor koh

17/1 @ 3:04pm email to premium authorise repair excess \$300

Part by Part \$9,862.40 - Cred: 642660 (39%)

RECEIVED 2018

Date/Time File Pass to? : Preli. Report

24 Typist : Final Report

Date/Time File Return to?

Days Of Repair: **4**

Resurvey No. of Trip: **1**

Survey Fee **200**

Transaction

Add Fee: : Site Insp. \$

: Inter. ev. \$

: Tech. ins. \$

: Wheelend \$

\$ - \$

Photos **10**

Others

Report Format: **OD**

Lump Sum / I.B.I. \$ **9862.40**

TOTAL **210**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AIG ASIA PACIFIC INSURANCE PTE LTD

Ref : CC3/AIG18000654/Atb

78 SHENTON WAY #08-16
CHARTIS BUILDING
SINGAPORE 079120

Date : 11-01-2018



Code : AIG

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SDP 2111T
Policy No. 2100495240	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	10/01/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer -	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	06/01/2018	Inspection Date	10/01/2018
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1. SINGAPORE 408699		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.
--

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Wednesday, 17 January 2018 3:04 PM
To: Claims; SUR
Subject: RE: SDP 2111 T Own Damage Claims (vehicle IN)

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SDP 2111T (Excess \$300/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims [<mailto:claims@premiumauto.com.sg>]
Sent: Wednesday, 17 January 2018 10:09 AM
To: Denise Tay (LKKAuto) <denisetay@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: SDP 2111 T Own Damage Claims (vehicle IN)

Update? Understand from AIG have approved.

Thank you.

Best Regards,
Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

View Received Message

This mail is associated with :
***SDP2111T (9357901435SG)**
OD
Jan 6 2018 12:00PM
[ANG CHONG HAN GALVIN]
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 17/01/2018 14:32 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (\$10939.00) - SDP2111T - Claim Handler: Chan, Klan Meng

Approved:10939.00:Re-inspect and upload damage photos of RH front fender. Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 6008E

Vehicle Details

Vehicle No.: SDP2111T
Vehicle to be Exported: No
Intended De-registration Date: 11 Jan 2018
Vehicle Make: AUDI
Vehicle Model: A3 SEDAN 1.0 TFSI S TRONIC (LED)
Primary Colour: Blue
Manufacturing Year: 2016
Engine No.: CHZ156800
Chassis No.: WAUZZZ8V6H1026722
Maximum Power Output: 85.0 kW (113 bhp)
Open Market Value: \$24,589.00
Original Registration Date: 22 Dec 2016
First Registration Date: 22 Dec 2016
Transfer Count: 0
Actual ARF Paid: \$16,425.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 21 Dec 2026
PARF Rebate Amount: \$12,318.00

Intended COE Rebate Details

COE Expiry Date: 21 Dec 2026
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$49,751.00
COE Rebate Amount: \$44,495.00
Total Rebate Amount: \$56,813.00

The information contained herein is correct as at 11 Jan 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/01/2018 20:19
Date Of Accident	06/01/2018 12:50
Exact Location Of Accident	ST MICHAEL'S ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDP2111T
Insured/Policyholder	
Name Of Registered Owner	ANG CHONG HAN GALVIN
NRIC No	S7416008E
Email Address	GALVIN.ANG@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96933874
Alternative Phone No	OTHERS-96933874

Vehicle Particulars

Manufacturer	AUDI
Model	A3 SEDAN 1.0 TFSI 8V

Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
--	-------------

Are you claiming under your own insurance policy for repair to your vehicle?	YES
--	-----

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100495240-01
Cover Note Number	

Driver

Name of Driver	ANG CHONG HAN GALVIN
NRIC No	S7416008E
Date Of Birth	27/05/1974
Occupation	INDOOR
Date Of Driving Pass	09/04/1997
Driving Experience	20 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96933874
Fax Number	
Contact Number	OTHERS-96933874
EMail Address	GALVIN.ANG@GMAIL.COM

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SKV5376L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan #2

SKETCH PLAN

Please refer to the attached
Sketch Plan

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please Refer to the attached
Statement

DECLARATION

I/We declare the foregoing particulars are true in every respect



Policyholder's Signature

Date & Time 2/1/2018

4:30pm

Driver's Signature

(if driver is not the policyholder)

Date & Time





Reporting Centre Personnel's Signature

Name: Tony Fong

NRIC/FIN No 62401672

Accident Sketch Plan

8/1/2018

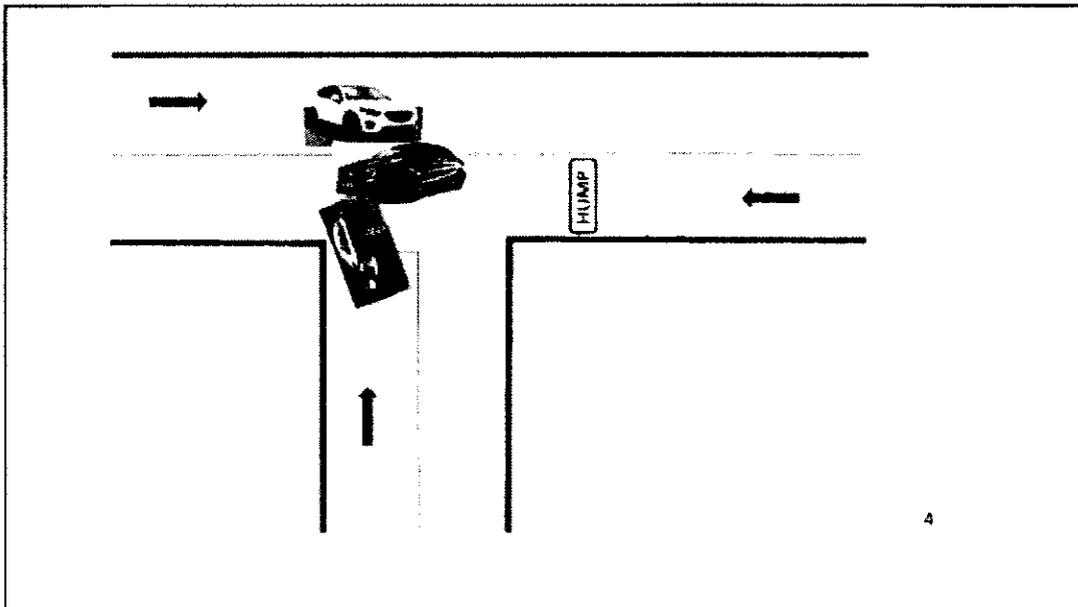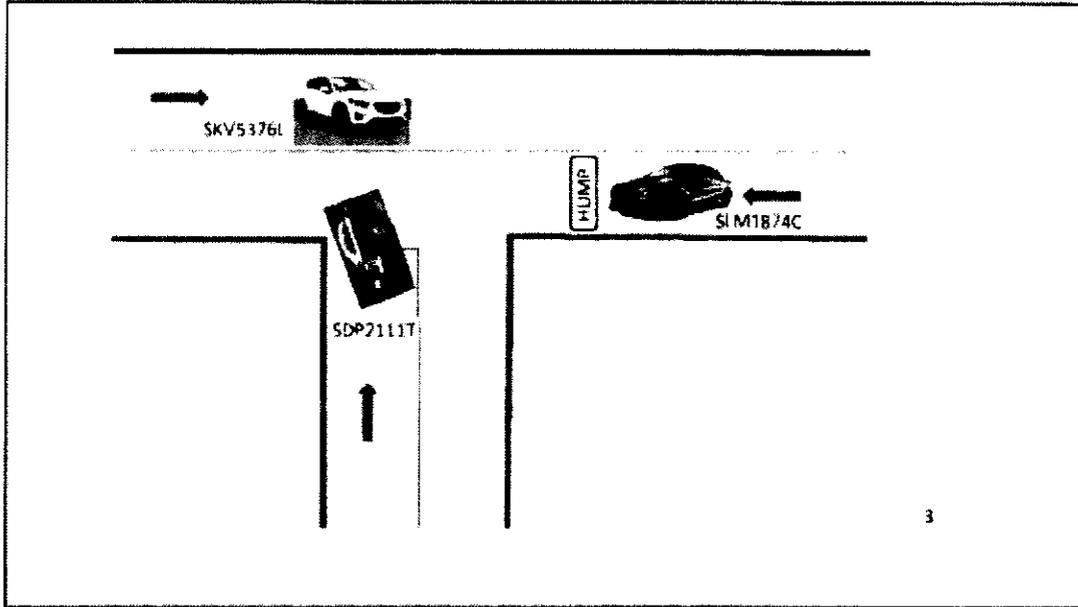

Accident Photo



Accident Photo



Accident Photo



Accident Photo



ACCIDENT SCENE PHOTO



ACCIDENT SCENE PHOTO



ACCIDENT SCENE PHOTO



REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S7416008E



Name

ANG CHONG HAN GALVIN
(WENG CONGHAN GALVIN)

翁 聰 汉

Race

CHINESE

Date of birth

27-05-1974

Sex

M

S7416008E

Country of birth

SINGAPORE



3611795



NRIC No. S7416008E



Date of issue

10-09-2004

30, ROBINSON ROAD #11-03

NRIC No. S7416008E

Date: 12/05/2011

No: 6762894

CLASS(ES)

Class 1B	Motorcycles not exceeding 200 cc	31 Jul 1995
Class 2A	Motorcycles between 201 cc and 400 cc	18 Nov 1997
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	09 Apr 1997




License No: S7416008E

NP 428A

24-HOUR AIG AUTO HOTLINE: +65 6338 6200

IMPORTANT: KEEP THIS DOCUMENT IN YOUR CAR AT ALL TIMES.

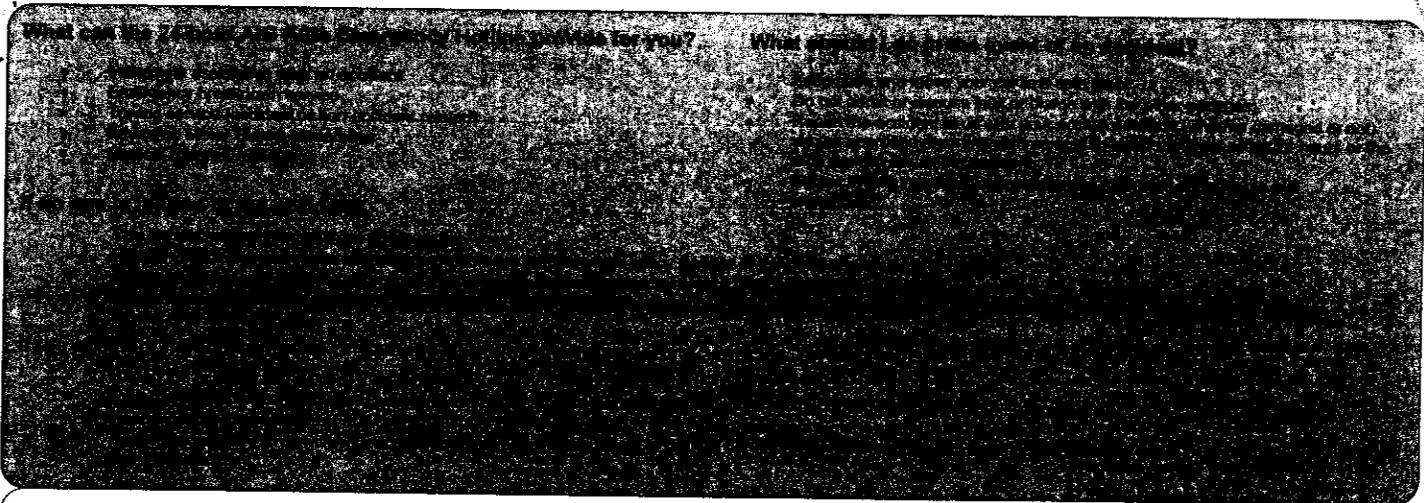

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number **(65) 6419-3000** for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within **3** working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the **original** insurance policy and schedule issued by AIG, a copy of the Accident Report from **Audi Customer Service Centre** must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Premium Automobiles Pte. Ltd.

Activation Hotline: 64741223

55 Ubi Road 1 Singapore 408699

Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 1pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is **IMPORTANT**, and **MUST** be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0046/2018/NK
Date : 10-Jan-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Ang Chong Han Galvin
Address : 38.St Michael's Road
#11-03
Singapore 328008
Telephone : HP +65 96933874
Type of Claim : Own Damage Claims
Policy No. : 2100495240-01
Vehicle No : **SDP 2111 T**
Model Code : Audi A3 Sedan 1.0 TFSI (A)
Model / Year : Dec-16
Engine No : CHZ156800
Chassis No : WAUZZZ8V6H1026722
Mileage :
Date In : 8-Jan-18
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 6-Jan-18
Place of Accident : St Micheal's Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDP 2111 T

<u>S/n</u>	<u>Nature of Jobs</u>	<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
2	To dismantle and renew front bumper, rhs front fender and headlight. Reorganise front crash managements components. Reinstall all parts removed.	\$ 2,100.00 1250	
3	To respray front bumper and front fender.	\$ 1,500.00 1100	
4	To carry out diagnostic checks	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ 4,152.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDP 2111 T

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER <i>Deformed.</i>	\$ 1,739.00 ✓	1391.20
2	FRONT BUMPER GUIDE - RHS <i>Not New</i>	\$ 33.00 X	
3	FRONT BUMPER CENTRE GRILLE <i>Not New</i>	\$ 140.00 X	
4	FRONT BUMPER LOWER PIECE <i>Not New</i>	\$ 460.00 X	
5	FRONT BUMPER CLOSING ELEMENT - RHS <i>Not New</i>	\$ 254.00 X	
6	FRONT BUMPER TRIM - LHS/RHS <i>R17 Dehd</i>	\$ 280.00 140.00	111.60
7	FRONT WHEEL HOUSE ADAPTOR - RHS <i>Not New</i>	\$ 32.00 X X	
8	FRONT AIR GRILLE - RHS <i>Dehd</i>	\$ 164.00 ✓	131.20
9	FRONT REINFORCEMENT TOP COVEF <i>Not New</i>	\$ 105.00 X X	
10	FOAM FILLER PIECE <i>Dehd</i>	\$ 162.00 ?	129.60
11	FRONT REINFORCEMENT BEAM <i>Bent</i>	\$ 633.00 ?	500
12	RADIATOR GRILLE <i>Not New</i>	\$ 1,239.00 X X	
13	RADIATOR GRILLE CLOSING ELEMENT <i>Not New</i>	\$ 167.00 X X	
14	FRONT FENDER - RHS <i>Dented.</i>	\$ 746.00 ✓	596.20
15	FRONT FENDER INNER BRACKET - RHS <i>Not New</i>	\$ 34.00 X X	
16	FRONT FENDER OUTER BRACKET - RHS <i>Not New</i>	\$ 24.00 X X	
17	FRONT FENDER BRACE - RHS <i>Bent</i>	\$ 84.00 ?	67.04
18	FRONT WHEEL HOUSE LINER - RHS <i>Not New</i>	\$ 151.00 X	
19	WHEEL HOUSE LINER ATTACHEMENT - RHS <i>Not New</i>	\$ 77.00 X	
20	LED HEADLIGHT - RHS <i>Not</i>	\$ 4,888.00 ✓	3910.40
SUB-TOTAL SPARE PARTS		\$ 11,412.00	

All charges are not inclusive of GST.
 Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
 Spare parts are Special Nett.

1994

30/11

V.02

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDP 2111 T

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	HORN - RHS <i>RHS New</i>	\$ 177.00	? X
22	HEADLIGHT WASHER - RHS <i>cracked,</i>	\$ 123.00	? 98
23	FRONT NO. PLATE <i>HP MA</i>	S/N \$ 25.00	X X
24	SUNDRIES <i>New</i>	\$ 400.00	? 18.56
TOTAL SPARE PARTS CHARGES		\$ 12,137.00	
TOTAL LABOUR CHARGES		\$ 4,152.00	
GRAND TOTAL		\$ 16,289.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 10/01/18
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised , 05 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0046/2018/NK
Date : 10-Jan-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120



Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Ang Chong Han Galvin
Address : 38.St Michael's Road
#11-03
Singapore 328008
Telephone : HP +65 96933874
Type of Claim : Own Damage Claims
Policy No. : 2100495240-01
Vehicle No : **SDP 2111 T**
Model Code : Audi A3 Sedan 1.0 TFSI (A)
Model / Year : Dec-16
Engine No : CHZ156800
Chassis No : WAUZZZ8V6H1026722
Mileage :
Date In : 8-Jan-18
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 6-Jan-18
Place of Accident : St Micheal's Road

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDP 2111 T

<u>S/n</u>	<u>Nature of Jobs</u>		<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$	360.00	\$ 360.00
2	To dismantle and renew front bumper, rhs front fender and headlight. Reorganise front crash managements components. Reinstall all parts removed.	\$	2,100.00	\$ 1,250.00
3	To respray front bumper and front fender.	\$	1,500.00	\$ 1,100.00
4	To carry out diagnostic checks	S/N \$	192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	\$ 4,152.00	\$ 2,902.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SDP 2111 T**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,739.00	\$ 1,391.20
2	FRONT BUMPER GUIDE - RHS	\$ 33.00	
3	FRONT BUMPER CENTRE GRILLE	\$ 140.00	
4	FRONT BUMPER LOWER PIECE	\$ 460.00	
5	FRONT BUMPER CLOSING ELEMENT - RHS	\$ 254.00	
6	FRONT BUMPER TRIM - LHS/RHS	\$ 280.00	\$ 111.60
7	FRONT WHEEL HOUSE ADAPTOR - RHS	\$ 32.00	
8	FRONT AIR GRILLE - RHS	\$ 164.00	\$ 131.20
9	FRONT REINFORCEMENT TOP COVEF	\$ 105.00	
10	FOAM FILLER PIECE	\$ 162.00	\$ 129.60
11	FRONT REINFORCEMENT BEAM	\$ 633.00	\$ 506.00
12	RADIATOR GRILLE	\$ 1,239.00	
13	RADIATOR GRILLE CLOSING ELEMENT	\$ 167.00	
14	FRONT FENDER - RHS	\$ 746.00	\$ 596.80
15	FRONT FENDER INNER BRACKET - RHS	\$ 34.00	
16	FRONT FENDER OUTER BRACKET - RHS	\$ 24.00	
17	FRONT FENDER BRACE - RHS	\$ 84.00	\$ 67.04
18	FRONT WHEEL HOUSE LINER - RHS	\$ 151.00	
19	WHEEL HOUSE LINER ATTACHEMENT - RHS	\$ 77.00	
20	LED HEADLIGHT - RHS	\$ 4,888.00	\$ 3,910.40
SUB-TOTAL SPARE PARTS		\$ 11,412.00	\$ 6,843.84

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SDP 2111 T**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
		<i>c/f</i>	\$ 6,843.84
21	HORN - RHS	\$ 177.00	
22	HEADLIGHT WASHER - RHS	\$ 123.00	\$ 98.00
23	FRONT NO. PLATE	S/N \$ 25.00	
24	SUNDRIES	\$ 400.00	\$ 18.56
TOTAL SPARE PARTS CHARGES		\$ 12,137.00	\$ 6,960.40
TOTAL LABOUR CHARGES		\$ 4,152.00	\$ 2,902.00
GRAND TOTAL		\$ 16,289.00	\$ 9,862.40

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SDP 2111 T

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0046/2018/MAS

27 March 2018

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SDP 2111 T, Audi A3 Sedan 1.0 TFSI

With reference to the above-mentioned vehicle, no **SDP 2111 T**, claimant,
Mr. Ang Chong Han Galvin, please find the related document per attached.

1. A copy of the Original invoice no. 85012275 – S\$10,231.77
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai

Claims Dept


Encls

AIG – SDP 2111 T

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183



Premium Automobiles Pte Ltd

Audi Centre Singapore
 281 Alexandra Road
 Singapore 159938
 Main Telephone 6836 2223
 Main Telefax 6471 3733

Alexandra Service Centre
 281 Alexandra Road
 Singapore 159938
 Telephone 6388 2223
 Telefax 6475 1023

Ubi Service Centre
 55 Ubi Road 1
 Singapore 408699
 Telephone 6388 2223

Customer Service
 Service Appointment 6366 2323
 24-hour Breakdown Service 9828 1233
 Email customer.care@premiumauto.com.sg

INS TAX INVOICE
 Company Reg. No. 199902271W
 GST Reg. No. 199902271W

Page 1 15:34

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012275 Date : 26/03/2018 Order : SDP2111T Term : 30	Account: 0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	---


Regn No. : SDP2111T (V 32130)	Regn Date: 22/12/2016	Mileage: 18804	WIP No. : 51469
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZZZ8V6H1026722	Engine: CHZ 156800	Dept: U
VSB No. :			
You have been assisted by :- UB-Carrine (33)			

		Details	Qty	Unit Price	Amount
S	BODYWORK	M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEDLIGHT WASHER ASSY.	360.00	1.00	360.00
Q	EXC	M: 8888 Insurance Excess/Liability	-300.00	1.00	-300.00
S	BODYWORK	M: TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FEN AND HEADLIGHT. REORGANISE FRONT CRASH MANAGERMENTS COMPONENTS. REINSTALL ALL PARTS REMOVED.	1250.00	1.00	1,250.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER AND FRONT FENDER.	1100.00	1.00	1,100.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECKS.	192.00	1.00	192.00
X	ABV0955102A	CYLINDER(V) Less 020%	1.00	122.50	98.00
X	ABV0941774D	HEADLIGHT (A) Less 020%	1.00	4888.00	3,910.40
X	ABV5821106A	FENDER(A) Less 020%	1.00	746.00	596.80
X	ABV0807550A	FOAM INSER Less 020%	1.00	162.00	129.60

Sub-Total

7% GST

Grand Total



Premium Automobiles Pte Ltd

Audi Centre Singapore
 281 Alexandra Road
 Singapore 159938
 Main Telephone 6836 2223
 Main Telefax 6471 3733

Alexandra Service Centre
 281 Alexandra Road
 Singapore 159938
 Telephone 6388 2223
 Telefax 6475 1023

Ubi Service Centre
 55 Ubi Road 1
 Singapore 408699
 Telephone 6388 2223
 Telefax 6441 1399

Customer Service
 Service Appointment 6366 2323
 24-hour Breakdown Service 9828 1233
 Email customer.care@premiumauto.com.sg

INS TAX INVOICE
 Company Reg. No. 199902271W
 GST Reg. No. 199902271W

Page 2 15:34

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85012275 Date : 26/03/2018 Order : SDP2111T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
--	---	--

Regn No.: SDP2111T (V 32130) Regn Date: 22/12/2016 Mileage: 18804 WIP No.: 51469
 Model: A3 SEDAN 1.0 TFSI 8VMANG Chassis: WAUZZZ8V6H1026722 Engine: CHZ 156800 Dept: U
 VSB No.:
 You have been assisted by :- UB-Carrine (33)

		Details		Qty	Unit Price	Amount
X	ABV4807109C	BEAM	Less 020%	1.00	632.50	506.00
X	ABV5807065R GRU	COVER(A)	Less 020%	1.00	1739.00	1,391.20
X	ABV5807534A	COVERSTRIP(A)	Less 020%	1.00	139.50	111.60
X	ABV0821136C	SUPPORT	Less 020%	1.00	83.80	67.04
X	ABV5807682M 9B9	GRILL(A)	Less 020%	1.00	164.00	131.20
X	AN 0161857	POP-RIVET	Less 020%	8.00	2.90	18.56

Parts	6,960.40	Sub-Total	9,562.40
Labour	0.00	7% GST	669.37
Sublet	2,902.00	Grand Total	10,231.77
Menus	0.00		
Lubricant	0.00		



Received by

For & on behalf of
 Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SDP 2111 T

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0046/2018/TF
25 January 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

1 total pages

Make & Model : Audi A3 SEDAN 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8V6H1026722
Vehicle Regn No. : **SDP 2111 T**
Vehicle Mileage : 18804 KM
Vehicle Owner : Mr. Ang Chong Han Galvin
Certificate No : 2100495240-01
Policy Excess : S\$321.00 (inclusive 7% GST)
Accident Date : 06/01/2018
Place : St Micheal’s Road
Repair Cost : \$ 10,231.77
WIP No. : 51469
Repairer’s Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer’s charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :



Time :

Date :

26/01/2018

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S7416008E



Name

ANG CHONG HAN GALVIN
(WENG CONGHAN GALVIN)

翁 聰 汉

Race

CHINESE

Date of birth

27-05-1974

Sex

M

S7416008E

Country of birth

SINGAPORE

REPUBLIC OF SINGAPORE DRIVING LICENCE

ANG CHONG HAN
(WENG CONGHAN GALVIN)

Date: 27 May 1974
Date: 13 Jun 2004

000575366G

3611795



NRIC No. S7416008E



Date of issue

10-09-2004

38, SINGAPORE ROAD #11-03

SINGAPORE S7416008E

NRIC No. S7416008E

Date: 12/05/2011

No: 6762894

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

Class 2B	Motorcycles not exceeding 200 cc	31 Jul 1985
Class 2A	Motorcycles between 201 cc and 400 cc	18 Nov 1997
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	09 Apr 1997

NP 428A

Licence No: S7416008E

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Policy No. : 2100495240-01
 Period of Insurance : 22 Dec 2017 to 21 Dec 2018

Issued Date : 12 Dec 2017

ABOUT THE POLICYHOLDER

Name of Policyholder : ANG CHONG HAN GALVIN(WENG CONGHAN GALVIN)
 Address : 38 ST MICHAEL'S ROAD
 11-03
 SINGAPORE 328008
 Occupation/Nature of Business : Executives

ABOUT THE VEHICLE

Registration No. : SDP2111T
 Chassis No. : WAUZZZ8V6H1026722
 Seating Capacity : 5
 Make/Model : AUDI A3 Sedan 1.0 TFSI S tronic
 Hire Purchase Company/Employer's Loan : United Overseas Bank Limited

Engine Capacity/Tonnage : 999.00 CC
 Engine No. : CHZ156800
 Body Type : Sedan
 First Year of Registration : 2016

ABOUT THE COVER

Sum Insured : Market Value
 Driver Restriction : NA
 Off Peak Car : No
 Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive :

- a) The Policyholder
 - b) Any other person who is driving on the Policyholder's order or with his/her permission.
- This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition
 Limitation as to use :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Other Key Policy Benefits :

Act of God, Strike, Riots and Civil Commotions, PA to Authorised Driver / Unnamed Passengers- \$10000, Dealer + AIG Authorised Workshops, PA Insured- \$100000, Fixture and Accessories (Cosmetic)- \$5000, Solar Film- \$1150, New For Old (36 months), Loss of Use, In-Car Camera Excess Waiver, Glass Roof/ Moon Roof/ Sun Roof/ Panoramic Glass Roof

EXCESS

Section 1
 Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver
 ANG CHONG HAN GALVIN(WENG CONGHAN GALVIN) - \$600 (Own Damage)

PREMIUM

Premium	:	\$	1,175.82
GST (7%)	:	\$	82.31
<hr/>			
Total	:	\$	1,258.13

Your Premium includes the following discount(s):
 Safe Driver Discount - 5.00%, No Claim Discount - 50%

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	11 Jan 2018		11 Jan 2018 13:37 Edit Adj Rpt	S\$9,862.40 Edit Estimates	S\$9,862.40 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS		[Created by insurer]							
Insured:	ANG CHONG HAN GALVIN, ID: S7416008E, Tel: +6596933874, Email: GALVIN.ANG@GMAIL.COM								
Vehicle Reg. No.:	SDP2111T	Date of Loss:	06/01/2018 12:00 - :59 [12 Months and 15 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 9357901435SG	Policy/Cover Note No.:	2100495240 (Comprehensive)						
		Excess:	S\$300.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Chan, Kian Meng] kianmeng.chan@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 22/01/2018]								
Driver/Custodian:	ANG CHONG HAN GALVIN (43 / Male), NRIC: S7416008E, Tel: +6596933874								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> AIG_SG (17/01/2018): Alert - Adj Mandate Approved (S\$10939.00) - SDP2111T - Claim Handler: Chan, Kian... AIG_SG (16/01/2018): SDP2111T / OD / 06/01/2018 / Coverage & Excess update 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SDP2111T (9357901435SG)**
OD
Jan 6 2018 12:00PM
[ANG CHONG HAN GALVIN]
Premium Automobiles Pte Ltd

Upload Documents		Upload Photos		Compose New Letter		Upload Video		Upload Audio		View <input type="button" value="View in Browser"/>			
Video										1 per page	<input checked="" type="checkbox"/>		
No	Finalized On	Premium Automobiles Pte Ltd (UBI)						Thumbnail	Print				
1	08/01/18 20:29	Video - Accident [Linked Accident Report Documents]							Load MP4	<input type="checkbox"/>			
Assessment Reports										1 per page	<input checked="" type="checkbox"/>		
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print				
1	11/01/18 16:08	Adjuster Immediate Advice							Load HTM	<input type="checkbox"/>			
Photos/Images										3 per page	<input checked="" type="checkbox"/>		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print				
1	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
2	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
3	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
4	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
5	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
6	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
7	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
8	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
9	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
10	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
11	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
12	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
13	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
14	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
15	11/01/18 15:35	General View							Load JPG	<input checked="" type="checkbox"/>			
16	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
17	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
18	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
19	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
20	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
21	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
22	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
23	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
24	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
25	19/03/18 17:09	Reinspection Photo							Load JPG	<input checked="" type="checkbox"/>			
Documentation										1 per page	<input checked="" type="checkbox"/>		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)						Thumbnail	Print				
1	11/01/18 15:34	Driver's Driving License							Load PDF	<input type="checkbox"/>			
2	11/01/18 15:34	ESTIMATE							Load PDF	<input type="checkbox"/>			
3	11/01/18 15:34	Singapore Accident Statement							Load PDF	<input type="checkbox"/>			
4	03/04/18 11:45	Workshop Invoice							Load PDF	<input type="checkbox"/>			
5	03/04/18 11:45	Discharge Voucher							Load PDF	<input type="checkbox"/>			

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print

Linked Accident Report Documents

Video			View	View in Browser
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	1 per page	<input checked="" type="checkbox"/>
1	08/01/18 20:29	Video - Accident		Load MP4
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	08/01/18 20:39	Accident Statement		Load HTM
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
2	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
3	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
4	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
5	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
6	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
7	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
8	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
9	08/01/18 20:32	Accident Photo		Load JPG <input checked="" type="checkbox"/>
10	08/01/18 20:33	ACCIDENT SCENE PHOTO		Load JPG <input checked="" type="checkbox"/>
11	08/01/18 20:33	ACCIDENT SCENE PHOTO		Load JPG <input checked="" type="checkbox"/>
12	08/01/18 20:33	ACCIDENT SCENE PHOTO		Load JPG <input checked="" type="checkbox"/>
13	08/01/18 20:33	ACCIDENT SCENE PHOTO		Load JPG <input checked="" type="checkbox"/>
14	08/01/18 20:33	ACCIDENT SCENE PHOTO		Load JPG <input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	08/01/18 20:34	Sketch Plan		Load JPG <input checked="" type="checkbox"/>
2	08/01/18 20:34	Sketch Plan #2		Load JPG <input checked="" type="checkbox"/>
3	08/01/18 20:35	Accident Sketch Plan		Load JPG <input checked="" type="checkbox"/>
4	08/01/18 20:35	Accident Sketch Plan		Load JPG <input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Handling Insurer
 Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CC3/AIG18000654/ATBE2

Date: 04/04/2018

REFERENCE

Insured/Claimant:	ANG CHONG HAN GALVIN	Policy No:	2100495240
Date of Loss:	06/01/2018	Nature of Claim:	OD
			Claim No: 9357901435SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SDP2111T	Engine No:	CHZ156800
Make & Model:	AUDI A3, 999cc TFSI (A)	Chassis No:	WAUZZZ8V6H1026722
Reg. Date:	22/12/2016 (Man. Year: 2016)	Odometer:	18804 km
Colour:	Blue		
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$110,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	12,137.00	6,960.40	5,176.60	42.65
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,152.00	2,902.00	1,250.00	30.11
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	16,289.00	9,862.40	6,426.60	39.45
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	15,989.00	9,562.40	6,426.60	40.19
+ GST 7.00/7.00% (S\$)	1,119.23	669.37	449.86	40.19
Nett Amount (S\$)	17,108.23	10,231.77	6,876.46	40.19

INSPECTION

Date of Assignment:	11/01/2018		
Date Inspected:	10/01/2018	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699

Estimated Period of Repair: 4.0 days

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	1,739.00 FS	*1,391.20 FS
2	1		*FRONT BUMPER GUIDE - RHS	Not Necessary	33.00 FS	*- FS
3	1		*FRONT BUMPER CENTRE GRILLE	Not Necessary	140.00 FS	*- FS
4	1		*FRONT BUMPER LOWER PIECE	Not Necessary	460.00 FS	*- FS
5	1		*FRONT BUMPER CLOSING ELEMENT - RHS	Not Necessary	254.00 FS	*- FS
6	1		*FRONT BUMPER TRIM - LHS/RHS	O/S Deformed	280.00 FS	*111.60 FS
7	1		*FRONT WHEEL HOUSE ADAPTOR - RHS	Not Necessary	32.00 FS	*- FS
8	1		*FRONT AIR GRILLE - RHS	Deformed	164.00 FS	*131.20 FS
9	1		*FRONT REINFORCEMENT TOP COVER	Not Necessary	105.00 FS	*- FS
10	1		*FOAM FILLER PIECE	Deformed	162.00 FS	*129.60 FS
11	1		*FRONT REINFORCEMENT BEAM	Bent	633.00 FS	*506.00 FS
12	1		*RADIATOR GRILLE	Not Necessary	1,239.00 FS	*- FS
13	1		*RADIATOR GRILLE CLOSING ELEMENT	Not Necessary	167.00 FS	*- FS
14	1		*FRONT FENDER - RHS	Dented	746.00 FS	*596.80 FS
15	1		*FRONT FENDER INNER BRACKET - RHS	Not Necessary	34.00 FS	*- FS
16	1		*FRONT FENDER OUTER BRACKET - RHS	Not Necessary	24.00 FS	*- FS
17	1		*FRONT FENDER BRACE - RHS	Bent	84.00 FS	*67.04 FS
18	1		*FRONT WHEEL HOUSE LINER - RHS	Not Necessary	151.00 FS	*- FS
19	1		*WHEEL HOUSE LINET ATTACHMENT - RHS	Not Necessary	77.00 FS	*- FS
20	1		*LED HEADLIGHT - RHS	Cut	4,888.00 FS	*3,910.40 FS
21	1		*HORN - RHS	Not Necessary	177.00 FS	*- FS
22	1		*HEADLIGHT WASHER - RHS	Cracked	123.00 FS	*98.00 FS
23	1		*FRONT NO. PLATE	Not Necessary	25.00 FS	*- FS
24	1		*SUNDRIES	Necessary	400.00 FS	*18.56 FS
Total Parts (S\$)					12,137.00	6,960.40

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
2	TO RESPRAY FRONT BUMPER AND FRONT FENDER	New	1,500.00	1,100.00
3	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
4	TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND HEADLIGHT. REORGANISE FRONT CRASH MANAGERMENTS COMPONENTS. REINSTALL ALL PARTS REMOVED	New	2,100.00	1,250.00
Gross Labour Cost (\$\$)			4,152.00	2,902.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >