


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB375M
Ref. No : TAX/04/18/2014
Reg. Date : 06/11/2014
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : YEO BOK HUA(YANG MUHUA)
Type of Accident : HEAD TO SIDE
Date / Time of Accident : 03/04/2018 11:35:00 PM
Accident Reported Date / Time : 04/04/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095355
Special Instruction to ARC,if any :
TOWED \$40 / SLX3588H - AXA
Prepared Date : 04/04/2018 11:25:28 AM

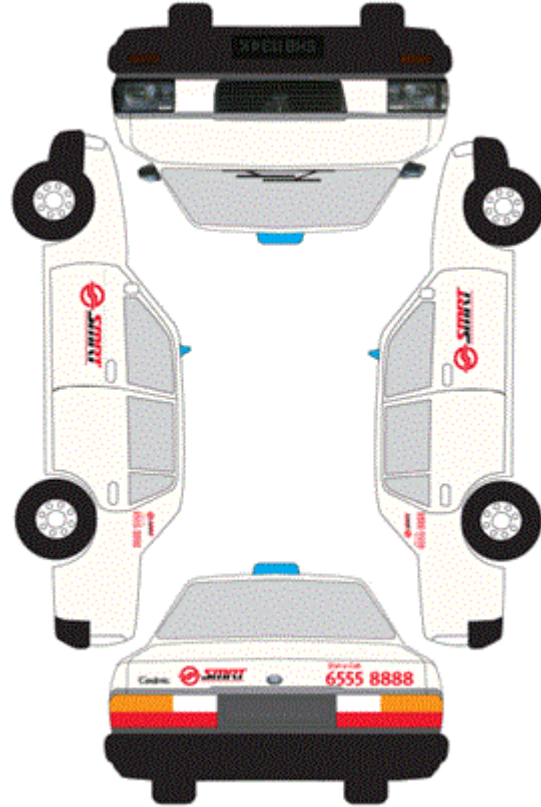

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U605752617

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,352.00	0.00
Total Spray Painting Charges :	2,034.00	0.00
Total Material Charges :	8,290.26	8,290.26
Other Charges :	1,220.00	0.00
TOTAL :	12,896.26	0.00
Lum Sum Total :	12,900.00	0.00
No. of Repair Days :	8.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	04/04/2018 01:50:15 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/04/2018 01:50:15 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	1,352.00	0.00
Total Labour	1,352.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT DOOR RH	378.00	0.00
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY APRON PANEL RH	180.00	0.00
TO RESPRAY RIM	180.00	0.00
TO REPSRAY FRONT BUMPER	378.00	0.00
TO RESPRAY FRONT SUPPORT PANEL	180.00	0.00
TO SPRAY FRONT BUMPER LOWER SUB GRILLE	180.00	0.00
Total Spray Painting & Panel Beating	2,034.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0.00
TO TRANSFER DOOR MECHANISM	120.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO REMOVE AND REFIT TYRE	120.00	0.00
TO TOP UP A/C GAS	120.00	0.00
TO CONDUCT RADIATOR PRESSURE CHECK	100.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,220.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
67001-47070		6505528	DOOR FRT/RH	1	894.40	25.00	670.80	Replace	Replace	No
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No
75851-47900			MOULDING BODY, RH	1	673.60	25.00	505.20	Replace	Replace	No
68710-12151			HINGE UPPER RHF, DOOR	1	80.50	25.00	60.37	Replace	Replace	No
68730-12120			HINGE LOWER RHF, DOOR	1	90.10	25.00	67.57	Replace	Replace	No
68610-47021			CHECK ASSY, FR DOOR,	1	150.30	25.00	112.72	Replace	Replace	No
53801-47050		6505557	FENDER FRT/RH	1	723.40	25.00	542.55	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No
53701-47050			FENDER APRON SUB FRT/RH	1	637.80	25.00	478.35	Replace	Replace	No
53875-47030		6505553	FENDER LINER FRT/RH	1	171.70	25.00	128.77	Replace	Replace	No
53851-47040			FENDER LINER PAD, FR WHEEL. RH	1	49.30	25.00	36.97	Replace	Replace	No
42611--47140 (Frt)		6505658	WHEEL DISC. FRONT	1	1,484.20	25.00	1,113.15	Replace	Replace	No
		6503707	TYRE	1	126.74	0.00	126.74	Replace	Replace	No
52119-47930		6505517	BUMPER FRT	1	482.00	25.00	361.50	Replace	Replace	No
52116-47040		6505516	BUMPER SUPPORT F/LH	1	76.40	25.00	57.30	Replace	Replace	No
52115-47040		6505515	BUMPER SUPPORT F/RH	1	76.40	25.00	57.30	Replace	Replace	No
52021-47023		6505539	BUMPER REINFORCEMENT FRT	1	498.40	25.00	373.80	Replace	Replace	No
52611-47080		6505518	BUMPER ENERGY ABSORBER FRT	1	78.80	25.00	59.10	Replace	Replace	No
57014-47030			ARM SUB-ASSY, FR BUMPER LH	1	250.40	25.00	187.80	Replace	Replace	No
57013-47030			ARM SUB-ASSY, FR BUMPER RH	1	250.40	25.00	187.80	Replace	Replace	No
81511-47050			LENS & BODY, FR TURN RH	1	511.80	10.00	460.62	Replace	Replace	No
81519-47050			BRACKET, FR TURN LOWER RH	1	26.00	25.00	19.50	Replace	Replace	No
81519-47060			BRACKET, FR TURN UPPER RH	1	24.40	25.00	18.30	Replace	Replace	No
81519-47060			BRACKET, FR TURN	1	58.20	25.00	43.65	Replace	Replace	No
76851-47020		6505616	BUMPER LIP FRT	1	139.60	25.00	104.70	Replace	Replace	No
52618-47050		6505540	BUMPER FRT ABSORBER LOWER	1	127.70	25.00	95.77	Replace	Replace	No
53113 - 47040			GRILLE RADIATOR LOWER NO.2	1	94.60	25.00	70.95	Replace	Replace	No
53102-47020		6505541	BUMPER GRILLE SUB-ASSY, LOWER	1	311.10	25.00	233.32	Replace	Replace	No
51410-12105			UNDER COVER CENTER	1	448.30	25.00	336.22	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
57104-47020		6505507	RADIATOR LOWER SUPPORT	1	876.30	25.00	657.22	Replace	Replace	No
88710-47150			TUBE & ACCESSORY	1	631.90	25.00	473.92	Replace	Replace	No
85315-47140			WIPER WASHER JAR	1	180.10	25.00	135.07	Replace	Replace	No
85330-47010			MOTOR NO:1, WIPER WASHER JAR	1	239.00	10.00	215.10	Replace	Replace	No
85330-60180			MOTOR NO:2, WIPER WASHER JAR	1	240.00	10.00	216.00	Replace	Replace	No
53201-47902			SUPPORT SUB-ASSY	1	1,460.40	25.00	1,095.30	Replace	Replace	No
81130-47500		6505437	HEAD LAMP RH	1	945.20	10.00	850.68	Replace	Replace	No
52114-47140			BRACKET, FR BUMPER	1	110.40	25.00	82.80	Replace	Replace	No
			NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace	No
			NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace	No
TOTAL MATERIALS							10,362.89	10,362.83		
TOTAL MATERIALS(Discounted)							8,290.26	8,290.26		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									