


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB5611Z
Ref. No : TAX/04/18/2030
Reg. Date : 19/12/2017
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS4
Name of Driver : TOH HOCK THIAM
Type of Accident : SIDE SWIPE
Date / Time of Accident : 05/04/2018 03:20:00 AM
Accident Reported Date / Time : 06/04/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 06/04/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095419
Special Instruction to ARC,if any :
TOWED TO TP COMPOUND / \$90 /S JL5102A - AXA
Prepared Date : 06/04/2018 11:50:29 AM

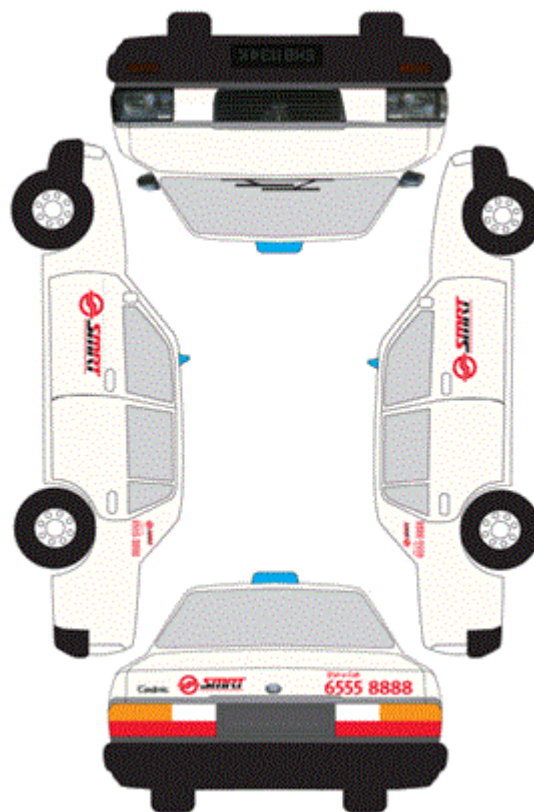

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU303576825

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	2,873.00	0.00
Total Spray Painting Charges :	4,428.00	0.00
Total Material Charges :	58,888.11	58,888.11
Other Charges :	4,366.00	0.00
TOTAL :	70,555.11	0.00
Lum Sum Total :	0.00	0.00
No. of Repair Days :	18.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	07/04/2018 02:31:54 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/04/2018 02:26:53 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 4/7/2018 2:26:49 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	2,535.00	0.00
TO REPAIR LH REAR PORTION	338.00	0.00
Total Labour	2,873.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY APRON PANEL RH	180.00	0.00
TO RESPRAY RIM	180.00	0.00
TO RESPRAY FRONT PILLAR RH	180.00	0.00
TO RESPRAY SILL MEMBER PANEL RH	180.00	0.00
TO RESPRAY ROCKER PANEL MOULDING	180.00	0.00
TO RESPRAY RH RAIL ROOF SIDE	180.00	0.00
TO RESPRAY CENTRE PILLAR	180.00	0.00
TO RESPRAY REAR FENDER RH	378.00	0.00
TO RESPRAY REAR RH WHEEL HOUSE	180.00	0.00
TO RESPRAY FRONT DOOR RH	378.00	0.00
TO RESPRAY REAR DOOR RH	378.00	0.00
TO RESPRAY DOOR HANDLE	360.00	0.00
TO RESPRAY VIEW MIRROR	180.00	0.00
TO RESPRAY FLOOR BOARD PANEL	180.00	0.00
TO RESPRAY TAIL GATE	378.00	0.00
Total Spray Painting & Panel Beating	4,428.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	126.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE / REFIT WINDSCREEN	120.00	0.00
TO REMOVE / REFIT SEAT	240.00	0.00
TO ALIGN CHASSIS	350.00	0.00
TO REMOVE & REFIT ROOF LINING	120.00	0.00
TO TRANSFER DOOR MECHANISM	240.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	950.00	0.00
TO REMOVE AND REFIX WING MIRROR	120.00	0.00
TO REMOVE AND REFIX AIR BAG SYSTEM	120.00	0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00
TO REMOVE AND REFIX UNDERCARRIAGE	200.00	0.00
TO REMOVE AND REFIT FRONT SEAT BELT	120.00	0.00
TO REMOVE AND REPLACE REAR SEAT BELT	120.00	0.00
TO CHECK & RESET SYSTEM FUNCTION	350.00	0.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO REMOVE AND REFIT TYRE	120.00	0.00
TO REMOVE AND REFIX DASHBOARD	250.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	4,366.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
5211947962			COVER, FR BUMPER	1	495.50	25.00	371.62	Replace	Replace	No
5211547050			SUPPORT, FR BUMPER RH	1	76.90	25.00	57.67	Replace	Replace	No
8114547691			UNIT, HEADLAMP , RH	1	2,558.90	10.00	2,303.01	Replace	Replace	No
5380147080			FENDER SUB-ASSY, FR , RH	1	933.10	25.00	699.82	Replace	Replace	No
7537447140			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.67	Replace	Replace	No
5387547070			LINER, FR FENDER, RH	1	198.40	25.00	148.80	Replace	Replace	No
5387930050			RETAINER, FR FENDER NO. 2	1	16.80	25.00	12.60	Replace	Replace	No
5382747050			PROTECTOR, FR FENDER RH	1	90.40	25.00	67.80	Replace	Replace	No
53857-12010			RETAINER, FR WHEEL RH	1	3.10	25.00	2.32	Replace	Replace	No
5380747020			SEAL SUB-ASSY, RH	1	50.20	25.00	37.65	Replace	Replace	No
5371047060			APRON ASSY, FRONT FENDER , RH	1	171.20	25.00	128.40	Replace	Replace	No
6011747020			COVER SUB-ASSY, FRONT PILLAR , UPR RH	1	96.90	25.00	72.67	Replace	Replace	No
			TYRE	1	126.74	0.00	126.74	Replace	Replace	No
42611-47450			WHEEL, DISC FRONT	1	1,555.10	25.00	1,166.32	Replace	Replace	No
5740147080			MEMBER SILL SUB-ASSY, FLOOR SIDE, INNER RH	1	543.10	25.00	407.32	Replace	Replace	No
6140347900			REINFORCE SUB-ASSY , ROCKER , OUTER RH	1	564.80	25.00	423.60	Replace	Replace	No
7585047910			MOULDING ASSY, BODY ROCKER PANEL , RH	1	576.00	25.00	432.00	Replace	Replace	No
6101347010			PILLAR, FRONT BODY, RH	1	339.40	25.00	254.55	Replace	Replace	No
6115847010			EXTENSION, FRONT PILLER , LOWER RH	1	106.30	25.00	79.72	Replace	Replace	No
6101547010			GUSSET SUB-ASSY, FRONT BODY PILLAR , UPPER RH	1	196.00	25.00	147.00	Replace	Replace	No
6110347060			GUSSET SUB-ASSY, FRONT BODY PILLAR , LOWER RH	1	213.10	25.00	159.82	Replace	Replace	No
6110847060			REINFORCEMENT SUB-ASSY FRONT PILLAR , LOWER RH	1	530.00	25.00	397.50	Replace	Replace	No
6102347070			PILLAR SUB-ASSY, FRONT BODY , INNER RH	1	369.50	25.00	277.12	Replace	Replace	No
6121147070			RAIL, ROOF SIDE , RH	1	361.80	25.00	271.35	Replace	Replace	No
6120147040			RAIL SUB-ASSY, ROOF SIDE , RH	1	473.30	25.00	354.97	Replace	Replace	No
6120347050			RAIL SUB-ASSY, ROOF SIDE , INNER RH	1	445.00	25.00	333.75	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
6101747010			MEMBER SUB-ASSY, RAIL ROOT SIDE REAR RH	1	279.20	25.00	209.40	Replace	Replace	No
6171347040			EXTENSION, ROOF SIDE , OUTER RH	1	89.80	25.00	67.35	Replace	Replace	No
6124747050			REINFORCEMENT, ROOF SIDE RAIL , INNER RH	1	117.50	25.00	88.12	Replace	Replace	No
6131147050			PILLAR, CENTER BODY, OUTER RH	1	313.40	25.00	235.05	Replace	Replace	No
6103747090			REINFORCEMENT SUB-ASSY , CENTER BODY PILLAR , RH	1	643.30	25.00	482.47	Replace	Replace	No
6130547010			REINFORCE SUB-ASSY, CENTER BODY PILLAR , LOWER RH	1	279.80	25.00	209.85	Replace	Replace	No
6134547040			PILLAR, CENTER BODY, INNER LOWER RH	1	116.30	25.00	87.22	Replace	Replace	No
6140147020			REINFORCEMENT SUB-ASSY, ROCKER PANEL , RH	1	332.30	25.00	249.22	Replace	Replace	No
6160147150			PANEL SUB-ASSY, FENDER REAR RH	1	824.80	25.00	618.60	Replace	Replace	No
6563747060			LINER, REAR FENDER , RH	1	135.80	25.00	101.85	Replace	Replace	No
6163147070			PANEL, QUARTER WHEEL HOUSE , OUTER RH	1	286.80	25.00	215.10	Replace	Replace	No
6160747900			PANEL QUARTER WHEEL HOUSE , INNER RH	1	527.00	25.00	395.25	Replace	Replace	No
6700147152			PANEL SUB-ASSY, FRONT DOOR RH	1	1,249.60	25.00	937.20	Replace	Replace	No
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No
6861047040			CHECK ASSY, FRONT DOOR	1	153.50	25.00	115.12	Replace	Replace	No
6873012120			HINGE ASSY, FRONT DOOR , LOWER RH	1	92.10	0.00	92.10	Replace	Replace	No
6871012151			HINGE ASSY, FRONT DOOR , UPPER RH	1	82.10	25.00	61.57	Replace	Replace	No
6786147050			WEATHERSTRIP, FRONT DOOR RH	1	223.80	25.00	167.85	Replace	Replace	No
6810147230			GLASS SUB-ASSY, FRONT DOOR , RH	1	796.70	25.00	597.52	Replace	Replace	No
7575547040			MOULDING, FRONT DOOR WINDOW FRAME , REAR RH	1	54.70	25.00	41.02	Replace	Replace	No
6783547010			COVER, FRONT DOOR SERVICE HOLE , RH	1	23.20	25.00	17.40	Replace	Replace	No
6785547010			PROTECTOR, FRONT DOOR PANEL , RH	1	49.10	25.00	36.82	Replace	Replace	No
6783747020			SEAL, FRONT DOOR VENT, RH	1	16.80	25.00	12.60	Replace	Replace	No
9054109124			CUSHION FRONT DOOR PANEL	2	4.50	25.00	6.75	Replace	Replace	No
6781133040			PAD, FRONT AND REAR DOOR SILENCER	1	33.10	25.00	24.82	Replace	Replace	No
6783747060			SEAL, FRONT DOOR DUST PROOF	1	2.30	25.00	1.72	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
6783547010			COVER, FRONT DOOR SERVICE HOLE , RH	1	23.20	25.00	17.40	Replace	Replace	No
6812547030			GLASS, FRONT DOOR FIX WINDOW , RH	1	309.90	25.00	232.42	Replace	Replace	No
6821547010			WEATHERSTRIP, FRONT DOOR FIX WINDOW , RH	1	74.30	25.00	55.72	Replace	Replace	No
6740347050			FRAME SUB-ASSY, FRONT DOOR , REAR LOWER RH	1	86.20	25.00	64.65	Replace	Replace	No
6814147061			RUN, FRONT DOOR GLASS , RH	1	141.70	25.00	106.27	Replace	Replace	No
6740347050			FRAME SUB-ASSY, FRONT DOOR , REAR LOWER RH	1	86.20	25.00	64.65	Replace	Replace	No
6903047100			LOCK ASSY, FRONT DOOR RH	1	581.90	10.00	523.71	Replace	Replace	No
6900547240			DOOR CYLINDER & KEY SET LOCK	1	240.90	25.00	180.67	Replace	Replace	No
6941020110			DOOR LOCK STRIKER	1	38.00	25.00	28.50	Replace	Replace	No
6924147020			DOOR PAD FRONT , FRT & RR DOOR OUTER HANDLE , RH & LH	1	15.90	25.00	11.92	Replace	Replace	No
6920147070			DOOR FRAME INNER HANDLE FRONT , RH	1	187.70	25.00	140.77	Replace	Replace	No
6929312030			DOOR SNAP , FRONT DOOR OUTER HANDLE , RH	1	5.00	25.00	3.75	Replace	Replace	No
6931147061			DOOR FRONT ROD, LOCK OPEN , RH	1	16.30	25.00	12.22	Replace	Replace	No
6975047070			DOOR FRONT CABLE ASSY, INSIDE LOCKING , RH & LH	1	41.70	25.00	31.27	Replace	Replace	No
6971047060			DOOR FRONT CABLE ASSY, LOCK REMOTE CONTROL , RH & LH	1	41.70	25.00	31.27	Replace	Replace	No
6920547070C0			DOOR FRONT & REAR , INSIDE HANDLE SUB-ASSY, RH	1	93.30	25.00	69.97	Replace	Replace	No
6980121020			DOOR FRONT WINDOW REGULATOR SUB-ASSY, RH	1	230.80	25.00	173.10	Replace	Replace	No
8571047140			DOOR FRONT MOTOR ASSY, POWER WINDOW REGULATOR , RH	1	768.60	10.00	691.74	Replace	Replace	No
6766347010			GARNISH, DOOR FRAME, RH	1	12.60	25.00	9.45	Replace	Replace	No
6817147070			WEATHERSTRIP, FR RH	1	126.10	25.00	94.57	Replace	Replace	No
6761047780C1			PANEL ASSY, FR DOOR RH	1	725.90	25.00	544.42	Replace	Replace	No
6928347020C0			PLUG, FRONT AND REAR DOOR INSIDE HANDLE BEZEL, RH	1	12.90	25.00	9.67	Replace	Replace	No
7421047010C0			ARMREST ASSY, FR RH	1	139.40	25.00	104.55	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
7423147220			PANEL, FRONT ARMREST BASE, UPPER RH	1	41.80	25.00	31.35	Replace	Replace	No
8123030200			LAMP ASSY, COURTESY	1	33.00	10.00	29.70	Replace	Replace	No
861600WX80			FRONT DOOR SPEAKER ASSY, RADIO RH & LH	1	767.30	10.00	690.57	Replace	Replace	No
6231147050			WEATHERSTRIP, FRONT DOOR OPENING TRIM, RH	1	311.30	25.00	233.47	Replace	Replace	No
8215147591			WIRE, FRONT DOOR, RH	1	445.70	10.00	401.13	Replace	Replace	No
8791047450			MIRROR ASSY, OUTER REAR VIEW , RH	1	1,373.50	10.00	1,236.15	Replace	Replace	No
8791547070A1			COVER, OUTER MIRROR, RH	1	89.50	25.00	67.12	Replace	Replace	No
8404047080			MASTER SWITCH ASSY, FRONT DOOR RH	1	786.60	10.00	707.94	Replace	Replace	No
8487247060			SWITCH ASSY, OUTER MIRROR , FRONT DOOR RH	1	258.60	10.00	232.74	Replace	Replace	No
6700347210			PANEL SUB-ASSY, REAR DOOR, RH	1	1,243.90	25.00	932.92	Replace	Replace	No
			PIXEL STICKER	1	60.00	0.00	60.00	Replace	Replace	No
6863047050			CHECK ASSY, REAR DOOR	1	153.50	25.00	115.12	Replace	Replace	No
6877052031			HINGE ASSY, REAR DOOR , LOWER RH	1	73.30	25.00	54.97	Replace	Replace	No
6875020122			HINGE ASSY, REAR DOOR , UPPER RH	1	83.30	25.00	62.47	Replace	Replace	No
6787147051			WEATHERSTRIP, REAR DOOR RH	1	174.40	25.00	130.80	Replace	Replace	No
6233147050			WEATHERSTRIP, REAR DOOR OPENING TRIM, RH	1	283.60	25.00	212.70	Replace	Replace	No
9054109124			CUSHION FRONT DOOR PANEL	1	4.50	25.00	3.37	Replace	Replace	No
6784347010			COVER, REAR DOOR SERVICE HOLE , NO.2 , RH	1	20.40	25.00	15.30	Replace	Replace	No
6785747040			PROTECTOR, REAR DOOR PANEL , RH	1	8.00	25.00	6.00	Replace	Replace	No
6784747030			SEAL, REAR DOOR VENT, RH	1	15.80	25.00	11.85	Replace	Replace	No
6789547010			WEATHERSTRIP, REAR DOOR , NO.2 , RH	1	33.20	25.00	24.90	Replace	Replace	No
6811347100			GLASS SUB-ASSY, REAR DOOR, RH	1	397.80	25.00	298.35	Replace	Replace	No
6812347030			GLASS , REAR DOOR QUARTER WINDOW , RH	1	104.60	25.00	78.45	Replace	Replace	No
6818847030			WEATHERSTRIP, REAR DOOR QUARTER WINDOW , RH	1	47.70	25.00	35.77	Replace	Replace	No
6740747050			BAR SUB-ASSY, REAR DOOR WINDOW DIVISION , RH	1	108.70	25.00	81.52	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
6814247051			RUN, REAR DOOR GLASS , RH	1	118.70	25.00	89.02	Replace	Replace	No
6784147130			COVER, REAR DOOR SERVICE HOLE , RH	1	30.30	25.00	22.72	Replace	Replace	No
8572047150			DOOR REAR MOTOR ASSY, POWER WINDOW REGULATOR , RH	1	768.60	10.00	691.74	Replace	Replace	No
6980347020			DOOR REAR WINDOW REGULATOR SUB-ASSY, RH	1	200.70	25.00	150.52	Replace	Replace	No
6990552060			CHANNEL SUB-ASSY, REAR DOOR GLASS , RH	1	27.20	25.00	20.40	Replace	Replace	No
6997547020			FILLER, REAR DOOR GLASS CHANNEL	1	14.30	25.00	10.72	Replace	Replace	No
7576147050			MOULDING, REAR DOOR WINDOW FRAME , FRONT RH	1	54.70	25.00	41.02	Replace	Replace	No
6811347100			GLASS SUB-ASSY, REAR DOOR, RH	1	397.80	25.00	298.35	Replace	Replace	No
6921147021A1			DOOR OUTER HANDLE REAR , RH	1	93.90	25.00	70.42	Replace	Replace	No
6922747020			DOOR REAR , COVER OUTER HANDLE , RH & LH	1	17.30	25.00	12.97	Replace	Replace	No
6924147020			DOOR PAD FRONT , FRT & RR DOOR OUTER HANDLE , RH & LH	1	15.90	25.00	11.92	Replace	Replace	No
6924247030			DOOR PAD REAR , FRT & RR DOOR OUTER HANDLE , RH & LH	1	15.90	25.00	11.92	Replace	Replace	No
6920347040			DOOR FRAME INNER HANDLE REAR , RH	1	187.70	25.00	140.77	Replace	Replace	No
6905052250			DOOR LOCK REAR , RH	1	544.70	10.00	490.23	Replace	Replace	No
6783633030			DOOR REAR LOCK COVER	1	8.90	25.00	6.67	Replace	Replace	No
6941020110			DOOR LOCK STRIKER	1	38.00	25.00	28.50	Replace	Replace	No
6767347030			GARNISH, REAR DOOR FRAME, RH	1	12.60	25.00	9.45	Replace	Replace	No
6817347060			WEATHERSTRIP, REAR DOOR GLASS, INNER RH	1	94.80	25.00	71.10	Replace	Replace	No
6928347020C0			PLUG, FRONT AND REAR DOOR INSIDE HANDLE BEZEL, RH	1	12.90	25.00	9.67	Replace	Replace	No
7425047010C0			ARMREST ASSY, REAR RH	1	122.20	25.00	91.65	Replace	Replace	No
7427147120			PANEL, REAR DOOR ARMREST BASE, UPPER RH	1	33.90	25.00	25.42	Replace	Replace	No
6763047500C1			BOARD SUB-ASSY, REAR DOOR TRIM, RH	1	566.60	25.00	424.95	Replace	Replace	No
6250547011			COVER SUB-ASSY, REAR QUARTER PILLAR, RH	1	201.30	25.00	150.97	Replace	Replace	No
5530047151C0			PANEL ASSY, INSTRUMENT DASH BOARD UPPER	1	451.60	25.00	338.70	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
5530247141C1			PANEL SUB-ASSY, INSTRUMENT DASH BOARD	1	1,542.60	25.00	1,156.95	Replace	Replace	No
5543547050C0			PANEL, INSTRUMENT PANEL FINISH , END RH	1	112.20	25.00	84.15	Replace	Replace	No
5540747020			COVER SUB-ASSY, INSTRUMENT, LOWER	1	96.90	25.00	72.67	Replace	Replace	No
5530347091C0			PANEL SUB-ASSY, INSTRUMENT DASH BOARD LOWER	1	361.30	25.00	270.97	Replace	Replace	No
5566047150C6			REGISTER ASSY, INSTRUMENT PANEL, NO.2	1	175.40	25.00	131.55	Replace	Replace	No
5560647080			COVER SUB-ASSY, INSTRUMENT PANEL UNDER, NO.1	1	93.90	25.00	70.42	Replace	Replace	No
5505475020			STOPPER SUB-ASSY, GLOVE COMPARTMENT DOOR	1	46.70	25.00	35.02	Replace	Replace	No
5555047140C0			DOOR ASSY, GLOVE COMPARTMENT	1	471.10	25.00	353.32	Replace	Replace	No
5891047040C2			BOX ASSY, CONSOLE, REAR	1	1,493.00	25.00	1,119.75	Replace	Replace	No
5541047100			PANEL ASSY, INSTRUMENT CLUSTER FINISH	1	434.10	25.00	325.57	Replace	Replace	No
6221047140B0			GARNISH ASSY, FRONT PILLAR , RH	1	200.10	25.00	150.07	Replace	Replace	No
6211147150C0			BOARD, COWL SIDE TRIM, RH	1	123.40	25.00	92.55	Replace	Replace	No
6791347070C0			PLATE, FRONT DOOR SCUFF, RH	1	109.80	25.00	82.35	Replace	Replace	No
6241047100C0			GARNISH ASSY, CENTER PILLAR, RH	1	162.40	25.00	121.80	Replace	Replace	No
6241347070C0			GARNISH, CENTER PILLAR, LOWER RH	1	227.80	25.00	170.85	Replace	Replace	No
7302358010C1			PLATE SUB-ASSY, FRONT SHOULDER SEAT BELT ANCHOR , RH	1	50.80	25.00	38.10	Replace	Replace	No
7155147270			PAD, FRONT SEAT BACK , RH	1	268.60	25.00	201.45	Replace	Replace	No
7107347700C4			COVER SUB-ASSY, FRONT SEAT BACK , RH	1	1,505.10	25.00	1,128.82	Replace	Replace	No
7155247240			PAD, FRONT SEAT BACK , LH	1	268.60	25.00	201.45	Replace	Replace	No
7107447570C4			COVER SUB-ASSY, FRONT SEAT BACK , LH	1	1,505.10	25.00	1,128.82	Replace	Replace	No
7321047281C2			SEAT BELT ASSY, FRONT SEAT , RH	1	838.20	25.00	628.65	Replace	Replace	No
7322047221C2			SEAT BELT ASSY, FRONT SEAT , LH	1	838.20	25.00	628.65	Replace	Replace	No
7337047050C0			SEAT BELT ASSY, REAR SEAT, LH	1	838.20	25.00	628.65	Replace	Replace	No
7336047090C0			SEAT BELT ASSY, REAR SEAT, RH	1	828.20	25.00	621.15	Replace	Replace	No
6331047160B0			ROOF HEADLINING ASSY	1	2,059.50	25.00	1,544.62	Replace	Replace	No
8917047630			AIR BAG , COMPUTER ASSY	1	1,083.80	10.00	975.42	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
8983128030			SENSOR, SIDE AIR BAG , RH & LH	1	567.80	10.00	511.02	Replace	Replace	No
8983128040			SENSOR, SIDE AIR BAG REAR , RH & LH	1	567.80	10.00	511.02	Replace	Replace	No
8983147050			SENSOR, SIDE AIR BAG , RH & LH , NO.2	1	709.30	10.00	638.37	Replace	Replace	No
8430747161			CABLE SUB-ASSY, SPIRAL W/SENSOR	1	881.80	10.00	793.62	Replace	Replace	No
8214047031			WIRE ASSY, AIR BAG INSTRUMENT PANEL PASSENGER	1	24.00	10.00	21.60	Replace	Replace	No
8917833050			SENSOR, SEAT POSITION AIR BAG	1	135.80	10.00	122.22	Replace	Replace	No
7396047100			AIR BAG ASSY, INSTRUMENT PANEL PASSENGER	1	3,240.20	10.00	2,916.18	Replace	Replace	No
6218047070			AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD , LH	1	1,463.80	10.00	1,317.42	Replace	Replace	No
6217047070			AIR BAG ASSY, ROOF SIDE CURTAIN SHIELD , RH	1	1,463.80	10.00	1,317.42	Replace	Replace	No
7391047110			AIR BAG ASSY, FRONT SEAT , RH	1	850.00	10.00	765.00	Replace	Replace	No
7392047130			AIR BAG ASSY, FRONT SEAT , LH	1	850.00	10.00	765.00	Replace	Replace	No
4513047241C0			AIR BAG STEERING WHEEL DRIVER ,PAD ASSY,	1	2,377.30	10.00	2,139.57	Replace	Replace	No
7390047060C0			AIR BAG ASSY, INSTRUMENT PANEL, LOWER NO.1	1	1,593.60	25.00	1,195.20	Replace	Replace	No
8215347250			WIRE, REAR DOOR, RH	1	206.70	10.00	186.03	Replace	Replace	No
8481047010			SWITCH ASSY, DOOR POWER WINDOW	1	164.70	10.00	148.23	Replace	Replace	No
6473047240C2			PANEL ASSY, DECK TRIM SIDE, RH	1	344.70	25.00	258.52	Replace	Replace	No
5811147100			PAN, FRONT FLOOR, RH	1	564.80	25.00	423.60	Replace	Replace	No
6700547440			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	929.60	25.00	697.20	Replace	Replace	No
6881047061			TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2	59.10	25.00	88.65	Replace	Replace	No
4853080791			ABSORBER SET, SHOCK, REAR RH & LH	1	116.80	25.00	87.60	Replace	Replace	No
4879047010			ARM ASSY, UPPER CONTROL, REAR LH	1	352.40	25.00	264.30	Replace	Replace	No
4825747020			INSULATOR, REAR COIL SPRING, UPPER RH & LH	1	16.60	25.00	12.45	Replace	Replace	No
4825847010			INSULATOR, REAR COIL SPRING, LOWER RH & LH	1	11.70	25.00	8.77	Replace	Replace	No
4823147170			SPRING, COIL, REAR RH & LH	1	193.10	25.00	144.82	Replace	Replace	No
4840947011			CAM SUB-ASSY, REAR SUSPENSION TOE ADJUST	1	26.40	25.00	19.80	Replace	Replace	No
4819847010			CAM, CAMBER ADJUST, REAR SUSPENSION TOE	1	21.40	25.00	16.05	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
9011912426			BOLT , W/WASHER (FOR REAR SUSPENSION ARM RH & LH)	1	6.60	25.00	4.95	Replace	Replace	No
4230547050			CARRIER SUB-ASSY, REAR AXLE, LH	1	802.70	25.00	602.02	Replace	Replace	No
4878047010			ARM ASSY, TRAILING, REAR LH	1	239.70	25.00	179.77	Replace	Replace	No
4871047010			ARM ASSY, REAR SUSPENSION, NO.1 RH & LH	1	200.80	25.00	150.60	Replace	Replace	No
4872747020			BRACKET, REAR SUSPENSION TRAILING ARM, LH	1	89.20	25.00	66.90	Replace	Replace	No
4875347020			COVER, REAR SUSPENSION ARM, LH	1	41.60	25.00	31.20	Replace	Replace	No
4883047010			LINK ASSY, REAR STABILIZER, RH & LH	1	149.40	25.00	112.05	Replace	Replace	No
4881247040			BAR, STABILIZER, REAR	1	286.30	25.00	214.72	Replace	Replace	No
4881847010			BUSH, STABILIZER, REAR	1	59.70	25.00	44.77	Replace	Replace	No
4883247010			BRACKET, REAR STABILIZER BAR	1	9.60	25.00	7.20	Replace	Replace	No
4873047010			ARM ASSY, REAR SUSPENSION, NO.2 RH & LH	1	497.50	25.00	373.12	Replace	Replace	No
9094702H48			BRAKE HOSE, FLEXIBLE(FOR REAR RH & LH)	1	69.80	25.00	52.35	Replace	Replace	No
4261147450			WHEEL, DISC	1	1,555.10	25.00	1,166.32	Replace	Replace	No
			TYRE	1	126.74	0.00	126.74	Replace	Replace	No
5762847020			COVER ASSY, CENTER FLOOR UNDER , LH	1	390.20	25.00	292.65	Replace	Replace	No
8940847020			SENSOR SUB-ASSY, HEIGHT CONTROL, REAR LH	1	661.10	10.00	594.99	Replace	Replace	No
7553347070			WINDSCREEN FRONT MOULDING, TOP FRONT	1	44.00	25.00	33.00	Replace	Replace	No
5611764010			WINDSCREEN FRONT DAM, WINDOW GLASS	1	44.00	25.00	33.00	Replace	Replace	No
561014E959			WINDSCREEN FRONT GLASS SUB-ASSY	1	1,626.40	25.00	1,219.80	Replace	Replace	No
	COMMO N		SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace	No
7426047010C0			ARMREST ASSY, REAR LH	1	122.20	25.00	91.65	Replace	Replace	No
TOTAL MATERIALS							58,888.50	58,888.11		
TOTAL MATERIALS(Discounted)							58,888.11	58,888.11		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									