



## Auto Insure Pte. Ltd.

Blk 3, 391A Woodlands Road  
Yew Tee Industrial Estate  
Singapore (677964)  
E: claims@autoinsure.com.sg  
W: www.autoinsure.com.sg  
T: 6368 2788 F: 6368 0081  
GST No.: 201437380M

Page No.1

### AUTOMOBILE ASSESSMENT REPORT

Our Ref: SLM8832C

Your Ref: SHD3133P

Date: 7-Apr-18

BY EMAIL ONLY  
(claims@autoinsure.com.sg)

**ATTENTION: MOTOR CLAIMS DEPT**  
email: motorclaim@iii.com.sg

India International Insurance Pte Ltd  
64 Cecil St,  
#04-#05 IOB building,  
49711

Assessed Vehicle No : SLM8832C  
Car Make and Model : KIA FORTE K3  
Date of Accident : 4-Apr-18  
Date of Assessment : 7-Apr-18

We have carried out a physical assessment of SLM8832C at our workshop Auto Insure Pte Ltd sustained damages to the REAR RH portion of the vehicle.


#### 4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the REAR RH portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : P/P  
Adjusted Amount : \$ 7,500.00  
Est. Repair Days : 4

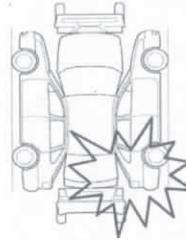

\*\* Considering that our vehicle is less then 6 months old.  
We will not agree to any repair of parts, only replacement will be done. \*\*

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

**Disclaimer**  
This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.  
No liability or responsibility whatsoever shall be held by  
**AUTO INSURE PTE. LTD.** For any reliance on this report by any third party.

Our Ref: SLM8832C  
Your Ref: SHD3133P

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	REAR BUMPER R		\$ 1,365.50
2	2	REAR BUMPER SIDE RETAINERS X		\$ 118.00
3	1	REAR BUMPER LOWER SKIRT R		\$ 439.00
4	1	REAR REINFORCEMENT BAR X		\$ 589.90
5	1	REAR FENDER TAIL LAMP RH X		\$ 889.00
6	1	REAR TAIL LAMP CLIPS X		\$ 38.00
7	1	REAR FENDER RH R		\$ 1,174.20
8	1	REAR FENDER INNER SHIELD LH X		\$ 279.20
9	2	REAR BUMPER REFLECTOR X		\$ 380.00
				SUB TOTAL \$ 5,272.80
				LESS 20% \$ 1,054.56
				TOTAL AMOUNT \$ 4,218.24
<b>SPECIAL NETT ITEMS</b>				
1	1 set	REAR BUMPER CLIPS		\$ 60.00
				SUB TOTAL \$ 60.00
				TOTAL PARTS COST \$ 60.00

Our Ref: SLM8832C  
Your Ref: SHD3133P

S/NO	DESCRIPTION	EST. BY WORKSHOP
<b>LABOUR &amp; PAINTWORK</b>		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ <del>900.00</del> 300
2	TOWING CHARGE	
3	TO DIAGNOSE ERASE FAULT MEMORY AFTER REPAIR	\$ 250.00 X
4	TO REMOVE / REFIX WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 150.00 X
5	TO REMOVE/INSTALL REAR WINDSCREEN	\$ -
6	TO REMOVE / INSTALL REAR REVERSE SENSOR	\$ -
7	TO REMOVE / REFIX UPHOSTERY. GARNISH AND ATTACHMENT PARTS	\$ 200.00 X
8	TO REMOVE / REFIX REAR LUGGAGE COMPARTMENT	\$ 150.00 X
9	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ <del>800.00</del> 400
10	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ 150.00 X
11	TO VACUUM, WAXING & CLEAN	\$ 100.00 X
12	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ 100.00 X
TOTAL BEFORE GST		\$ 7,018.24
GST 7%		\$ 491.28
TOTAL (PARTS & LABOUR):		\$ 7,509.52

**Adjustments / Recommendations**

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$7,500.00 for direct settlement with the third party insurance.

Yours Faithfully,

Jason Heng  
Claims Director

Sebastian  
12/4/18.  
- Part by part repair  
- Photo After Paint  
90036121

sebastian.yeang@lkk-auto.com

Finalized = \$ 700

3 days -

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer

Signature:

Date: