

**MOVA AUTOMOTIVE PTE  
LTD**

**MOVA BUILDING  
22 JALAN KILANG  
SINGAPORE 159419**

**Claim Reference:  
Assessment Number: CK131914  
Version: MOVAAUTO/1**

**Full Report - V1  
Registration: SGT2974M  
Printed: 28/06/2018 13:12**

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Jia Yu	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	HYUNDAI
Model:	Getz
Sub Model:	BASE MODEL
Model Sheet Number:	3013 01
Registration:	SGT2974M
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

**Model Specs**

5-DOOR	TWO COAT METALLIC
PREPARE OFF VEHICLE	

**Vehicle Condition**



**Vehicle Status**

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	28/06/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

# MOVA AUTOMOTIVE PTE LTD

**Claim Reference:**  
**Assessment Number: CK131914**  
**Version: MOVAAUTO/1**

**Full Report - V1**  
**Registration: SGT2974M**  
**Printed: 28/06/2018 13:12**

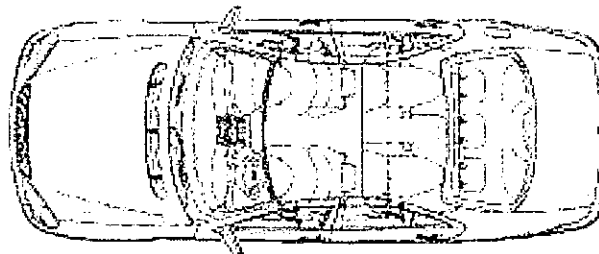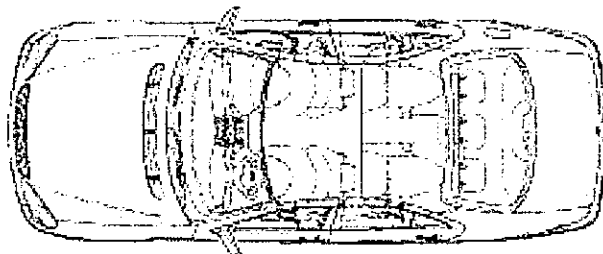

## Addresses

## Cost Summary

Total Labour	\$733.50
Total Paint/Material	\$164.98
Total Parts	\$1,263.00
Excess:	TBA
Grand Total Exc GST:	\$2,161.48
7 % GST:	\$151.30
Grand Total Inc GST:	\$2,312.78

## Repair Information

### LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR  
Price/Dent = \$45.00/HR

### Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
86510R00)	R + R FRONT BUMPER	6.0	27.00
86530R00)	R + R BUMPER CARRIER (BUMPER REMOVED)	1.0	4.50
86512R00)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R RADIATOR GRILLE AND NECESSARY ATTACHED PARTS	4.0	18.00
98630R00	R + R LEFT FRONT WASHER NOZZLE	2.0	9.00
92305R0R	R + R RIGHT SIDE FLASHER LAMP	2.0	9.00
66300R00)	R + R L/F WING INCLUDES: R + R WHEELHOUSE INSERT AND TRIM	4.0	18.00
66300R00)	RENEW L/F WING (REMOVED) INCLUDES: R + R REPEATER LAMP	1.0	4.50
92000R00)	REMOVE/REFIT LH HEADLIGHT UNIT INCLUDES: SET HEADLIGHT BEAMS	1.0	4.50
92000R0R)	REMOVE/REFIT RH HEADLIGHT UNITS INCLUDES: SET HEADLIGHT BEAMS	1.0	4.50
92000R0B)	R + R HEADLAMP	1.0	4.50
0471	REPAIR BONNET	20.0*	90.00
0475	REPAIR LEFT BONNET HINGE	5.0*	22.50
0476	REPAIR RIGHT BONNET HINGE	5.0*	22.50
0742	REPAIR R/F WING	5.0*	22.50
<b>LABOUR COST</b>			
<b>Total Work Units</b>		<b>58.0</b>	
<b>Sub Total</b>		<b>5.8HRS</b>	<b>\$261.00</b>
<b>Paint Labour</b>		<b>10.5HRS</b>	<b>472.50</b>
<b>Total Labour</b>		<b>16.3HRS</b>	<b>\$733.50</b>

# **MOVA AUTOMOTIVE PTE LTD**

**Claim Reference:**

**Assessment Number: CK131914**

**Version: MOVAAUTO/1**

**Full Report - V1**

**Registration: SGT2974M**

**Printed: 28/06/2018 13:12**

<b>PAINT WORK</b>		<b>Time Basis 10 WU = 1 HR. Price = \$45.00/HR</b>	
<b>Guide Number</b>	<b>Description</b>	<b>WU</b>	<b>Cost Price (\$)</b>
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
340	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
741	L/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER NEW PART PAINT K1R	10.0	
311	L/F BUMPER MOULDING NEW PART PAINT K1R	3.0	
312	R/F BUMPER MOULDING NEW PART PAINT K1R	3.0	
410	GRILLE NEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	25.0	
742	R/F WING REPAIR PAINTING >50%	16.0	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	75.0	
	<b>Preparation Main Work Plastic</b>	5.0	
	<b>Preparation Main Work Metal</b>	25.0	
	<b>Preparation Work Multi Layer Paint</b>	0.0	
	<b>Total Work Units (10WU/HR)</b>	105.0	
	<b>Total Paintwork Labour</b>	10.5HRS	\$472.50
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
	<b>New Part Painting</b>		\$19.61
	<b>New Part Painting - Plastic K1R</b>		\$54.61
	<b>Material-Constant Main Work Metal</b>		\$28.60
	<b>Surface-/Blend Paint</b>		\$2.99
	<b>Repair Painting</b>		\$50.17
	<b>Material-Const Main Work Plastic</b>		\$9.00
	<b>Total Excluding Pearlescent Uplift</b>		\$164.98
	<b>Pearlescent Uplift @ 0.0%</b>		\$0.00
	<b>Total Paint Material Cost</b>		\$164.98

## **PARTS**

				<b>Price Valid: 01/06/2015</b>	
<b>Guide No.</b>	<b>Qty</b>	<b>Description</b>	<b>Part Number</b>	<b>Supplier</b>	<b>Price (\$)</b>
283	1	FRONT BUMPER	865111C100		0% 140.00*
315	1	FRONT IMPACT DAMPER	865201C000		0% 60.00*
257	1	FRONT NUMBER PLATE	KNPL3		0% 45.00*
980	1	FRT BUMPER AIR GUIDE	865221C300		0% 70.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0% 38.00*
340	1	FRT BUMPER SUPPORT	865300B000		0% 140.00*
258	1	FRT NO PLATE REINF	KNPL0		0% 25.00*
410	1	GRILLE	863611C000		0% 40.00*
431	1	GRILLE BADGE	863003A001		0% 20.00*
419	1	GRILLE TRIM	863651C000		0% 90.00*
311	1	L/F BUMPER MOULDING	865231C000		0% 60.00*
741	1	L/F WING	663111C600		0% 165.00*
561	1	LEFT HEADLAMP ASSY	921011C040		0% 155.00*
312	1	R/F BUMPER MOULDING	865241C000		0% 60.00*
562	1	RIGHT HEADLAMP ASSY	921021C040		0% 155.00*
f: OEM Parts			<b>Sub Total</b>		<b>\$1,263.00</b>
g: Original			<b>Total Parts</b>		<b>\$1,263.00</b>

h: Secondhand

p: Parallel

x: Exchange

**MOVA AUTOMOTIVE PTE LTD****Claim Reference:****Assessment Number: CK131914****Version: MOVAAUTO/1****Full Report - V1****Registration: SGT2974M****Printed: 28/06/2018 13:12****NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER****Total Extras****\$0.00****Final Calculation**

<b>Total Parts</b>		<b>\$1,263.00</b>
<b>Labour</b>		
Total Panel/Mechanical	\$261.00	
Total Paintwork	\$472.50	
<b>Total Labour</b>		<b>\$733.50</b>
<b>Total Paint/Material Costs</b>		<b>\$164.98</b>
<b>Grand Total Excludes GST</b>		<b>\$2,161.48</b>
GST @ 7 %		<b>\$151.30</b>
<b>Grand Total Includes GST</b>		<b>\$2,312.78</b>

**Assessment Notes**