



JKS MOTOR WORKS (ACCIDENT CLAIMS) PTE LTD

8 KAKI BUKIT AVENUE 4, #03-46, Premier @ Kaki Bukit, Singapore, 415875

CO REG & GST No. : 201529104D

TEL: 67026828 FAX: 6702 6829

EMAIL: admin@jksmotorworks.com.sg

Motor Claims Department

AXA INSURANCE SINGAPORE PTE LTD

8 SHENTON WAY, #24-01 AXA TOWER,

Singapore 068811

REF. NO :

VEH NO : SJD9500A

QUOTATION NO. : JKSQUOT035

DATE : 4-Jul-18

VEHICLE NO SLS1755G

MAKE/MODEL KIA CARENS

CHASSIS KNAHU815VJ7188292

ENGINE NO D4FDHH109191

REG. DATE 12 Sep 2017

CAPACITY 1685 cc

MILEAGE

Estimate for SLS1755G KIA CARENS

No	Description	Qty	UOM	Repairer's Estimate	Revised Amount (Less 10%)
SPARE PART ITEMS					
1	FRONT BUMPER / re	1	PC 691.2	750.00	675.00 /
2	FRONT BUMPER CENTER - UPPER * / CRA	1	PC 49.5	100.00	90.00 /
3	FRONT BUMPER GRILLE * / BR	1	PC 265.5	490.00	441.00 /
4	FRONT BUMPER CHROME GARNISH BR * / BR NN	1	PC X	250.00	225.00 /
5	FRONT BUMPER "KIA" EMBLEM / SCR	1	PC 68.4	100.00	90.00 /
6	FRONT BUMPER GRILLE CLIPS / MC	1	SET 20	50.00	45.00 /
7	FRONT BUMPER LOWER GRILLE * / Cut	1	PC 164.7	180.00	162.00 /
8	FRONT BUMPER LOWER GARNISH SPOILER / re	1	PC 189	250.00	225.00 /
9	FRONT BUMPER LOWER GRILLE CLIPS / MC	1	SET 20	50.00	45.00 /
10	FRONT BUMPER FOG LAMP GARNISH LH & RH X NN	2	PCS X	240.00	216.00 X
11	FRONT BUMPER FOGLAMP LH/RH * LH - BR. RH X NN	2	PCS 185.4	480.00	432.00 216
12	HEADLAMP LH & RH * LH - BR. RH X NN 1402.2	2	PCS X	3,400.00	3,060.00 1530
13	FRONT BUMPER REINFORCEMENT * / ST	1	PC	500.00	450.00 /
14	FRONT BUMPER SIDE RETAINER LH & RH * / BR.	2	PCS 21.6	50.00	45.00 /
15	FRONT BUMPER CLIPS / MC	1	SET 20	50.00	45.00 /
16	AIRCON CONDENSER X NN	1	PC X	900.00	810.00 X
17	RADIATOR X	1	PC X	780.00	702.00 X
18	FRONT SUPPORT PANEL * / BR.	1	PC 650	750.00	675.00 /
19	BONNET X NN	1	PC X	920.00	828.00 X
20	REAR BUMPER / re	1	PC 576	650.00	585.00 /
21	REAR BUMPER CLIPS / MC	1	SET 20	50.00	45.00 /
22	REAR BUMPER LOWER GARNISH / re	1	PC 189	250.00	225.00 /
23	REAR BUMPER BOTTOM DIFFUSER / re	1	PC 189	500.00	450.00 /
24	REAR BUMPER REFLECTOR LH/RH * / CRA	2	PCS 232	320.00	288.00 /
25	REAR BUMPER FOG LAMP BULBS X NN	2	PCS X	30.00	27.00 X

26	REAR BUMPER REINFORCEMENT	B / BT	1	PC	367	500.00	450.00	/
27	REAR BUMPER REINFORCEMENT BRACKET	R / BT	2	PCS	318	360.00	324.00	/
28	REAR BUMPER SIDE RETAINER LH/RH	X / Re.	2	PCS	50	160.00	144.00	/
29	REAR BUMPER UPPER PROTECTOR	X NN	1	PC	X	50.00	45.00	X
30	TAILGATE	/ BMC	1088	1	PC	X	1,500.00	/
31	TAILGATE "KIA" EMBLEM	/	1	PC	68.4	100.00	90.00	/
32	TAILGATE "CARENS" EMBLEM	/ mbc	1	PC	36	70.00	63.00	/
33	TAILGATE "CRDI" EMBLEM	/	1	PC	29	70.00	63.00	/
34	TAILGATE RUBBER	X X NN	1	PC	X	125.00	112.50	X
35	TAILGATE "C&C" LOGO	/ mbc	1	PC	50	100.00	90.00	/
36	TAIL LIGHT LH & RH	X	2	PCS	X	760.00	684.00	X
37	TAILGATE REFLECTOR LH & RH	X NN	2	PCS	X	600.00	540.00	X
38	TAILGATE INNER TRIM	X X NN	1	PC	X	260.00	234.00	X
39	TAILGATE INNER TRIM CLIPS	/ mbc	1	SET	20	50.00	45.00	/
40	TAILGATE LOCK	R / BT	1	PC	109	150.00	135.00	/
41	TAILGATE WINDSCREEN MOULDING	/ mbc	1	PC	60(SN)	180.00	162.00	/
42	TAILGATE WEATHER STRIP	X / Cut	1	PC	131	160.00	144.00	/
43	REAR TAILGATE LOCK CATCH	X NN	1	PC	X	30.00	27.00	X
44	REAR END PANEL	R / BMC	1	PC	453	600.00	540.00	/
45	REAR END PANEL TOP GARNISH	R / Re.	1	PC	71	85.00	76.50	/
46	REAR END PANEL TOP GARNISH CLIPS	X	1	SET	X	50.00	45.00	X
47	SPARE TYRE PANEL	X	1	PC	X	150.00	135.00	X
48	SPARE TYRE PANEL TOP TRIM	X NN	1	PC	X	360.00	324.00	X
49	REAR EXHAUST MUFFLER AND MOUNTING	X	1	PC	X	800.00	720.00	X
							8243.9	0.00
								7419.51

SPECIAL NETT

50	FRONT NUMBER PLATE W/ HOLDER	/ Cut	1	SET		50.00	50.00	40
51	REAR NUMBER PLATE W/ HOLDER	X NN	1	SET		50.00	50.00	X
52	REAR BUMPER REVERSE SENSOR	R / tape r/c	4	PCS		1,000.00	1,000.00	7250

LABOUR

LABOUR TO REMOVE/REPLACE, CUT/WELD INCLUSIVE OF PANEL BEATING ON AFFECTED/NECESSARY PARTS AFFECTED BY THE ACCIDENT (FRONT)								
53			1	SRV		800.00	800.00	600
TO PUTTY AND SPRAY PAINT ON ACCIDENT AFFECTED PORTION (FRONT)								
54			1	SRV		700.00	700.00	200
LABOUR TO REMOVE/REPLACE, CUT/WELD INCLUSIVE OF PANEL BEATING ON AFFECTED / NECESSARY PARTS AFFECTED BY THE ACCIDENT (REAR)								
55			1	SRV		1,100.00	1,100.00	600
TO PUTTY AND SPRAY PAINT ON ACCIDENT AFFECTED PORTION (REAR)								
56			1	SRV		1,400.00	1,400.00	700
TO APPLY ANTI RUST COATING ON REPAIRED/REPLACE PANELS								
57			1	SRV		180.00	180.00	60
TO CHECK/RECONNECT WIRING AND ENSURE PROPER FUNCTION INCLUSIVE OF HEADLAMP ALIGNMENT								
58			1	SRV		100.00	100.00	X NN

59	TO REMOVE AND TRANSFER SERVICEABLE TAILGATE COMPARTMENTS TO NEW TAILGATE	1	SRV	200.00	200.00	60
60	TO TRANSFER REAR WINDSCREEN TO NEW TAILGATE AND CONDUCT WATER LEAKAGE TEST	1	SRV	180.00	180.00	100
61	TO REMOVE AND REPLACE / REINSTALL AIRCON CONDENSER INCLUDING TOP UP GAS	1	SRV	180.00	180.00	100 X
62	TO REMOVE AND REINSTALL LUGGAGE COMPARTMENT TRIMMINGS AND FITTINGS TO FACILITATE REPAIRS	1	SRV	250.00	250.00	60 X
63	TO RESET AND REPROGRAM ECU AFTER REPAIRS	1	SRV	350.00	350.00	X
64	COMPUTERIZED ALIGNMENT	1	SRV	100.00	100.00	X

2480

8 Days.

10229.51

part by part

before paint photos.

Gino Qiang - 82880282

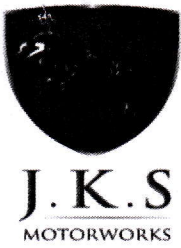
06/7/18.

Total: 10690.85

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

**JKS MOTOR WORKS (ACCIDENT CLAIMS) PTE LTD**

8 KAKI BUKIT AVENUE 4, #03-46, Premier @ Kaki Bukit, Singapore, 415875

CO REG & GST No. : 201529104D

TEL: 67026828 FAX: 6702 6829

EMAIL: admin@jksmotorworks.com.sg

Motor Claims Department

AXA INSURANCE SINGAPORE PTE LTD

8 SHENTON WAY, #24-01 AXA TOWER,
Singapore 068811

REF. NO :

VEH NO : SJD9500A

QUOTATION NO. : JKSQUOT035**DATE : 9-Jul-18**

VEHICLE NO SLS1755G
MAKE/MODEL KIA CARENS
CHASSIS KNAHU815VJ7188292
ENGINE NO D4FDHH109191
REG. DATE 12 Sep 2017
CAPACITY 1685 cc
MILEAGE

Estimate for SLS1755G KIA CARENS

No	Description	Qty	UOM	Repairer's Estimate	Revised Amount (Less 10%)
SUPPLEMENTARY					
1	TAIL GATE GARNISH / PR	1	PC	280.00	252.00
2	BOOT INNER TOOL BOX CONTAINER REAR / PR	1	PC	400.00	360.00
3	TOWING COVER REAR / PR	1	PC	30.00	27.00
4	BUMPER BRACKET FRONT / PR. X 2	1	PC	80.00	72.00
5	BUMPER INNER SPONGE FRONT / CHA	1	PC	120.00	108.00
6	BRACKET REINFORCEMENT FRONT X GTR NV	1	PC	180.00	162.00

7. Antenna Sensor. / DM

1 PC 180 135 79

Gave Ref.
09/7/18.512.6
10% = 461.34

accidentclaims@jksmotorworks.com