

Vehicle Make/Model/Colour	VAN
Name of Driver	CHAN KAM JONG
Insurance Company Name	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SHC5481B
Vehicle Make/Model/Colour	TRANSCAB TAXI
Name of Driver	YEO POH SENG
Insurance Company Name	

DETAILS OF INJURED PERSON 1

Name	ISMAIL BIN HASSAN
Injured person in which vehicle?	SLM8775J

Sketch Plan

SKETCH PLAN

VEHICLE NO.: SLM 877SJ
INSURER : NMC
DATE & TIME: 25/11/2017 14:15 hrs

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


 25/11/17
Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

 25/11/2017
Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.: (48)

Sketch Plan #2

SKETCH PLAN

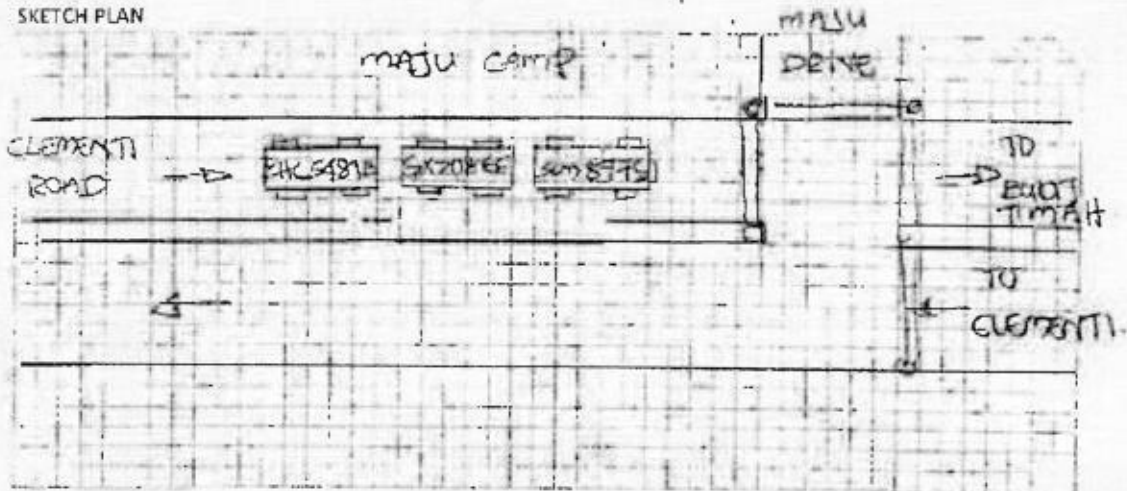

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Ms refer Police Report (T/20171175/7009)

Note: Please note that your insurer may have 14 days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature] 25/11/17
 Policyholder's Signature
 Date & Time:

 Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

Wendy 25/11/17
 Reporting Centre Personnel's Signature
 Name: (YS)
 NRIC/FIN No.:

() Claim Own Policy (☒) Claim Third Party () Reporting Only
 () Claim OD/TP at other workshop ()

PR



SINGAPORE POLICE FORCE



T/20171125/7009

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408665
Tel No: 65470000

1 of 3

Report No. T/20171125/7009

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 25/11/2017 17:04		Vide Report No.		Station Diary No.:	
Name of Informant: ISMAIL BIN HASSAN			Address: APT BLK 520 WOODLANDS DRIVE 14 #07-309 SINGAPORE 730520		
ID Type / ID No.: NRIC NO / S6830614J			Contact No.: Home/Office: Mobile: 83334536		
Nationality: SINGAPORE CITIZEN			Email: ismailnexus7@gmail.com		
Sex: Male	Age: 49	Date of Birth: 21/09/1968	Type of Informant: Vehicle Owner		
Race: Malay			Language: English		Institution / School Name:
Occupation: FIRE TEST ENGINEER			Driving Licence Information: Class: 2B, 2A, 3		Date of Expiry

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 25/11/2017 14:15	Type of Location: traffic light
Location: CLEMENTI ROAD				
We were at that Junction of Clementi Road and Maju Drive going towards Bukit Timah Road.				
Weather: Clear		Road Surface: Dry	Road Speed Limit: 60 Km/h	
Traffic Flow: Two Way		Traffic Control: Traffic Light - Working		Traffic Volume: Light
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Vehicle No.	Vehicle Type	Make	Color	Damage
GX2086E	Van	NISSAN	Black	0
SHC5481B	Car	RENAULT	Red	0
SLM8775J	Car	HYUNDAI	Accent Blue	Slightly Damaged 1

PR



**SINGAPORE
POLICE FORCE**



T/20171125/7009

Police Station Of Origin
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408855
Tel No: 65470000

2 of 3

Report No. T/20171125/7009

CONTINUATION OF REPORT

Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Name	ISMAIL BIN HASSAN	ID No.	S6830614J
Related Vehicle	SLM8775J (Car)	Contact No.	83384536
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 2B,2A,3 Date of Expiry: NIL
Date Treatment	25/11/2017	Date Discharge	25/11/2017
No. of Days granted Medical Leave	01	Degree of Injury	Slight

Brief Details:

3 vehicles involved. 1 Car, Van and Taxi.

Our car, Hyundai Accent SLM 8775J (front vehicle) was rammed from behind by a Nissan Van GX 2066E (center vehicle) which was rear ended by a Renault Taxi SHC 5481B (last vehicle) at 2.15pm along Clementi Road before Maju Drive junction toward Bukit Timah Road.
Our car was stationary while waiting for the traffic light to turn green.

The following are particulars of drivers of the other vehicles involved are as follows:

Nissan Van GX 2066E
Mr. Chan Kam Jong
F7112590N


Renault Taxi
Mr. Yeo Poh Seng
S1324341G

PR



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Traffic Police Division HQ
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000



T/20171125/7008

3 of 3

Report No. T/20171125/7008

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

Signature Of Officer Recording The Report:
Not applicable

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / TPIB /
YEO KIA HUAT
Contact No.: 65476325

Authentication Stamp
NP158

Signature Of Informant:

The identity of the person making this report has
been authenticated by SingPass. No signature is
required.

Date/Time:
25/11/2017 17:04

Classification Of Case:



Invoice

CHIN SENG ENGINEERING SERVICES

Invoice No : GWIN0001041

Invoice Date : 18/12/2017

Due Date : 18/12/2017

VHA No : 14822

Referral ID : N011

Description :	Amount
Rental for 19 Day/s @ \$140 per Day	\$2,660

Vehicle No : GBE4577B

Vehicle Description : TOYOTA HIACE

Rental Period : 27/11/2017 to 15/12/2017

Total Amount Payable : \$2,660


GOOD WAY CAR RENTAL

8 Kaki Bukit Ave 4 #06-04 Premier@Kaki Bukit Singapore 415875
Tel: 6315 8479 H/P: 9833 0807

VHA No: 14822



UEN: 53207137M


VEHICLE RENTAL AGREEMENT

HIRER'S PARTICULAR Name: (as in I/C) <u>CHIN SENG SENG</u> NRIC/PASSPORT No: _____ Address (Res): _____ Name & Address of Employer: _____ Occupation: _____ Driving Exp: _____ Driving Licence No: _____ D/L Type: Local / International Issue Date: _____ Date of Birth: _____ Tel: (O) _____ (R) _____ HP: _____ ADDITIONAL DRIVER'S PARTICULARS Name: (as in I/C) <u>CHIN SENG SENG</u> NRIC/PASSPORT No: <u>F7112890N</u> Address (Res): _____ Driving License No: _____ D/L Type: Local / International Issue Date: _____ Date of Birth: <u>30/2/73</u> Occupation: _____ Driving Exp: _____		Vehicle No: _____ Replace Veh No: _____ Mileage Out: _____ Mileage Out: _____ Make & Model: _____ Auto / Manual Group: _____ Out : Date _____ Time: <u>11-0</u> HIRE / PERIOD EXPIRY _____ Time: _____ NON-WAIVER EXCESS=\$ <u>250</u> <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="4">CHARGES</th> </tr> <tr> <td>Daily</td> <td><u>19</u></td> <td>@ \$ <u>140</u></td> <td>per day</td> </tr> <tr> <td>Weekly</td> <td></td> <td>@ \$</td> <td>per week</td> </tr> <tr> <td>Monthly</td> <td></td> <td>@ \$</td> <td>per month</td> </tr> <tr> <td>Hours</td> <td></td> <td>@ \$</td> <td>per hour</td> </tr> <tr> <td>Others</td> <td></td> <td>@ \$</td> <td></td> </tr> <tr> <td>CDW</td> <td></td> <td>@ \$</td> <td>per day/month</td> </tr> <tr> <td>PAI</td> <td></td> <td>@ \$</td> <td>per day/month</td> </tr> <tr> <td colspan="4">Delivery/Collection Service</td> </tr> <tr> <td colspan="4" style="text-align: right;">SUB-TOTAL \$</td> </tr> </table> <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="6">PETROL LEVEL</th> </tr> <tr> <td>Out</td> <td>E</td> <td>1/4</td> <td>1/2</td> <td>3/4</td> <td>F</td> </tr> <tr> <td>In</td> <td><u>E</u></td> <td>1/4</td> <td>1/2</td> <td>3/4</td> <td>F</td> </tr> <tr> <th colspan="6">EXTENSION</th> </tr> <tr> <td colspan="6">Misc.</td> </tr> <tr> <td colspan="6" style="text-align: right;">TOTAL CHARGES \$</td> </tr> </table> <div style="text-align: center;">  Hirer's Signature _____ Additional Driver's Signature _____ </div>		CHARGES				Daily	<u>19</u>	@ \$ <u>140</u>	per day	Weekly		@ \$	per week	Monthly		@ \$	per month	Hours		@ \$	per hour	Others		@ \$		CDW		@ \$	per day/month	PAI		@ \$	per day/month	Delivery/Collection Service				SUB-TOTAL \$				PETROL LEVEL						Out	E	1/4	1/2	3/4	F	In	<u>E</u>	1/4	1/2	3/4	F	EXTENSION						Misc.						TOTAL CHARGES \$					
CHARGES																																																																															
Daily	<u>19</u>	@ \$ <u>140</u>	per day																																																																												
Weekly		@ \$	per week																																																																												
Monthly		@ \$	per month																																																																												
Hours		@ \$	per hour																																																																												
Others		@ \$																																																																													
CDW		@ \$	per day/month																																																																												
PAI		@ \$	per day/month																																																																												
Delivery/Collection Service																																																																															
SUB-TOTAL \$																																																																															
PETROL LEVEL																																																																															
Out	E	1/4	1/2	3/4	F																																																																										
In	<u>E</u>	1/4	1/2	3/4	F																																																																										
EXTENSION																																																																															
Misc.																																																																															
TOTAL CHARGES \$																																																																															

VEHICLE CHECK LIST

INDICATE:
 D - DENTS
 S - SCRATCHES
 A - ACCIDENTS



RIGHT FRONT TOP LEFT

ACCESSORIES CHECK

☐ Ashtray

☐ Cig Lighter

☐ S/Tyre

☐ STD Tools

☐ Jack

☐ Hub Caps

☐ Radio/Cass

☐ CD


☐ Cartridges

I have read and agree to the terms and condition on both sides of the agreement. If I have presented a charge/credit card for payment. I agree that all amounts payable under this agreement and for parking and traffic infringements may be billed to that account and my signature above will be considered to have been made on the charge/credit card voucher. All information I have given GOOD WAY CAR RENTAL in connection with this agreement is true.

*IMPORTANT

- ONLY PERSON ABOVE 23 YEARS OF AGE WITH MORE THAN 2 YEARS DRIVING EXPERIENCE, AUTHORIZED, LICENSED AND SIGNING THIS AGREEMENT MAY DRIVE THE VEHICLE.
- ALL PARKING AND TRAFFIC VIOLATIONS ARE THE RESPONSIBILITY OF THE HIRER. AN ADMINISTRATIVE CHARGE WILL BE LEVIED ON ANY TRAFFIC VIOLATIONS REDIRECTED.
- THE HIRER SHALL BE LIABLE FOR EXCESS CHARGES FOR ANY LATE RETURN AT THE RATE SHOWN PER HOUR OR PER DAY, INCLUSIVE OF CDW AND/OR PAI WHERE APPLICABLE.
- IN CASE OF ACCIDENT, THE HIRER SHALL REPORT TO RENTAL OFFICE IMMEDIATELY. IF THERE IS BODILY INJURIES, A POLICE REPORT MUST BE MADE WITHIN 24 HOURS.
- VEHICLE IS STRICTLY FOR SINGAPORE USE ONLY. AND MAY NOT BE DRIVEN OUT OF SINGAPORE WITHOUT PRIOR CONSENT OF THE COMPANY GOOD WAY CAR RENTAL.

RETURN OF VEHICLE, THE HIRER / DRIVER IS REQUIRED TO SIGN IN THE COLUMN " SINGAPORE OF HIRER / DRIVER " FAILING WHICH THE DAY AND TIME INSERTED BELOW SHALL BE DEEMED TO BE THE DAY AND TIME THE VEHICLE IS RETURNED TO GOOD WAY CAR RENTAL AND THE SAME SHALL BE ACCEPTED AS CONCLUSIVE EVIDENCE OF THE SAME AND SHALL NOT BE CHALLENGED OR QUESTIONED ON ANY ACCOUNT WHATSOEVER.

DATE IN	TIME IN	MILEAGE	CHECKED BY	REMARKS	
					 SIGNATURE OF HIRER/DRIVER

TERMS AND CONDITIONS FOR CAR RENTAL

Good Way Car Rental (hereinafter called the "owner" which expression shall where the context so admits include the owner's (successors-in-title) hereby agrees to let and the hirer named herein (hereinafter called "the Hirer") agrees to take on hire the motor vehicle described herein (hereinafter called "the said vehicle") subject to the following terms and conditions:-

1. The said vehicle (and all tools and accessories therein) is the property of the Owner and the Hirer shall be a mere bailee thereof and no interest in it shall pass on to the Hirer.
2. The hiring shall commence on the date and at the time specified and shall continue for the period and end on the date and at the time stated unless extended or as expressly requested by the Hirer.
3. The Hirer shall pay in full the hire charge specified herein before the commencement of hiring. No part of such hire charge shall in any circumstances be refunded except at the discretion of the Owner. All credit return is subject to the approval of General Manager.
4. If the Hirer shall fail to return the said vehicle at the expiration of the period of hire, then without prejudice to the other rights of the Owner, the Hirer shall pay to the Owner for every hour elapsing between the time of such expiration and the time the said vehicle is returned to the Owner, such further other charge in accordance with the Owner's current rate of hire charges or at such other rates as the Owner may in its absolute discretion thinks fit. All charges and amounts due which are not paid when due shall bear an interest of 1.5% per month until they are paid.
5. The said vehicle may only be driven by the Hirer or persons who have expressly designated and authorized therein (hereinafter called the authorized driver"). The Hirer and the authorized driver must be in possession of a valid driving licence and shall at all times drive the said vehicle in a careful and skilful manner, observing the traffic regulations and laws and in the event of any breach thereof, the Hirer shall pay all fines, cost of repairs and penalties which may be incurred and shall also answer all Police and Traffic Court Summonses, Notices and Inquiries in connection therewith. Particular attention is to be accorded to the following:-
 - (i) The Hirer shall not carry load or passengers in excess of the Motor Vehicle's Licensed carrying capacity (i.e. one driver and four passengers);
 - (ii) The Hirer shall not drive the said vehicle whilst under the influence of intoxicating liquor or drugs;
 - (iii) It is expressly forbidden to hire the said vehicle out to third persons or to let unauthorized persons or learners to use the said vehicle or to permit the said vehicle to be used for illegal purposes (for instance, in connection with theft, drug peddling or trafficking, smuggling or any other criminal activity) or the purposes of test or racing. Failure to comply may entail serious consequences as the Hirer assumes full responsibility and in the event of the said vehicle being seized, confiscated or forfeited as a result thereof, the Hirer shall indemnify the Owner for all losses incurred including the value of the said vehicle;
 - (iv) The Hirer and the authorized driver must be over 23 years of age and under 60 years and be holding valid driving licenses and have a minimum of 2 years regular and qualified driving experience. Failure to observe stipulation may return all damages costs to be Borne by the Hirer.
6. The Hirer agrees that a punctured tyre, empty petrol tank, loss of vehicle's key or locked keys inside of vehicle, by itself, does not constitute a breakdown and that in the event the owner's 24-Hours Emergency Service is called upon to respond to such occurrence, the Hirer shall bear the cost of such response at \$30.00 per trip.
7. The Hirer or authorized driver shall report all accidents involving the said vehicle to the Owner immediately and should there be bodily injuries also to the police not later than 24 hours after the accident. The Hirer or authorized driver shall not admit or compound any claim either partially or in full. Hirer is to secure the names and addresses of all witnesses as well as the registration number of all vehicles involved in the accident. All communications or letters received from the police or third parties are to be referred to the owner immediately. The Hirer shall not abandon the said vehicle without adequate provisions for safeguarding and security the same. Failure to comply with rule 5 and 7 will render Hirer liable for all cost and third party claims irrespective of CDW fee being paid.
8. The Owner shall not under any circumstances be liable to make any payment to the Hirer in respect of or to indemnify the Hirer against any loss, injury or damage sustained by the Hirer or by any third party as result of the use of the said vehicle or as result of any defect therein and in taking delivery of the said vehicle the hirer shall be deemed to have satisfied himself that it is in all respects roadworthy and in a proper and safe condition.
9. If for any reason the vehicle described in the schedule of any other vehicle ordered by the Hirer prior to the commencement of the period of hire is not available at the time of such commencement, the Owner shall have the right to replace the said vehicle with an alternative vehicle of similar seating capacity and performance and if no such alternative vehicle is available or if the Owner shall decline to provide an alternative vehicle then the Hirer shall be repaid any hire charge and deposit (if any) paid by him after offsetting the rental charge and costs incurred but shall have no other claim of any kind whatsoever against the Owner. However if no deposit is paid, Hirer must pay for rental charges incurred on demand.
10. The Hirer shall pay for the cost of petrol during the period of hiring PROVIDED ALWAYS that the Hirer having taken delivery of the said vehicle with a full tank of petrol shall return it likewise filling which the Owner shall be entitled to refill the tank and the refilling cost including a S\$5 service charge thereof shall be recoverable from the Hirer.
11. The vehicle is NOT covered by a motor insurance policy covering personal accident insurance for the Hirer, his passenger or authorized driver and the Owner shall not be responsible for any liability claims, injuries or otherwise in connection with any accident death or the losses arising from the use of the vehicle. The Owner may at the request of the Hirer and upon payment of the requisite charges arrange for separate personal accident coverage for bodily injury or death.
12. The said vehicle shall be covered under a Vehicle Insurance policy, which contains an excess Clause as Stipulated/Stated in the current Owner's Car rental Standard Brochure Tariff. Paying the current premium rate per day for Collision Damage Waiver may reduce the excess Clause. For the category of vehicle hired Collision Damage Waiver does not cover Missing/Stolen vehicles' item.
13. On or prior to the expiration of the period of hire, the Hirer shall return the said vehicle together with all tyres, tools, accessories and equipment to the Owner at any of the Owner's designated stations in as good order and condition as the said vehicle was when collected by the Hirer from the Owner.
14. No relaxation forbearance or indulgence by the Owner in enforcing any of the terms and conditions of this Agreement shall prejudice or affect the rights and powers of the Owner hereunder nor shall any waiver any breach operate as a waiver of any subsequent or continuing breach.
15. The Hirer is responsible for obtaining the required cash card with sufficient balance prior entry into any roads within the ERP system.
16. In the breach of the terms and conditions of the agreement the Owner reserves the right to resume possession of the hired vehicle at anytime from the Hirer in the Owners' interest without prejudice.
17. The Owner shall not be liable to the Hirer or any person for any loss or damage whatsoever and howsoever caused or occasioned by reason of the Owner resuming possession of the vehicle nor shall the Owner be liable to any person for monies, goods, articles or things not belonging to the Owner which are in or alleged to be in the vehicle at the time the Owner resumes possession of the vehicle.
18. The Hirer shall not take the said vehicle outside mainland Singapore, Malaysia or any other territory outside Singapore without the written consent of the Owner. Failure to comply with this term may entail serious consequences and the Hirer shall assume personal and full responsibility and in the event of the said vehicle being damaged, seized, confiscated or forfeited as a result thereof, the Hirer shall indemnify the Owner for all losses incurred including the value of the said vehicle.
19. That in addition, the Hirer shall be deemed to have extended the period of hire by reason of the Hirer's failure to return the said vehicle or continued possession and/or continued use of the said vehicle upon the same terms and contained herein. The Hirer shall also be bound by these terms and conditions in respect of any "replacement vehicle hired in lieu of the said vehicle by means of new Rental Agreement or Replacement Voucher".

NEXWAVE AUTO

160 SINMING DRIVE
SINMING AUTOCITY SPORE:575722
MOBILE :81881184 , 91384382
FAX:69090049
CO .REG.NO .53099059L

CHAN INNOVATIONS SERVICES

FINAL REPAIR BILL FOR - GX 2086E NISSAN URVAN

Lump sum total repairs

\$ 13,750.00



NEXWAVE AUTO

160 SINMING DRIVE
SINMING AUTOCITY SPORE:575722
MOBILE :81881184 , 91384382
FAX:69090049
CO .REG.NO :53099059L

[illegible]

NEXWAVE AUTO



AXA Insurance Singapore Pte Ltd
8 Shenton Way
#24-01
AXA Tower
Singapore 068811
(Attn: Motor Claims Dept)



WINCHESTER LAW LLC
ADVOCATES & SOLICITORS

NOTARY PUBLIC

COMMISSIONER FOR OATHS

171 Tras Street #03-171 Union Building
Singapore 079025

Tel: 6227 6353 Fax: 6227 5179

E-mail: legal@lawssp.com



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Invoice

Customer: Chan Innovations Services

Date: 15.12.2018

C/o: 160 Sin Ming Drive #05-15
Sin Ming AutoCity (S) 575722

Invoice No: NS-1711-459

Description		Amount
Vehicle No:	GX2086E	
Make & Model:	Nissan Urvan (Van)	
Our reference:	AAS/2017/459	
Services rendered for appraiser / inspection report		
Survey Fee		
Photographs		
Transport Fees		
Re-inspection Fees		
SGD Dollar : Nine hundred eighty four dollar only	Total:	SGD \$ 984.00

EN:

All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd"

Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.



Absolute Appraisal Services Pte Ltd



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: Chan Innovations Services
C/o: 160 Sin Ming Drive #05-15
Sin Ming AutoCity (S) 575722

Date of report: 15.12.2018
Date of request: 27.11.2017
Date of inspection: 27.11.2017
Date of accident: 25.11.2017
Claim type: Third Party Claim

Report No: AAS/2017/459

Particulars of affected vehicle:

Registration no: GX2086E
Make/Model: Nissan Urvan (Van)
Year of registration: 2004
Colour: Metallic Blue

Odometer: 248457 km
Engine Capacity: 2953 cc
Engine no: ZD30031112
Chassis no: JN1MG4E25Z0710320

Condition of tires:

Front Left: 6mm
Make: Yokohama
Rear Left: 6mm
Make: Linam

Front Right: 6mm
Make: Yokohama
Rear Right: 6mm
Make: Linam

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

The Assignment

The inspection was conducted at M/s. Nexwave Auto
160 Sin Ming Drive #05-15
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

Assessment

Repairer's estimate: \$ 23,733.38

Revised estimate: \$ 17,186.93

Recommended reserve: \$ 13,750.00 (Lump sum)

Estimated normal duration of repairs : 18 Working days



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
Mobile: 9688-0413 Fax: 6266-7396
Email: absolute.app.svcs@gmail.com

Vehicle No: GX2086E

Report No: AAS/2017/459

W/O PREJUDICE

Point of impact

At the front & rear portion.

General description of damages

The front panel, front grille, headlamps, RHF signal lamp, front bumper, tailgate, rear bumper, rear end outer panel, rear end inner panel, exhaust pipe, LH quarter panel, RH quarter panel, floor panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Nexwave Auto as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$17,186.93

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$13,750.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 18 working days.

have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 114 photographs.

Your Faithfully
Absolute Appraisal Services Pte Ltd



Nicky Seah
Automobile Appraiser
MSAAA / MSMCTA



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: GX2086E

Report No: AAS/2017/459

Appraisal Schedule

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Front panel	1	Dented		\$ 1,194.30	\$ 1,194.30
2	Front bumper <i>654.00</i>	1	Dented		\$ 891.60	\$ 891.60
3	Front bumper fog lamp LH/RH	2	Serviceable	\$ 131.20	\$ 262.40	-
4	Front bumper stay LH/RH	2	Dented	\$ 90.30	\$ 180.60 <i>not</i>	\$ 180.60 X
5	Front bumper crossmember	1	Dented		\$ 582.30	\$ 582.30
6	Tailgate <i>2101-10</i>	1	Dented		\$ 2,597.20	\$ 2,597.20
7	Tailgate outer moulding	1	Cracked		\$ 362.00 <i>not</i>	\$ 362.00 X
8	Tailgate stay LH/RH	2	Serviceable	\$ 195.10	\$ 390.20	-
	Tail lamp panel LH/RH	2	Dented	\$ 290.40	\$ 580.80	\$ 580.80 X
10	Rear bumper <i>652.50</i>	1	Dented		\$ 684.60	\$ 684.60
11	Rear bumper centre bracket	1	Dented		\$ 310.80	\$ 310.80
12	Rear end outer panel <i>347.60</i>	1	Dented		\$ 709.20	\$ 709.20
13	Rear end inner panel <i>437.60</i>	1	Dented		\$ 662.50 <i>not</i>	\$ 662.50 <i>150.00</i>
14	RH quarter panel	1	Distorted/Repair		\$ 2,210.30	-
15	LH quarter panel	1	Distorted/Repair		\$ 2,211.60	-
16	Exhaust pipe	1	Dented	<i>not</i>	\$ 1,652.00	\$ 1,652.00 <i>200.00</i>
Total:					\$ 15,482.40	\$ 10,407.90
-30%					\$ 4,644.72	\$ 3,122.37
List total:					\$ 10,837.68	\$ 7,285.53
1	Front glass moulding	1	Necessary		\$ 77.30	\$ 77.30
2	Front grille	1	Cracked		\$ 290.00	\$ 290.00
3	Front grille emblem	1	Necessary		\$ 52.60	\$ 52.60
	headlamp LH/RH	2	Broken/Cracked	\$ 556.80	\$ 1,113.60	\$ 1,113.60
5	Front signal lamp LH/RH	2	RH Cracked	\$ 187.50	\$ 375.00	\$ 187.50
6	Front bumper fog lamp grille	2	Grazed	\$ 67.60	\$ 135.20 <i>not</i>	\$ 135.20 X
7	LH/RH					
8	Front bumper retainer LH/RH	2	Necessary	\$ 16.40	\$ 32.80	\$ 32.80
9	Tailgate sticker 'Urvan'	1	Necessary		\$ 21.30	\$ 21.30
10	Tailgate sticker '3.0 DI'	1	Necessary		\$ 32.60	\$ 32.60
11	Tailgate wiper motor	1	Malfunctioned		\$ 496.30	\$ 496.30 ?
12	Tailgate lock	1	Distorted/Jammed		\$ 281.60	\$ 281.60
13	Tailgate lock cover	1	Cracked		\$ 15.20	\$ 15.20
14	Tailgate striker	1	Distorted		\$ 36.20	\$ 36.20
15	Tailgate weather-strip	1	Necessary		\$ 152.60	\$ 152.60 <i>50.00</i>
16	Tail lamp LH/RH	2	Loop Broken	\$ 310.60	\$ 621.20	\$ 621.20
17	Spare tyre hanger	1	Serviceable		\$ 239.50	-
Total:					\$ 3,973.00	\$ 3,546.00
-10%					\$ 397.30	\$ 354.60
Nett total:					\$ 3,575.70	\$ 3,191.40



ABSOLUTE APPRAISAL SERVICES PTE LTD
LOSS ADJUSTERS & MOTOR APPRAISERS
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722
 Mobile: 9688-0413 Fax: 6266-7396
 Email: absolute.app.svcs@gmail.com

Vehicle No: GX2086E

Report No: AAS/2017/459

1	Front glass sealant	1	Necessary	\$ 60.00	\$ 40.00
2	ERP bracket	1	Necessary	\$ 30.00	\$ 30.00 <i>265n</i>
3	Front number plate	1	Dented	\$ 50.00	\$ 25.00
4	Front bumper clips	1set	Necessary	\$ 50.00	\$ 20.00
5	Tailgate glass inner seal	1	Necessary	\$ 20.00	\$ 20.00
6	Tailgate glass sealant	1	Necessary	\$ 60.00	\$ 40.00
7	Tailgate sticker '70km/h'	1	Necessary	\$ 20.00	\$ 20.00
8	Rear number plate	1	Dented	\$ 50.00	\$ 25.00
9	Reverse sensor	1set	Cracked	\$ 300.00	\$ 250.00 <i>2001n</i>
10	Rear bumper clips	1set	Necessary	\$ 50.00	\$ 20.00
11	Rear floor wooden plank	1	Dented/Cracked	<i>NIJ</i> \$ 350.00	\$ 350.00 <i>X</i>

Special nett total: \$ 1,040.00 \$ 840.00

Parts Total: \$ 15,453.38 \$ 11,316.93

S/N	Labour Description	Repairer's Est	Revised Est
1	Check front lightings & wirings.	\$ 50.00	\$ 30.00
2	Remove & refit front glass.	\$ 200.00	\$ 150.00 <i>120l</i>
3	Rust proofing on front affected panels.	\$ 100.00	\$ 60.00
4	Remove & refit dashboard.	\$ 500.00	\$ 400.00 <i>250l</i>
5	Labour to replace front damaged parts. Align all front affected areas.	\$ 1,500.00	\$ 1,000.00 <i>700l</i>
6	Spray paint on front affected portions.	\$ 1,000.00	\$ 600.00 <i>500l</i>
7	Check rear lightings & wirings.	\$ 50.00	\$ 30.00
8	Remove & transfer tailgate glass.	\$ 200.00	\$ 150.00 <i>120l</i>
9	Remove & transfer tailgate component.	\$ 100.00	\$ 80.00
10	Drill hole & renew reverse sensor.	\$ 100.00	\$ 60.00
11	Rust proofing on rear affected panels.	\$ 150.00	\$ 90.00 <i>60l</i>
12	Remove & renew exhaust pipe.	\$ 150.00	\$ 120.00 <i>80l</i>
13	Remove/refit/renew rear trim boards, carpet, floor plank, etc.	\$ 180.00	\$ 150.00 <i>80l</i>
14	Labour to replace rear damaged parts. Align all rear affected areas.	\$ 2,500.00	\$ 1,750.00 <i>1000l</i>
15	Spray paint on rear affected portions.	\$ 1,500.00	\$ 1,200.00 <i>1000l</i>
Labour Total:		\$ 8,280.00	\$ 5,870.00

Grand Total: \$ 23,733.38 \$ 17,186.93

The final adjusted lump sum amount is \$13,750.00

Under normal circumstances, the repair should be completed within a reasonable period of 18 working days.

14 days

114 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AXA INSURANCE PTE LTD		Ref : CS3/AXA17022725/Kqbs2-1	
8 SHENTON WAY #24-01 AXA TOWERS SINGAPORE 068811 ATTN: XINYOU		Date : 23-10-2018 Code : AXA2	
1. Policy Particulars :- THIRD PARTY CLAIM (RESURVEY INSPECTION)			
Insured Veh.	SHC 5481B	Veh. Inspected	GX 2086E
Policy No.	P1680520	Coverage (\$)	0.00
Claim No.	C0466935	Excess (\$)	0.00
Assign From	CHEN XINYOU	Assign Date	24/08/2018
2. Vehicle Particulars & Condition			
Make & Model	NISSAN URVAN	c.c	2953
Engine No.	HIDDEN	Year of Reg.	2004
Chassis No.	JN1MG4E25Z0710320	Colour	DARK BLUE
Odometer	257888	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195 R15X8	BRIDGESTONE	5 mm
L/H Front Tyre	195 R15X8	BRIDGESTONE	5 mm
R/H Rear Tyre	195 R15X8	BRIDGESTONE	4 mm
L/H Rear Tyre	195 R15X8	BRIDGESTONE	4 mm
4. Description of Damages			
THE VEHICLE HAD COMMENCED ITS REPAIR AT THE TIME OF INSPECTION. REPAIR CONDITION SEE DETAILS.			
5. General Information			
Accident Date	25/11/2017	Inspection Date	28/08/2018
Survey held at	NEXWAVE AUTO 160 SIN MING DRIVE #05-15 SIN MING AUTOCITY SINGAPORE 575722		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GX 2086E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT PANEL	REPLACED	1,194.30	1,194.30
1	FRONT BUMPER	REPLACED	891.60	654.00
2	FRONT BUMPER FOG LAMP LH/RH @ \$131.20	SERVICEABLE	262.40	-
2	FRONT BUMPER STAY LH/RH @ \$90.30	NOT CHANGED	180.60	-
1	FRONT BUMPER CROSSMEMBER	REPLACED	582.30	582.30
1	TAILGATE	REPLACED	2,597.20	2,101.10
1	TAILGATE OUTER MOULDING	NOT CHANGED	362.00	-
2	TAILGATE STAY LH/RH @ \$195.10	SERVICEABLE	390.20	-
2	TAIL LAMP PANEL LH/RH @ \$290.40	REPAIRED SEE LABOUR	580.80	-
1	REAR BUMPER	REPLACED	684.60	652.50
1	REAR BUMPER CENTRE BRACKET	REPLACED	310.80	310.80
1	REAR END OUTER PANEL	REPLACED	709.20	347.60
1	RH QUARTER PANEL	REPAIRED SEE LABOUR	2,210.30	-
1	LH QUARTER PANEL	REPAIRED SEE LABOUR	2,211.60	-
	LESS 30% DISCOUNT		-3,950.37	-1,752.78
			9,217.53	4,089.82
1	REAR END INNER PANEL (LOCAL REPAIR) (SN)	REPLACED	662.50	150.00
1	EXHAUST PIPE (LOCAL REPAIR) (SN)	REPLACED	1,652.00	200.00
	LESS 30% DISCOUNT		-694.35	-
			1,620.15	350.00
<u>NETT ITEMS</u>				
1	FRONT GLASS MOULDING (N)	REPLACED	77.30	77.30
1	FRONT GRILLE (N)	REPLACED	290.00	290.00
1	FRONT GRILLE EMBLEM (N)	REPLACED	52.60	52.60
2	HEADLAMP LH/RH @ \$556.80 (N)	REPLACED	1,113.60	1,113.60
2	FRONT SIGNAL LAMP LH/RH @ \$187.50 (N)	O/S REPLACED	375.00	187.50
2	FRONT BUMPER FOG LAMP GRILLE LH/RH @ \$67.60 (N)	NOT CHANGED	135.20	-

Report Ref No. CS3/AXA17022725/Kqbs2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT BUMPER RETAINER LH/RH @ \$16.40 (N)	REPLACED	32.80	32.80
1	TAILGATE STICKER 'URVAN' (N)	REPLACED	21.30	21.30
1	TAILGATE STICKER '3.0 DI' (N)	REPLACED	32.60	32.60
1	TAILGATE WIPER MOTOR (N)	* CHECK, VERIFY FURTHER	496.30	-
1	TAILGATE LOCK (N)	REPLACED	281.60	281.60
1	TAILGATE LOCK COVER (N)	REPLACED	15.20	15.20
1	TAILGATE STRIKER (N)	REPLACED	36.20	36.20
2	TAIL LAMP LH/RH @ \$310.60 (N)	LOOP REPLACED	621.20	621.20
1	SPARE TYRE HANGER (N)	SERVICEABLE	239.50	-
	LESS 10% DISCOUNT		-382.04	-276.19
			3,438.36	2,485.71
1	TAILGATE WEATHER-STRIP (50%) (SN)	REPLACED	152.60	76.30
	LESS 10% DISCOUNT		-15.26	-
			137.34	76.30
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT GLASS SEALANT (SN)	REPLACED	60.00	40.00
1	ERP BRACKET (SN)	REPLACED	30.00	26.00
1	FRONT NUMBER PLATE (SN)	REPLACED	50.00	25.00
1	SET FRONT BUMPER CLIPS (SN)	REPLACED	50.00	20.00
1	TAILGATE GLASS INNER SEAL (SN)	REPLACED	20.00	20.00
1	TAILGATE GLASS SEALANT (SN)	REPLACED	60.00	40.00
1	TAILGATE STICKER '70KM/H' (SN)	REPLACED	20.00	20.00
1	REAR NUMBER PLATE (SN)	REPLACED	50.00	25.00
1	SET REVERSE SENSOR (SN)	REPLACED	300.00	200.00
1	SET REAR BUMPER CLIPS (SN)	REPLACED	50.00	20.00
1	REAR FLOOR WOODEN PLANK (SN)	NOT CHANGED	350.00	-
			1,040.00	436.00
	<u>LABOUR</u>			
	CHECK FRONT LIGHTINGS & WIRINGS.		100.00	60.00
	REMOVE & REFIT FRONT GLASS.		200.00	120.00

Report Ref No. CS3/AXA17022725/Kqbs2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	RUST PROOFING ON FRONT AFFECTED PANELS.		100.00	60.00
	REMOVE & REFIT DASHBOARD.		500.00	250.00
	LABOUR TO REPLACE FRONT DAMAGED PARTS. ALIGN ALL FRONT AFFECTED AREAS.		1,500.00	700.00
	SPRAY PAINT ON FRONT AFFECTED PORTIONS.		1,000.00	500.00
	REMOVE & TRANSFER TAILGATE GLASS.		200.00	120.00
	REMOVE & TRANSFER TAILGATE COMPONENT.		100.00	80.00
	DRILL HOLE & RENEW REVERSE SENSOR.		100.00	60.00
	RUST PROOFING ON REAR AFFECTED PANELS.		150.00	60.00
	REMOVE & RENEW EXHAUST PIPE.		150.00	80.00
	REMOVE / REFIT / RENEW REAR TRIM BOARDS, CARPET, FLOOR PLANK, ETC.		180.00	80.00
	LABOUR TO REPLACE REAR DAMAGED PARTS. ALIGN ALL FRONT AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF TAIL LAMP PANEL LH/RH, RH QUARTER PANEL AND LH QUARTER PANEL.		2,500.00	1,000.00
	SPRAY PAINT ON REAR AFFECTED PORTIONS.		1,500.00	1,000.00
			8,280.00	4,170.00
GRAND TOTAL			23,733.38	11,607.83
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,250.00

Report Ref No. CS3/AXA17022725/Kqbs2-1

THE REPAIRER IS INFORMED ON THE REVISED AMOUNT NOT AGREED WITH OUR OFFER

NOTE: TO VERIFY FURTHER DUE TO LACK OF SUPPORTING DOCUMENTS.NO PHOTO TO SUBSTANTIATE THE DAMAGES.

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.