

ASS. REC. BY:

REF:

CS/FCU9000019/Kthn2

Special Instruction:

Surveyor:

KamAh

ASSIGNMENT (Office)

From (Person):

CWS Sathora

of

FCL

Date/Time:

02012019 1103am

Estimated Cost:

Bill to:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SJR 1J

Insured:

SHD 8833U

at Workshop m/s

Optima Werkz

Tel:

6481 1522

of

9A Serungoon North Ave 5

Policy No:

Claim No:

D19000 073M FSH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

26/22018

(Client's Record)

CA / REV / REP. / REV 24 HRS 'wp'

H.O.D. Endorsement:

Date/Time:

02012019 1103am

Person Contacted:

Sharon

Vehicle:

OUT

Date/Time	Action/Instruction (✓) Estimate
	SJR 1J - NBA/DAL18023161/Y
	SHD 8833U - X
3/1	Sent email pending part prices.
	lump sum \$11800 - (Red: 18514.86 : 53%)

ASS. REC. BY:

REF: P021

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 137k

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Date / Time

Action / Instruction

3/1

File pass to Customer

RECEIVED 08 MAR 2019

Veh No: STR 15Yr Regn: 07, 12Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Porsche Cayenne2995Colour: M. Grey

A/C: Insured / Std / NI / NA

Sp. Reading: 93862

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WPI 888 928 CLA 90707Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rim / STD / R/Rim orTyre Size: F: 285/35ZR22

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal. 8 mm

Rear

R/Bal. 8 mmL/Bal. 8 mmL/Bal. 8 mmD.O.A. 26/12/18D.O.I. 2/1/19

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

013 Typist

Date/Time, File Return to?



Prell. Report



Final Report

Days Of Repair: 8Resurvey No. of Trip: 1Add Fee: ☐

Site Insp (\$



Interview (\$



Tech Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S - RS - SI

F - RS - SI

Others

TOTAL

24x15 = 360

170 + 360

50

50

28

658

Report Format: TPLump Sum / I.B.I: (\$ 15800)



Auto
Consultants
Pte Ltd

S1 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19000073MFSH

Date: 8/3/2019

Our Ref: CS/FCI19000019/Ktb

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,


INITIAL INSPECTION REPORT OF VEHICLE NO. SJR 1J

Please be informed that we had conducted the inspection of the abovementioned vehicle
2/1/2019 at the premises of M/s Optima Werkz have the following to report: -

Workshop Estimate Amount	: S\$ 34,314.86
Revised Estimate Amount	: S\$ 19,793.10
"Check" Items Amount	: S\$ 0.00
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the n/s body portion

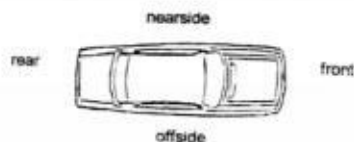

Comments/ Present Status:

Damages Consistent.

Yours faithfully

Kenneth

Automotive Assessor

MOTOR SURVEY ASSIGNMENT

Date	28-12-2018	Our Ref No. D19000073MFSH
Accident Date	26-12-2018	Claim Type. Third Party
Insured Vehicle	SHD8833U	Third Party Vehicle. SJR1J
Survey Location	6 KUNG CHONG ROAD	
Contact Person.	SHARON TEN	
Contact No.	64811522/ 0	Fax No. 64811011
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	OPTIMA WERKZ PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	SITHARA	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Thursday, 3 January 2019 5:02 PM
To: Admin-D (LKKAUTO); 'CWS Motor Claims'; assignments
Cc: 'Sithara'; SUR
Subject: RE: SURVEY ASSESSMENT - D19000073MFSH/1

Dear Sir/Madam,

Please be informed that we have inspected the vehicle SJR 1J on 2/1/2018
We are pending part prices.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Wednesday, 2 January 2019 11:04 AM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Sithara' <Sithara@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19000073MFSH/1

Dear Sir / Madam,

Thank you for the assignment.

Best Regards,

Catherine Chong | Admin

LKK Auto Consultants Pte Ltd

Phone: 6741-8434 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Wednesday, 2 January, 2019 10:02 AM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Sithara <Sithara@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D19000073MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Note: All the accident reports are uploaded into CWS for your perusal.

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Friday, 8 March 2019 11:53 AM
To: Admin-D (LKKAUTO); 'CWS Motor Claims'; assignments
Cc: 'Sithara'; SUR
Subject: RE: SURVEY ASSESSMENT - D19000073MFSH/1
Attachments: PRELI ADVISED SJR 1J.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SJR 1J**

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Denise Tay (LKKAUTO)
Sent: Thursday, 3 January 2019 5:02 PM
To: Admin-D (LKKAUTO) <admin-d@lkkauto.com>; 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Sithara' <Sithara@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19000073MFSH/1

Dear Sir/Madam,

Please be informed that we have inspected the vehicle SJR 1J on 2/1/2018
We are pending part prices.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Wednesday, 2 January 2019 11:04 AM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Sithara' <Sithara@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19000073MFSH/1

Dear Sir / Madam,

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

0439B

Vehicle Details

Vehicle No.:

SJR1J

Vehicle to be Exported:

No

Intended Deregistration Date:

31 Dec 2019

Vehicle Make:

PORSCHE

Vehicle Model:

CAYENNE S HYBRID 3.0 A

Primary Colour:

Brown

Manufacturing Year:

2011

Engine No.:

CGE101353

Chassis No.:

WP1ZZZ92ZCLA90707

Maximum Power Output:

245.0 kW (328 bhp)

Open Market Value:

\$96,277.00

Original Registration Date:

07 Jul 2012

First Registration Date:

07 Jul 2012

Transfer Count:

0

Actual ARF Paid:

\$57,767.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

06 Jul 2022

PARF Rebate Amount:

\$34,660.00

Intended COE Rebate Details

COE Expiry Date:

06 Jul 2022

COE Category:

E - Open Category

COE Period(Years):

10

QP Paid:

\$86,999.00

COE Rebate Amount:

\$20,704.00

Total Rebate Amount:

\$55,364.00

The information contained herein is correct as at 27 Dec 2018

OK

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 28 DECEMBER 2018

Third Party Insurer: MS FIRST CAPITAL

Vehicle No: SJR1J

Third Party Veh No: SHD8833U

Model: PORSCHE CAYENNE-3.0 S HYBRID (A)

Date of Accident: 26 DECEMBER 2018

Chassis: WP1ZZZ927CLA90707 - 2012

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	FRONT HEADLAMP ASSY LH	1		CM \$1,850.00
2	FRONT BUMPER	1		Ar \$1,940.00
3	FRONT BUMPER SIGNAL LAMP LH	1		Ar \$140.00
4	FRONT BUMPER SIDE BRACKET LH (RETAINER)	1		CM \$125.00
5	FRONT BUMPER LOWER SIDE GUARD COVER LH (DIFFUSER)	1		Ar \$1,176.00
6	FRONT BUMPER CLIPS	10	\$12.50	Ar \$125.00
7	FRONT FENDER LH 1750	1		Ar \$2,445.00
8	FRONT FENDER EXTENTION COVER LH (ARCH GARNISH)	1		Ar \$675.00
9	FRONT FENDER EXTENTION COVER CLIPS	8	\$10.50	Ar \$84.00
10	FRONT FENDER INNER LINER LH (INNER SHIELD)	1		Ar \$720.00
11	FRONT FENDER INNER LINER CLIPS	12	\$12.20	Ar \$146.40
12	FRONT ALLOY RIM LH 22" 2300	1		Ar \$3,800.00
13	FRONT DOOR SIDE MIRROR LH	1		Ar \$1,460.00
14	FRONT DOOR LH 2950	1		Ar \$4,975.00
15	FRONT DOOR OUTER HANDLE LH	1		Ar \$458.00
16	FRONT DOOR WEATHER STRIP LH	1		Ar \$675.00
17	REAR DOOR LH 2910	1		Ar \$4,970.00
18	REAR DOOR OUTER HANDLE LH	1		Ar \$458.00
19	REAR TAILLAMP LH 1300	1		Ar \$1,683.00
20	REAR ALLOY RIM LH 22"	1		Ar \$3,800.00
21	REAR FENDER LH	1		REPAIR
22	REAR BUMPER	1		REPAIR
SUB TOTAL				\$31,705.40
LESS 10%				-\$3,170.54
PARTS TOTAL				\$28,534.86

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	FRONT TYRE LH 285/35ZR22 106W	1		Ar \$350.00
2	REAR TYRE LH 285/35ZR22 106W	1		Ar \$350.00
3	REAR TYRE TUBE VALVE LH	2	\$5.00	Ar \$10.00
S/N TOTAL				\$710.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 28 DECEMBER 2018

Third Party Insurer: MS FIRST CAPITAL

Vehicle No: SJR1J

Third Party Veh No: SHD8833U

Model: PORSCHE CAYENNE-3.0 S HYBRID (A)

Date of Accident: 26 DECEMBER 2018

Chassis: WP1ZZZ927CLA90707 - 2012

ESTIMATE

LABOUR CHARGES:

LABOUR CHARGE FOR KNOCKING & PARTS REPLACEMENT

\$2,100.00

1400

LABOUR CHARGE FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS

\$2,300.00

1750

TO TUFF KOTE / ANTI-RUST

\$100.00

90

TO REMOVE & REFIT FRONT DOOR LH INTERIOR TRIM, POWER WINDOW GLASS,
FRONT DOOR GLASS, DOOR CENTRAL LOCKING SYSTEM & ETC. TO EFFECT REPLACE
ON FRONT DOOR LH

\$180.00

✓

TO CHECK WIRING, REPLACED WITH FOCUS HEADLAMP

\$60.00

30

TO SEND VEHICLE FOR 3D COMPUTERISED CHECK & ADJUSTED ALL WHEEL ALIGNMENT

\$80.00

✓

TO DIAGNOSTIC CHECK & RESET MEMORY TO IDENTIFICATION STANDARD

\$250.00

200

LABOUR TOTAL \$5,070.00

ONG

TOTAL \$34,314.86



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD

Ref : CS/FCI19000019/Ktbn2

36 ROBINSON ROAD

Date: 11.03.2000



PORSCHE CAYENNES
RJR1J

Labour charges

- ① To remove & Refit front door interior trim, Power Window gear, front Door Glass, Door Central Locking System & etc. to effect replace on front door LG. ✓
- ② To check wiring ✓ to Electrical Diagnosis ✓
- ③ To wheel alignment & balancing ✓
- ④ Labour charge for Knocking & Parts replacement. ✓
- ⑤ Labour charge for Painting & to supply paint & finishing materials ✓



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJR 1J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT HEADLAMP ASSY LH	CRACKED	1,850.00	1,850.00
1	FRONT BUMPER	BUCKLED	1,940.00	1,940.00
1	FRONT BUMPER SIGNAL LAMP LH	BROKEN	140.00	140.00
1	FRONT BUMPER SIDE BRACKET LH (RETAINER)	CRACKED	125.00	125.00
1	FRONT BUMPER LOWER SIDE GUARD COVER LH (DIFFUSER)	SERVICEABLE	1,176.00	-
10	FRONT BUMPER CLIPS @\$12.50	NECESSARY	125.00	125.00
1	FRONT FENDER LH	BENT	2,445.00	1,750.00
1	FRONT FENDER EXTENSION COVER LH (ARCH GARNISH)	DISTORTED	675.00	675.00
8	FRONT FENDER EXTENSION COVER CLIPS @\$10.50	NECESSARY	84.00	84.00
1	FRONT FENDER INNER LINER LH (INNER SHIELD)	SERVICEABLE	720.00	-
12	FRONT FENDER INNER LINER CLIPS @\$12.20	NOT NECESSARY	146.40	-
1	FRONT ALLOY RIM LH 22"	DENTED	3,800.00	2,300.00
1	FRONT DOOR SIDE MIRROR LH	DENTED / CUT	1,460.00	1,460.00
1	FRONT DOOR LH	BENT	4,975.00	2,950.00
1	FRONT DOOR OUTER HANDLE LH	TO REPAIR SEE LABOUR	458.00	-
1	FRONT DOOR WEATHER STRIP LH	SERVICEABLE	675.00	-
1	REAR DOOR LH	BENT	4,970.00	2,910.00
1	REAR DOOR OUTER HANDLE LH	TO REPAIR SEE LABOUR	458.00	-
1	REAR TAILLAMP LH	CUT	1,683.00	1,300.00
1	FRONT ALLOY RIM LH 22"	SERVICEABLE	3,800.00	-
1	REAR FENDER LH (NPA)	TO REPAIR SEE LABOUR	-	-
1	REAR BUMPER (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 10% DISCOUNT		-3,170.54	-1,760.90
			28,534.86	15,848.10
SPECIAL NETT ITEMS				
1	FRONT TYRE LH 285/35ZR22 106W (60%)(SN)	CUT	350.00	210.00

Report Ref No. CS/FCI19000019/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TYRE LH 285/35ZR22 106W (SN)	SERVICEABLE	350.00	-
2	REAR TYRE TUBE VALVE LH @\$5.00 (SN)	NECESSARY (1 PC ONLY)	10.00	5.00
			710.00	215.00
	LABOUR			
	LABOUR CHARGE FOR KNOCKING & PARTS REPLACEMENT.INCLUSIVE OF THE REPAIR OF FRONT DOOR OUTER HANDLE LH,REAR DOOR OUTER HANDLE LH,REAR FENDER LH AND REAR BUMPER.		2,100.00	1,400.00
	LABOUR CHARGE FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS.		2,300.00	1,750.00
	TO TUFF KOTE/ANTI-RUST.		100.00	90.00
	TO REMOVE & REFIT FRONT DOOR LH INTERIOR TRIM,POWER WINDOW GLASS,FRONT DOOR GLASS,DOOR CENTRAL LOCKING SYSTEM & ETC.TO EFFECT REPLACE ON FRONT DOOR LH.		180.00	180.00
	TO CHECK WIRING REPLACED WITH FOCUS HEADLAMP.		60.00	30.00
	TO SEND VEHICLE FOR 3D COMPUTERISED CHECK & ADJUSTED ALL WHEEL ALIGNMENT.		80.00	80.00
	TO DIAGNOSTIC CHECK & RESET MEMORY TO IDENTIFICATION STANDARD.		250.00	200.00
			5,070.00	3,730.00
	GRAND TOTAL		34,314.86	19,793.10
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			15,800.00

Report Ref No. CS/FC119000019/Ktbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 28 DECEMBER 2018

Third Party Insurer: MS FIRST CAPITAL

Vehicle No: SJR1J

Third Party Veh No: SHD8833U

Model: PORSCHE CAYENNE-3.0 S HYBRID (A)

Date of Accident: 26 DECEMBER 2018

Chassis: WP1ZZZ927CLA90707 - 2012

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	FRONT HEADLAMP ASSY LH	1		CM \$1,850.00
2	FRONT BUMPER	1		Br \$1,940.00
3	FRONT BUMPER SIGNAL LAMP LH	1		Br \$140.00
4	FRONT BUMPER SIDE BRACKET LH (RETAINER)	1		CM \$125.00
5	FRONT BUMPER LOWER SIDE GUARD COVER LH (DIFFUSER)	1		in \$1,176.00
6	FRONT BUMPER CLIPS	10	\$12.50	na \$125.00
7	FRONT FENDER LH	1		Ry \$2,445.00
8	FRONT FENDER EXTENTION COVER LH (ARCH GARNISH)	1		dis \$675.00
9	FRONT FENDER EXTENTION COVER CLIPS	8	\$10.50	na \$84.00
10	FRONT FENDER INNER LINER LH (INNER SHIELD)	1		\$720.00
11	FRONT FENDER INNER LINER CLIPS	12	\$12.20	\$146.40
12	FRONT ALLOY RIM LH 22"	1		Not \$3,800.00
13	FRONT DOOR SIDE MIRROR LH	1		Not/Br \$1,460.00
14	FRONT DOOR LH	1		Ry \$4,975.00
15	FRONT DOOR OUTER HANDLE LH	1		R \$458.00
16	FRONT DOOR WEATHER STRIP LH	1		\$675.00
17	REAR DOOR LH	1		Ry \$4,970.00
18	REAR DOOR OUTER HANDLE LH	1		R \$458.00
19	REAR TAILLAMP LH	1		Gr \$1,683.00
20	REAR ALLOY RIM LH 22"	1		\$3,800.00
21	REAR FENDER LH	1		REPAIR
22	REAR BUMPER	1		REPAIR
SUB TOTAL				\$31,705.40
LESS 10%				-\$3,170.54
PARTS TOTAL				\$28,534.86

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	FRONT TYRE LH 285/35ZR22 106W	1		Gr \$350.00
2	REAR TYRE LH 285/35ZR22 106W	1		in \$350.00
3	REAR TYRE TUBE VALVE LH	2	\$5.00	na \$10.00
S/N TOTAL				\$710.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

OPTIMA WERKZ PTE LTD

Head office : 6 Kung Chong Road Singapore 159143

Tel : +65 6472 1313 Fax : +65 6472 2112

Branch office : 9A Serangoon North Ave 5 Singapore 554500 Tel : +65 6484 9919 Fax : +65 6481 1011

Co. Reg. No. 201212455W

Date: 28 DECEMBER 2018

Vehicle No: SJR1J

Model: PORSCHE CAYENNE-3.0 S HYBRID (A)

Chassis: WP1ZZZ927CLA90707 - 2012

Third Party Insurer: MS FIRST CAPITAL

Third Party Veh No: SHD8833U

Date of Accident: 26 DECEMBER 2018

ESTIMATE

LABOUR CHARGES:

LABOUR CHARGE FOR KNOCKING & PARTS REPLACEMENT	\$2,100.00	1400/
LABOUR CHARGE FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS	\$2,300.00	1750/
TO TUFF KOTE / ANTI-RUST	\$100.00	90/
TO REMOVE & REFIT FRONT DOOR LH INTERIOR TRIM, POWER WINDOW GLASS, FRONT DOOR GLASS, DOOR CENTRAL LOCKING SYSTEM & ETC. TO EFFECT REPLACE ON FRONT DOOR LH	\$180.00	✓
TO CHECK WIRING, REPLACED WITH FOCUS HEADLAMP	\$60.00	30/
TO SEND VEHICLE FOR 3D COMPUTERISED CHECK & ADJUSTED ALL WHEEL ALIGNMENT	\$80.00	✓
TO DIAGNOSTIC CHECK & RESET MEMORY TO IDENTIFICATION STANDARD	\$250.00	?
LABOUR TOTAL		\$5,070.00
ONG	TOTAL	\$34,314.86

BJR1J PORSCHE CAYENNES

Chasis No: WP1ZZZ9>ZCLA90707

Year: 2012.

Front Bumper ✓ Bw—
 Front Bumper Clips 10pc ✓ Nc—
 Front Bumper Side Bracket LH ✓ D11—
 Front Bumper Lower Side Guard Corner LH ✓ D11—
 Front "signal lamp" LH ✓ CM—
 Front Fender LH ✓ BT—
 Front Fender Extension Corner LH ✓ + clips ?
 Front Fender Inner Liner LH ✓ ?
 Front Fender Inner Liner Clips LH ✓ Spn ?
 Front Door Side Mirror LH ✓ Gt—
 Front Door LH ✓ Rdwgy—
 Front Door Outer Handle LH ✓ Rd—
 Rear Door Outer Handle LH ✓ Rd—
 Rear Tail Lp LH ✓ Scr—
 Rear Tyre LH ✓ 285/35R22 ✓ N.C X
 Rear Tyre Tube Valve LH X N.C X
 Front Tyre LH 285/35R22 ✓ ?
 Labour charges for knocking/repair + No need ref
 Rear Door LH ✓ Rdwgy—
 Rear Quarter Panel ✓ R X
 Front Alloy Rim LH ✓ Rd—
 Rear Alloy Rim LH ✓ R X
 Rear bumper ✓

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: