

Taufikh

REF:

ACG

Merimen

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To inspect Vehicle No: _____
at Workshop m/v: _____
of: _____
Insured: _____
Policy No: **18000 35160**
Claims No: _____
Sum Insured: _____ Excess: **\$1,000/-**
(Client's Record)
Make of Veh: _____
(Policy Condition)
Remark: The veh had commenced its repair at the time of inspection.
Bal. or Market Value: **\$235K**
IDAC Accident Rpt: Consistent?: Yes or No
GIA / PR Seen: Consistent?: Yes or No
Est. Repairs: days Res.: Yes or No
Lump Sum: % 3 Val: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Vehicle: **SLX 8613K** Yr Regn: **2018 April**
Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: **Audi A7** cc: **1984**
Colour: **Blue** A/C: Insured / Std / NI / NA
Sp. Reading: **861** T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: **W4H 2224M 830234077**
Gen. Cond: Good / Fair / Poor / Burnt
Steering: Inorder / Jammed / Leaked / Burnt or
Brake: Inorder / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: **255/55R19**
R: **L-7**
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or
Front: _____ Rear: _____
R/Bal: **6** mm R/Bal: **6** mm
L/Bal: **6** mm L/Bal: **6** mm
D.O.A: **1/2/19** D.O.I: **8/2/19**
Survey held at: **Premium Serv.**
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Frt. O/S
The U/C / Chassis frame / Body Structure affected due to collision.

N/S	O/S

Date / Time	Action / Instruction
-------------	----------------------

- SLX 8613K -X**
- 11/2/19 Revert via merimen
 - 12/2/19 Rece approved from Victor by merimen
 - 12/2/19 Informed Tony CLA & TBA
 - 24/05/19 Confirmed P/P \$ 22,981.16 @ 9 days with Taufikh (\$ 21,324.34 Red - 48%)

RECEIVED 24 MAY 2019

RECEIVED 18 DEC 2019

Date/Time File Pass to: **18/12/19**
Type: **Typ.4**
Date/Time File Return to: _____
☐ : Prel. Report
☒ : Final Report
Days Of Repair: **7**
Resurvey No. of Trip: **1**
Survey Fee: _____
Transportation: _____
Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Insp (\$)
☐ : Wash and (\$)
Report Format: _____
Lump Sum / L.B to: **22,981.16 P/P**
Survey Fee: **200**
Transportation: **10**
Total: **210**

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4671H
Vehicle Details	
Vehicle No.:	SLX8613K
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Feb 2019
Vehicle Make:	AUDI
Vehicle Model:	Q7 2.0 TFSI QU (252 BHP)
Primary Colour:	Brown
Manufacturing Year:	2018
Engine No.:	CYR059826
Chassis No.:	WAUZZZ4M8JD034077
Maximum Power Output:	185.0 kW (248 bhp)
Open Market Value:	\$59,280.00
Original Registration Date:	13 Apr 2018
First Registration Date:	13 Apr 2018
Transfer Count:	0
Actual ARF Paid:	\$78,704.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	12 Apr 2028
PARF Rebate Amount:	\$59,028.00
Intended COE Rebate Details	
COE Expiry Date:	12 Apr 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$39,001.00
COE Rebate Amount:	\$35,761.00
Total Rebate Amount:	\$94,789.00

The information contained herein is correct as at 11 Feb 2019

OK

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Friday, 6 December 2019 9:43 am
To: Carrine Leong
Cc: jayee.yap@premiumauto.com.sg; 'Chang Chee Sing'; Adrian Ling (LKKAuto); SUR
Subject: RE: FINAL REVISION - SLX8613K - OD AIG - SURVEYED 8 FEB 19

Dear Carrine,

Confirmed final fig of \$22,981.16 @ 9 days of repairs before excess \$ 1,000/- & GST.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Friday, 26 July 2019 2:39 pm
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: jayee.yap@premiumauto.com.sg; 'Chang Chee Sing' <claims@premiumauto.com.sg>
Subject: RE: FINAL REVISION - SLX8613K - OD AIG - SURVEYED 8 FEB 19

Hi Adrian, Taufikh and all,

Reminder

We have yet receive your confirmation of repair cost and days of repair for above vehicle.

Revised estimate was mailed to you 18 April 2019.

We sincerely appreciate your early closure.

Thanks & Best Regard
Carrine Leong
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183
e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 12 February 2019 2:49 PM
To: 'Claims'
Cc: SUR; 'NORA'
Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Dear Tony,

As instructed by our client , please proceed to repair the **insured vehicle SLX 8613K (Excess TBA)**

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler **on behalf of Shirley**

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 12 February 2019 12:34 PM
To: Victor-CK.Koh@aig.com
Cc: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>; 'NORA ' <nora.khai@premiumauto.com.sg>; claims@premiumauto.com.sg
Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Dear Victor,

Owner contact AIG on this morning and told her authorise repair.

But we are still pending mandate approval from your end.

Kindly advise.

Best Regards,

Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]
Sent: Tuesday, 12 February, 2019 11:52 AM
To: Claims <claims@premiumauto.com.sg>; 'NORA ' <nora.khai@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Dear Shelia,

You may check with Victor.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 12 February 2019 9:50 AM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; 'NORA ' <nora.khai@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Hi Veron ,

I just received a call from the owner earlier, she insisted that the insurance company already gave her approval , please advise again.

Thank you so much.

Best Regards,
Sheila M Ismail
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 200902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]

Sent: Tuesday, 12 February 2019 7:55 AM

To: NORA ; 'Claims'; SUR

Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Dear Nora,

Pending approval from insurance.

Best Regards,

Veron Chen | Case Handler on behalf of Shirley

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: NORA <nora.khai@premiumauto.com.sg>

Sent: Monday, 11 February 2019 6:32 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; 'Claims' <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>

Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Importance: High

Hi Veron,

Any updates on the approval please.

Thank you.

Best Regards,

Norah Khai
Claims Manager

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: NORA [<mailto:nora.khai@premiumauto.com.sg>]
Sent: Monday, 11 February 2019 1:59 PM
To: 'Veron Chen (LKKAUTO)'; 'Claims'; 'SUR'
Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Hi Veron,

Attached document as per your kind request.

Thank you.

Best Regards,

Norah Khai
Claims Manager

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]

Sent: Monday, 11 February 2019 11:50 AM

To: Claims; SUR

Subject: RE: SLX 8613 K - OD AIG-DOA: 1/2/2019

Dear Mastura,

Please provides us CI and driving licensed before chase for approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>

Sent: Monday, 11 February 2019 9:49 AM

To: Admin-D (LKKAuto) <admin-d@lkkauto.com>; Admin A <admin-a@lkkauto.com>; SUR <sur@lkkauto.com>; claims@premiumauto.com.sg

Subject: RE: SLX 8613 K - OD AIG

Importance: High

Good morning,

Kindly assist on the approval urgently.

Thank you and wish you a happy and prosperous Chinese New Year.

Best Regards,

Mastura
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 189902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: NORA [<mailto:nora.khai@premiumauto.com.sg>]

Sent: Saturday, 9 February, 2019 12:19 PM

To: 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'PAL Claim' <claims@premiumauto.com.sg>; 'Admin A' <admin-a@lkkauto.com>; 'SUR' <sur@lkkauto.com>

Subject: RE: SLX 8613 K - OD AIG

Importance: High

Urgent please

Dear All,

Please assist for urgent approval please.

Vehicle is in workshop.

Thank you.

Best Regards,

Norah Khai
Claims Manager

Premium Automobiles Pte Ltd (Reg No 189902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Admin-D (LKKAuto) [mailto:admin-d@lkkauto.com]
Sent: Friday, 8 February 2019 10:16 AM
To: 'PAL Claim'; Admin A; SUR
Subject: RE: SLX 8613 K - OD AIG

Dear Chang,

Noted, with thanks.



BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



From: PAL Claim [mailto:claims@premiumauto.com.sg]
Sent: Friday, 8 February 2019 10:13 AM
To: 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'Admin A' <admin-a@lkkauto.com>; 'SUR' <sur@lkkauto.com>

Cc: 'PAL Claim' <claims@premiumauto.com.sg>

Subject: RE: SLX 8613 K - OD AIG

Dear Nivitha,

Kindly be inform that above mentioned vehicle currently located @ 24 Benoi Sector.

Please arrange survey by this afternoon.

Thank you.

Best regards,

Chang Chee Sing

Claims Specialist

Premium Automobiles Pte Ltd (Reg No 199903271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Admin-D (LKKAuto) <admin-d@lkkauto.com>

Sent: Thursday, 7 February 2019 12:55 PM

To: 'Claims Dept' <claims@premiumauto.com.sg>; Admin A <admin-a@lkkauto.com>; SUR <sur@lkkauto.com>

Subject: RE: SLX 8613 K - OD AIG

Dear Justin,

Noted, with thanks.



BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



From: Claims Dept [mailto:claims@premiumauto.com.sg]

Sent: Monday, 4 February 2019 2:47 PM

To: Admin A <admin-a@lkkauto.com>; SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>

Cc: 'Claims' <claims@premiumauto.com.sg>

Subject: SLX 8613 K - OD AIG

Importance: High

Dear All,

Kindly refer to our attach file of SLX 8613 K – GIA & Estimate, Survey on 8/02/2019 – vehicle in.

Thank you.

Best Regards,
Justin Ee
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

View Received Message

This mail is associated with :

***SLX8613K (1752062397SG)**

OD

Feb 1 2019 5:10PM

[DASON RAJ S/O SELVA RAJ]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 05/12/2019 16:33 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$22981.16) - SLX8613K - Claim Handler: Dally Amri, Mimi Zarina

Approved:22981.16.

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SLX8613K (1752062397SG)**

OD

Feb 1 2019 5:10PM

[DASON RA] S/O SELVA RAJ]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 02/07/2019 14:28 PM.

To LKK_HQ

Subject Alert - Adj Mandate Maintained - SLX8613K - Claim Handler: Dally Amri, Mimi Zarina

Maintained:TO RESPRAY BOTH FRONT WHEEL ARCH COVERS - To take out not necessary. Labour 3 at 3.5 days \$2100.00.

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SLX8613K (1752062397SG)**

OD

Feb 1 2019 5:10PM

[DASON RAJ S/O SELVA RAJ]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From **AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG)**, sent on **12/02/2019 14:24 PM**.

To LKK_HQ

Subject **Alert - Adj Mandate Approved (\$25360.00) - SLX8613K - Claim Handler: Dally Amri, Mimi Zarina**

Approved:25360.00:Kindly advise why 5 days of labour needed for replacement of Front bumper, RH Front fender and Lock carrier? Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 24 May 2019

Preliminary Advice

Vehicle No	: SLX8613K	Accident Date	: 01/02/2019
Make	: AUDI Q7	Policy No.	: 1800035160
Assignment Date	: 11/02/2019	Excess	: S\$1,000.00
Date of Inspection	: 08/02/2019	Est. Duration of Repair	: 9.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (BENOI) 24 BENOI SECTOR SINGAPORE 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	44,306.00 (inclusive supplementary)
Revised Amount	:S\$	22,981.16 (inclusive supplementary)
Check Items (Estimated)	:S\$	0.00
Total	:S\$	22,981.16
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	235,000.00
COE / PARF Rebate	:S\$	94,789.00
Salvage Value	:S\$	
Margin for Repair	:S\$	140,211.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Supplementary amount is \$ 761.20.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chan, Kian Meng

Date: 11 Feb 2019

Preliminary Advice

Vehicle No	: SLX8613K	Accident Date	: 01/02/2019
Make	: AUDI Q7	Policy No.	: 1800035160
Assignment Date	: 11/02/2019	Excess	: S\$0.00
Date of Inspection	: 08/02/2019	Est. Duration of Repair	: 8.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (BENOI) 24 BENOI SECTOR SINGAPORE 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	43,254.00
Revised Amount	:S\$	25,360.00
Check Items (Estimated)	:S\$	6,189.00
Total	:S\$	31,549.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	235,000.00
COE / PARF Rebate	:S\$	94,789.00
Salvage Value	:S\$	
Margin for Repair	:S\$	140,211.00

Remarks

(X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

() The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

() Other comments :

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	02/02/2019 10:36
Date Of Accident	01/02/2019 17:10
Exact Location Of Accident	KATONG SHOPPING CTR CARPARK LEVEL 4
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLX8613K
Insured/Policyholder	
Name Of Registered Owner	DASON RAJ S/O SELVA RAJ
NRIC No	S7484671H
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96936329
Alternative Phone No	OTHERS-96936329

Vehicle Particulars

Manufacturer	AUDI
Model	Q7 2.0 TFSI QU
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE, LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800035160
Cover Note Number	

Driver

Name of Driver	LIM KHIANG SENG
NRIC No	S0188549I
Date Of Birth	11/12/1949
Occupation	INDOOR
Date Of Driving Pass	22/01/1968
Driving Experience	51 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96629696
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	349A JOO CHIAT PLACE
Postcode	428014
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - FATHER-IN -LAW
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLIDED INTO PROPERTY
Weather Conditions	RAINING
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	1
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	NO
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

WHILE NEGOTIATING INTO THE 4TH LEVEL OF KATONG SHOPPING CENTRE, THE FRONT RIGHT LOWER PART OF THE CAR, HIT THE RECTANGULAR COLUMN (WHICH IS ONLY ABOUT 75CM HIGH), (USED TO ENCLOSED THE FIRE RISER). THE RECTANGULAR COLUMN WAS PROTRUDING OUT TO THE TURNING LANE WHICH WAS NARROW.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be cited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (b) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies in reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature:
Date & Time:
2/2/19 9:23am


Driver's Signature
(If driver is not the policyholder)
Date & Time:
2/2/19


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No:



Sketch Plan #2

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

While negotiating into the 4th level of Katong Shopping Centre the front right lower part of the car hit the rectangular column (which is only approx about 80cm high (used to enclose the fire dry riser). The rectangular column was protruding out to the turning lane which was narrow.

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature

Date & Time
2/2/19, 9:23 AM



Driver's Signature
(If driver is not the policyholder)

Date & Time
2/2/19

Reporting Centre Personnel's Signature

Name:
NRCYS No:

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo




Accident Photo



Accident Photo



Accident Photo

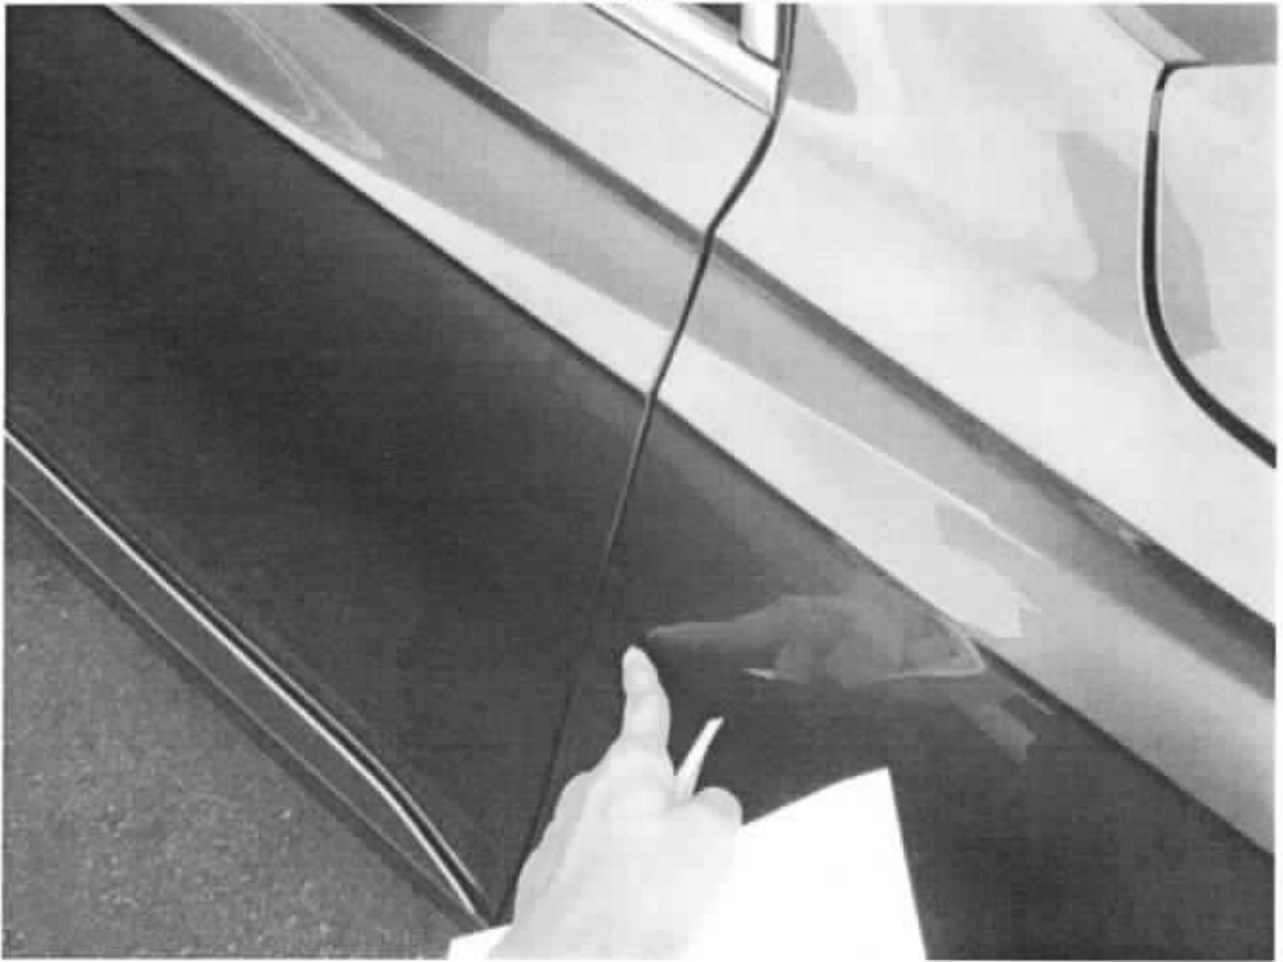

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo





AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
75 Shenton Way
#07-16

MOTOR ACCIDENT INTERVIEW FORM

NAME (DRIVER) : Lim Khian Seng
VEHICLE NUMBER : SLX 8613 K
DATE/TIME OF ACCIDENT : 1/2/19 @ 5.10 PM
PLACE OF ACCIDENT : Katong Shopping Centre
THIRD PARTY VEHICLE (IF ANY) : N/A

WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED
DESTINATION BEFORE THE ACCIDENT?

Chinese Swimming Club

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF
THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE-
ANALYSER TEST ON YOU? IF YES, WHAT IS THE RESULT?

No

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES
TO ALL VEHICLES INVOLVED?

Hitting the low rectangular column (enclosed) fire riser
protruding out to the narrow driveway

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL?
WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

No

Lim Khian Seng

Name:

I Affirmed The Above Information Is Given To My Best Knowledge.

UNDERTAKING

I, Liam Kheng Seng, (NRIC No. S0188549I), hereby confirm that the Singapore Accident Statement lodged by me on 2/2/19 at 9.15 hours pertaining to the accident involving motor car Reg. No: _____, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature	:	<u>[Signature]</u>
Name of Insured / Driver	:	<u>S</u>
Nric No.	:	<u>S0188549I</u>
Date	:	<u>2/2/19</u>
Signature	:	<u>[Signature]</u>
Name of Policyholder	:	<u>DASOW RAS</u>
Nric No.	:	<u>274806811</u>
Date	:	<u>2/2/19</u>



CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : DASON RAJ S/O SELVA RAJ
Period of Insurance : 13 Apr 2018 To 12 Apr 2019
Engine No. : CYR 059826
Chassis No. : WAUZZZ4M8JD034077

Vehicle No. : SLX8613K
Policy No. : 1800035160
Endorsement No. :
Issued Date : 16 Apr 2018

ABOUT THE COVER

Make/Model : AUDI Q7 2.0 TFSI
Engine Capacity/Tonnage : 1,984.00 CC
Driver Restriction : NA

Sum Insured : Market Value
Off Peak Car : No

First Year of Registration : 2018
Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive* :

- a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 186) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$1000 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

DASON RAJ S/O SELVA RAJ - \$1000 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG 3G Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: MALAYAN BANKING BERHAD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 186), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125203

PREMIUM LEASING - KT
281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

Stanley Loh

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0158/2019/JE
Date : 4-Feb-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Dason Raj S/O Selva Raj
Address : 349A Joo Chiat Place
Singapore 428014
Telephone : (HP) 9693 6329
Type of Claim : Own Damage Claim
Policy No. : 1800035160
Vehicle No : **SLX 8613 K**
Model Code : Q7 2.0 TFSI Qu
Model / Year : 13/4/2018
Engine No : CYR 059826
Chassis No : WAUZZZ4M8JD034077
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 1-Feb-19
Place of Accident : Katong Shopping CTR CarPark Level 4

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLX 8613 K

S/N	Nature of Jobs	Estimated Charges
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓
2	To remove and transfer aircon condenser, radiator, charged air cooler, electrical fans and control unit. To carry out vacuum/regas and to pressurise cooling system.	S/N \$ 1,200.00 ✓
3	To dismantle front bumper, rhs front fender and headlight. Renew front lock carrier and align to position. Renew front bumper, rhs front fender and headlight. Re-organise front crash management components. Reinstall all parts removed.	\$ 5,200.00 ²⁵⁰⁰ 3300
4	To remove and reinstall rhs front door board, to dismantle rhs side mirror assy to facilitate door respray.	S/N \$ 360.00 ³⁰⁰ ✓
5	To respray front bumper, rhs front lower spoiler, rhs front fender and rhs front door.	\$ 3,000.00 ¹⁶⁵² 1300
6	To renew rhs front tyre. Carry out wheel alignment.	S/N \$ 280.00 ✓ ²⁴⁰
7	To carry out diagnostic check.	S/N \$ 192.00 ✓
TOTAL LABOUR CHARGES		: \$ 10,712.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 2,242.00	car / 1293.60
2	FRONT BUMPER LOWER GRILLE GRILL	\$ 735.00	? X nn
3	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	\$ 191.00	? car / 152.40
4	RADIATOR GRILLE	\$ 2,269.00	car / 1815.20
5	FRONT BUMPER GRILLE ANTHRACITE - LOWER CENTRE	\$ 187.00	X ? X nn
6	FRONT BUMPER FIXING PARTS	\$ 403.00	nn / X nn
7	FRONT AIR GUIDE - RHS	\$ 60.00	mis / 48
8	FRONT END CAP - RHS	\$ 32.00	car / 35.44
9	FRONT CLOSING ELEMENT - UPPER CENTRE	\$ 252.00	? X nn
10	FRONT SPOILER ANTHRACITE - LH&RH	1/2 \$ 252.00	24-X RH de / 126 / 100
11	FRONT SPOILER - RIGHT OUTER	\$ 40.00	at / 31.52
12	FRONT SPOILER - RH FRONT INNER	\$ 55.00	at / 43.60
13	AIR GUIDE GRILLE - CHROM - RH	\$ 31.00	? / 24.16 de
14	FRONT SENSOR	2 \$ 462.00	X nn
15	SEAL RING	4 \$ 48.00	nn / X nn
16	FRONT BUMPER WIRING SET	\$ 582.00	X nn
17	FRONT FOAM FILLER	\$ 156.00	de / 124.40
18	FRONT BUMPER REINFORCEMENT	\$ 800.00	? X nn
19	FRONT BUMPER SUPPORT - RH	\$ 33.00	X nn
20	FRONT BUMPER GUIDE SECTION - LH&RH	1/2 \$ 80.00	24-X, RH de / 40
SUB TOTAL PARTS CHARGES		\$ 8,910.00	31.52

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	FRONT FENDER - RH	\$ 1,481.00	bt - 1134.60
22	FRONT FENDER ATTACHMENT PARTS	\$ 69.00	X un
23	FRONT FENDER REAR BRACKET - RH	\$ 56.00	ae - 44.24
24	FRONT FENDER CENTRE BRACKET - RH	\$ 59.00	ae - 46.56
25	FRONT FENDER BRACE - RH FRONT	\$ 94.00	bt - 74.48
26	WHEEL HOUSING LINER - RH	\$ 223.00	an - 178.40
27	WHEEL HOUSING LINER ATTACHEMENT PARTS	\$ 50.00	ae - 39.28
28	WHEEL HOUSING LINER - RH REAR	\$ 223.00	an - 178.40
29	WHEEL COVER - LH&RH FRONT	2 \$ 604.00	ae - 482.40
30	LED HEADLIGHT - RH	\$ 9,074.00	Cr 9 - 7259.20
31	CONTROL UNIT LIGHT SYSTEM - RH	\$ 685.00	? X
32	POWER MODULE - RH	\$ 716.00	? X
33	HEADLIGHT FAN - RH	\$ 363.00	? X
34	FRONT HORN - HIGH TONE RIGHT	\$ 206.00	X
35	FRONT HORN BRACKET	\$ 27.00	X
36	LOCK CARRIER WITH MOUNTING RADIATOR	\$ 1,100.00	ae - 880
37	FRONT HEADLIGHT MOUNTING - RH	\$ 107.00	ae - 85.20
38	FRONT AIR GUIDE - RH	\$ 25.00	? X
39	FRONT AIR GUIDE - LOWER	\$ 37.00	? X
40	FRONT TYRE " BRIDGESTONE "	\$ 1,358.00	X
SUB TOTAL PARTS CHARGES		\$ 22,607.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

16557

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	<u>Damage Parts & Prices</u>	
		S/NETT	REMARKS
41	FRONT NO PLATE	\$ 25.00	ne
42	SUNDIES	\$ 1,000.00	? 39.36 ne
	TOTAL PARTS CHARGES	\$ 32,542.00	
	TOTAL LABOUR CHARGES	\$ 10,712.00	
	GRAND TOTAL	\$ 43,254.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

44306

38165.20

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Tanji 9749 1749
Ex: to be advise.
Revert. Not Authorise.
2/2/19 @ 3:50 pm
8 days
Basing before print


13/2/19

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel: 6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd



Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0158/2019/JE 13-Feb-19 Kee Siang 1 of 1 SLX 8613 K Q7 2.0 TFSI Qu
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Lift Cylinder RH	\$ 181.00	\$ <i>ma</i> 144.80
2	Air Guide Grille RH	\$ 271.00	\$ <i>de</i> 216.40
		\$ 452.00	\$ 361.20
Total :		\$ 452.00	\$ 361.20

For Premium Automobiles Pte Ltd

Authorised Signature

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer:

Signature:

Date:

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315	Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0158/2019/JE 18-Apr-19 Glory Tan 1 of 1 SLX 8613 K Q7 2.0 TFSI Qu
--	---	--

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
		\$ -	
<u>LABORS</u>			
<u>1</u>	To respray both front wheel arch covers.	\$ 600.00	\$ 400.00
	TOTAL	\$ 600.00	\$400.00

For Premium Automobiles Pte Ltd

Authorised Signature

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khal@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0158/2019/JE
Date : 4-Feb-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian, Taufikh
9 days - ok - jb 18 Apr 19

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Dason Raj S/O Selva Raj
Address : 349A Joo Chiat Place
Singapore 428014
Telephone : (HP) 9693 6329
Type of Claim : Own Damage Claim
Policy No. : 1800035160
Vehicle No : **SLX 8613 K**
Model Code : Q7 2.0 TFSI Qu
Model / Year : 13/4/2018
Engine No : CYR 059826
Chassis No : WAUZZZ4M8JD034077
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 1-Feb-19
Place of Accident : Katong Shopping CTR CarPark Level 4

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLX 8613 K

S/N	Nature of Jobs	Estimated Charges			
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N	\$	480.00	\$ 480.00
2	To remove and transfer aircon condenser, radiator, charged air cooler, electrical fans and control unit. To carry out vacuum/regas and to pressurise cooling system.	S/N	\$	1,200.00	\$ 1,200.00
3	To dismantle front bumper, rhs front fender and headlight. Renew front lock carrier and align to position. Renew front bumper, rhs front fender and headlight. Re-organise front crash management components. Reinstall all parts removed.		\$	5,200.00	\$ 3,300.00
4	To remove and reinstall rhs front door board, to dismantle rhs side mirror assy to facilitate door respray.	S/N	\$	360.00	\$ 300.00
5	To respray front bumper, rhs front lower spoiler, rhs front fender and rhs front door. (Q7 @ \$600 x 3 = \$1800.00)		\$	3,000.00	\$ 1,800.00
6	To renew rhs front tyre. Carry out wheel alignment.	S/N	\$	280.00	\$ 240.00
6a	Added labour charges - see attached		\$	600.00	\$ 400.00
7	To carry out diagnostic check.	S/N	\$	192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	\$	11,312.00	\$ 7,912.00

*** Labour charges item 3 - Frt bumper, fender HL = 2.5

Lock carrier - 3 days - Total 5.5 x \$600 = \$3300.00

Pls refer Adrian if any problem.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	<u>Damage Parts & Prices</u>	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 2,242.00	\$ 1,793.60
2	FRONT BUMPER LOWER GRILLE GRILL	\$ 735.00	
3	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	\$ 191.00	\$ 152.40
4	RADIATOR GRILLE	\$ 2,269.00	\$ 1,815.20
5	FRONT BUMPER GRILLE ANTHRACITE - LOWER CENTRE	\$ 187.00	
6	FRONT BUMPER FIXING PARTS	\$ 403.00	
7	FRONT AIR GUIDE - RHS	\$ 60.00	\$ 48.00
8	FRONT END CAP - RHS	\$ 32.00	\$ 25.44
9	FRONT CLOSING ELEMENT - UPPER CENTRE	\$ 252.00	
10	FRONT SPOILER ANTHRACITE - LH&RH	2 \$ 252.00	\$ 100.80
11	FRONT SPOILER - RIGHT OUTER	\$ 40.00	\$ 31.52
12	FRONT SPOILER - RH FRONT INNER	\$ 55.00	\$ 43.60
13	AIR GUIDE GRILLE - CHROM - RH	\$ 31.00	\$ 24.16
14	FRONT SENSOR	2 \$ 462.00	
15	SEAL RING	4 \$ 48.00	
16	FRONT BUMPER WIRING SET	\$ 582.00	
17	FRONT FOAM FILLER	\$ 156.00	\$ 124.40
18	FRONT BUMPER REINFORCEMENT	\$ 800.00	
19	FRONT BUMPER SUPPORT - RH	\$ 33.00	
20	FRONT BUMPER GUIDE SECTION - LH&RH	\$ 80.00	\$ 31.52
SUB TOTAL PARTS CHARGES		\$ 8,910.00	\$ 4,190.64

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$4,190.64
	<i>c/f</i>		
21	FRONT FENDER - RH	\$ 1,481.00	\$ 1,184.80
22	FRONT FENDER ATTACHMENT PARTS	\$ 69.00	
23	FRONT FENDER REAR BRACKET - RH	\$ 56.00	\$ 44.24
24	FRONT FENDER CENTRE BRACKET - RH	\$ 59.00	\$ 46.56
25	FRONT FENDER BRACE - RH FRONT	\$ 94.00	\$ 74.48
26	WHEEL HOUSING LINER - RH	\$ 223.00	\$ 178.40
27	WHEEL HOUSING LINER ATTACHEMENT PARTS	\$ 50.00	\$ 39.28
28	WHEEL HOUSING LINER - RH REAR	\$ 223.00	\$ 178.40
29	WHEEL COVER - LH&RH FRONT	\$ 604.00	\$ 482.40
30	LED HEADLIGHT - RH	\$ 9,074.00	\$ 7,259.20
31	CONTROL UNIT LIGHT SYSTEM - RH	\$ 685.00	
32	POWER MODULE - RH	\$ 716.00	
33	HEADLIGHT FAN - RH	\$ 363.00	
34	FRONT HORN - HIGH TONE RIGHT	\$ 206.00	
35	FRONT HORN BRACKET	\$ 27.00	
36	LOCK CARRIER WITH MOUNTING RADIATOR	\$ 1,100.00	\$ 880.00
37	FRONT HEADLIGHT MOUNTING - RH	\$ 107.00	\$ 85.20
38	FRONT AIR GUIDE - RH	\$ 25.00	
39	FRONT AIR GUIDE - LOWER	\$ 37.00	
40	FRONT TYRE " BRIDGESTONE "	\$ 1,358.00	
	SUB TOTAL PARTS CHARGES	\$ 22,607.00	\$14,643.60

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8613 K

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$14,643.60
41	FRONT NO PLATE	\$ 25.00	\$ 25.00
42	Added parts - see attached	\$ 452.00	\$ 361.20
43	SUNDIES	\$ 1,000.00	\$ 39.36
	TOTAL PARTS CHARGES	\$ 32,994.00	\$ 15,069.16
	TOTAL LABOUR CHARGES	\$ 11,312.00	\$ 7,912.00
	GRAND TOTAL	\$ 44,306.00	\$ 22,981.16

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLX 8613 R

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0158/2019/NK

9 Dec 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SLX 8613 ^KR, Audi Q7 2.0 TFSI QU.

With reference to the above-mentioned vehicle, no. **SLX 8613 ^KR** claimant,
Mr. Dason Raj S/O Selva Raj, please find the related document per attached.

1. A copy of the Original invoice no. 85014565 – S\$23,519.84.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SLX 8613 K

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 14:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014565 Date : 06/12/2019 Order : SLX8613K Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SLX8613K (V 37110) Regn Date: 13/04/2018 Mileage: 11169 WIP No.: 41783

Model: Q7 2.0 TFSI QU (252 bhp) 4MB0I Chassis: WAUZZZ4M8JD034077 Engine: CYR 059826 Dept: U

You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE	25.00	1.00	25.00
Q	EXC	M: 8888 Insurance Excess/Liability	-1000.00	1.00	-1,000.00
S	BODYWORK	M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	480.00	1.00	480.00
S	BODYWORK	M: TO REMOVE AND TRANSFER AIRCON CONDENSER, RADIATOR, CHARGED AIR COOLER, ELECTRICAL FANS AND CONTROL UNIT. TO CARRY OUT VACUUM/REGAS AND TO PRESSURISE COOLING SYSTEM	1200.00	1.00	1,200.00
S	BODYWORK	M: TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND HEADLIGHT. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. REORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	3300.00	1.00	3,300.00
S	BODYWORK	M: TO REMOVE AND REINSTALL RHS FRONT DOOR BOARD, TO DISMANTLE RHS SIDE MIRROR ASSY TO FACILITATE DOOR RESPRAY	300.00	1.00	300.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER, RHS FRONT FENDER AND RHS FRONT DOOR	1800.00	1.00	1,800.00
S	BODYWORK	M: TO CARRY OUT WHEEL ALIGNMENT	240.00	1.00	240.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
S	BODYWORK	M: TO RESPRAY BOTH FRONT WHEEL ARCH COVER	400.00	1.00	400.00
X	A4M0853888C	(V) (G) SPOILER 13/02/ Less 020%	1.00	54.50	43.60

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2223
24-hour Breakdown Service 9628 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 14:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014565 Date : 06/12/2019 Order : SLX8613K Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SLX8613K (V 37110) Regn Date: 13/04/2018 Mileage: 11169 WIP No: 41783

Model: Q7 2.0 TFSI QU (252 bhp) 4MB0I Chassis: WAUZZZ4M8JD034077 Engine: CYR 059826 Dept: U

You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
X	A4M0821192H	(A) (SK) WHEEL HOUS 14	Less 020%	1.00	223.00
X	A4M0955102A	(V) (G) CYLINDER 14/02	Less 020%	1.00	181.00
X	A4M0853651J MX3	GRILLE	Less 020%	1.00	2269.00
X	A4M0941774D	(A) (SK) HEADLIGHT 14/	Less 020%	1.00	9074.00
X	A4M0853717 4W3	COVER	Less 020%	1.00	301.50
X	A4M0853718 4W3	COVER	Less 020%	1.00	301.50
X	A4M0821172R	(A) (SK) WHEEL HOUS 14	Less 020%	1.00	223.00
X	A4M0821106D	(V) (G) FENDER RH 13/0	Less 020%	1.00	1481.00
X	A4M0805594B	(A) (SK) CARRIER 14/02	Less 020%	1.00	1100.00
X	A4M0807062D 4W3	FR.SPOILER	Less 020%	1.00	126.00
X	A4M0807611D	PLATE	Less 020%	1.00	190.50
X	A4M0807550D	FOAM INSER	Less 020%	1.00	155.50
X	A4M0807065B GRU	(V) (SK) COVER 13/02/1	Less 020%	1.00	2242.00
X	A4M0098629	ATT.PARTS	Less 020%	1.00	49.10
X	A4M0807241B 4W3	COVER	Less 020%	1.00	35.20
X	A4M0807158D	(A) (SK) AIR DUCT 14/0	Less 020%	1.00	60.00
X	A4M0821168A	BRACKET	Less 020%	1.00	55.30
X	A4M0807750B	(A) (SK) COVER 14/02/1	Less 020%	1.00	31.80
X	A4M0807548D	(A) (SK) SPOILER 14/02	Less 020%	1.00	39.40
X	A4M0821132C	(A) (SK) SUPPORT 14/02	Less 020%	1.00	93.10
X	A4M0821432	BRACKET	Less 020%	1.00	58.20
X	A4M0807284B	GUIDE	Less 020%	1.00	39.40
X	A4M0805608	MOUNTING	Less 020%	1.00	106.50
X	ABX0867189	CLIP	Less 020%	4.00	0.70
X	A4M0807152A 9B9	COVER	Less 020%	1.00	30.20
X	A4M0807682T 4W3	(A) (SK) GRILL 14/02/1	Less 020%	1.00	270.50
X	A5Q0919133 704	WASHER	Less 020%	4.00	2.80

Parts 15,044.16
Labour 0.00
Sublet 7,937.00
Menus 0.00
Lubricant 0.00

Sub-Total 21,981.16

7% GST 1,538.68

Grand Total 23,519.84



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLX 8613 K

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0158/2019/SM
22 February 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

RE : CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

1

total pages

Make & Model : AUDI Q7 2.0 TFSI QU
Vehicle Chassis No. : WAUZZZ4M8JD034077
Vehicle Regn No. : SLX 8613 K
Vehicle Mileage : 8665 KM
Vehicle Owner : Mr. Dason Raj S/O Selva Raj
Certificate No : 1800035160

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

Own Damage Excess : S\$ 1,070.00 (Inclusive GST)
Accident Date : 1/2/2019
Place : Katong Shopping Ctr Carpark Level 4
Repair Cost : S\$ 23,519.04
WIP No. : 41783
Repairer's Name : Premium Automobiles Pte Ltd

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :

Time :

Date :


6³⁰ pm
22/02/2019.

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	07 Feb 2019		11 Feb 2019 10:57 Edit Adj Rpt	S\$22,981.16 Edit Estimates	S\$22,981.16 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	DASON RAJ S/O SELVA RAJ, ID: S7484671H, Tel: +6596936329								
Vehicle Reg. No.:	SLX8613K	Date of Loss:	01/02/2019 17:00 - :59 [9 Months and 19 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 1752062397SG	Policy/Cover Note No.:	1800035160 (Comprehensive)						
		Excess:	S\$1,000.00						
Repairer:	Premium Automobiles Pte Ltd (Benoi) 24 Benoi Sector, 629857 Pioneer - Tel: 67689911 / 63882323								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Dally Amri, Mimi Zarina] MimiZarina.DallyAmri@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 20/02/2019]								
Driver/Custodian:	LIM KHIANG SENG (69 / Male), NRIC: S0188549I, Tel: +6596629696 Email: NOEMAIL								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (05/12/2019): Alert - Adj Mandate Approved (S\$22981.16) - SLX8613K - Claim Handler: Dally Amri... - AIG_SG (02/07/2019): Alert - Adj Mandate Maintained - SLX8613K - Claim Handler: Dally Amri, Mimi Zari... - AIG_SG (27/05/2019): Alert - Adj Mandate Maintained - SLX8613K - Claim Handler: Dally Amri, Mimi Zari... - AIG_SG (12/02/2019): Alert - Adj Mandate Approved (S\$25360.00) - SLX8613K - Claim Handler: Dally Amri...									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLX8613K (1752062397SG)
OD
Feb 1 2019 5:10PM
[DASON RAJ S/O SELVA RAJ]
Premium Automobiles Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View View in Browser		
Assessment Reports														1 per page		☒	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)											Thumbnail	Print			
1	11/02/19 13:38	Adjuster Immediate Advice											Load HTM				
2	24/05/19 10:05	Adjuster Immediate Advice											Load HTM				
Photos/Images														3 per page		☒	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)											Thumbnail	Print			
1	11/02/19 11:59	General View											Load JPG	☒			
2	11/02/19 11:59	General View											Load JPG	☒			
3	11/02/19 11:59	General View											Load JPG	☒			
4	11/02/19 11:59	General View											Load JPG	☒			
5	11/02/19 11:59	General View											Load JPG	☒			
6	11/02/19 11:59	General View											Load JPG	☒			
7	11/02/19 11:59	General View											Load JPG	☒			
8	11/02/19 11:59	General View											Load JPG	☒			
9	11/02/19 11:59	General View											Load JPG	☒			
10	11/02/19 11:59	General View											Load JPG	☒			
11	11/02/19 11:59	General View											Load JPG	☒			
12	11/02/19 11:59	General View											Load JPG	☒			
13	11/02/19 11:59	General View											Load JPG	☒			
14	11/02/19 11:59	General View											Load JPG	☒			
15	11/02/19 11:59	General View											Load JPG	☒			
16	11/02/19 11:59	General View											Load JPG	☒			
17	11/02/19 11:59	General View											Load JPG	☒			
18	11/02/19 11:59	General View											Load JPG	☒			
19	11/02/19 11:59	General View											Load JPG	☒			
20	11/02/19 11:59	General View											Load JPG	☒			
21	11/02/19 11:59	General View											Load JPG	☒			
22	11/02/19 11:59	General View											Load JPG	☒			
23	11/02/19 11:59	General View											Load JPG	☒			
24	11/02/19 11:59	General View											Load JPG	☒			
25	11/02/19 11:59	General View											Load JPG	☒			
26	11/02/19 11:59	General View											Load JPG	☒			
27	11/02/19 11:59	General View											Load JPG	☒			
28	11/02/19 11:59	General View											Load JPG	☒			
29	11/02/19 11:59	General View											Load JPG	☒			
30	11/02/19 11:59	General View											Load JPG	☒			
31	11/02/19 11:59	General View											Load JPG	☒			
32	11/02/19 11:59	General View											Load JPG	☒			
33	11/02/19 11:59	General View											Load JPG	☒			
34	11/02/19 11:59	General View											Load JPG	☒			
35	11/02/19 11:59	General View											Load JPG	☒			
36	11/02/19 11:59	General View											Load JPG	☒			
37	11/02/19 11:59	General View											Load JPG	☒			
38	11/02/19 11:59	General View											Load JPG	☒			
39	11/02/19 11:59	General View											Load JPG	☒			
40	11/02/19 11:59	General View											Load JPG	☒			

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
41	11/02/19 11:59	General View	 Load JPG	☒
42	11/02/19 11:59	General View	 Load JPG	☒
43	11/02/19 11:59	General View	 Load JPG	☒
44	11/02/19 11:59	General View	 Load JPG	☒
45	11/02/19 11:59	General View	 Load JPG	☒
46	11/02/19 11:59	General View	 Load JPG	☒
47	11/02/19 11:59	General View	 Load JPG	☒
48	11/02/19 11:59	General View	 Load JPG	☒
49	11/02/19 11:59	General View	 Load JPG	☒
50	11/02/19 11:59	General View	 Load JPG	☒
51	11/02/19 11:59	General View	 Load JPG	☒
52	11/02/19 11:59	General View	 Load JPG	☒
53	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
54	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
55	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
56	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
57	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
58	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
59	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
60	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
61	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
62	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
63	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
64	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
65	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
66	24/05/19 10:07	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	11/02/19 12:06	Singapore Accident Statement	 Load PDF	
2	11/02/19 12:07	MARK ESTIMATE	 Load PDF	
3	11/02/19 14:14	Driver's Driving License	 Load PDF	
4	11/02/19 14:15	Certificate of Insurance	 Load PDF	
5	24/05/19 10:07	ESTIMATE & SUPP MARKED.pdf	 Load PDF	
6	24/12/19 15:04	Workshop Invoice	 Load PDF	
7	24/12/19 15:04	Discharge Voucher	 Load PDF	

Linked Accident Report Documents

Assessment Reports			View	View in Browser
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	03/09/19 23:26	Accident Statement	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	02/02/19 11:00	Accident Photo	 Load JPG	☒
2	02/02/19 11:00	Accident Photo	 Load JPG	☒
3	02/02/19 11:00	Accident Photo	 Load JPG	☒
4	02/02/19 11:00	Accident Photo	 Load JPG	☒
5	02/02/19 11:00	Accident Photo	 Load JPG	☒
6	02/02/19 11:00	Accident Photo	 Load JPG	☒
7	02/02/19 11:00	Accident Photo	 Load JPG	☒
8	02/02/19 11:00	Accident Photo	 Load JPG	☒
9	02/02/19 11:00	Accident Photo	 Load JPG	☒
10	02/02/19 11:00	Accident Photo	 Load JPG	☒
11	02/02/19 11:00	Accident Photo	 Load JPG	☒
12	02/02/19 11:00	Accident Photo	 Load JPG	☒

Assessment Reports				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
13	02/02/19 11:00	Accident Photo		Load JPG	☒
14	02/02/19 11:00	Accident Photo		Load JPG	☒
15	02/02/19 11:00	Accident Photo		Load JPG	☒
16	02/02/19 11:00	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	02/02/19 10:49	Sketch Plan		Load JPG	☒
2	02/02/19 10:49	Sketch Plan #2		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) ^ v			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd

(Co. Reg. No: 199807198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19002323/T1SD3E2

Date: 24/12/2019

REFERENCE

Insured/Claimant: DASON RAJ S/O SELVA RAJ Policy No: 1800035160
Date of Loss: 01/02/2019 Nature of Claim: OD Claim No: 1752062397SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLX8613K
Make & Model: AUDI Q7, 2.0 TFSI QU (A) Engine No: CYR059826
Reg. Date: 13/04/2018 (Man. Year: 2018) Chassis No: WAUZZZ4M8JD034077
Colour: Brown Odometer: 8661 km
Engine Capacity: 1984 cc
Market Value/New Car Price: S\$235,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 255/55 R19 Rear Tyre Size: 255/55 R19
Front Left Side: Bridgestone 6 mm Rear Left Side: Bridgestone 6 mm
Front Right Side: Bridgestone 6 mm Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	26,853.20	15,069.16	11,784.04	43.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	11,312.00	7,912.00	3,400.00	30.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	38,165.20	22,981.16	15,184.04	39.79
- Excess (S\$)	1,000.00	1,000.00	0.00	0.00
(S\$)	37,165.20	21,981.16	15,184.04	40.86
+ GST 7.00/7.00% (S\$)	2,601.56	1,538.68	1,062.88	40.86
Nett Amount (S\$)	39,766.76	23,519.84	16,246.92	40.86

INSPECTION

Date of Assignment: 11/02/2019

Date Inspected: 08/02/2019 Inspected At:

Premium Automobiles Pte Ltd (Benoi)
24 Benoi Sector
Singapore 629857

Estimated Period of Repair: 9.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	2,242.00 FS	*1,793.60 FS
2	1		*FRONT BUMPER LOWER GRILLE GRILL	Not Necessary	735.00 FS	*- FS
3	1		*FRONT BUMPER CLOSING ELEMENT-LOWER CENTRE	Cracked	191.00 FS	*152.40 FS
4	1		*RADIATOR GRILLE	Cracked	2,269.00 FS	*1,815.20 FS
5	1		*FRONT BUMPER GRILLE ANTHRACITE-LOWER CENTRE	Not Necessary	187.00 FS	*- FS
6	1		*FRONT BUMPER FIXING PARTS	Not Necessary	403.00 FS	*- FS
7	1		*FRONT AIR GUIDE-RHS	Missing	60.00 FS	*48.00 FS
8	1		*FRONT END CAP-RHS	Cracked	32.00 FS	*25.44 FS
9	1		*FRONT CLOSING ELEMENT-UPPER CENTRE	Not Necessary	252.00 FS	*- FS
10	1		*FRONT SPOILER ANTHRACITE-LH & RH	O/s Deformed/N/s Not Necessary	252.00 FS	*100.80 FS
11	1		*FRONT SPOILER-RIGHT OUTER	Cut	40.00 FS	*31.52 FS
12	1		*FRONT SPOILER-RH FRONT INNER	Cut	55.00 FS	*43.60 FS
13	1		*AIR GUIDE GRILLE-CHROM-RH	Deformed	31.00 FS	*24.16 FS
14	2		*FRONT SENSOR	Not Necessary	462.00 FS	*- FS
15	4		*SEAL RING	Not Necessary	48.00 FS	*- FS
16	1		*FRONT BUMPER WIRING SET	Not Necessary	582.00 FS	*- FS
17	1		*FRONT FOAM FILLER	Deformed	156.00 FS	*124.40 FS
18	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	800.00 FS	*- FS
19	1		*FRONT BUMPER SUPPORT-RH	Not Necessary	33.00 FS	*- FS
20	1		*FRONT BUMPER GUIDE SECTION-LH & RH	O/s Deformed/N/s Not Necessary	80.00 FS	*31.52 FS
21	1		*FRONT FENDER-RH	Bent	1,481.00 FS	*1,184.80 FS
22	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	69.00 FS	*- FS
23	1		*FRONT FENDER REAR BRACKET-RH	Necessary	56.00 FS	*44.24 FS
24	1		*FRONT FENDER CENTRE BRACKET-RH	Necessary	59.00 FS	*46.56 FS
25	1		*FRONT FENDER BRACE-RH FRONT	Bent	94.00 FS	*74.48 FS
26	1		*WHEEL HOUSING LINER-RH	Torn	223.00 FS	*178.40 FS
27	1		*WHEEL HOUSING LINER ATTACHMENT PARTS	Necessary	50.00 FS	*39.28 FS
28	1		*WHEEL HOUSING LINER-RH REAR	Torn	223.00 FS	*178.40 FS
29	2		*WHEEL COVER-LH & RH FRONT	Necessary	604.00 FS	*482.40 FS
30	1		*LED HEADLIGHT-RH	Cracked	9,074.00 FS	*7,259.20 FS
31	1		*CONTROL UNIT LIGHT SYSTEM-RH	Not Necessary	685.00 FS	*- FS
32	1		*POWER MODULE-RH	Not Necessary	716.00 FS	*- FS
33	1		*HEADLIGHT FAN-RH	Not Necessary	363.00 FS	*- FS
34	1		*FRONT HORN-HIGH TONE RIGHT	Not Necessary	206.00 FS	*- FS
35	1		*FRONT HORN BRACKET	Not Necessary	27.00 FS	*- FS
36	1		*LOCK CARRIER WITH MOUNTING RADIATOR	Cracked	1,100.00 FS	*880.00 FS
37	1		*FRONT HEADLIGHT MOUNTING-RH	Cracked	107.00 FS	*85.20 FS
38	1		*FRONT AIR GUIDE-RH	Not Necessary	25.00 FS	*- FS
39	1		*FRONT AIR GUIDE-LOWER	Not Necessary	37.00 FS	*- FS
40	1		*FRONT TYRE BRIDGESTONE	Not Necessary	1,358.00 FS	*- FS
41	1		*FRONT NO PLATE	Necessary	25.00 FS	*25.00 FS
42	1		*SUNDRIES	Necessary	1,000.00 FS	*39.36 FS
43	1		*LIFT CYLINDER RH	Cracked	144.80 FS	*144.80 FS
44	1		*AIR GUIDE GRILLE RH	Deformed	216.40 FS	*216.40 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) 26,853.20 15,069.16

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,FOG LAMPS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER AIRCON CONDENSER,RADIATOR,CHARGED AIR COOLER,ELECTRICAL FANS AND CONTROL UNIT,TO CARRY OUT VACUUM/REGAS AND TO PRESSURIES COOLING SYSTEM	New	1,200.00	1,200.00
3	TO DISMANTLE FRONT BUMPER,RHS FRONT FENDER AND HEADLIGHT.RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.RENEW FRONT BUMPER,RHS FRONT FENDER AND HEADLIGHT.RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	5,200.00	3,300.00
4	TO REMOVE AND REINSTALL RHS FRONT DOOR BOARD,TO DISMANTLE RHS SIDE MIRROR ASSY TO FACILITATE DOOR RESPRAY	New	360.00	300.00
5	TO RESPRAY FRONT BUMPER,RHS FRONT LOWER SPOILER,RHS FRONT FENDER AND RHS FRONT DOOR	New	3,000.00	1,800.00
6	TO RENEW RHS FRONT TYRE,CARRY OUT WHEEL ALIGNMENT	New	280.00	240.00
7	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
8	TO RESPRAY BOTH FRONT WHEEL ARCH COVERS	New	600.00	400.00
Gross Labour Cost (S\$)			11,312.00	7,912.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >