

ASS. REC. BY

REF

CS/FC119002947/Eqdb. 72

Special Instruction

Surveyor: Steve

ASSIGNMENT (Office)

CWS

From (Phone): Henry Kao

of FCI

Date/Time: 11:29am @ 15/2/19

Estimated Cost:

Bill to:

OD/TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLJ 2106X

Insured:

SHD 8809R

at Workshop info:

Trans Eurocars

Tel:

81289802

of

5 ubi close

Policy No:

Claim No:

D19001012MPS4

Sum Insured:

Excess:

Make of Veh:

D.O.A.

10/2/19

(Client's Record)

CA / REV / REP. / REV 24 HRS

lup

H.O.D. Endorsement:

Date/Time:

3:52pm @ 15/2/19

Person Contacted:

JCS

Vehicle IN/OUT

(OUT)

Date/Time	Action/Instruction (✓) Estimate
	SLJ 2106X - X.
	SHD 8809R - CG3 / LCR18002425 / Mijb3 DOB: 6/2/2018
28/3/19 @ 2.46pm	NOTED to Henry Kao by email.
28/4/19 @	Submit Prel. report - the repairer still awaiting liability.

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 QD / TP / WS / TP RES / QD RES / EVA / INV / MV
 To Inspct Vehicle No: _____
 at Workshop n/a:
 ol
 Insured
 Policy No
 Claims No
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value:
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 4 days Res.: Yes or No
 Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLJ2196X Yt Regn: 30/11/16
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Mazda B1ante
 Colour: Blue A/C Insured / Std / NI / NA
 Sp. Reading: 52982 T/Ratio: Insured / Std / NI / NA
 Eng/No:
 CiNo: JM6CC 1071G 0109782
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 205/60R16
 R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front Rear
 R/Bal. 7 mm R/Bal. 7 mm
 L/Bal. 7 mm L/Bal. 7 mm
 D.O.A. 10/2/19 D.O.I. 21/3/19
 Survey held at Trans Eunters

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
 Front LH

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time : Action / Instruction

RECEIVED 26 APR 2019

Date/Time, File Pass to:



Prel. Report

4/26/19 Trans



Final Report

Date/Time, File Return to:

2)

Report Format :

Lump Sum / I.B.F. :

Days Of Repair:

Resurvey No. of Trip:

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech Invs (\$)
☐ Weekend (\$)

Survey Fee:

Transportation

) S.R. 21

) Photos

) Other

)

291

170+15
50
16
291



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19001012MFSH
Our Ref: CS/FCI19002947/Eqd3

Date: 22 March 2019

The Motor Claims Department
First Capital Insurance Ltd


Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SLJ 2106X .

Please be informed that we had conducted the inspection of the abovementioned vehicle on 21/03/2019 at the premises of M/s TRANS EUROKARS , and have the following to report:-

Workshop Estimate Amount	: S\$ <u>11,042.06</u> .
Revised Estimate Amount	: S\$ <u>3,586.79</u> .
"Check" Items Amount	: S\$ <u>556.92</u> .
Market Value	: S\$ <u>-</u> .
LTA Reimbursement Value	: S\$ <u>-</u> .
Nett Value	: S\$ <u>-</u> .

Description of Damage:
The vehicle sustained damages
at the front n/s portion.

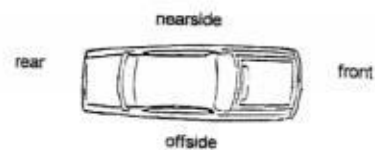

Yours faithfully

Steve
Automotive Assessor

MOTOR SURVEY ASSIGNMENT

Date	12-02-2019	Our Ref No. D19001012MFSH
Accident Date	10-02-2019	Claim Type. Third Party
Insured Vehicle	SHD8809R	Third Party Vehicle. SLJ2106X
Survey Location	5 UBI CLOSE	
Contact Person.	JESS FRANCIS CARLOS	
Contact No.	81289802/ 81289802	Fax No. 0
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS EUROKARS PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	HENRY KAO	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Shiau Chan (LKKAUTO)

From: jess.francis@eurokars.com.sg
Sent: Friday, 26 April 2019 3:35 PM
To: Shiau Chan (LKKAUTO); catherinechua@eurokars.com.sg
Subject: Re: SURVEYOR APPOINTED; OUR REF : D19001012MFSH ; YOUR REF: SLJ2106X

Hi Shiau Chan,

Still chasing liability.

Regards.

Jess Francis Carlos
Insurance Claim Executive
TRANS EUROKARS PTE LTD
5 Ubi Close
Singapore 408605
HP: 8128 9802

This email, including any attachment, is intended for the sole use of the recipient(s) named above and may contain information that is confidential and/or proprietary to the Eurokars Group. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Sent: Friday, April 26, 2019 3:24:43 PM
To: Jess Francis Amurao Carlos; Catherine Chua
Subject: RE: SURVEYOR APPOINTED; OUR REF : D19001012MFSH ; YOUR REF: SLJ2106X

Dear Jess,

Kindly advise vehicle status.

If vehicle has been repaired, please finalize with us.

Best Regards,

Shiau Chan (Ms) | Case Handler
LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jess.francis@eurokars.com.sg <jess.francis@eurokars.com.sg>
Sent: Tuesday, 19 March 2019 4:48 PM
To: Admin-D (LKKAUTO) <admin-d@lkkauto.com>
Cc: HenryKao@msfirstcapital.com.sg
Subject: Re: SURVEYOR APPOINTED; OUR REF : D19001012MFSH ; YOUR REF: SLJ2106X

Dear LKK,

Can we arrange the survey on Mar 21, 2019 at 4 pm?

Regards.

Jess Francis Carlos
Insurance Claim Executive

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Friday, 22 March 2019 2:46 PM
To: assignments; 'CWS Motor Claims'
Cc: 'Henry Kao Cai Jie'; SUR
Subject: RE: SURVEY ASSESSMENT - D19001012MFSH/1
Attachments: CSFCI19002947Eqd3.pdf

Dear Henry,

Enclosed herewith preliminary advice of SLJ 2106X.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Friday, 15 February 2019 3:53 PM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Henry Kao Cai Jie' <HenryKao@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19001012MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Please be informed vehicle not in the workshop, repairer will arrange.

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Friday, 15 February 2019 11:29 AM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Henry Kao Cai Jie



[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4462C
Vehicle Details	
Vehicle No.:	SLJ2106X
Vehicle to be Exported:	No
Intended Deregistration Date:	22 Mar 2019
Vehicle Make:	MAZDA
Vehicle Model:	BIANTE 5-DOOR WAGON 2.0L SP.6EAT
Primary Colour:	Blue
Manufacturing Year:	2016
Engine No.:	PE30900823
Chassis No.:	JM6CC1071G0109782
Maximum Power Output:	111.0 kW (148 bhp)
Open Market Value:	\$22,139.00
Original Registration Date:	30 Nov 2016
First Registration Date:	30 Nov 2016
Transfer Count:	0
Actual ARF Paid:	\$22,995.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Nov 2026
PARF Rebate Amount:	\$17,246.00
Intended COE Rebate Details	
COE Expiry Date:	29 Nov 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,001.00
COE Rebate Amount:	\$40,737.00
Total Rebate Amount:	\$57,983.00

The information contained herein is correct as at 22 Mar 2019

OK

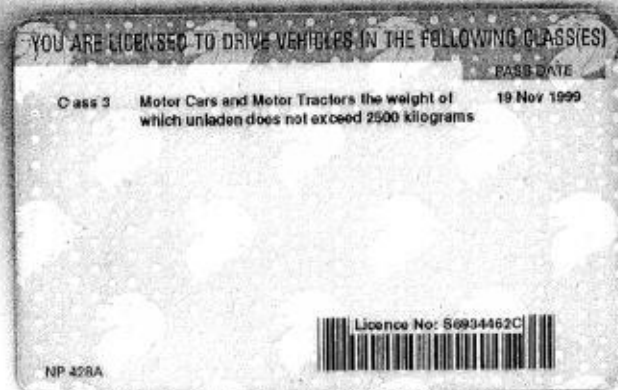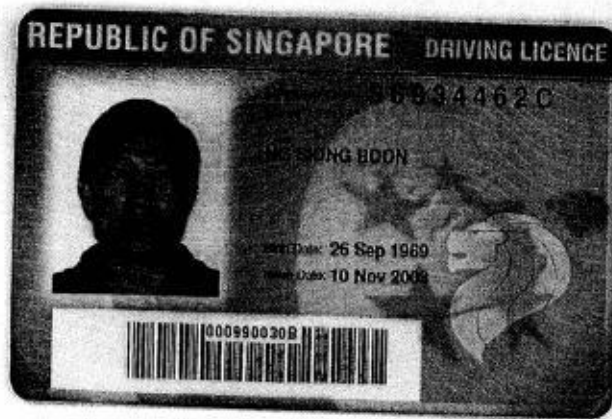



CERTIFICATE OF INSURANCE

MAZDA AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : Ng Siong Boon
Period of Insurance : 30 Nov 2018 To 29 Nov 2019
Engine No. : PE30900823
Chassis No. : JM6CC1071G0109782

Vehicle No. : SLJ2106X
Policy No. : 2100493542-02
Endorsement No. :
Issued Date : 01 Nov 2018

ABOUT THE COVER

Make/Model : MAZDA BIANTE

Engine Capacity/Tonnage : 1,998.00 CC

Driver Restriction : NA

Sum Insured : Market Value

Off Peak Car : No

First Year of Registration : 2016

Insuring with COE/PAF : Yes

Person or Classes of Persons Entitled to Drive* :

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission.

This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDER") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business. This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1500cc - 1600cc Optional

* Limitations rendered inoperative by Section B of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

Ng Siong Boon - \$600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Trans Eurokars Pte Ltd Add: 27A Tanjong Perjur, Singapore 609042 63310608

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: OCBC Bank Ltd

I/We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0503599190

ARF (AP) PTE LTD - MAZDA

7 MAXWELL ROAD #01-100 ANNEX B MND COMPLEX

SINGAPORE 069111

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

Mobile

AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

SSCA58



TRANS EUROKARS PTE LTD
NO:5 UBI CLOSE, SINGAPORE 408605
ESTIMATE COST OF REPAIRS



FIRST CAPITAL INSURANCE LTD		NAME : Mr Ng Siong Boon	WIP : 42736
36 ROBINSON ROAD		ADDRESS : Blk 220b Bedok Central	EXCESS :
#16-01		#15-42	DATE: 12-Feb-19
CITY HOUSE SINGAPORE 068877		Singapore 462220	
ATTN. :	MOTOR CLAIMS	TEL : 98419416	
FAX :			

VEH NO :	SLJ2106X	DATE IN :		CONTACT PERSON :	Jess 63957874
CHASSIS NO :	JM6CC1071G0109782	MILEAGE :		TYPE OF CLAIM :	THIRD PARTY CLAIM
MODEL :	BIANTE	DATE REG.:	26-Nov-18	POLICY NO. :	

NATURE OF WORKS

Parts Description

NO	QTY	REVISED	PRICES
1	FRONT BUMPER / DD 1 MC605-50-031CBB		\$ 1,023.10
2	STRIPE LHS, FRONT BUMPER / NEC 1 MC467-50-887		\$ 77.60
3	STRIPE RHS, FRONT BUMPER / NEC 1 MC467-50-877		\$ 77.60
4	RETAINER LHS / BR 1 MC273-50-0U1D		\$ 38.80
5	BRACKET LHS X NN 1 MC467-50-161A		\$ 127.10
6	COVER LHS, FOGLAMP ? 1 MC605-50-C21A		\$ 177.20
7	FOGLAMP LHS ? 1 MC461-51-690		\$ 441.60
8	CHROME LHS X NN 1 MC467-50-7K1		\$ 543.70
9	CLIP, FRONT BUMPER / NEC 10 MC274-50-133		\$ 35.00
10	SEAL RUBBER, FRONT BUMPER / NEC 2 MC467-50-2G2		\$ 80.80
11	FRONT GRILLE ASSY X NN 1 MC605-50-710B		\$ 2,131.30
12	FASTENER, FRONT GRILLE / NEC 2 MD350-50-E21		\$ 21.00
13	FASTENER, FRONT GRILLE / NEC 2 MB041-68-865 02		\$ 9.20
14	FRONT FENDER LHS X R 1 MC275-52-211B		\$ 364.00
15	MUDGUARD LHS X NN 1 MC273-56-140C		\$ 172.40
16	FASTENER, MUDGUARD X NN 10 MB45A-56-146A		\$ 28.00
17	HEADLAMP LHS X NN 1 MC274-51-041D		\$ 2,613.70
18	CLIP, HEADLAMP X NN 5 MC273-50-133A		\$ 48.00
19	RIVET, HEADLAMP X NN 1 MB092-51-833		\$ 3.30
TOTAL PARTS			\$ 8,013.40
LESS 10%			\$ 801.34
TOTAL PARTS COST			\$ 7,212.06

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and

Labour Description

1	MZ-BR-FRONT7	TO REPLACE FRONT BUMPER AND FRONT FENDER LH. REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.	600 660	\$ 1,320.00
2	MZ-SP-SFRT07	TO RESPRAY FRONT BUMPER AND FRONT FENDER LH	1260	\$ 1,260.00

3	MZ-BR-CAVITY	TO CARRY-OUT BODY CAVITY PRESERVATION.		\$ 250.00	X
4	MZ-BR-ELECTR	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	150	\$ 250.00	
5	MZ-BR-REPROG	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	180	\$ 350.00	
6		TO SUPPLY BRILA PREMIUM COATING.	NETT 100	\$ 300.00	
7	MZ-BR-SUNDRI	SUNDRIES.	NETT 10	\$ 100.00	NEL

TOTAL LABOUR	\$ -	\$ 3,830.00
TOTAL PARTS	\$ -	\$ 7,212.06
TOTAL	\$ -	\$ 11,042.06
LESS EXCESS	\$ -	\$ -
TOTAL AFTER EXCESS	\$ -	
GST 7%	\$ -	\$ -
GRAND TOTAL	\$ -	\$ -

REMARKS:
THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT. TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A **QUOTATION FEE OF \$400** WILL BE APPLIED ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

TRANS EUROKARS PTE LTD

Authorised Signature

Steve (LKK)
8322 8813

with print 21/3/19 5.30pm
4 days
P/P
Re before spray


25/3/19



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19002947/Eqd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 06-05-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 8809R	Veh. Inspected	SLJ 2106X	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19001012MFSH	Excess (\$)	0.00	
Assign From	HENRY KAO	Assign Date	15/02/2019	
2. Vehicle Particulars & Condition				
Make & Model	MAZDA BIANTE	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JM6CC1071G0109782	Colour	BLUE	
Odometer	52982	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	YOKOHAMA	7 mm	
L/H Front Tyre	205/60 R16	YOKOHAMA	7 mm	
R/H Rear Tyre	205/60 R16	YOKOHAMA	7 mm	
L/H Rear Tyre	205/60 R16	YOKOHAMA	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	10/02/2019	Inspection Date	21/03/2019	
Survey held at	TRANS EUROKARS PTE LTD NO 5 UBI CLOSE SINGAPORE 408605			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLJ 2106X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BUMPER	DENTED	1,023.10	1,023.10
1	STRIPE LHS,FRONT BUMPER	NECESSARY	77.60	77.60
1	STRIPE RHS,FRONT BUMPER	NECESSARY	77.60	77.60
1	RETAINER LHS	BROKEN	38.80	38.80
1	BRACKET LHS	NOT NECESSARY	127.10	-
1	COVER LHS,FOGLAMP	* CHECK	177.20	-
1	FOGLAMP LHS	* CHECK	441.60	-
1	CHROME LHS	NOT NECESSARY	543.70	-
10	CLIP,FRONT BUMPER	NECESSARY	35.00	35.00
2	SEAL RUBBER,FRONT BUMPER	NECESSARY	80.80	80.80
1	FRONT GRILLE ASSY	NOT NECESSARY	2,131.30	-
2	FASTENER,FRONT GRILLE	NECESSARY	21.00	21.00
2	FASTENER,FRONT GRILLE	NECESSARY	9.20	9.20
1	FRONT FENDER LHS	TO REPAIR SEE LABOUR	364.00	-
1	MUDGUARD LHS	NOT NECESSARY	172.40	-
10	FASTENER,MUDGUARD	NOT NECESSARY	28.00	-
1	HEADLAMP LHS	NOT NECESSARY	2,613.70	-
5	CLIP,HEADLAMP	NOT NECESSARY	48.00	-
1	RIVET,HEADLAMP	NOT NECESSARY	3.30	-
	LESS 10% DISCOUNT		-801.34	-136.31
			7,212.06	1,226.79
SPECIAL NETT ITEMS				
1	SUNDRIES (SN)	NECESSARY	100.00	10.00
			100.00	10.00
LABOUR				
	TO REPLACE FRONT BUMPER AND FRONT FENDER LH.REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.INCLUSIVE OF THE REPAIR OF FRONT FENDER LHS.		1,320.00	660.00
	TO RESPRAY FRONT BUMPER AND FRONT FENDER LH.		1,260.00	1,260.00

Report Ref No. CS/FCI19002947/Eqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CARRY-OUT BODY CAVITY PRESERVATION.	NOT NECESSARY	250.00	-
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		350.00	180.00
	TO SUPPLY BRILA PREMIUM COATING.		300.00	100.00
			3,730.00	2,350.00
GRAND TOTAL			11,042.06	3,586.79
RECOMMENDED COST OF REPAIRS (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$556.92 NETT)				3,586.79

Report Ref No. CS/FCI19002947/Eqd3n2

CHEN TSUE YEE
Automotive Assessor

ADRIAN LING WAI PING
B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI
Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.