




REF: AIG

ASSIGNMENT

From \_\_\_\_\_ Date: 22/2/19  
 Estimated Cost: \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To inspect Vehicle No: SJE 8346E  
 at Workshop m/s: TEAM AUTO PRO  
 of 8 Kaki Bukit Ave 4 # 06-21  
 Insured: \_\_\_\_\_  
 Policy No: \_\_\_\_\_  
 Claims No: \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_  
 (Policy Condition)  
 Remark: The veh had commenced its repair at the time of inspection.  
 Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? Yes or No  
 GIA / PR Sect: \_\_\_\_\_ Consistent? Yes or No  
 Est. Repairs: 18 days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

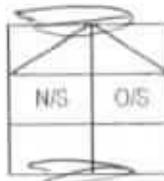

Veh No: SJE 8346E Yr Regn: 9/5/2008  
 Type:  Car /  M.Cycle /  Bus /  Van /  Lorry /  Taxi /  Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: HONDA FIT 1.3G C.C: 1339  
 Colour: WHITE A/C: Insured / Std / NI / NA  
 Sp. Reading: 200290 T/Radio: Insured / Std / NI / NA  
 Eng/No: L3A4075655  
 C/No: GE61066495  
 Gen. Cond: Good / Fair /  Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Modi: Nil /  Rim / STD A/Rim or \_\_\_\_\_  
 Tyre Size: F: 185/60/15  
 R: 185/60/15  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or \_\_\_\_\_  
 Front \_\_\_\_\_ Rear \_\_\_\_\_  
 R/Bal: 5 mm R/Bal: 5 mm  
 L/Bal: 5 mm L/Bal: 5 mm  
 D.O.A: 15.2.19 D.O.I: 22/2/19  
 Survey held at: TEAM AUTO PRO  
 Des. of Damages:  Frt /  Rear /  O/S /  N/S /  UIC /  Rooftop or \_\_\_\_\_  
 The UIC / Chassis frame / Body Structure affected due to collision

Date / Time \_\_\_\_\_ Action / Instruction  
Range 10,000/- - 11,000/-  
18 days + 3 Sundays + 1 PRS = 22 days

MV 47,000/-  
 PV 35,144/-  
 NV 11,856/-  
H/S 11,800/-  
cred \$ 9,696.57 (45%) TAG Lim  
25/2/19

Date/Time, File Pass to?  : Prel. Report  
 : Final Report  
 Date/Time, File Return to? \_\_\_\_\_  
 Report Format: \_\_\_\_\_  
 Lump Sum / I.B.I.: (\$ \_\_\_\_\_)  
 Days Of Repair: \_\_\_\_\_  
 Resurvey No. of Trip: \_\_\_\_\_  
 Survey Fee: \_\_\_\_\_  
 Transportation: \_\_\_\_\_  
 Add Fee:  Site Insp (\$ \_\_\_\_\_)  
 Interview (\$ \_\_\_\_\_)  
 Tech. Invs (\$ \_\_\_\_\_)  
 Weekend (\$ \_\_\_\_\_)  
 TOTAL \_\_\_\_\_

SJE : \_\_\_\_\_  
 Date of Survey : \_\_\_\_\_  
 Date of ReSurvey: \_\_\_\_\_ After-Paint: \_\_\_\_\_  
 Contacts : \_\_\_\_\_

Vehicle Nos : **SJE 8346 E**  
 Model : HONDA FIT  
 Year : \_\_\_\_\_  
 Chassis No : \_\_\_\_\_

**\* AGREED Cost Of Repair and Repair Day/s with SJE \***

Amount: \_\_\_\_\_ Working Day: \_\_\_\_\_

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$	
1	BONNET	1	\$ 433.85	\$ 433.85	CRU ✓
2	BONNET LOCK	1	\$ 90.65	\$ 90.65	BT ✓
3	BONNET SAFETY HOOK	1	\$ 45.30	\$ 45.30	BT ✓
4	BONNET LOCK CABLE	1	\$ 33.60	\$ 33.60	BT ✓
5	BONNET INSULATOR PAD	1	\$ 195.30	<del>195.30</del> 134.50	NEC ✓
6	BONNET HINGES	2	\$ 35.05	\$ 70.10	BT ✓
7	BONNET INNER SIDE TOP RUBBER	2	\$ 28.53	\$ 57.06	CUT ✓
8	FRONT CENTRE GRILLE	1	\$ 137.55	\$ 137.55	BR ✓
9	FRONT LOGO	1	\$ 32.92	\$ 32.92	NEC ✓
10	FRONT BUMPER	1	\$ 532.55	\$ 532.55	CRU ✓
11	FRONT BUMPER RETAINER	2	\$ 18.55	\$ 37.10	NEC ✓
12	FRONT BUMPER REINFORCEMENT	1	\$ 261.05	\$ 261.05	BT ✓
13	FRONT BUMPER LOWER	1	\$ 125.00	\$ 125.00	BR ✓
14	FRONT BUMPER LOWER GRILLE	1	\$ 98.65	\$ 98.65	BR ✓
15	FRONT SUPPORT PANEL TOP	1	\$ 680.35	<del>680.35</del> 599.50	CRU ✓
16	FRONT SUPPORT PANEL FRAME	1	\$ 408.25	<del>408.25</del> 293.80	BR ✓
17	A/C CONDENSER	1	\$ 782.85	<del>782.85</del> 762.80	BT ✓
18	A/C CONDENSER HIGH PRESSURE PIPE	1	\$ 128.67	\$ 128.67	} BT ✓
19	A/C CONDENSER LOW PRESSURE PIPE	1	\$ 122.30	\$ 122.30	
20	A/C CONDENSER MOUNTING BUSH	1	\$ 109.75	<del>109.75</del> 12.00	CUT ✓
21	RADIATOR	1	\$ 1,382.55	\$ 1,382.55	? BR ✓
22	RADIATOR TOP BRACKET	1	\$ 96.90	<del>96.90</del> 75.80	? BT ✓
23	RADIATOR TOP BRACKET BUSH	1	\$ 98.20	<del>98.20</del> 30.80	? CUT ✓
24	RADIATOR TOP HOSE	1	\$ 129.75	<del>129.75</del> 40.00	} ? CUT ✓
25	RADIATOR BOTTOM HOSE	1	\$ 129.75	<del>129.75</del> 58.60	
26	RADIATOR FAN COWLING	1	\$ 133.53	<del>133.53</del> 105.45	? BR ✓
27	RADIATOR FAN BLADE	1	\$ 95.50	<del>95.50</del> 78.50	} ? BR ✓
28	RADIATOR FAN MOTOR	1	\$ 283.90	\$ 283.90	
29	AIR INTAKE DUCT	1	\$ 75.88	\$ 75.88	
30	AIR FILTER HOUSING ASSY	1	\$ 105.70	\$ 105.70	? BR ✓
31	WASHER TANK	1	\$ 88.00	<del>88.00</del> 72.90	} ? BR ✓
32	WASHER TANK MOTOR	1	\$ 159.30	<del>159.30</del> 102.10	
33	WASHER FILLER HOSE	1	\$ 39.00	\$ 39.00	
34	HEADLAMP RH	1	\$ 598.00	<del>598.00</del> 587.70	BR ✓
35	HEADLAMP LOWER BRACKET RH	1	\$ 58.90	<del>58.90</del> 57.60	BT ✓
36	HEADLAMP PANEL RH	1	\$ 286.50	<del>286.50</del> 185.00	? DD ✓
37	HEADLAMP LH	1	\$ 598.00	<del>598.00</del> 587.70	BR ✓
38	HEADLAMP LOWER BRACKET LH	1	\$ 58.90	<del>58.90</del> 57.60	BT ✓
39	HEADLAMP PANEL LH	1	\$ 286.50	<del>286.50</del> 185.00	? DD ✓
40	FRONT FENDER RH	1	\$ 397.20	<del>397.20</del> 375.60	DD ✓

41	FRONT FENDER INNER SHEILD <i>RH</i>	1	\$	108.00	\$ <i>92.90</i>	<del>108.00</del>	?TNV
42	FRONT FENDER LH	1	\$	397.20	\$ <i>375.60</i>	<del>397.20</del>	DDV
43	FRONT FENDER INNER SHEILD <i>LH</i>	1	\$	108.00	\$ <i>92.90</i>	<del>108.00</del>	?TNV
44	FRONT FENDER QUATER GLASS SIDE GARNISH RH	1	\$	70.00	\$	<del>70.00</del>	} MBSV
45	FRONT FENDER QUATER GLASS SIDE GARNISH LH	1	\$	70.00	\$	<del>70.00</del>	
46	FRONT WINDSCREEN MOULDING	1	\$	95.00	\$ <i>85.00</i>	<del>95.00</del>	} NEC
47	FRONT WINDSCREEN INNER SEAL	1	\$	58.53	\$ <i>35.00</i>	<del>58.53</del>	
48	FRONT ABS SENSOR RH	1	\$	389.80	\$	<del>389.80</del>	} ?NNX
49	FRONT ABS SENSOR LH	1	\$	389.80	\$	<del>389.80</del>	
50	TAILGATE	1	\$	737.65	\$	<del>737.65</del>	DDV
51	TAILGATE INNER TRIM BOARD	1	\$	130.25	\$	<del>130.25</del>	BRV
52	TAILGATE DAMPER	2	\$	136.25	\$	<del>272.50</del>	?NNX
53	TAILGATE HINGE	2	\$	44.50	\$	<del>89.00</del>	?BTV
54	TAILGATE LOGO	1	\$	35.00	\$	<del>35.00</del>	NECV
55	TAILGATE LOCK MECHANISM	1	\$	189.55	\$ <i>175.00</i>	<del>189.55</del>	BTV
56	TAILGATE STRIKER	1	\$	38.00	\$	<del>38.00</del>	NNX
57	TAILGATE WEATHER STRIP	1	\$	183.00	\$ <i>92.30</i>	<del>183.00</del>	CUT
58	TAILGATE OUTER HANDLE	1	\$	58.35	\$	<del>58.35</del>	?NNX
59	TAILGATE OUTER GARNISH	1	\$	119.25	\$	<del>119.25</del>	?NNX
60	TAILGATE WIPER MOTOR	1	\$	238.05	\$	<del>238.05</del>	?NNX
61	TAILGATE WIPER ARM	1	\$	45.00	\$	<del>45.00</del>	?NNX
62	REAR END PANEL	1	\$	276.55	\$	<del>276.55</del>	DDV
63	REAR END PANEL TOP GARNISH	1	\$	60.85	\$	<del>60.85</del>	DLV
64	SPARE TYRE PANEL	1	\$	737.05	\$	<del>737.05</del>	?NNX
65	SPARE TYRE PANEL TOP BOARD	1	\$	190.75	\$	<del>190.75</del>	?NNX
66	REAR BUMPER	1	\$	474.55	\$	<del>474.55</del>	BRV
67	REAR BUMPER RETAINER	2	\$	<i>36.80</i> <del>38.00</del>	\$ <i>73.60</i>	<del>76.00</del>	NECV
68	REAR BUMPER BRACKET	2	\$	24.00	\$	<del>48.00</del>	BTV
69	REAR BUMPER TOWING CAP	1	\$	18.00	\$ <i>13.30</i>	<del>18.00</del>	DLV
70	REAR BUMPER LOWER	1	\$	108.53	\$	<del>108.53</del>	?BRV
71	TAILLAMP RH	1	\$	206.55	\$	<del>206.55</del>	?BRV
72	TAILLAMP LOWER BRACKET RH	1	\$	89.80	\$	<del>89.80</del>	?NNX
73	TAILLAMP LH	1	\$	206.55	\$	<del>206.55</del>	?BRV
74	TAILLAMP LOWER BRACKET LH	1	\$	89.80	\$	<del>89.80</del>	?NNX
75	REAR WINDSCREEN MOULDING	2	\$	<i>68.50</i> <del>85.00</del>	\$ <i>137.00</i>	<del>170.00</del>	} NEC
76	REAR WINDSCREEN INNER SEAL	1	\$	58.50	\$ <i>40.00</i>	<del>58.50</del>	

3726.08

Parts Sub Total : \$ 12211.51 15,188.49

*5%* @ 20% Discount \$ 2442.30 759.42

PARTS TOTAL : \$ 9769.21 14,429.07

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$			
1	FRONT CENTRE GRILLE CLIPS	1	\$	50.00	\$ <i>30.00</i>	<del>50.00</del>	} NEC
2	FRONT BUMPER CLIPS	1	\$	50.00	\$ <i>30.00</i>	<del>50.00</del>	
3	FRONT NO PLATE WITH COVER	1	\$	100.00	\$ <i>50.00</i>	<del>100.00</del>	
4	FRONT BUMPER GRILLE CLIPS	1	\$	50.00	\$ <i>30.00</i>	<del>50.00</del>	
5	A/C CONDENSER FLUID	1	\$	50.00	\$	<del>50.00</del>	} NEC
6	RADIATOR COOLANT	1	\$	50.00	\$	<del>50.00</del>	
7	RADIATOR TOP HOSE CLIPS	1	\$	30.00	\$	<del>30.00</del>	} NEC
8	RADIATOR BOTTOM HOSE CLIPS	1	\$	30.00	\$	<del>30.00</del>	
9	FENDER INNER SHEILD CLIPS RH	1	\$	50.00	\$ <i>30.00</i>	<del>50.00</del>	
10	FENDER INNER SHEILD CLIPS LH	1	\$	50.00	\$ <i>30.00</i>	<del>50.00</del>	
11	FRONT WINDSCREEN SEALANT	1	\$	100.00	\$ <i>60.00</i>	<del>100.00</del>	
12	WINDSCREEN PRIMER AND CLEANER	1	\$	80.00	\$ <i>60.00</i>	<del>80.00</del>	NNX

450.00

13	TAILGATE INNER TRIM BOARD CLIPS	1	\$	50.00	\$ 30.00	50.00	} NEC
14	REAR END PANEL TOP GARNISH CLIPS	1	\$	50.00	\$ 30.00	50.00	
15	FRONT FENDER SEALANT RH	1	\$	80.00	\$ 60.00	80.00	} NEC
16	FRONT FENDER SEALANT LH	1	\$	80.00	\$ 60.00	80.00	
17	SPARE TYRE PANEL INSULATOR PAD	1	\$	189.50		189.50	? NNX
18	REAR BUMPER CLIPS	1	\$	50.00	\$ 30.00	50.00	NEC
19	REAR BUMPER REVERSE SENSOR	2	\$	DIN 250.00	\$ 250.00	500.00	
20	REAR BUMPER LOWER CLIPS	1	\$	50.00	\$ 30.00	50.00	NEC
21	REAR WINDSCREEN SEALANT	1	\$	100.00	\$ 60.00	100.00	
				910.00	<b>SPECIAL NETT TOTAL :</b>	\$ 910	1,839.50

Nos.	LABOUR					\$S
1	R&R A/C CONDENSER					\$ 120.00 150.00
2	R&R RADIATOR					\$ 120.00 150.00
3	R&R FRONT WINDSCREEN					\$ 120.00 200.00
4	R&R TAILGATE COMPONENT					\$ 50.00 100.00
5	R&R REAR WINDSCREEN					\$ 120.00 200.00
6	R&R REVERSE SENSOR					\$ 60.00 100.00
7	PANEL BEAT					\$ 1600.00 2,200.00
8	RUST PROOFING					\$ 120.00 250.00
9	SPRAY PAINTING					\$ 1,800.00
10	CHECK WIRING					\$ 50.00 80.00
					<b>LABOUR TOTAL :</b>	\$ 4,160.00 5,230.00

PARTS TOTAL : \$ 14,429.07  
 SPECIAL NETT TOTAL : \$ 1,839.50  
 LABOUR TOTAL : \$ 5,230.00  
**GRAND TOTAL : \$ 21,498.57**

Parts 9,767.51  
 SN 910.00  
 Labour 4,160.00  
 14,837.51  
 Lump Sum Repair @ 20% 2,967.50  
 Repair days 18 11,870.00

**LKK Auto Consultants** hence notify the Repairer of the following:  
 • To resurvey before/after spray painting  
 • To display damaged part(s) during resurvey  
 • Parts prices are subject to confirmation  
 • Third party survey is on a "Without Prejudice" basis  
 • No illegal modification(s) is allowed  
 • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company  
 Acknowledged by Repairer  
 Signature:  
 Date:

? Photo

Lump Sum Repair  
Repair days 18

22/2/19

Talim  
Min

L/S 11,800/2

SJE : \_\_\_\_\_  
 Date of Survey : \_\_\_\_\_  
 Date of ReSurvey: \_\_\_\_\_ **After-Paint:** \_\_\_\_\_  
 Contacts : \_\_\_\_\_

Vehicle Nos : **SJE 8346 E**  
 Model : \_\_\_\_\_  
 Year : \_\_\_\_\_  
 Chassis No : \_\_\_\_\_

**Supplementary Repor**

**\* AGREED Cost Of Repair and Repair Day/s with SJE \***

Amount: \_\_\_\_\_

Working Day: \_\_\_\_\_

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$
1	ENGINE MOUNTING	3	\$ 188.00	\$ 564.00
2	BATTERY BRACKET	1	\$ 68.00	\$ 68.00
3	BATTERY TRAY	1	\$ 138.00	\$ 138.00
4	GEAR BOX MOUNTING	1	\$ 238.00	\$ 238.00
<b>Amt</b>				\$ 1,008.00
20% <b>Discount(0.00%)</b>				\$ 201.60
<b>Subtotal</b>				\$ 806.40

BRV ✓  
 BTV ✓  
 BRV ✓  
 NECV ✓

Nos.	SPECIAL NETT ITEM	Qty	Unit S\$	TOTAL S\$
1	BATTERY	1	\$ 185.00	\$ 185.00
<b>TOTAL</b>				\$ 185.00

DIS ✓

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature: \_\_\_\_\_  
 Date: \_\_\_\_\_

> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	2978H
Vehicle Details	
Vehicle No.:	SJEB346E
Vehicle to be Exported:	No
Intended Deregistration Date:	25 Feb 2019
Vehicle Make:	HONDA
Vehicle Model:	FIT 1.3G SKYROOF A
Primary Colour:	Red
Manufacturing Year:	2008
Engine No.:	L13A4075655
Chassis No.:	GE61066495
Maximum Power Output:	73.0 kW (97 bhp)
Open Market Value:	\$12,848.00
Original Registration Date:	09 May 2008
First Registration Date:	09 May 2008
Transfer Count:	2
Actual ARF Paid:	\$14,133.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	08 May 2028
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
PQP Paid:	\$38,192.00
COE Rebate Amount:	\$35,144.00
<b>Total Rebate Amount:</b>	<b>\$35,144.00</b>

The information contained herein is correct as at 25 Feb 2019

OK

MV 47,000/2  
 PV 35,144/2  
 NV 11,856/2

Rim  
 25/2/19

	<b>Honda Fit 1.3A G Skyroof (New 5-yr COE)</b>	<b>\$28,800</b>	\$5,760 /yr	06-Feb-2009	1,339 cc	96,000 km	Hatchback	Available
COE Specialist With 100% Loan Approval! Additional 6 Months Warranty And Road Tax For You! Priced Lowest In The Market! Superbly Well Maintained By Previous Car Enthusiast Owner! Call Us Now To Book A...								
Photo: 03-Feb-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (New 10-yr COE)</b>	<b>\$45,800</b>	\$4,580 /yr	17-Feb-2009	1,339 cc	67,000 km	Hatchback	Available
AA Trust Certified Quality D1 Owner Vehicle! Extremely Well Maintained By 1 Owner Only! Low Fuel Consumption! Low Maintenance Cost! Smooth And Responsive Engine And Yet Packs A Punch! The Most Spaciou...								
AA Trust Automotive Photo: 01-Feb-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (COE till 05/2028)</b>	<b>\$48,000</b>	\$5,180 /yr	30-May-2008	1,339 cc	108,000 km	Hatchback	Available
Honda's Signature Compact And Nimble VTEC Hatchback In Factory Black Exterior And Red On Black Leather Upholstery. Buy With A Peace Of Mind, Always Parked Under Shelter, Regularly Serviced At Reputabl...								
Master Motors Pte Ltd Photo: 01-Feb-2019 Tags: 2008 Honda Fit, 2008 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (New 5-yr COE)</b>	-	N.A	23-Jan-2009	1,339 cc	-	Hatchback	<b>SOLD</b>
Well Kept And Maintained By Careful Owner! Fuel Efficient, Sporty Outlook, Yet Spacious Interior! View It Yourself! Financing Available! Monthly Installment From \$500! In House Loan Packages Available...								
Universe Motoring Photo: 21-Jan-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (New 5-yr COE)</b>	-	N.A	22-Jan-2009	1,339 cc	-	Hatchback	<b>SOLD</b>
Monthly Payment Of \$520, New 5 Years COE, (2 Owners Only) Showroom Condition Guaranteed! Price Include New Paintwork/ New Leather Seat/ New Sports Rims) Come With 6 Months Engine And Gearbox Warranty, All ...								
Car World Automobile Photo: 11-Jan-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (COE till 02/2024)</b>	-	N.A	02-Feb-2009	1,339 cc	-	Hatchback	<b>SOLD</b>
Sleek Black Honda Fit! New 5 Years COE. Low Mileage Done. Regularly Serviced And Maintained. Low Monthly Repayment. Loan Options Available. New Paint/Road Tax. Best Selling, Reliable, Spacious 1.3L Ha...								
Prestige Photo: 09-Jan-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G Skyroof (New 5-yr COE)</b>	<b>\$33,800</b>	\$6,760 /yr	11-Feb-2009	1,339 cc	116,050 km	Hatchback	Available
Drive Away These Beautiful Blue Honda Fit At Only \$2000! Insurance Can Be Paid By Credit Card Or By Giro x 12 Months Instalments. No Gimmicks, Call Us For Viewing Now.								
Adminstrating.sg Photo: 08-Jan-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								
	<b>Honda Fit 1.3A G (New 10-yr COE)</b>	<b>\$39,800</b>	\$3,980 /yr	14-Feb-2009	1,339 cc	130,000 km	Hatchback	Available
Photo: 30-Jan-2019 Tags: 2009 Honda Fit, 2009 honda fit, Honda Fit, honda fit, Honda, Fit, fit, Used Honda								

Save this search criteria, to get email alerts whenever a match is found.

Filter:  Found:  Price:  Depreciation:  Reg Date:  Eng Cap:  Mileage:  Veh Type:  Status:

For old advertisements, view Expired ads

◀ Back ( 1 2 3 4 ) Next ▶

100 results/page

[Home](#) [New Cars](#) [Used Cars](#) [Sell My Car](#) [Directory](#) [Products](#) [Insurance](#) [Article](#) [Forum](#) [Resources](#)

sgCarMart is the number one car classified for localized import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or motorbikes, SUV, MPV, hatchback, 3rd COE cars & CPC cars. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, cars & car insurance. Find buy used honda, Honda Singapore, used Honda Singapore, used Honda, used vehicles Singapore or even buy used Honda Singapore. We have new car dealers.com & car importers, authorized car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for S jobs, real estate properties for sale, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

All prices listed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

© 2019

### MOTORCAR (Rear)

Rear Portion

Vehicle No: SJE 834GE

NAC	INC	Item	CON	AC	Qty
1137	993626	Rear Number Plate	BT	✓	
1138	993627	Rear Number Plate Base			
1139	993630	Rear Number Plate Garnish			
1140	993632	Rear Number Plate Lamp			
1141	992958	Rear Bumper	NG		
1142	993085	Rear Bumper Upper			
1143	993017	Rear Bumper Lower			
1144	993054	Rear Bumper Side			
1145	993103	Rear Bumper Tow Cover			
1146	992341	Rear Bumper Clips	NG		
1147	992976	Rear Bumper Bracket			
1148	993068	Rear Bumper Side Retainer	NG		
1149	993045	Rear Bumper Reinforcement			
1150	992970	Rear Bumper Beam			
1151	993077	Rear Bumper Sponge			
1152	992999	Rear Bumper Damper			
1153	993040	Rear Bumper Protector			
1154	993036	Rear Bumper Pad			
1155	993026	Rear Bumper Moulding			
1156	993044	Rear Bumper Reflector			
1157	993023	Rear Bumper Lower Spoiler			
1158	994023	Reverse Sensor	BT	✓	
1159	993327	Rear End Panel	DP	✓	
1160	993339	Rear End Panel Top Garnish	DP	✓	
1161	993333	Rear End Panel Inner Trim			
1162	990333	Boot Compartment Inner Trim			
1163	993851	Rear LH Taillamp	NG		
1164	993853	Rear LH Taillamp Garnish			
1165	993859	Rear LH Taillamp Panel			
1166	995116	Rear RH Taillamp	NG		
1167	993853	Rear RH Taillamp Garnish			
1168	993859	Rear RH Taillamp Panel			
1169	993554	Rear Apron Panel			
1170	992895	Bootlid			
1171	991328	Bootlid Emblem			
1172	990356	Bootlid Handle			
1173	995250	Bootlid Moulding			
1174	990376	Bootlid Reflector			
1175	995222	Bootlid Lamp LH			
1176	992899	Bootlid Lamp RH			
1177	995243	Bootlid Lock			
1178	990377	Bootlid Rubber			
1179	990382	Bootlid Hinge			
1180	993877	Bootlid Spoiler			
1181	994543	Tailgate	DP	✓	
1182	991328	Tailgate Emblem	NG	✓	
1183	994643	Tailgate Outer Handle			
1184	994640	Tailgate Moulding			
1185	994545	Tailgate Garnish			
1186	994648	Tailgate Reflector			
1187	994549	Tailgate Lamp	NG	✓	
1188	994646	Tailgate Protector			
1189	994676	Tailgate Wiper Arm			
1190	994677	Tailgate Wiper Blade			
1191	994679	Tailgate Wiper Nozzle			
1192	994555	Tailgate Wiper Motor			
1193	994602	Tailgate Glass			
1194	994606	Tailgate Glass Rubber	NG	✓	
1195	994604	Tailgate Glass Moulding	NG	✓	
1196	994607	Tailgate Glass Sealant	NG	✓	
1197	994629	Tailgate Lock	BT	✓	
1198	994651	Tailgate Rubber	CU	✓	
1199	994611	Tailgate Hinge	BT	✓	
1200	994594	Tailgate Damper			
1201	994613	Tailgate Inner Board	BR	✓	

NAC	INC	Item	CON	AC	Qty
1202	993784	Spare Tyre Board			
1203	994328	Spare Tyre Panel			
1204	995065	Spare Tyre			
1205	994326	Spare Tyre Lock Screw			
1206	993787	Spare Tyre Cover			
1207	995323	Triangle Breakdown Sign			
1208	990507	CD Changer Assy			
1209	990164	Antenna			
1210	990534	Centre Exhaust Pipe Assy	BT	✓	
1211	990532	Centre Exhaust Mounting			
1212	993364	Rear Exhaust Pipe			
1213	993357	Rear Exhaust Chrome Pipe			
1214	993361	Rear Exhaust Mounting	NG	✓	
1215	993358	Rear Exhaust Heat Shield			
1216	995223	Rear LH Chassis Member			
1217	993165	Rear RH Chassis Member			
1218	993436	Rear LH Fender			
1219	993449	Rear LH Fender Protector			
1220	993420	Rear LH Fender Inner Panel			
1221	993431	Rear LH Fender Inner Trim			
1222	993415	Rear LH Fender Inner Garnish			
1223	993425	Rear LH Fender Inner Shield			
1224	993621	Rear LH Mudflap			
1225	993933	Rear LH Wheel Rim			
1226	994025	Rear LH Rim Cover			
1227	995065	Rear LH Tyre			
1228	993456	Rear RH Fender			
1229	993450	Rear RH Fender Protector			
1230	993420	Rear RH Fender Inner Panel			
1231	993431	Rear RH Fender Inner Trim			
1232	993415	Rear RH Fender Inner Garnish			
1233	993425	Rear RH Fender Inner Shield			
1234	993622	Rear RH Mudflap			
1235	993934	Rear RH Wheel Rim			
1236	994025	Rear RH Rim Cover			
1237	995065	Rear RH Tyre			
1238	995162	Rear Fender Extension Panel LH			
1239	993401	Rear Fender Extension Panel RH			
1240	993430	Rear Fender Inner Top Garnish			
1241	993673	Rear Fender 1/4 Glass			
1242	993452	Rear Fender 1/4 Glass Rubber			
1243	993453	Rear Fender 1/4 Glass Sealant			
1244	993949	Rear Windscreen Glass			
1245	993976	Rear Windscreen Rubber	NG	✓	
1246	993961	Rear Windscreen Moulding	NG	✓	
1247	993955	Rear Windscreen Sealant	NG	✓	
1248	994729	Third Brake Light			
1249	993385	Rear Fender Air Grille			
1250	992167	Fuel Lid			
1251	992168	Fuel Neck			
1252	992179	Fuel Tank			
1253	992184	Fuel Tank Bracket			
1254	992191	Fuel Tank Float			
1255	990247	Sticker			

**MOTOR CAR (Frt)**

Vehicle No: **SJE 8346E**

**Front Portion**

NAC	INC	Item	CON	AC	Qty
1001	991886	Frt Number Plate			
1002	991887	Frt Number Plate Base			
1003	991889	Frt Number Plate Garnish			
1004	991300	Frt Bumper			
1005	992341	Frt Bumper Clips			
1006	991325	Frt Bumper Bracket			
1007	991462	Frt Bumper Side Retainer			
1008	991433	Frt Bumper Reinforcement			
1009	991318	Frt Bumper Beam			
1010	991468	Frt Bumper Sponge			
1011	991427	Frt Bumper Protector			
1012	991420	Frt Bumper Pad			
1013	991363	Frt Bumper Grille	BK	V	
1014	991301	Frt Bumper Moulding			
1015	991407	Frt Bumper Lower Spoiler			
1016	991438	Frt Bumper Sensor			
1017	995100	Frt LH Bumper Fog Lamp Cover			
1018	991355	Frt RH Bumper Fog Lamp Cover			
1019	995079	Frt LH Bumper Fog Lamp			
1020	995080	Frt RH Bumper Fog Lamp			
1021	991793	Frt Grille	BR	V	
1022	991328	Frt Grille Emblem	NEC	V	
1023	991799	Frt Grille Chrome Moulding			
1024	991222	Frt Apron Panel			
1025	992013	Frt Support Panel	CR	V	
1026	992025	Frt Support Panel Top Garnish Cover	CR	V	
1027	992416	Horn	CR	V	
1028	991277	Frt Brace Panel			
1029	995153	Frt LH Headlamp Assy	BR	V	
1030	991821	Frt RH Headlamp Assy	BR	V	
1031	995088	Frt LH Side Lamp			
1032	995089	Frt RH Side Lamp			
1033	990248	Bonnet			
1034	991328	Bonnet Emblem	CR	V	
1035	990287	Bonnet Lock	BT	V	
1036	990285	Bonnet Insulator	NEC	V	
1037	990273	Bonnet Hinge	NEC	V	
1038	990261	Bonnet Damper			
1039	990305	Bonnet Rubber	CR	V	
1040	990252	Bonnet Cable	BT	V	
1041	990311	Bonnet Stand			
1042	990119	Air Con Condenser	BT	V	
1043	990122	Air Con Fan Assy	BR	V	
1044	990134	Air Con Suction Pipe (Low Pressure)			
1045	990118	Air Con Suction Hose	CR	V	
1046	990133	Air Con Discharge Pipe (High Pressure)			
1047	990114	Air Con Discharge Hose			
1048	990149	Air Con Liquid Pipe			
1049	995066	Air Con Receiver Drier			
1050	990111	Air Con Compressor Assy			
1051	995294	Air Con Belt			
1052	995074	Radiator	BT	V	
1053	992738	Radiator Cowling			
1054	992742	Radiator Fan Assy	CR	V	
1055	992745	Radiator Fan Clutch			
1056	992758	Radiator Hose Top			
1057	992757	Radiator Hose Bottom			
1058	992741	Radiator Expansion Tank	CR	V	
1059	990151	Air Duct	BR	V	
1060	990070	Air Cleaner Assy			
1061	990056	Air Cleaner Hose			
1062	990089	Air Cleaner Resonator			
1063	991712	Frt Exhaust Manifold			
1064	991713	Frt Exhaust Manifold Cover			
1065	991054	Frt Exhaust Manifold Sensor (Oxygen)			
1066	991714	Front Exhaust Pipe	BT	V	
1067	990219	Battery	CR	V	
1068	990224	Battery Cover			
1069	990223	Battery Bracket	BT	V	
1070	990229	Battery Tray	CR	V	

NAC	INC	Item	CON	AC	Qty
1071	992205	Fuse Box			
1072	994011	Relay Box			
1073	995053	Wiper Washer Tank	BR	V	
1074	995052	Wiper Washer Tank Motor	BR	V	
1075	990159	Alternator Assy			
1076	990160	Alternator Belt			
1077	992688	Power Steering Pump			
1078	992669	Power Steering Belt			
1079	994431	Power Steering Cooler Pipe			
1080	992692	Power Steering Hose			
1081	990010	ABS Pump Control Unit			
1082	990427	Brake Master Pump Assy			
1083	990403	Brake Booster Pump Assy			
1084	991005	Engine Top Cover			
1085	991011	Engine Under Cover			
1086	990946	Engine Mounting			
1087	990949	Engine Mounting Frt	NEC	V	
1088	990950	Engine Mounting LH	NEC	V	
1089	990952	Engine Mounting RH	BA	V	
1090	990951	Engine Mounting Rear	NEC	V	
1091	992234	Gear Box Mounting	NEC	V	
1092	991520	Frt LH Chassis Member			
1093	991520	Frt RH Chassis Member			
1094	990728	Frt Vertical Cross Member			
1095	991863	Frt Lower Cross Member			
1096	995070	Frt LH Fender	CR	V	
1097	995072	Frt LH Fender Inner Panel			
1098	995147	Frt LH Fender Lamp			
1099	995148	Frt LH Fender Protector			
1100	991740	Frt LH Fender Inner Shield	TR	V	
1101	995179	Frt LH Mudflap			
1102	995170	Frt LH Wheel Rim			
1103	994025	Frt LH Rim Cover			
1104	995065	Frt LH Tyre			
1105	995071	Frt RH Fender	CR	V	
1106	991739	Frt RH Fender Inner Panel			
1107	991744	Frt RH Fender Lamp			
1108	991752	Frt RH Fender Protector			
1109	991740	Frt RH Fender Inner Shield	TR	V	
1110	991884	Frt RH Mudflap			
1111	992087	Frt RH Wheel Rim			
1112	994025	Frt RH Rim Cover			
1113	995065	Frt RH Tyre			
1114	992093	Frt Windscreen Glass			
1115	992117	Frt Windscreen Rubber			
1116	992108	Frt Windscreen Moulding	NEC	V	
1117	992098	Frt Windscreen Sealant			
1118	991019	ERP Bracket			
1119	991020	ERP Unit			
1120	992140	Frt Wiper Arm			
1121	992142	Frt Wiper Blade			
1122	995045	Wiper Panel Garnish			
1123	991126	Firewall Panel			
1124	990753	Dashboard Assy			
1125	992282	Glove Box Cover			
1126	992281	Glove Box Compartment			
1127	994483	Steering Wheel Airbag			
1128	994485	Steering Wheel Airbag Sensor			
1129	990749	Dashboard Airbag			
1130	990750	Dashboard Airbag Sensor			
1131	990029	Airbag Control Unit			
1132	990864	Frt Driver Seat			
1133	991922	Frt RH Seat Belt Assy			
1134	991899	Frt Passenger Seat			
1135	995182	Frt LH Seat Belt Assy			
1136	990247	Sticker			

**- Pre repair inspection request - SJE8346E VS SKE7310C (OI) DOA 15/02/2019**

From: Mithoosingh, Aashweenjeetkaur  
To: admin-a@lkkauto.com, assignments@lkkauto.com  
Cc: Fong, Andy-SY, Chin, Lee-Ying, Abu Kassim, Noor Mariesa, Lim, Sheng Yang, Chan, Yoke Shi, Kaur, Baljit, Hor, Yinrul, Azlan, Syazairdina  
Sent: 22/2/2019 10:15:58 AM  
Attachments:  20\_SJE8346E\_SKE7310C\_150219.pdf

Hi,

Please refer to the enclosed request from **Team AutoPro Pte Ltd.**

Claim no : 1042224501SG003  
Case Owner : LOH CHEE HENG

If you have any queries/concerns, please let us know.

Thanks and regards,

Aashweenjeet Kaur (Aashween)  
AIG  
Express Claims Adjuster II  
SG Claims Operations | AIG Shared Services

10:57am @ 22/2/2019  
vehicle in  
person @ adel  
from Mr. Lim

---

**From:** teamautopl@gmail.com [mailto:teamautopl@gmail.com]  
**Sent:** Friday, February 22, 2019 9:47 AM  
**To:** Mithoosingh, Aashweenjeetkaur  
**Cc:** Fong, Andy-SY; Chin, Lee-Ying; Abu Kassim, Noor Mariesa; Lim, Sheng Yang; Chan, Yoke Shi; Kaur, Baljit; Hor, Yinrul  
**Subject:** RE: - PRE-REPAIR INSPECTION - ACCIDENT INVOLVING OUR INSURED VEHICLE SKE7310C AND SJE8346E ON 15/02/2019

Dear Sirs,

With reference to your list of surveyors, we are agreeable with the appointment of **Mr Lim - LKK Auto Consultants Pte Ltd** as the SJE for subject claim.

Kindly note our personnel in charge for the survey as follows:-

Contact Person	Alan Koh	9092 7279
	Frederick Lim	9674 6635

Email [teamautopl@gmail.com](mailto:teamautopl@gmail.com)  
Address

Survey  
Address 8 Kaki Bukit Ave 4 #06-21, Premier @ Kaki Bukit (S' 415875)

Thank you for your kind attention to our request.

--

Cheers,  
Adel

---

**From:** Mithoosingh, Aashweenjeetkaur  
**Sent:** Fri, 22 Feb 2019 00:56:18 +0000  
**To:** teamautopl@gmail.com  
**Cc:** Fong, Andy-SY, Chin, Lee-Ying, Abu Kassim, Noor Mariesa, Lim, Sheng Yang, Mithoosingh, Aashweenjeetkaur, Chan, Yoke Shi, Kaur, Baljit, Hor, Yinrul  
**Subject:** - PRE-REPAIR INSPECTION - ACCIDENT INVOLVING OUR INSURED VEHICLE SKE7310C AND SJE8346E ON 15/02/2019

Without Prejudice

Your Reference : SJE8346E  
Our Reference : 1042224501SG003

Dear Sir/Madam,

We refer to your Notice of Accident of even date.

We intend to conduct a pre-repair survey of the damage to your client's/your customer's vehicle jointly with your client/your motor workshop. We propose to use one of the motor surveyors named in the attached list to conduct the joint pre-repair survey as a single joint expert.

Name of Surveyor	Company Name
AIG In House Surveyor	AIG Asia Pacific Insurance Pte Ltd
Lawrence Ng Chun Kee	Priority Services
Jeffrey Ong Leng Kiat	Priority Services
Jimmy Lee	Priority Services
EC Looi	Automobile Inspection Services Pte Ltd
Pang Kiah Keen (Frankie)	Formteam Adjusters Pte Ltd
Ng You Han	Formteam Adjusters Pte Ltd
Soon HanXin (Gary)	Formteam Adjusters Pte Ltd
Chow Bo Xiong	Formteam Adjusters Pte Ltd
Chua Soo Teck (Benjamin)	Formteam Adjusters Pte Ltd
Kalvin Ang	LKK Auto Consultants Pte Ltd
Xing Guo Qiang	LKK Auto Consultants Pte Ltd
Marcus Chua	LKK Auto Consultants Pte Ltd
Mohamad Taufikh	LKK Auto Consultants Pte Ltd
Adrian Ling	LKK Auto Consultants Pte Ltd
Mohammed Rasul	LKK Auto Consultants Pte Ltd
Kenneth Kong	LKK Auto Consultants Pte Ltd

Please let us know within two (2) working days whether you agree to the appointment of any of these motor surveyors as a single joint expert. You may select one or more of the listed motor surveyors. We will bear the cost of the pre-repair survey carried out by the single joint expert.

Thanks and regards,

Aashweenjeet Kaur (Aashween)  
AIG  
Express Claims Adjuster II  
SG Claims Operations | AIG Shared Services

---

**From:** TeamAutoPro North [mailto:teamautopl@gmail.com]

**Sent:** Thursday, February 21, 2019 4:48 PM

**To:** Chan, Yoke Shi; Chin, Lee-Ying; Fong, Andy-SY; Kaur, Baljit; Lim, Sheng Yang; Md Ishak, Mohd Imran; Abu Kassim, Noor Mariesa; Supramaniam, Darshene; Tan, Lily (AIG)

**Subject:** 2 Days Notice: SJE 8346E (Our Ref) and SKE 7310C (Your Ref) Dated 15 February 2019

Dear Sir/Madam,

**Road Traffic Accident Involving SJE 8346E (Our Ref) and SKE 7310C (Your Ref)**

**Dated 15 February 2019, Time around 21:50**

**@ CTE towards Braddell (After Exit 10)**

---

We represent our client; Wee Chong Kiat, Daryl, to notify you of the aforesaid road traffic accident involving our client's vehicle registration number: SJE 8346E and your insured's vehicle registration number: SKE 7310C.

Enclosed herewith a copy of our 2 Days Notice Letter and the relevant Singapore Accident Statement filed for your reference.

Please let us know within **2 working days** from today, your list of at least **ten (10) motor surveyors, via email to the following personnel:-**

<b>Contact Person</b>	Alan Koh Frederick Lim	9092 7279 9674 6635
<b>Email Address</b>	teamautopt@gmail.com	
<b>Survey Address</b>	8 Kaki Bukit Ave 4 #06-21, Premier @ Kaki Bukit (S' 415875)	

Thank you for your attention to this email and we look forward to your earliest reply.

--

\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

Cheers,

Adel

**Team AutoPro Pte Ltd**

Tel: 6258 1955

Fax: 6258 1956

385 Sin Ming Drive

#01-02 Vicom Inspection Centre

Singapore 575718

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

## Khanchna (LKK Auto)

---

**From:** Khanchna (LKK Auto)  
**Sent:** Friday, 12 July 2019 11:22 AM  
**To:** teamautopl@gmail.com  
**Cc:** teamautooffice@gmail.com; Admin A  
**Subject:** YOUR REF: SJE8346E [MVA BETWEEN SKE7310C & SJE8346E ON 15/2/2019]

Tracking:	Recipient	Delivery
	teamautopl@gmail.com	
	teamautooffice@gmail.com	
	Admin A	
	shupeil@lkkauto.com	Delivered: 12/7/2019 11:22 AM
	Meikwan@lkkauto.com	Delivered: 12/7/2019 11:22 AM
	olivialau@lkkauto.com	Delivered: 12/7/2019 11:22 AM

Our ref: CC4/AIG19003387/Bka3

### Without Prejudice

Dear Sirs/Mdm,

Thank you for your patience.

For COR, recommended amount at **L/S \$11,800.00(before GST)** with **18 repair days**.

\*\* Kindly forward your LOD with all the relevant documents(je: final repair bill, authorisation to act, rental receipt) **to us (LKK)** for our necessary action.

Please note that all the finalisation subject to insurer approval.

**"Kindly note that this negotiation between parties on this matter is purely on a without prejudice basis with the sole intention of resolving the matter amicably without parties resorting to legal proceedings. No admission of liability, whatsoever, should be deemed / inferred from this negotiation of terms/settlement.**

**In the event of new evidence being discovered or subsequently produced by either party that will materially affect/influence on the issues of liability/damages, either party is not bound, thereafter, by the negotiation terms/settlement."**

Best Regards,  
Khanchna | Case Handler  
LKK Auto Consultants Pte Ltd  
DID: 6841 2360 | email: [Khanchna@lkkauto.com](mailto:Khanchna@lkkauto.com) | Fax: 6741-4108  
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

## Khanchna (LKK Auto)

---

**From:** Khanchna (LKK Auto)  
**Sent:** Monday, 16 September 2019 4:05 PM  
**To:** TeamAuto Pro  
**Cc:** Admin A  
**Subject:** RE: LOD - Our Ref: SJE 8346E and Your Ref: SKE 7310C (AIG) / DOA: 15-02-2019

Tracking:	Recipient	Delivery
	TeamAuto Pro	
	Admin A	
	olivialau@lkkauto.com	Delivered: 16/9/2019 4:05 PM
	Meikwan@lkkauto.com	Delivered: 16/9/2019 4:05 PM
	shupei@lkkauto.com	Delivered: 16/9/2019 4:05 PM

Your Ref: SJE 8346E

Our Ref: CC4/AIG19003387/Bka3

Without Prejudice

Dear Sirs/Mdm,

We refer to the above matter.

We propose settlement as follows:

1. Cost of Repair	\$ 11,800.00
2. Loss of Use (22 days x \$ 60)	\$ 1,320.00
3. Disbursement (Towing + 3 <sup>rd</sup> party Report fee)	\$ 147.00
<b>Total</b>	<b>\$ 13,267.00</b>

Please confirm acceptance.

"Kindly note that this negotiation between parties on this matter is purely on a without prejudice basis with the sole intention of resolving the matter amicably without parties resorting to legal proceedings. No admission of liability, whatsoever, should be deemed / inferred from this negotiation of terms/settlement.

In the event of new evidence being discovered or subsequently produced by either party that will materially affect/influence on the issues of liability/damages, either party is not bound, thereafter, by the negotiation terms/settlement."

Best Regards,  
**Khanchna** | Case Handler  
**LKK Auto Consultants Pte Ltd**

## Khanchna (LKK Auto)

---

**From:** TeamAuto Pro <teamautooffice@gmail.com>  
**Sent:** Monday, 23 September 2019 1:34 PM  
**To:** Khanchna (LKK Auto)  
**Cc:** Admin A  
**Subject:** Re: LOD - Our Ref: SJE 8346E and Your Ref: SKE 7310C (AIG) / DOA: 15-02-2019

Dear Khanchna,

**Without Prejudice**

Pertaining to our email dated 18-09-2019, we are still pending your DV.

--  
\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

---

Cheers,  
Adel  
Team AutoPro Pte Ltd  
Tel: 6258 1955  
Fax: 6258 1956

**(Newly Shifted) Main Office:** 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722  
**Workshop/Survey Venue:** 160 Sin Ming Dr, #01-14 Sin Ming AutoCity Singapore 575722

On Wed, Sep 18, 2019 at 3:02 PM TeamAuto Pro <teamautooffice@gmail.com> wrote:  
Dear Khanchna,

**Without Prejudice**

For the sake of an amicable settlement, we are pleased to confirm our acceptance to your PD offer as follows:-

1. Cost of Repair	\$ 11,800.00
2. Loss of Use (22 days x \$ 60)	\$ 1,320.00
3. Disbursement (Towing + 3 <sup>rd</sup> party Report fee)	\$ 147.00
<b>Total</b>	<b>\$ 13,267.00</b>

Thank you and we await your DV for our further necessary.

**Note:** Our client's acceptance of your offer is strictly on a without admission to liability basis and solely for our client's claim for Property Damage and not prejudicial to any other claims arising from the same accident.

--  
\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

DID: 6841 2360 | email: [Khanchna@lkkauto.com](mailto:Khanchna@lkkauto.com) | Fax: 6741-4108  
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

**From:** TeamAuto Pro <teamautooffice@gmail.com>  
**Sent:** Friday, 12 July 2019 5:58 PM  
**To:** Khanchna (LKK Auto) <khanchna@lkkauto.com>  
**Subject:** LOD - Our Ref: SJE 8346E and Your Ref: SKE 7310C (AIG) / DOA: 15-02-2019

BY EMAIL

**WITHOUT PREJUDICE**

Our Ref: SJE 8346E  
Your Ref: SKE 7310C

Dear Khanchna,

**Accident Involving:** SJE 8346E and SKE 7310C  
**Date of Accident:** 15 February 2019  
**Location of Accident:** CTE towards Braddell (After Exit 10)

We refer to the above-mentioned accident and hereby submit our claim as below, with the relevant documents attached.

Cost of Repair as agreed	\$ 11,800.00
Add Loss of Use	\$ 1,760.00 22 Days @ \$80/day 2 Days PRS + 18 Repair Days Agreed + 2 Sunday
<b>Total</b>	<b>\$ 13,560.00</b>
Add Towing Fee	\$ 90.00
Add 3rd Party Report Fee	\$ 57.00
<b>GRAND TOTAL</b>	<b>\$ 13,707.00</b>

Please feel free to contact us if you have any query otherwise kindly pay the Grand Total Amount to :

**Team AutoPro Pte Ltd**  
160 Sin Ming Drive #01-14  
Sin Ming AutoCity  
Singapore 575722

Thank you.

--  
\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

-----  
Cheers,  
Adel  
**Team AutoPro Pte Ltd**  
Tel: 6258 1955  
Fax: 6258 1956

**(Newly Shifted) Main Office:** 160 Sin Ming Dr, #01-14 Sin Ming AutoCity Singapore 575722  
**Reporting Centre:** 385 Sin Ming Drive #01-02 Vicom Inspection Centre Singapore 575718

----- **Forwarded message** -----

From: **TeamAutoPro North** <[teamautopl@gmail.com](mailto:teamautopl@gmail.com)>

Date: Fri, Feb 22, 2019 at 1:06 PM

Subject: Re: 2 Days Notice: SJE 8346E (Our Ref) and SKE 7310C (Your Ref) Dated 15 February 2019

To: Chan, Yoke Shi <[yokeshi.chan@aig.com](mailto:yokeshi.chan@aig.com)>, Chin, Lee-Ying <[Lee-Ying.Chin@aig.com](mailto:Lee-Ying.Chin@aig.com)>, Fong, Andy-SY <[Andy-SY.Fong@aig.com](mailto:Andy-SY.Fong@aig.com)>, Kaur, Baljit <[Baljit.Kaur@aig.com](mailto:Baljit.Kaur@aig.com)>, Lim, Sheng Yang

<[ShengYang.Lim@aig.com](mailto:ShengYang.Lim@aig.com)>, Md Ishak, Mohd Imran <[Imran.Ishak@aig.com](mailto:Imran.Ishak@aig.com)>, Noor Mariesa

<[NoorMariesa.AbuKassim@aig.com](mailto:NoorMariesa.AbuKassim@aig.com)>, Supramaniam, Darshene <[Darshene.Supramaniam@aig.com](mailto:Darshene.Supramaniam@aig.com)>, Tan,

Lily (AIG) <[Lily.Tan@aig.com](mailto:Lily.Tan@aig.com)>

Cc: <[admin-d@lkkauto.com](mailto:admin-d@lkkauto.com)>

Dear Sir,

Kindly ignore my earlier sent email, we have further spoke to LKK and have agreed on SJE.

Case to proceed as direct settlement.

--

\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

-----  
Cheers,

Michelle Lim

**Team AutoPro Pte Ltd**

Tel: 6258 1955

Fax: 6258 1956

385 Sin Ming Drive

#01-02 Vicom Inspection Centre

Singapore 575718

On Fri, Feb 22, 2019 at 12:36 PM TeamAutoPro North <[teamautopl@gmail.com](mailto:teamautopl@gmail.com)> wrote:

Dear Sir,

We had earlier confirmed our choice SJE as Mr Lim of LKK through your email link.

LKK had contacted us and advised that Mr Lim is not available. Since we are not able to have a mutual agreement on SJE, we will have no choice but have to appoint our own surveyor and have this claim proceed for lawyer settlement.

Please continue to send your independent surveyor for your required survey while we appoint our own surveyor.

Thank you.

--

\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

---

Cheers,  
Michelle Lim  
**Team AutoPro Pte Ltd**  
Tel: 6258 1955  
Fax: 6258 1956

385 Sin Ming Drive  
#01-02 Vicom Inspection Centre  
Singapore 575718

**- PRE-REPAIR INSPECTION - ACCIDENT INVOLVING OUR INSURED VEHICLE SKE7310C  
AND SJE8346E ON 15/02/2019**

Inbox



**Mithoosingh, Aashweenjeetkaur**

to me, Andy-SY, Lee-Ying, Noor, Sheng, Aashweenjeetkaur, Yoke, Baljit, Yinrul



Thai  
English

Translate message

Turn off for: Thai

**Error! Filename not specified.**

**Error! Filename not specified.**

This is a secure, encrypted message. To read it, open the attachment.

这是安全加密信息 · 如要阅读此信息 · 请开启附件。

นี่คือการรักษาความปลอดภัยกับข้อความที่เข้ารหัสลับ  
เพื่ออ่านมันให้เปิดไฟล์ที่แนบมา

이것은 안전하고 암호화된 메시지입니다. 그것을 읽으려면  
첨부 파일을 엽니다.

Ini adalah pesan, aman terenkripsi. Untuk membacanya, membuka  
attachment.

[Click here](#) by 2019-03-01 08:56 +08 to read your message.  
After that, open the attachment.

[More info](#)

Disclaimer: This email and its content are confidential and intended solely for the use of the addressee. Please notify the sender if you have received this email in error or simply delete it.

Secured by Proofpoint Encryption, Copyright © 2009-2017 Proofpoint, Inc. All rights reserved.

#### Attachments area

On Thu, Feb 21, 2019 at 4:48 PM TeamAutoPro North <[teamautop1@gmail.com](mailto:teamautop1@gmail.com)> wrote:

Dear Sir/Madam,

**Road Traffic Accident Involving SJE 8346E (Our Ref) and SKE 7310C (Your Ref)  
Dated 15 February 2019, Time around 21:50  
@ CTE towards Braddell (After Exit 10)**

We represent our client; Wee Chong Kiat, Daryl, to notify you of the aforesaid road traffic accident involving our client's vehicle registration number: SJE 8346E and your insured's vehicle registration number: SKE 7310C.

Enclosed herewith a copy of our 2 Days Notice Letter and the relevant Singapore Accident Statement filed for your reference.

Please let us know within **2 working days** from today, your list of at least **ten (10) motor surveyors**, **via email to the following personnel**:-

<b>Contact Person</b>	Alan Koh Frederick Lim	9092 7279 9674 6635
<b>Email Address</b>	<a href="mailto:teamautopl@gmail.com">teamautopl@gmail.com</a>	
<b>Survey Address</b>	8 Kaki Bukit Ave 4 #06-21, Premier @ Kaki Bukit (S' 415875)	

Thank you for your attention to this email and we look forward to your earliest reply.

--

\*The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.\*

---

Cheers,  
Adel  
**Team AutoPro Pte Ltd**  
Tel: 6258 1955  
Fax: 6258 1956

385 Sin Ming Drive  
#01-02 Vicom Inspection Centre  
Singapore 575718

## Certificate of Insurance

MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)  
 MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) RULES, 1960  
 ROAD TRANSPORT ACT, 1987 (MALAYSIA)  
 MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

Certificate/Policy Number : DMPG18001774  
 Vehicle Registration Number : SJE6346E  
 Cover Type : Superior Comprehensive  
 Policy Type : Private Car  
 Name of Policyholder/Insured : WEE CHONG KIAT, DARYL  
 Commencement Date of Insurance : 24/05/2018  
 Expiry Date of Insurance : 23/05/2019  
 Excess :  
 EXCESS: (SECTION I)..... S\$ 500.00  
 ADD'L EXCESS: UNNAMED DRIVERS (SECTION I)... S\$ 500.00  
 ADD'L EXCESS: NON-AUTH WORKSHOPS (SECTION I) S\$ 300.00  
 EXCESS: WINDSCREEN S\$ 100.00  
 YOUNG & INEXP DRIVERS (SECTION I) S\$ 3,000.00

24-Hour Motor Accident Reporting  
 and Assistance Helpline  
**6333 2222**  
 www.ergo.com.sg

**Finance Company/Hire Purchase Owner :**

\*Persons or Classes of Persons entitled to drive:

1. The Policyholder
2. Any Person who is driving on the Policyholder's order or permission

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act and its registration under the Road Traffic Act has not been cancelled at the time of the accident loss or damage.

\* Limitations as to Use:

- 1) Use only for social domestic and pleasure purposes
- 2) Use for Policyholder's business


This Policy does not cover

- 1) Use for hire or reward, racing, pace-making, reliability trial or speed-testing and on race track
- 2) Use for the carriage of goods other than samples in connection with any trade or business
- 3) Use for any purpose in connection with the Motor Trade

Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia) are not to be included under these headings (\*).

WE HEREBY CERTIFY that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia)

For and on behalf of **ERGO Insurance Pte. Ltd.**  
 Approved Insurer



Authorized Signature

A000472	ZEAL INSURANCE AGENCY	Contact Number: 66848884
Vehicle Chassis Number : GE61066495, Vehicle Engine Number : L13A4075655		PC1, 26/04/2018 16:25

REPUBLIC OF SINGAPORE  
IDENTITY CARD NO. S8842978H



Name

WEE CHONG KIAT, DARYL

黄宗杰

Race

CHINESE

Date of birth

04-11-1988

Sex

M

00842978H

Country of birth  
SINGAPORE

REPUBLIC OF SINGAPORE DRIVING LICENCE

License Number S8842978H



Name  
WEE CHONG KIAT, DARYL

Issue Date 04 Nov 1988

Valid Until 14 Nov 2011



0020174778



4810880



NRIC No S8842978H

Date of issue

22-12-2011

APT BLY 280C PUNGGOL FIELD #11-211  
SINGAPORE 823268  
NRIC No: S8842978H

Date: 10/02/2018 (H)

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(S)

EFFECTIVE DATE

Class 2B Motorcycle  $\leq$  250 CC  
Class 1A Motorcycles between 251 CC and 499 CC  
Class 1 Motor cars  $\leq$  3500 kg with  $\leq$  7 passengers, exclusive of the driver; and motor tractors  $\leq$  2500 kg

22 Dec 2009  
01 Feb 2012  
25 Dec 2019

S8842978H

S / No. 9000164469

NP 428A



License No. S8842978H



160 Sin Ming Drive #02-12  
 Sin Ming AutoCity  
 Singapore 575722

Tel: 6258 1955 Fax: 6 258 1956  
 teamautoffice@gmail.com / teamautopl@gmail.com

# THIS IS YOUR INVOICE

Kindly remit payment to our office address stated. If you have any query pertaining to this invoice, please feel free to contact us.

INVOICE DATE:	18-Sep-19
INVOICE NOS:	TAP8346E-19/0421
Your Reference:	SJE 8346E
Date Of Accident:	15/2/2019

**Billed To:** AIG Asia Pacific Insurance Pte Ltd

**On Behalf Of:** Wee Chong Kiat, Daryl  
**Invoice Type:** 3rd Party PD Claim

**INVOICE TOTAL IN SGD**  
**\$ 11,800.00**

DESCRIPTION	AMOUNT (S\$)
Lump Sum Amount Payable for Supply of Spare Parts & Labour Pertaining to Accident Repair of: <u>SJE 8346E</u>	\$ 11,800.00
Discount	\$ -
<b>Amount Due</b>	<b>\$ 11,800.00</b>

**COMMENTS**

1. Total payment due in 30 days.
2. All Cheques must be made payable to TEAM AUTOPRO PTE LTD.
3. Please include our invoice number at the back of your cheque.

For Team Auto Pro Pte Ltd  
  
 Signature & Stamp

**PAYMENT DETAILS**

## Claim Audit

### AUDIT TRAIL

No.	On	Audit	Remarks	By
1	22 Feb 2019 16:41	<b>Cim Veh Model Changed</b>	(201492) HONDA FIT 1.3 G (A).	[A] HOW MEI KWAN
2	22 Feb 2019 16:41	<b>Cim Created</b>	Reg No: SJE8346E. Acct Date: 2019/02/15. Claim Type: TP. Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG). TP Insurer: ERGO Insurance Pte. Ltd. (HQ). Workshop: Team Autopro Pte Ltd (KAKI BUKIT)	[A] HOW MEI KWAN
3	22 Feb 2019 16:41	<b>Adj Co Assigned</b>	LKK Auto Consultants Pte Ltd (HQ):	[A] HOW MEI KWAN
4	22 Feb 2019 16:41	<b>Adj Next Rpt Changed</b>	Next Rpt:Final Rpt.Due Date:2019/03/05	[A] HOW MEI KWAN
5	22 Feb 2019 16:41	<b>Adj Mandate Set</b>	Approved:8000.00.Reinsp:Adj decides.	[A] HOW MEI KWAN
6	22 Feb 2019 16:41	<b>Cim Ins Co Changed</b>	[200005] AIG Asia Pacific Insurance Pte. Ltd. (SG) -> [203630] AIG Asia Pacific Insurance Pte. Ltd. (Express)	[I] Merimen Administrator
7	22 Feb 2019 16:42	<b>Label Added</b>	(19):Fastlane.	[A] HOW MEI KWAN
8	22 Feb 2019 16:42	<b>Adj Adjuster Assigned</b>	[None] -> Lim Teow Guan	[A] HOW MEI KWAN
9	26 Jul 2019 11:14	<b>Adj Rpt Initiated</b>		[A] JOANNE LEE KHANG MIN
10	26 Jul 2019 11:14	<b>Cim Dtl Modified</b>	JPJ Reg. Date: -> 2008/05/09.	[A] JOANNE LEE KHANG MIN
11	26 Jul 2019 11:14	<b>Cim Details Notified</b>		[A] JOANNE LEE KHANG MIN
12	11 Sep 2019 11:48	<b>Adj Mandate Request</b>	Cur.Req:13267.00:Liability: 100% (BOLA 28: 4 vehicle chain collision, Insured vehicle last).**18 days recommendation for repair + 3 Sundays + 1 PRS = 22 days	[A] Khanchana Pothura

Date From



Date To



Audit Type None



Go

### ACTIVITY

No record

### Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Bill Type	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2225623	26 Jul 2019 11:14:57	OD/TP Case (Adjuster)	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SJE8346E	SKE7310C	11.77

## INFORMATION RESOURCES

WHILST EVERY ENDEAVOR IS MADE TO ENSURE THAT INFORMATION PROVIDED IS UPDATED AND CORRECT, THE AUTHORITY DISCLAIMS ANY LIABILITY FOR ANY DAMAGE OR LOSS THAT MAY BE CAUSED AS A RESULT OF ANY ERROR OR OMISSION.

Business Profile (Company) of TEAM AUTOPRO PTE. LTD. (201811621K)

Date: 30/08/2019

## The Following Are The Brief Particulars of :

Registration No.	201811621K
Company Name	TEAM AUTOPRO PTE. LTD.
Former Name if any	
Incorporation Date.	05/04/2018
Company Type	EXEMPT PRIVATE COMPANY LIMITED BY SHARES
Status	Live Company
Status Date	05/04/2018

## Principal Activities

Activities (I)	REPAIR AND MAINTENANCE OF MOTOR VEHICLES (INCLUDING INSTALLATION OF PARTS & ACCESSORIES) (95301)
Description	
Activities (II)	RENTING AND LEASING OF PRIVATE CARS WITHOUT OPERATOR (77101)
Description	

## Capital

Issued Share Capital (AMOUNT)	Number of Shares *	Currency	Share Type
500000	500000	SINGAPORE, DOLLARS	ORDINARY

\* Number of Shares includes number of Treasury Shares

Paid-Up Capital (AMOUNT)	Number of Shares	Currency	Share Type
500000		SINGAPORE, DOLLARS	ORDINARY

COMPANY HAS THE FOLLOWING ORDINARY SHARES HELD AS TREASURY SHARES

Number Of Shares	Currency
------------------	----------

## INFORMATION RESOURCES

WHILST EVERY ENDEAVOR IS MADE TO ENSURE THAT INFORMATION PROVIDED IS UPDATED AND CORRECT, THE AUTHORITY DISCLAIMS ANY LIABILITY FOR ANY DAMAGE OR LOSS THAT MAY BE CAUSED AS A RESULT OF ANY ERROR OR OMISSION.

## Business Profile (Company) of TEAM AUTOPRO PTE. LTD. (201811621K)

Date: 30/08/2019

Registered Office Address	160 SIN MING DRIVE #02-12 SIN MING AUTOCITY SINGAPORE (575722)
Date of Address	22/08/2019
Date of Last AGM	
Date of Last AR	
FYE As At Date of Last AR	

<b>Audit Firms</b>	
<b>NAME</b>	

<b>Charges</b>				
<b>Charge No.</b>	<b>Date Registered</b>	<b>Currency</b>	<b>Amount Secured</b>	<b>Chargee(s)</b>

<b>Officers/Authorised Representative(s)</b>					
<b>Name</b>	<b>ID</b>	<b>Nationality</b>	<b>Source of Address</b>	<b>Date of Appointment</b>	
<b>Address</b>		<b>Position Held</b>			
LEE WEI KOK	S7305773F	SINGAPORE CITIZEN	ACRA	05/04/2018	
127C KIM TIAN ROAD #15-549 KIM TIAN GREEN SINGAPORE (163127)		Director			
TAN ZHI RONG	S8934111F	SINGAPORE CITIZEN	OSCARS	13/07/2018	
70A TELOK BLANGAH HEIGHTS #06-513 TELOK BLANGAH RIDGEVIEW SINGAPORE (101070)		Secretary			

<b>Shareholder(s)</b>					
<b>Name</b>	<b>ID</b>	<b>Nationality/Place of incorporation/Origin</b>	<b>Source of Address</b>	<b>Address Changed</b>	
<b>Address</b>					
1 KO KOK CHUAN	S1701263J	SINGAPORE CITIZEN	OSCARS	04/01/2015	

Authentication No. : J19643168D

## Print Received Message

This mail is associated with :

**\*SJE8346E (1042224501SG)**  
**[SKE7310C]**

TP

WEE CHONG KIAT, DARYL

Feb 15 2019 9:00PM

[Ho Soo Kit Philip]

Team Autopro Pte Ltd

**From** AIG Asia Pacific Insurance Pte. Ltd. (Express) (AIG\_SG\_EXPRESS), sent on 11/09/2019 15:01 PM.  
**To** LKK\_HQ  
**Subject** Alert - Adj Mandate Approved (S\$13267.00) - SJE8346E - Claim Handler: Loh, Chee-Heng

Approved:13267.00.



**WITHOUT PREJUDICE**

Our Ref: SJE 8346E

Your Ref: SKE 7310C

12<sup>th</sup> July 2019

**ATTN:** LKK Auto Consultants Pte Ltd  
**INSURER:** AIG Asia Pacific Insurance Pte Ltd

Dear Khanchna,

**Accident Involving:** SJE 8346E and SKE 7310C  
**Date of Accident:** 15 February 2019  
**Location of Accident:** CTE towards Braddell (After Exit 10)

We refer to the aforementioned accident and hereby submit our claim as below:

Cost of Repair as agreed	\$ 11,800.00
Add Loss of Use	\$ 1,760.00 <small>22 Days @ \$80/day 2 Days PRS + 18 Repair Days Agreed + 2 Sunday</small>
<b>Total</b>	<b>\$ 13,560.00</b>
Add Towing Fee	\$ 90.00
Add 3rd Party Report Fee	\$ 57.00
<b>GRAND TOTAL</b>	<b>\$ 13,707.00</b>

Kindly pay the Grand Total Amount of **\$13,707.00** to:

**Team AutoPro Pte Ltd**  
160 Sin Ming Drive #01-14  
Sin Ming AutoCity  
Singapore 575722

For further query, please feel free to contact us at 6258 1955 or email: [teamautooffice@gmail.com](mailto:teamautooffice@gmail.com)

Thank you.  
  
TEAM AUTO PRO  
Regards  
Add: (65) 11071K



Our Ref: CC4/AIG19003387/Bha3

03 April 2019

**HO SOO KIT PHILIP**  
539 HOUGANG ST 52  
#08-60  
SINGAPORE 530539

Dear Sir/Madam,

**ACCIDENT INVOLVING SKE 7310C / SJE 8346E / OTHERS ON 15/02/2019**

We refer to the above accident where we are acting for AIG Asia Pacific Insurance Pte Ltd to resolve the claim against you and/or your authorized driver under the Auto Insurance policy taken up with them.

Pursuant to the above said accident wherein you and/or your authorized driver had amongst other information given us your version of how the accident had occurred, we as the appointed agent of your insurers shall proceed to negotiate for an amicable settlement with third party claimant

Should you however wish to further discuss on the matter prior to our negotiations and settlement, please contact us within 10 days from the date of this letter.

You are aware that your No-Claim Discount (NCD – if applicable) will be with held for the time being. Pending for final allocation of liability in settlement by our principal AIG Asia Pacific Insurance Pte Ltd.

Please call us if you have further queries.

Yours faithfully,

Cecilia Chong  
Case Handler  
DID: 6749 4274  
FAX: 6741 4108  
EMAIL: Ceciliachong@lkkauto.com

c.c. AIG Asia Pacific Insurance Pte Ltd  
(Motor Claims Dept)

To : Team AutoPro Pte Ltd  
CRN : 201811621K  
located at : 385 Sin Ming Drive #01-02 Vicom Inspection Centre Singapore 575718

**Letter of Authorization & Undertaking**

In Respect of Accident involving my/our Vehicle No.: SJE 8346 E  
and SKE 7310 C (B) and SMG 8831 A (C)  
and SLX 6686m and \_\_\_\_\_  
@ CTE towards Braddell After Exit 10

dated 15/02/2019

1. I/We hereby irrevocably authorize you to demand claim- settle/receive whatever amount settled/payable by the third party and/or its insurer in my/our name, for the costs of repair, loss of use/rental and all other necessary costs related to my/our vehicle that was damaged pursuant to the aforesaid accident.
2. I/We acknowledge that any settlement you may reach on my/our behalf is on a "Without Prejudice" and "Without Admission Of Liability" basis.
3. I/We agree to assign the whole proceeds of my/our third party claim to you. The third party and /or its insurer shall accept this letter as my irrevocable authorization to pay the compensated amount directly to you - in the form of payment cheque made in favor to **Team AutoPro Pte Ltd.**

In the event that the payment cheque is being made in my/our favor, I/we hereby undertake to return the full amount to you, within 7 days from receiving and clearance of the said payment cheque. Failing which, you will have the legal rights to take legal proceedings against me/us to recover the said sum, with further costs and disbursements to be incurred by me/us.

4. I/We further authorize you to settle the aforesaid claim in a manner that you deem fit and to utilize the monies to pay your charges without further reference to me/us. The payment to you shall amount to a good discharge of your obligation to me/us in respect of the settlement monies.
5. Should the third party claim be unsuccessful due to untruthful statements from me/us, I/we undertake to pay for all your expenses, costs and fees incurred, immediately upon your demand.
6. This authorisation shall remain in force until revoked by me/us in writing to you, subject to terms and conditions being agreed by both parties. I/We further understand that revocation is not allowed once your workshop has commenced on the repair of my/our vehicle.

Yours faithfully,



Claimant Signature & Co's Stamp (if applicable)

Date: 17/02/2019

**RELEASE VOUCHER**  
**(AIG Asia Pacific - Express Third Party Claim)**

"We/I, **TEAM AUTOPRO PTE LTD**("the workshop") hereby confirm that we/I have reached an agreement with the appointed surveyor of AIG Asia Pacific Insurance Pte Ltd **LKK AUTO CONSULTANTS PTE LTD** (name of surveyor) with respect to the amount claimed for **SS11,800.00** (Repair Cost), **SS1,320.00**(Loss of Use/Rent), **SS147.00** (Disbursement) for vehicle no. **SJE8346E** that was damaged pursuant to the accident which occurred on **15/02/2019** (date) along **CTE TOWARDS BRADDELL (AFTER EXIT 10)**(location) involving vehicle no/s **SKE7310C**. This is pursuant to the inspection conducted on **22/02/2019**(date) at "the workshop".

We/I confirm that we/I are/am authorized by the owner **WEE CHONG KIAT, DARYL**(the third party claimant") of vehicle no. **SJE8346E** make the claim as set out in the above paragraph and we/I have full authority to settle the matter on his/her behalf in a manner that we/I deem fit. We/I enclose herein the letter of authority given by "the third party claimant".

We/I further confirm that we/I will indemnify AIG Asia Pacific Insurance Pte Ltd for all damages, loss and/or expense that they will or have already incurred in the event that "the third party claimant" after the above said agreement lodges a further claim against the former for any loss and expenses suffered pertaining to costs of repairs and/or rental and/or loss of use pursuant to the damage to **SJE8346E**(vehicle no.) as a result of the accident.

We/I confirm that the agreement reached above is in full and final settlement of any claim of "the third party claimant" pursuant to the accident and that further this settlement is reached on a without prejudice and without admission of liability basis.

This agreement is subject to the application of Singapore law and the Singapore Courts have exclusive jurisdiction over any dispute arising out of the same.

Dated this 16<sup>th</sup> (day) of October (month) 2019 (year)



LTG

Signed by appointed surveyor

"My execution of this Discharge Voucher is solely for my claim for Property Damage & nonprejudicial to any other claims arising from the same accident."



Signed by "the workshop" (with chop)

**PROFORMA INVOICE****ATTENTION:**

Wee Chong Kiat, Daryl

PI Number	P1907-0375
PI Date	12-Jul-2019
Vehicle No.	SJE 8346E
Accident Date	15-Feb-2019

S/No	Description	Unit Price	Quantity	Amount
1	Spare Parts and Labour for Accident Repair of Vehicle Nos. SJE 8346E	COR Lump Sum		\$ 11,800.00

**Notes:**

1) All payments must be made only in the form of cash or crossed cheque payable to "Team AutoPro Pte Ltd".

Total Amount	\$ 11,800.00
--------------	--------------

Authorized Signature





**24 HOUR RECOVERY SERVICES** Co. Reg No. 53339929D  
**24 HRS HOTLINE: 8455 5669**



No. **15119**

Date : 15/2/19

(ERIC)

*TEAM AUTO*

M/S : \_\_\_\_\_  
 Vehicle No : SJE 8346 E Model : F17  
 From : CTE Time Start : 2155  
 To : SIN MING (VICOM) Time End : 2220  
 Remarks : 81814459 (A)

- |  |   |   |                                 |
|--|---|---|---------------------------------|
| <input type="checkbox"/> Change Tyres / Jump Start | <input checked="" type="checkbox"/> Accident        | <input type="checkbox"/> Use Car Carrier      | <input type="checkbox"/> Loaded |
| <input type="checkbox"/> Basement / Multi Carpark  | <input type="checkbox"/> Low Body Kit / Low Spoiler | <input type="checkbox"/> Open Door            |                                 |
| <input type="checkbox"/> Using King Dolley         | <input type="checkbox"/> Dismantle Brake / Shaft    | <input type="checkbox"/> Crane Up / Winch Out |                                 |

AMOUNT S\$ 90/-

*Jimmy*

Received By \_\_\_\_\_

for 24 hour Recovery Services

Vehicle is transported at owner's risk. The company accepts no responsibility for damaged or other misdemeanour to your vehicle whilst being transported.



**GENERAL INSURANCE ASSOCIATION OF SINGAPORE  
RECORDS MANAGEMENT CENTRE**  
6 Raffles Quay #18-00, Singapore 048580  
Phone: +65 6224 0010 Fax: +65 6224 0030  
Operating Hours: Monday to Friday 9am to 5pm  
GST Registration No: M400017735

## TAX INVOICE

Our Ref No: GR-19-025640

Date of Request: 18/02/2019

Your Ref No:

WALK IN TAN CW

TEAM AUTOPRO PTE LTD  
385 SIN MING DRIVE, #01-02 VICOM INSPECTION CENTRE  
SINGAPORE 575718

Dear Sir/Madam,

Your Vehicle No: SJE8346E

Date of Accident: 15/02/2019

Place of Accident: CTE

Involving Vehicle No: SKE7310C, SMG8831A, SLX6688M

DESCRIPTION	AMOUNT (S\$)
E-File Search Fee (Public)	14.02
GST Amount	0.98
Total Amount Due (GST Inclusive)	15.00

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

GIRO  Cash  Cheque

## TAX INVOICE

Our Ref No: GR-19-025641

Date of Request: 18/02/2019

Your Ref No: WALK IN TAN CW

TEAM AUTOPRO PTE LTD  
385 SIN MING DRIVE, #01-02 VICOM INSPECTION CENTRE  
SINGAPORE 575718

Dear Sir/Madam,

Date of Accident: 15/02/2019

Vehicle No: SJE8346E

Place of Accident: CTE towards BRADDELL (After Exit 10)

Involving Vehicle No: SKE7310C

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SKE7310C	CTE towards BRADDELL (After Exit 10)	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

GIRO  Cash  Cheque



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE  
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580  
Phone: +65 6224 0010 Fax: +65 6224 0030  
Operating Hours: Monday to Friday 9am to 5pm  
GST Registration No: M400017735

**TAX INVOICE**

Our Ref No: GR-19-025845

Date of Request: 18/02/2019

Your Ref No: WALK IN TAN CW

TEAM AUTOPRO PTE LTD  
385 SIN MING DRIVE, #01-02 VICOM INSPECTION CENTRE  
SINGAPORE 575718

Dear Sir/Madam,

Date of Accident: 15/02/2019

Vehicle No: SJE8348E

Place of Accident: CTE towards BRADDELL (After Exit 10)

Involving Vehicle No: SMG8831A

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SMG8831A	CTE towards BRADDELL (After Exit 10)	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

GIRO  Cash  Cheque



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE  
RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580  
Phone: +65 6224 0010 Fax: +65 6224 0030  
Operating Hours: Monday to Friday 9am to 5pm  
GST Registration No: M400017735

**TAX INVOICE**

Our Ref No: GR-19-025648  
Date of Request: 18/02/2019

Your Ref No: WALK IN TAN CW

TEAM AUTOPRO PTE LTD  
385 SIN MING DRIVE, #01-02 VICOM INSPECTION CENTRE  
SINGAPORE 575718

Dear Sir/Madam,

Date of Accident: 15/02/2019  
Vehicle No: SJE8346E  
Place of Accident: CTE towards BRADDELL (After Exit 10)  
Involving Vehicle No: SLX6686M

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SLX6686M	CTE towards BRADDELL (After Exit 10)	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

GIRO  Cash  Cheque

### ...CLAIM SUBFOLDER...(Pending for Survey Report)

Fastlane

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	18 Feb 2019 <a href="#">Edit Reg</a>		22 Feb 2019 00:00 <a href="#">Edit Adj Rpt</a>	<b>S\$11,800.00</b> <a href="#">Edit Estimates</a>	<b>S\$11,800.00</b> <a href="#">View Rpt</a>		<b>Pending for Survey Report</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	Show All					
<b>CLAIM SUBFOLDER DETAILS</b> <span style="float: right;">[Created by adjuster]</span>									
Insured:	<b>Ho Soo Kit Philip</b> , ID: S1117240G								
Main Claimant:	<b>WEE CHONG KIAT, DARYL</b> , ID: S8842978H								
Vehicle Reg. No.:	<b>SJE8346E</b>	Date of Loss:	15/02/2019 21:00 - :59 [129 Months and 6 Days From LTA Reg Date (Man Yr)]						
Claim Type:	<b>TP / 1042224501SG</b>	Policy/Cover Note No.:	2100293918 (Comprehensive)						
Vehicle Reg. No. (Insured):	<b>SKE7310C</b>	Policy No. (Claimant):	DMPG18001774						
Repairer:	<b>Team Autopro Pte Ltd (KAKI BUKIT)</b> No.8 Kaki Bukit Avenue 4, #06-21 Premier@ Kaki Bukit (Gate 2), 415875 Kaki Bukit - Tel: 90927279								
Handling Insurer:	<b>AIG Asia Pacific Insurance Pte. Ltd. (Express)</b> - Tel: 65-6419-3000 ... [Handled by <b>Loh, Chee-Heng</b> ] Chee-Heng.Loh@aig.com								
Claimant's Insurer:	<b>ERGO Insurance Pte. Ltd. (HQ)</b> - Tel: 6829 9199								
Adjuster:	<b>LKK Auto Consultants Pte Ltd (HQ)</b> - Tel: 6256-3561 ... [Handled by <b>Lim Teow Guan</b> ] ... [Final Rpt due 05/03/2019]								
<b>ASSOCIATED MAIL RECEIVED</b> <span style="float: right;"><a href="#">View All</a> <a href="#">Compose Case Mail</a></span>									
• AIG_SG_EXPRESS (11/09/2019): Alert - Adj Mandate Approved (S\$13267.00) - SJE8346E - Claim Handler: Loh, Chee-...									
<b>ALL ASSOCIATED TASKS</b> <span style="float: right;"><a href="#">View All</a> <a href="#">Search Tasks</a> <a href="#">Create New Task</a> <a href="#">Complete</a></span>									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

## Claim Documents

\*SJE8346E (1042224501SG)  
[SKE7310C]

TP

WEE CHONG KIAT, DARYL

Feb 15 2019 9:00PM

[Ho Soo Kit Phillip]

Team Autopro Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View <input type="text" value="View in Browser"/>	
<b>Letters/Correspondences</b>														1 per page	<input checked="" type="checkbox"/>	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)										Thumbnail	Print			
1	(Draft)	Third Party Express Settlement - Payment Breakdown											Edit			
<b>Photos/Images</b>														3 per page	<input checked="" type="checkbox"/>	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)										Thumbnail	Print			
1	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
2	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
3	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
4	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
5	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
6	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
7	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
8	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
9	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
10	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
11	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
12	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
13	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
14	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
15	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
16	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
17	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
18	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
19	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
20	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
21	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
22	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
23	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
24	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
25	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
26	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
27	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
28	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
29	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
30	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
31	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
32	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
33	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
34	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
35	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
36	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
37	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
38	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
39	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			
40	05/08/19 15:28	General View											Load JPG <input checked="" type="checkbox"/>			

Letters/Correspondences			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
				<input checked="" type="checkbox"/>
41	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
42	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
43	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
44	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
45	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
46	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
47	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
48	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
49	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
50	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
51	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
52	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
53	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
54	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
55	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
56	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
57	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
58	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
59	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
60	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
61	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
62	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
63	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
64	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
65	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
66	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
67	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
68	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
69	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
70	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
71	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
72	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
73	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
74	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
75	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
76	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
77	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
78	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
79	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
80	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
81	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
82	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
83	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
84	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
85	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
86	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
87	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
88	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
89	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
90	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
91	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
92	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
93	05/08/19 15:28	General View	 Load JPG	<input checked="" type="checkbox"/>
94	05/08/19 15:28	General View	Load JPG	<input checked="" type="checkbox"/>
95	05/08/19 15:28	General View	Load JPG	<input checked="" type="checkbox"/>

Letters/Correspondences			1 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
		<b>LKK Auto Consultants Pte Ltd (HQ)</b>		
96	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
97	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
98	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
99	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
100	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
101	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
102	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
103	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
104	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
105	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
106	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
107	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
108	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
109	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
110	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
111	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
112	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
113	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
114	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
115	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
116	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
117	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
118	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
119	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
120	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
121	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
122	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
123	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
124	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
125	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
126	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
127	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
128	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
129	05/08/19 15:28	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
130	05/08/19 15:28	<b>Odometer Reading</b>	Load JPG	<input checked="" type="checkbox"/>
131	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
132	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
133	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
134	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
135	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
136	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
137	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
138	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
139	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
140	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
141	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
142	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
143	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
144	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
145	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
146	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
147	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
148	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
149	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
150	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>
151	05/08/19 15:29	<b>Reinspection Photo</b>	Load JPG	<input checked="" type="checkbox"/>

Letters/Correspondences			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
152	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
153	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
154	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
155	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
156	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
157	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
158	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
159	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
160	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
161	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
162	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
163	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
164	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
165	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
166	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
167	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
168	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
169	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
170	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
171	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
172	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
173	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
174	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
175	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
176	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
177	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
178	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
179	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
180	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
181	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
182	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
183	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
184	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
185	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
186	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
187	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
188	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
189	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
190	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
191	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
192	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
193	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
194	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
195	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
196	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
197	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
198	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
199	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
200	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
201	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
202	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
203	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
204	05/08/19 15:29	Reinspection Photo		<input checked="" type="checkbox"/>
<b>Documentation</b>			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print

Letters/Correspondences				1 per page	<input checked="" type="checkbox"/>
No	Finalized On			Thumbnail	Print
<b>LKK Auto Consultants Pte Ltd (HQ)</b>					
1	22/02/19 16:43	ACKNOWLEDGEMENT EMAIL TO AIG DD 22.02.2019		Load PDF	
2	22/02/19 16:43	EMAIL FROM AIG DD 22.02.2019		Load PDF	
3	22/02/19 16:43	TP GIA REPORT		Load PDF	
4	25/02/19 20:59	TP ESTIMATE + SUPP		Load PDF	
5	26/07/19 11:35	LETTER TO OI		Load PDF	
6	11/09/19 11:38	TP LOD, Final Repair Invoice, LTA Search, Towing Receipt		Load PDF	
7	17/10/19 12:20	WORKSHOP INVOICE		Load PDF	
8	17/10/19 12:20	AUTHORISATION TO ACT FORM		Load PDF	
9	17/10/19 12:20	Release Voucher		Load PDF	
10	17/10/19 12:20	TOWING FEE		Load PDF	
11	17/10/19 12:20	LOD		Load PDF	
12	17/10/19 12:20	GIA SEARCH		Load PDF	
<b>AIG Asia Pacific Insurance Pte. Ltd. (SG)</b>					
1	25/02/19 10:51	OI GIA REPORT		Load PDF	

### Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
<b>Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)</b>			
<div style="border: 1px solid black; height: 40px; width: 100%;"></div>			
<b>Show Remarks To:</b> <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM \_\_\_\_\_

**THIRD PARTY EXPRESS SETTLEMENT  
(PAYMENT BREAKDOWN)**

<b>Vehicle No:</b>	SKE7310C (Insd veh)	<b>Model:</b>	HONDA FIT 1.3 G (A)
	SJE8346E (TP veh)		
<b>Date of Accident:</b>	15/02/2019		

Global Sum Settlement	:	[ ] Yes	[ X ] No	
Repair Estimate	:		<input checked="" type="checkbox"/>	\$ 23,524.41
Final Repair Cost	:		<input checked="" type="checkbox"/>	\$ 11,800.00
Loss of Use	:		<input checked="" type="checkbox"/>	\$ 1,320.00      22.00 days at \$60.00 per day
Rental (if any)	:		<input checked="" type="checkbox"/>	\$ 0.00      days
LTA / GIA Search Fee	:		<input checked="" type="checkbox"/>	\$ 57.00
Others: Towing Fee	:		<input checked="" type="checkbox"/>	\$ 90.00
	:		<input checked="" type="checkbox"/>	\$
<b>Final Settlement Sum</b>	:		<input checked="" type="checkbox"/>	<b>\$ 13,267.00</b>
<b>Is Third Party Workshop GIA Registered?</b> [ ] YES    [ X ] NO    (Kindly indicate below)				
<b>A) For Non GIA Registered Workshop:</b> Agreed Liability ____ 100 ____ (%)				
<b>B) For GIA Registered Workshop:</b> BOLA Applicable: Yes/ No    BOLA Scenario No: _____				
BOLA Liability: _____ (%)      Assessed Liability (*): ____ 100 ____ (%)				
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.				
Remarks _____				

<b>Payment Instruction: Payee's Breakdown</b>			
1)	Team Autopro Pte Ltd	:	\$ 13,267.00
2)		:	\$
3)		:	\$
4)		:	\$

\_\_\_\_\_  
JOANNE LEE KHANG MIN

\_\_\_\_\_  
17 Oct  
2019

LKK Auto Consultants Pte Ltd

Date

Please attach all the supporting documents to the form.  
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report;  
Medical Report/ Bill (if any))

## LKK Auto Consultants Pte Ltd (Co.Reg.No.199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG19003387/BKA3Q2

**Date:** 17/10/2019

#### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100293918
<b>Claimant</b>	<b>Insured Vehicle No :</b>	SKE7310C
<b>Vehicle No :</b> SJE8346E	<b>Nature of Claim:</b>	TP
<b>Date of Loss:</b> 15/02/2019	<b>Claim No:</b>	1042224501SG

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJE8346E	Engine No:	L13A4075655
Make & Model:	HONDA FIT, 1.3 G (A)	Chassis No:	GE61066495
Reg. Date:	09/05/2008 (Man. Year: 2008)	Odometer:	200290 km
Colour:	White		
Engine Capacity:	1339 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

#### CONDITION OF TYRES

Front Tyre Size:	185/60 R15	Rear Tyre Size:	185/60 R15
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	18,294.41	11,730.61	6,563.80	35.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,230.00	4,160.00	1,070.00	20.46
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>23,524.41</b>	<b>15,890.61</b>	<b>7,633.80</b>	<b>32.45</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>11,800.00</b>		
<b>Nett Amount (S\$)</b>	<b>23,524.41</b>	<b>11,800.00</b>	<b>11,724.41</b>	<b>49.84</b>
<b>+ Loss of Use (22.0 x S\$60.00/day) (S\$)</b>		1,320.00		
<b>+ Doc/Search Fee (S\$)</b>		57.00		
<b>+ Other Costs (S\$)</b>		90.00		
<b>Nett Liability (S\$)</b>		<b>13,267.00</b>		

#### INSPECTION

Date of Assignment:	22/02/2019	
Date Inspected:	22/02/2019 Inspected At:	Team Autopro Pte Ltd (KAKI BUKIT) No.8 Kaki Bukit Avenue 4, #06-21 Premier@ Kaki Bukit (Gate 2) Singapore 415875
Estimated Period of Repair:	18.0 days	

**Adjuster:** Lim Teow Guan

**Manager:** Khanchna Pothuraj

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Crumpled	433.85 FL	*433.85 FL
2	1		*BONNET LOCK	Bent	90.65 FL	*90.65 FL
3	1		*BONNET SAFETY HOOK	Bent	45.30 FL	*45.30 FL
4	1		*BONNET LOCK CABLE	Bent	33.60 FL	*33.60 FL
5	1		*BONNET INSULATOR PAD	Necessary	195.30 FL	*134.50 FL
6	2		*BONNET HINGES	Bent	70.10 FL	*70.10 FL
7	2		*BONNET INNER SIDE TOP RUBBER	Cut	57.06 FL	*57.06 FL
8	1		*FRONT CENTRE GRILLE	Broken	137.55 FL	*137.55 FL
9	1		*FRONT LOGO	Necessary	32.92 FL	*32.92 FL
10	1		*FRONT BUMPER	Crumpled	532.55 FL	*532.55 FL
11	2		*FRONT BUMPER RETAINER	Necessary	37.10 FL	*37.10 FL
12	1		*FRONT BUMPER REINFORCEMENT	Bent	261.05 FL	*261.05 FL
13	1		*FRONT BUMPER LOWER	Broken	125.00 FL	*125.00 FL
14	1		*FRONT BUMPER LOWER GRILLE	Broken	98.65 FL	*98.65 FL
15	1		*FRONT SUPPORT PANEL TOP	Crumpled	680.35 FL	*589.50 FL
16	1		*FRONT SUPPORT PANEL FRAME	Broken	408.25 FL	*293.80 FL
17	1		*A/C CONDENSER	Bent	782.85 FL	*762.80 FL
18	1		*A/C CONDENSER HIGH PRESSURE PIPE	Bent	128.67 FL	*128.67 FL
19	1		*A/C CONDENSER LOW PRESSURE PIPE	Bent	122.30 FL	*122.30 FL
20	1		*A/C CONDENSER MOUNTING BUSH	Cut	109.75 FL	*12.00 FL
21	1		*RADIATOR	Broken	1,382.55 FL	*1,382.55 FL
22	1		*RADIATOR TOP BRACKET	Bent	96.90 FL	*75.80 FL
23	1		*RADIATOR TOP BRACKET BUSH	Cut	98.20 FL	*30.00 FL
24	1		*RADIATOR TOP HOSE	Cut	129.75 FL	*40.00 FL
25	1		*RADIATOR BOTTOM HOSE	Cut	129.75 FL	*58.50 FL
26	1		*RADIATOR FAN COWLING	Broken	133.53 FL	*105.45 FL
27	1		*RADIATOR FAN BLADE	Broken	95.50 FL	*78.50 FL
28	1		*RADIATOR FAN MOTOR	Broken	283.90 FL	*283.90 FL
29	1		*AIR INTAKE DUCT	Broken	75.88 FL	*75.88 FL
30	1		*AIR FILTER HOUSING ASSY	Broken	105.70 FL	*105.70 FL
31	1		*WASHER TANK	Broken	88.00 FL	*72.90 FL
32	1		*WASHER TANK MOTOR	Broken	159.30 FL	*102.10 FL
33	1		*WASHER FILLER HOSE	Broken	39.00 FL	*39.00 FL
34	1		*HEADLAMP LH	Broken	598.00 FL	*587.70 FL
35	1		*HEADLAMP LOWER BRACKET RH	Bent	58.90 FL	*57.60 FL
36	1		*HEADLAMP PANEL RH	Dented	286.50 FL	*185.00 FL
37	1		*HEADLAMP LH	Broken	598.00 FL	*587.70 FL
38	1		*HEADLAMP LOWER BRACKET LH	Bent	58.90 FL	*57.60 FL
39	1		*HEADLAMP PANEL LH	Dented	286.50 FL	*185.00 FL
40	1		*FRONT FENDER RH	Dented	397.20 FL	*375.60 FL
41	1		*FRONT FENDER INNER SHIELD RH	Torn	108.00 FL	*92.90 FL
42	1		*FRONT FENDER LH	Dented	397.20 FL	*375.60 FL
43	1		*FRONT FENDER INNER SHIELD LH	Torn	108.00 FL	*92.90 FL
44	1		*FRONT FENDER QUARTER GLASS SIDE GARNISH RH	Missing	70.00 FL	*70.00 FL
45	1		*FRONT FENDER QUARTER GLASS SIDE GARNISH LH	Missing	70.00 FL	*70.00 FL
46	1		*FRONT WINDSCREEN MOULDING	Necessary	95.00 FL	*85.00 FL
47	1		*FRONT WINDSCREEN INNER SEAL	Necessary	58.53 FL	*35.00 FL
48	1		*FRONT ABS SENSOR RH	Not Necessary	389.80 FL	*. FL
49	1		*FRONT ABS SENSOR LH	Not Necessary	389.80 FL	*. FL
50	1		*TAILGATE	Dented	737.65 FL	*737.65 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
51	1		*TAILGATE INNER TRIM BOARD	Broken	130.25 FL	*130.25 FL
52	2		*TAILGATE DAMPER	Not Necessary	272.50 FL	*- FL
53	2		*TAILGATE HINGE	Bent	89.00 FL	*89.00 FL
54	1		*TAILGATE LOGO	Necessary	35.00 FL	*35.00 FL
55	1		*TAILGATE LOCK MECHANISM	Bent	189.55 FL	*175.00 FL
56	1		*TAILGATE STRIKER	Not Necessary	38.00 FL	*- FL
57	1		*TAILGATE WEATHERSTRIP	Cut	183.00 FL	*92.30 FL
58	1		*TAILGATE OUTER HANDLE	Not Necessary	58.35 FL	*- FL
59	1		*TAILGATE OUTER GARNISH	Not Necessary	119.25 FL	*- FL
60	1		*TAILGATE WIPER MOTOR	Not Necessary	238.05 FL	*- FL
61	1		*TAILGATE WIPER ARM	Not Necessary	45.00 FL	*- FL
62	1		*REAR END PANEL	Denied	276.55 FL	*276.55 FL
63	1		*REAR END PANEL TOP GARNISH	Dislodged	60.85 FL	*60.85 FL
64	1		*SPARE TYRE PANEL	Not Necessary	737.05 FL	*- FL
65	1		*SPARE TYRE PANEL TOP BOARD	Not Necessary	190.75 FL	*- FL
66	1		*REAR BUMPER	Broken	474.55 FL	*474.55 FL
67	2		*REAR BUMPER RETAINER	Necessary	76.00 FL	*73.60 FL
68	2		*REAR BUMPER BRACKET	Bent	48.00 FL	*48.00 FL
69	1		*REAR BUMPER TOWING CAP	Dislodged	18.00 FL	*13.30 FL
70	1		*REAR BUMPER LOWER	Broken	108.53 FL	*108.53 FL
71	1		*TAILLAMP RH	Broken	206.55 FL	*206.55 FL
72	1		*TAILLAMP LOWER BRACKET RH	Not Necessary	89.80 FL	*- FL
73	1		*TAILLAMP LH	Broken	206.55 FL	*206.55 FL
74	1		*TAILLAMP LOWER BRACKET LH	Not Necessary	89.80 FL	*- FL
75	2		*REAR WINDSCREEN MOULDING	Necessary	170.00 FL	*137.00 FL
76	1		*REAR WINDSCREEN INNER SEAL	Necessary	58.50 FL	*40.00 FL
77	1		*FRONT CENTRE GRILLE CLIPS	Necessary	50.00 FS	*30.00 FS
78	1		*FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
79	1		*FRONT NO PLATE WITH COVER	Necessary	100.00 FS	*50.00 FS
80	1		*FRONT BUMPER GRILLE CLIPS	Necessary	50.00 FS	*30.00 FS
81	1		*A/C CONDENSER FLUID	Necessary	50.00 FS	*50.00 FS
82	1		*RADIATOR COOLANT	Necessary	50.00 FS	*50.00 FS
83	1		*RADIATOR TOP HOSE CLIPS	Necessary	30.00 FS	*30.00 FS
84	1		*RADIATOR BOTTOM HOSE CLIPS	Necessary	30.00 FS	*30.00 FS
85	1		*FENDER INNER SHIELD CLIPS RH	Necessary	50.00 FS	*30.00 FS
86	1		*FENDER INNER SHIELD CLIPS LH	Necessary	50.00 FS	*30.00 FS
87	1		*FRONT WINDSCREEN SEALANT	Necessary	100.00 FS	*60.00 FS
88	1		*WINDSCREEN PRIMER AND CLEANER	Not Necessary	80.00 FS	*- FS
89	1		*TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*30.00 FS
90	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	50.00 FS	*30.00 FS
91	1		*FRONT FENDER SEALANT RH	Necessary	80.00 FS	*60.00 FS
92	1		*FRONT FENDER SEALANT LH	Necessary	80.00 FS	*60.00 FS
93	1		*SPARE TYRE PANEL INSULATOR PAD	Not Necessary	189.50 FS	*- FS
94	1		*REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
95	1		*REAR BUMPER REVERSE SENSOR	Damaged	500.00 FS	*250.00 FS
96	1		*REAR BUMPER LOWER CLIPS	Necessary	50.00 FS	*30.00 FS
97	1		*REAR WINDSCREEN SEALANT	Necessary	100.00 FS	*60.00 FS
98	3		*ENGINE MOUNTING	Broken / Necessary	564.00 FL	*564.00 FL
99	1		*BATTERY BRACKET	Bent	68.00 FL	*68.00 FL
100	1		*BATTERY TRAY	Broken	138.00 FL	*138.00 FL
101	1		*GEAR BOX MOUNTING	Necessary	238.00 FL	*238.00 FL
102	1		*BATTERY	Distorted	185.00 FS	*185.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc

**Sub Total (\$\$) 19,150.72 14,374.51**  
**- List Item Discount on L Items 5.00/20.00% (\$\$) 856.31 2,643.90**

Report was unsubmitted during this print-out.
---

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
					<b>Total Parts (S\$)</b>	<b>18,294.41</b>	<b>11,730.61</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	R&R A/C CONDENSER	New	150.00	120.00
2	R&R RADIATOR	New	150.00	120.00
3	R&R FRONT WINDSCREEN	New	200.00	120.00
4	R&R TAILGATE COMPONENT	New	100.00	50.00
5	R&R REAR WINDSCREEN	New	200.00	120.00
6	R&R REVERSE SENSOR	New	100.00	60.00
7	PANEL BEAT	New	2,200.00	1,600.00
8	RUST PROOFING	New	250.00	120.00
9	SPRAY PAINTING	New	1,800.00	1,800.00
10	CHECK WIRING	New	80.00	50.00
<b>Gross Labour Cost (\$\$)</b>			<b>5,230.00</b>	<b>4,160.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >