

07/1/13

ASS. REC. BY:

Steve

REF

CC3/A1619010363/Evd307

ASSIGNMENT

From: _____ Date: 11/6/19

Veh No: SLX 5292 Yr Regn: 14/3/16

Estimated Cost: _____

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or

To Inspect Vehicle No: SLX 5292

Make: Audi A3 c.c. 999

at Workshop m/s Premium

Colour: White A/C: Insured / Std / NI / NA

of 281 Alexandra Rd

Sp. Reading: 29391 T/Radio: Insured / Std / NI / NA

Insured: _____

Eng/No: _____

Policy No. 1800025878

C/No: WA42228V3J1046464

Claims No. 301032766086

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured: _____ Excess: 600

Steering: In order / Jammed / Leaked / Burnt or

(Client's Record)

Brake: In order / Jammed / Leaked / Burnt or

Make of Veh: _____

Modi: Nil / S/Rim / STD A/Rim or

(Policy Condition)

10am owner waiting

N/S	O/S

Remark: The veh had commenced its repair at the time of inspection.

Tyre Size: F: 205/55R16

R: 1

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Bal. or Market Value: \$103K

Front R/Bal. 6 mm R/Bal. 6 mm

IDAC Accident Rpt: _____ Consistent?: Yes or No

L/Bal. 6 mm L/Bal. 6 mm

GIA / PR Seen: _____ Consistent?: Yes or No

D.O.A. 4/6/19 D.O.I. 11/6/19

Est. Repairs: 6 days Res.: Yes or No

Survey held at Premium

Lum Sum: _____ % 3 Val.: Yes or No

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

CA / REV / REP. / 24 HRS

The U/C / Chassis frame / Body Structure affected due to collision.

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time	Action / Instruction
	MV - 103K
12/6/19	Revert via merimen
13/6/19	Rece approved from victor via merimen
13/6/19	Informed Tony c/A ex \$600 by email
23/8/19	Final fig \$7324.80 confirmed by email

RECEIVED 16 SEP 2019

Date/Time, File Pass to?

: Prel. Report
 : Final Report

Days Of Repair: 6

Resurvey No. of Trip: 1

1)

Date/Time, File Return to?

2) 16/9 - typst

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech. Invs (\$)
 : Weekend (\$)

Survey Fee:

Transportation: \$ + RS, \$

Photos

Others

TOTAL

Report Format: merimen
Lump Sum / I.B.I. (\$) 7324.80

200
11
211

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Thursday, 13 June 2019 12:38 PM
To: Claims; SUR
Subject: RE: OD CLAIM FOR SLX 529 Z - DOA: 4/6/2019 (AIG OD)

Dear Tony,

As instructed by our client , please proceed to repair the **insured vehicle SLX 529Z (Excess S600/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 4 June 2019 5:07 PM
To: SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: OD CLAIM FOR SLX 529 Z - AIG

Dear all,

Kindly register OD claim and arrange survey on 11/6/2019- 10am(Owner waiting) - 281 Alexandra Road Singapore 159938.

Thank you.

Best Regards,

Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
281 Alexandra Road Singapore 159938
p. +65 6366 2323, option 1
e. Claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom 281 Alexandra Road Singapore 159938 p. +65 68362223

View Received Message

This mail is associated with :

***SLX529Z (3010327660SG)**

OO

Jun 4 2019 4:00PM

[YE YANSI ESTHER]

Premium Autocare Centre

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 13/06/2019 11:49 AM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$7916.00) - SLX529Z - Claim Handler: Yap, Weijoe

Approved:7916.00:Labour at \$500/day @\$1000.00, S/Paint at \$550/panel @\$2200.00 to amend, Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

RE: SLX 529Z-DOA: 4/6/2019 (AIG REF: 3010327660SG))

From: Yap, Weijoe
To: Koh, Victor-CK, Lim, Kok-Chong
Cc: Veron Chen (LKKAuto)
Sent: 13/6/2019 11:44:50 AM

Dear Kok Chong & Victor,

Kindly assist on this request.

Thankyou
Best Regards.

Yap Wei Joe
AIG
Express Claim Adjuster,
Singapore- Auto Express & FNOL
E: Weijoe.Yap@aig.com

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]
Sent: Thursday, June 13, 2019 11:40 AM
To: Koh, Victor-CK; Yap, Weijoe
Subject: [EXTERNAL] SLX 529Z-DOA: 4/6/2019 (AIG REF: 3010327660SG)

This message is from an external sender; be cautious with links and attachments.

Dear Sir,

Kindly assist for mandate approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd. AIG Building 78 Shenton Way #08-16 Singapore 079120	From: LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn: Nadaraja, Deeban	Date: 12 Jun 2019

Preliminary Advice

Vehicle No	: SLX529Z	Accident Date	: 04/06/2019
Make	: AUDI A3	Policy No.	: 1800025878
Assignment Date	: 12/06/2019	Excess	: S\$0.00
Date of Inspection	: 11/06/2019	Est. Duration of Repair	: 6.00
Inspection At	: PREMIUM AUTOCARE CENTRE (ALEXANDRA) 281 ALEXANDRA ROAD SINGAPORE 159938		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	14,280.00
Revised Amount	:S\$	7,916.00
Check Items (Estimated)	:S\$	857.00
Total	:S\$	8,773.00
Lump Sum Repair	:S\$	
Total Loss Consideration		
New for Old Value	:S\$	
Pre-Accident Value	:S\$	103,000.00
COE / PARF Rebate	:S\$	52,164.00
Salvage Value	:S\$	
Margin for Repair	:S\$	50,836.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :



CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder	: YE YANSI, ESTHER MRS SCH-YE YANSI ESTHER	Vehicle No.	: SLX529Z
Period of Insurance	: 14 Mar 2018 To 13 Mar 2020	Policy No.	: 1800025878
Engine No.	: CHZ654583	Endorsement No.	:
Chassis No.	: WAUZZZ8V3J1048464	Issued Date	: 14 Mar 2018

ABOUT THE COVER

Make/Model	: AUDI A3 Sedan 1.0 TFSI S tronic	Sum Insured	: Market Value	First Year of Registration	: 2018
Engine Capacity/Tonnage	: 999.00 CC	Off Peak Car	: No	Insuring with COE/PARF	: Yes
Driver Restriction	: NA				

Person or Classes of Persons Entitled to Drive*

a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorized driver only if he/she meets the specified age condition.
 You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDE") if You are or Your Authorized Driver (named or unnamed) is under the age of 22 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use*

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 188) and Section 55 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
 Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

YE YANSI, ESTHER MRS SCH-YE YANSI ESTHER - \$600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Centre: Add 55, Ubi Road 1, Singapore 408095 63623223

For other Approved Reporting Centres/Audited Repairers, please contact our 24-hour accident emergency hotline at +65 6339 8200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 188), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1989 (Malaysia).

0504125207

PREMIUM LEASING - SLEE
 281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

AUTHORIZED REPRESENTATIVE

Doing Our Best

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S8500905B




Name
SOH JWO SHYANG

蘇 茁 翔

Race
CHINESE

Date of birth
10-01-1985

Sex
M

Country/Place of birth
SINGAPORE

S8500905B

REPUBLIC OF SINGAPORE DRIVING LICENCE



SOH JWO SHYANG

Age: 10 Jan 1985

Issue Date: 24 Mar 2018



0002796450K

5913002



NRIC No. S8500905B



Date of issue
24-03-2018

APT BLK B2A STRATHMORE AVENUE #04-48
SINGAPORE 142062

NRIC No: S8500905B Date: 24/11/2018

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(S)

Class	Description	EFFECTIVE DATE
Class 3	Motor cars with unladen weight \leq 3000kg with \leq 7 passengers, exclusive of driver; and other motor vehicles with unladen weight \leq 2500kg	17 May 2005



Licence No: S8500905B

NP 426A

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	04/06/2019 15:48
Date Of Accident	04/06/2019 08:25
Exact Location Of Accident	INTERSECTION OF MARYMOUNT LANE AND UPPER THOMPSON
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLX529Z
Insured/Policyholder	
Name Of Registered Owner	YE YANSI ESTHER
NRIC No	S8523317C
Email Address	ESTHERYYE@GMAIL.COM
Mobile Phone No	(LOCAL) +65-98028476
Alternative Phone No	OFFICE-98028476
Vehicle Particulars	
Manufacturer	AUDI
Model	A3-1.4 SEDAN TFSI (AMBIENTE) (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800025878
Cover Note Number	

Driver

Name of Driver	SOH JWO SHYANG
NRIC No	S8500905B
Date Of Birth	10/01/1985
Occupation	INDOOR
Date Of Driving Pass	17/05/2005
Driving Experience	14 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-93830708
Fax Number	
Contact Number	

Address 62A STRATHMORE AVE #04-46

Postcode

Was driver an employee of the Insured's Company NO
If No, Relationship of the Driver with the Insured SPOUSE
Vehicle Registration Number of Driver's Own Vehicle -
-
-
Insurance Company of Driver's Own Vehicle -
-
-

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
Weather Conditions CLEAR
Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
Number of vehicles (including own vehicle) involved in the accident 2
Was any body injured in the Accident? NO
Was any injured conveyed to hospital by ambulance?
Was any other material or property damaged? YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
If Yes, Please state which Police Station
Was notice of intended Prosecution given? NO
If Yes, against whom?

Circumstances of Accident

MY CAR HIT THE REAR OF THE LORRY WHEN IT JAM BRAKE AFTER THE TRAFFIC LIGHT. TRAFFIC LIGHT WAS CHANGING FROM GREEN TO YELLOW AT THAT TIME

Attachment(s)


Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBB4657U
Vehicle Make/Model/Colour
Details Of Properties
Vehicle Category GOODS VEHICLE
Name of Driver
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Sketch Plan

SKETCH PLAN

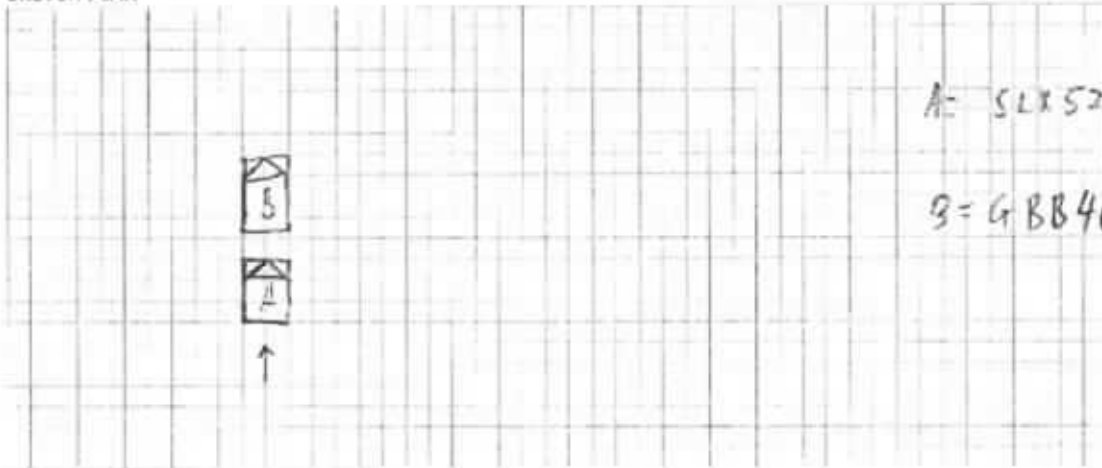

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

My car hit the rear of the lorry when it jam-braked after the traffic light. Traffic Light was changing from green to yellow at that point.

DECLARATION

I/We declare the foregoing particulars are true in every respect

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time: 4/6/14



Reporting Centre Personnel's Signature
Name: Tony Fong
RUC/PA No: G 20401678

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repeal policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the indgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes");
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time: 4/6/14

Reporting Centre Personnel's Signature
Name: Tony Fong
NRK/FN No.: 62040197X



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0733/2019/DY/TF
Date : 10-Jun-19

Vehicle NOT IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Ms. Ye Yansi Esther
Address : 62A Strathmore Ave
#04-46
Singapore 142062
Telephone : (HP) +65 98028476
Type of Claim : Own Damage Claim
Policy No. : 1800025878
Vehicle No : **SLX 529 Z**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year : Mar-18
Engine No : CHZ 654583
Chassis No. : WAUZZZ8V3J1046464
Mileage : -
Date In : -
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 04-Jun-19
Place of Accident : Intersection of Marymount Lane-

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLX 0529 Z

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$ 360.00 /	✓
2	To remove front fittings, dismantle and renew front bumper and damaged attachments. Renew bonnet, hinges, striker and locks. Re-align both front fender and bonnet. Re-organise front crash management components. Reinstall all parts removed.	\$ 1,800.00 1100 1000 ✓ 550 500	
3	To respray front bumper, bonnet and both front fenders.	\$ 2,800.00 2200 2200 ✓ 550 550	
4	To carry out diagnostic check	S/N \$ 192.00 /	✓
TOTAL LABOUR CHARGES		: \$ 5,152.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 0529 Z

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER X R	\$ 1,830.00	
2	FRONT BUMPER FIXING PARTS X NAI	\$ 170.00	
3	FOAM FILLER PIECE X NAI	\$ 172.00	
4	RIVET X NAI	\$ 30.00	
5	FRONT REINFORCEMENT BAR X NAI	\$ 660.00	
6	FRONT BUMPER GRILLE - CENTER X NAI	\$ 146.00	
7	FRONT BUMPER COVER TRIM - LH / RH X NAI	\$ 296.00	
8	FRONT BUMPER GUIDE SECTION - LH / RH X NAI	\$ 70.00	
9	RADIATOR GRILLE / BR	\$ 1,301.00	1640.80
10	RADIATOR GRILLE CLOSING ELEMENT ? ✓ BR	\$ 174.00	38.80
11	BONNET / DD	\$ 2,898.00	2316.40
12	BONNET ATTACHMENT PARTS ? X NAI	\$ 149.00	
13	BONNET EDGE PROTECTION / REC	\$ 25.00	1992
14	BONNET CATCH - TOP ? X NAI	\$ 81.00	
15	BONNET STRIKER X NAI	2 \$ 200.00	
16	BONNET SOUND ABSORBER X NAI	\$ 201.00	
17	BOWDEN CABLE COVER X NAI	\$ 9.00	
18	BOWDEN CABLE X NAI	\$ 53.00	
19	BONNET LOCK X NAI	2 TBC	
20	BONNET CATCH - BOTTOM X NAI	\$ 58.00	
SUB - TOTAL SPARE PARTS CHARGES		\$ 8,523.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 0529 Z

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	BONNET HINGE - LH / RH <i>X NAI</i>	\$ 112.00	
22	FRONT AIR GUIDE - CENTER <i>? X NAI</i>	\$ 53.00	
23	FRONT NO. PLATE <i>/ DD</i>	S/N \$ 40.00	<i>40</i>
24	SUNDRIES <i>? ✓ All</i>	\$ 400.00	<i>14.88</i>
TOTAL SPARE PARTS CHARGES		: \$ 9,128.00	
TOTAL LABOUR CHARGES		: \$ 5,152.00	
GRAND TOTAL		: \$ 14,280.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183


12/6/19

Telefax

11/6/19, 10.15 am

Name : Steve (LKK)
Surveyed Date : OD - Author
Authorised Date : Excess - ?
Excess Cost : 6 days
Liability :
Remarks :

Please Note

: This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0733/2019/DY/TF
Date : 10-Jun-19

Vehicle NOT IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Steve,
6 days - ok - Jy - 22 Aug 19

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Ms. Ye Yansi Esther
Address : 62A Strathmore Ave
#04-46
Singapore 142062
Telephone : (HPI) + 65 98028476
Type of Claim : Own Damage Claim
Policy No. : 1800025878
Vehicle No : **SLX 529 Z**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year : Mar-18
Engine No : CHZ 654583
Chassis No. : WAUZZZ8V3J1046464
Mileage : -
Date In : -
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 04-Jun-19
Place of Accident : Intersection of Marymount Lane-

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLX 0529 Z

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy. TO REMOVE FRONT TRILLINGS, DISMANTLE AND RENEW front bumper and damaged attachments.	S/N \$ 360.00	\$ 360.00
2	Renew bonnet, hinges, striker and locks. Re-align both front fender and bonnet. Re-organise front crash management.	\$ 1,800.00	\$ 1,000.00
3	To respray front bumper, bonnet and both front fenders.	\$ 2,800.00	\$ 2,200.00
4	To carry out diagnostic check	S/N \$ 192.00	\$ 192.00
TOTAL LABOUR CHARGES		: \$ 5,152.00	\$ 3,752.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 0529 Z

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,830.00	
2	FRONT BUMPER FIXING PARTS	\$ 170.00	
3	FOAM FILLER PIECE	\$ 172.00	
4	RIVET	\$ 30.00	
5	FRONT REINFORCEMENT BAR	\$ 660.00	
6	FRONT BUMPER GRILLE - CENTER	\$ 146.00	
7	FRONT BUMPER COVER TRIM - LH / RH	\$ 296.00	
8	FRONT BUMPER GUIDE SECTION - LH / RH	\$ 70.00	
9	RADIATOR GRILLE	\$ 1,301.00	\$ 1,040.80
10	RADIATOR GRILLE CLOSING ELEMENT	\$ 174.00	\$ 138.80
11	BONNET	\$ 2,898.00	\$ 2,318.40
12	BONNET ATTACHMENT PARTS	\$ 149.00	
13	BONNET EDGE PROTECTION	\$ 25.00	\$ 19.92
14	BONNET CATCH - TOP	\$ 81.00	
15	BONNET STRIKER	2 \$ 200.00	
16	BONNET SOUND ABSORBER	\$ 201.00	
17	BOWDEN CABLE COVER	\$ 9.00	
18	BOWDEN CABLE	\$ 53.00	
19	BONNET LOCK	2 TBC	
20	BONNET CATCH - BOTTOM	\$ 58.00	
	SUB - TOTAL SPARE PARTS CHARGES	: \$ 8,523.00	\$ 3,517.92

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 0529 Z

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 3,517.92
21	BONNET HINGE - LH / RH		\$ 112.00	
22	FRONT AIR GUIDE - CENTER		\$ 53.00	
23	FRONT NO. PLATE	S/N	\$ 40.00	\$ 40.00
24	SUNDRIES		\$ 400.00	\$ 14.88
	TOTAL SPARE PARTS CHARGES	:	\$ 9,128.00	\$ 3,572.80
	TOTAL LABOUR CHARGES	:	\$ 5,152.00	\$ 3,752.00
	GRAND TOTAL	:	\$ 14,280.00	\$ 7,324.80

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Friday, 23 August 2019 9:13 AM
To: jiajee.yap@premiumauto.com.sg; Steve Chen (LKK Auto); SUR
Cc: 'Boo seng yak'; 'Carrine Leong'; 'Chang Chee Sing'
Subject: RE: FINAL REVISION - SLX529Z - OD AIG - SURVEYED 11 JUNE 19

Dear Jia Yee,

Confirm repair cost of \$7324.80 before excess \$600 and GST @ 6 days of repairs.

Kindly send us invoice and discharge voucher for us to close file.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jiajee.yap@premiumauto.com.sg <jiajee.yap@premiumauto.com.sg>
Sent: Thursday, 22 August 2019 6:11 PM
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; CS A Team <cs-a@lkkauto.com>; Admin A <admin-a@lkkauto.com>; Steve Chen (LKK Auto) <SteveChen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: 'Boo seng yak' <boojohnny@gmail.com>; 'Carrine Leong' <carrine.leong@premiumauto.com.sg>; 'Chang Chee Sing' <claims@premiumauto.com.sg>
Subject: FINAL REVISION - SLX529Z - OD AIG - SURVEYED 11 JUNE 19

Hi Adrian, Steve and all,

Revised estimate and photographs is attached.

Please confirm repair cost of \$7324.80 @ 6 days of repairs.

Your early closure is well appreciated

Thanks & Best Regard

JiaYee Yap

Claims Administrator

Premium Automobiles Pte Ltd (Reg No 109902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183

e. jiajee.yap@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLX 529 Z

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0677/2019/KK

12 Sep 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

1

total pages

RE: INSURANCE CLAIM FOR SLX 529 Z, Audi A3 SEDAN 1.0 TFSI.

With reference to the above-mentioned vehicle, no. **SLX 529 Z**, claimant, **Ms Ye Yansi Esther**, please find the related document per attached.

1. A copy of the Original invoice no. 85014240 – S\$ 7,195.54.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SLX 529 Z

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
251 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
251 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

C

INS TAX INVOICE

Page 1 17:03

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014240	Account: A0006 (T 0)
	Date : 12/09/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SLX0529E	
	Term : 30	
Regn No: SLX0529E (V 37053)	Regn Date: 14/03/2018	Mileage: 31350
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZZ28V3J1046464	Engine: CHZ 654583
		WIP No.: 55732
You have been assisted by :- UB-Kelvin Khoo (138)		

	Details	Qty	Unit Price	Amount
S	SUBLET M: TO SUPPLY VEHICLE NUMBER PLATE	40.00	1.00	40.00
Q	EXC M: 8888 Insurance Excess/Liability	-600.00	1.00	-600.00
S	BODYWORK M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	360.00	1.00	360.00
S	BODYWORK M: TO DISMANTLE AND RENEW BONNET. REPAIR FRONT BUMPER. REORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	1000.00	1.00	1,000.00
S	BODYWORK M: TO RESPRAY FRONT BUMPER, BONNET AND BOTH FRONT FENDER	2200.00	1.00	2,200.00
S	BODYWORK M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
X	A8V3853651AA3FZ GRILLE Less 020%	1.00	1301.00	1,040.80
X	A8V5823029A HOOD Less 020%	1.00	2898.00	2,318.40
X	A8V0823126B EDGING (LAST) Less 020%	1.00	24.90	19.92
X	A8K0010520A PLATE Less 020%	1.00	12.20	9.76
X	A8V0010515A STICKER Less 020%	1.00	6.40	5.12
X	A8V3853949 PLATE Less 020%	1.00	173.50	138.80

Parts 3,532.80
Labour 0.00
Sublet 3,792.00
Menus 0.00
Lubricant 0.00

Sub-Total 6,724.80

7% GST 470.74

Grand Total 7,195.54



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLX 529 Z

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0733/2019/KK
22 July 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 SEDAN 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8V3J1046464
Vehicle Regn No. : SLX 529 Z
Vehicle Mileage : 31744 KM
Vehicle Owner : Ms. Ye Yansi Esther
Certificate No : 1800025878
Own Damage Excess : \$642.00 (Incl. 7% GST)
Accident Date : 4 June 2019
Place : Intersection Of Marymount Lane And Upper Thomson
Repair Cost : \$ 7,195.54
WIP No. : 55732
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :



Time :

Date :

22/07/2019









































...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	06 Jun 2019		12 Jun 2019 11:48 Edit Adj Rpt	S\$7,324.80 Edit Estimates	S\$7,324.80 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by Insurer]									
Insured:	YE YANSI ESTHER , ID: 58523317C, Tel: +6598028476								
Vehicle Reg. No.:	SLX529Z	Date of Loss:	04/06/2019 16:00 - :59 [14 Months and 21 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 3010327660SG	Policy/Cover Note No.:	1800025878 (Comprehensive)						
		Excess:	S\$600.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Yap, Weijoe] Weijoe.Yap@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by CHEN TSUE YEE] ... [Final Rpt due 21/06/2019]								
Driver/Custodian:	SOH JWO SHYANG (34 / Male), NRIC: S8500905B, Tel: +6593830708 Email: JWOSHYANG@GMAIL.COM								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> AIG_SG (13/06/2019): Alert - Adj Mandate Approved (S\$7916.00) - SLX529Z - Claim Handler: Yap, Weijoe AIG_SG (12/06/2019): SLX529Z / OD / 04/06/2019 / Coverage & Excess update 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLX529Z (3010327660SG)
 OD
 Jun 4 2019 4:00PM
 [YE YANSI ESTHER]
 Premium Automobiles Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View	View in Browser
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/06/19 12:28	Adjuster Immediate Advice	 Load HTM	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
2	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
3	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
4	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
5	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
6	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
7	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
8	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
9	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
10	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
11	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
12	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
13	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
14	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
15	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
16	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
17	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
18	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
19	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
20	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
21	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
22	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
23	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
24	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
25	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
26	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
27	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
28	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
29	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
30	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
31	12/06/19 12:29	General View	 Load JPG	<input checked="" type="checkbox"/>
32	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
33	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
34	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
35	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
36	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
37	23/08/19 08:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/06/19 12:29	Singapore Accident Statement	 Load PDF	
2	12/06/19 12:30	Certificate of Insurance	 Load PDF	

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
3	12/06/19 12:30	LKK Auto Consultants Pte Ltd (HQ) Driver's Driving License		Load PDF
4	12/06/19 12:30	MARK ESTIMATE		Load PDF
5	03/10/19 15:04	Workshop Invoice		Load PDF
6	03/10/19 15:04	Discharge Voucher		Load PDF

Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
1	04/06/19 16:59	Premium Automobiles Pte Ltd (UBI) Accident Statement		Load HTM

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
1	04/06/19 16:31	Premium Automobiles Pte Ltd (UBI) Accident Photo		Load JPG <input checked="" type="checkbox"/>
2	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
3	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
4	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
5	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
6	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
7	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
8	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
9	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
10	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
11	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
12	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>
13	04/06/19 16:31	Accident Photo		Load JPG <input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
1	04/06/19 15:56	Premium Automobiles Pte Ltd (UBI) Sketch Plan		Load JPG <input checked="" type="checkbox"/>
2	04/06/19 15:56	Sketch Plan #2		Load JPG <input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; width: 100%;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19010363/EVD3E2

Date: 03/10/2019

REFERENCE

Insured/Claimant: YE YANSI ESTHER Policy No: 1800025878
Date of Loss: 04/06/2019 Nature of Claim: OD Claim No: 3010327660SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLX529Z**
Make & Model: AUDI A3, 1.4 SEDAN TFSI (AMBIENTE) (A) Engine No: CHZ654583
Reg. Date: 14/03/2018 (Man. Year: 2018) Chassis No: WAUZZZ8V3J1046464
Colour: White Odometer: 29391 km
Engine Capacity: 999 cc
Market Value/New Car Price: S\$103,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Bridgestone 6 mm Rear Left Side: Bridgestone 6 mm
Front Right Side: Bridgestone 6 mm Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,128.00	3,572.80	5,555.20	60.86
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,152.00	3,752.00	1,400.00	27.17
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,280.00	7,324.80	6,955.20	48.71
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	13,680.00	6,724.80	6,955.20	50.84
+ GST 7.00/7.00% (S\$)	957.60	470.74	486.86	50.84
Nett Amount (S\$)	14,637.60	7,195.54	7,442.06	50.84

INSPECTION

Date of Assignment: 12/06/2019
Date Inspected: 11/06/2019 Inspected At: 281 Alexandra Road
Repaire: Premium Automobiles
Estimated Period of Repair: 6.0 days

Adjuster: CHEN TSUE YEE

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Repair	1,830.00 FS	*- FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	170.00 FS	*- FS
3	1		*FOAM FILLER PIECE	Not Necessary	172.00 FS	*- FS
4	1		*RIVET	Not Necessary	30.00 FS	*- FS
5	1		*FRONT REINFORCEMENT BAR	Not Necessary	660.00 FS	*- FS
6	1		*FRONT BUMPER GRILLE - CENTER	Not Necessary	146.00 FS	*- FS
7	1		*FRONT BUMPER COVER TRIM - LH / RH	Not Necessary	296.00 FS	*- FS
8	1		*FRONT BUMPER GUIDE SECTION - LH / RH	Not Necessary	70.00 FS	*- FS
9	1		*RADIATOR GRILLE	Broken	1,301.00 FS	*1,040.80 FS
10	1		*RADIATOR GRILLE CLOSING ELEMENT	Broken	174.00 FS	*138.80 FS
11	1		*BONNET	Dented	2,898.00 FS	*2,318.40 FS
12	1		*BONNET ATTACHMENT PARTS	Not Necessary	149.00 FS	*- FS
13	1		*BONNET EDGE PROTECTION	Necessary	25.00 FS	*19.92 FS
14	1		*BONNET CATCH - TOP	Not Necessary	81.00 FS	*- FS
15	2		*BONNET STRIKER	Not Necessary	200.00 FS	*- FS
16	1		*BONNET SOUND ABSORBER	Not Necessary	201.00 FS	*- FS
17	1		*BOWDEN CABLE COVER	Not Necessary	9.00 FS	*- FS
18	1		*BOWDEN CABLE	Not Necessary	53.00 FS	*- FS
19	2		*BONNET LOCK (NPA)	Not Necessary	0.00 FS	*- FS
20	1		*BONNET CATCH - BOTTOM	Not Necessary	58.00 FS	*- FS
21	1		*BONNET HINGE - LH / RH	Not Necessary	112.00 FS	*- FS
22	1		*FRONT AIR GUIDE - CENTER	Not Necessary	53.00 FS	*- FS
23	1		*FRONT NO. PLATE	Dented	40.00 FS	*40.00 FS
24	1		*SUNDRIES	Necessary	400.00 FS	*14.88 FS
Total Parts (\$\$)					9,128.00	3,572.80

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
2	TO RESPRAY FRONT BUMPER, BONNET AND BOTH FRONT FENDERS	New	2,800.00	2,200.00
3	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
4	TO REMOVE FRONT FITTINGS, DISMANTLE AND RENEW FRONT BUMPER AND DAMAGED ATTACHMENTS. RENEW BONNET, HINGES, STRIKER AND LOCKS. RE-ALIGN BOTH FRONT FENDER AND BONNET, RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	1,800.00	1,000.00
Gross Labour Cost (\$\$)			5,152.00	3,752.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >