

ASS. REC. BY:

REF:

CD/INC19013081/Bgd302

Special Instruction:

Surveyor: Mr Jim

ASSIGNMENT (Office)

From (Person): Cynthia Any

of

INC

Date/Time:

24/7/19 @ 9.47am

Estimated Cost:

Bill to:

OD ☒ TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLG 586Y

Insured:

SLQ 6072X

at Workshop in/s

Vin's Automotive

Tel:

6453 2121

of

160 Sin Ming Drive # 08-09

Policy No:

Claim No:

MT/1054330-002

Sum Insured:

Excess:

Make of Vehc:

(Client's Record)

D.O.A

20/07/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

9.50am @ 24/7/19

Person Contacted:

Raymond

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction
	SLG 586Y - X
	SLQ 6072X - NA/TMI/5017 094/k9
20/8/19 @ 7.58pm	Confirmed with Raymond final fig \$ 16185.36, 8 days. (clerk \$ 1660.80, 9%)

opel/mokka
1.6

REF: INC

ASSIGNMENT

From: Date: 24.7.2019

Estimated Cost:

OD (TP / WS / TP RES / OD RES / EVA / INV / MV)

To Inspect Vehicle No: SLG 5864

at Workshop m/s Vin's Auto

of 160 Simming Drive # 08-09

Insured:

Policy No.:

Claims No.:

Sum Insured:


Excess:

(Client's Record)

Make of Veh.:

(Police Condition)

Remarks: The veh had commenced its repair at the time of inspection.

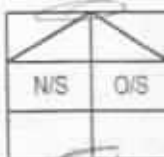

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 8 days Res.: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SLG 5864 Y: Regn: 19/9/2016

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mazda 3 1.5 cc 1496

Colour: Red A/C: Insured / Std / NI / NA

Sp. Reading: 48355 T/Radio: Insured / Std / NI / NA

Eng/No: P520368317

C/No: JM6BM42A8603112752

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/60/16

R: 205/60/16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal: 7 mm R/Bal: 7 mm

L/Bal: 7 mm L/Bal: 7 mm

D.O.A: 22/7/19 D.O.I: 24/7/2019 0009p

Survey held at Vin's Auto

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Range 15,000/2 - 16,000/2

Part by Part repair

Repair cost 16,185.36
(Less \$1660.80, 9%.)

26/7/19

MV 65,000/2

PV 47,750/2

NV 17,241/2

RECEIVED 21 AUG 2019

Teeim Liu
24/7/19

Date/Time, File Pass to?

1) 27/8/2019

Date/Time, File Return to?

2)

: Preli. Report

: Final Report

Days Of Repair: 8

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS \$

Phone

Others

TOTAL

Add Fee: Site Inap (\$)

Interview (\$)

Tech. Invs (\$)

Weekend (\$)

Report Format: TP

Lump Sum / I.B.I. (\$) 16185.36

290

290

Nivitha (LKK Auto)

From: Cynthia Ang <Cynthia.Ang@income.com.sg>
Sent: Wednesday, 24 July 2019 11:38 AM
To: 'assignments@lkkauto.com'; Admin-D (LKKAuto)
Cc: Cynthia Ang
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear LKK,

Resend with following details.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at Income.com.sg/careers



PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

From: Cynthia Ang
Sent: Wednesday, 24 July 2019 9:47 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: Teng Ken Leong <kenleong.teng@income.com.sg>; Thio Tse Kiat <tsekiat.thio@income.com.sg>; Cynthia Ang <Cynthia.Ang@income.com.sg>
Subject: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	OIC	Claim No.	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	OI Veh	DOA	Additional Remarks
1	Eric Tang	MT/1054041-002	SKP40U	AUBURN AUTO PTE LTD	176 SING MING DRIVE #04-18 SIN MING AUTOCARE SINGAPORE 575721	SAM NG /		SJX5746D	18/07/2019	
2		*Pending advise*	SLD8749H	COMFORTDELGRO ENGINEERING PTE LTD	205 BRADDELL ROAD EAST WING 3RD FLR SINGAPORE 579701	ANDREW / 63837656				
3	Fiona Shen	MT/1054783-001	SLK1780A	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	carmen / 87990066	10:00-12:00	GBD9099L	12/07/2019	
4	Eng Huey Huey	MT/1053378-002	SLG3325P	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	CARM / 87990066	10:30-12:30	SMC4602S	13/07/2019	

5	Fiona Shen	MT/1054563-002	SLQ2069H	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	SERENE CHEE / 87990066		SLK9926U	22/07/2019
6	Jeff Lin	MT/1051997-002	SKF8917R	LAI HUAT MENG KEE MOTOR PTE LTD	160 SIN MING DRIVE #04-01 SIN MING AUTOCITY SINGAPORE 575722	DEBORAH LAI / 64538110		SJS5571S	05/07/2019
7		*Pending advise*	SME7036X	LEONG AUTO PTE LTD	160 SIN MING DRIVE #02-13 SIN MING AUTOCITY	DANIEL TAN/CADY LEE / 9692 4113			
8	Eng Huey Huey	MT/1052391-002	SMC660A	MOTOR IMAGE ENTERPRISES PTE LTD	19 LORONG 8 TOA PAYOH SINGAPORE 319255	DANIEL A JUDE / 86113195	10:00-12:00	SLT8341R	07/07/2019
9	Jared Liu	MT/1054437-002	SMH6433Z	SKS AUTOMOBILE SOLUTION	176 SIN MING DRIVE #01-17 SIN MING AUTOCARE SINGAPORE 575721	MS YIWEN / 64550747		SME7134X	20/07/2019
10		*Pending advise*	SMC7382G	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	STEVEN / 82636295			
11	Jeff Lin	MT/1054330-002	SLG586Y	VIN'S AUTOMOTIVE GROUP	160 SIN MING DRIVE #08-09 SIN MING DRIVE SINGAPORE 575722	RAYMOND TEO / 64532121		SLQ6072X	20/07/2019

Please contact workshops.

Please revert to officer-in-charge after survey.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at income.com.sg/careers

in with you

PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Thursday, 29 August 2019 3:38 PM
To: Cynthia Ang
Cc: SUR; Thio Tse Kiat; Teng Ken Leong
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear Cynthia,

Noted with thanks.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Cynthia Ang <Cynthia.Ang@income.com.sg>
Sent: Thursday, 29 August 2019 3:38 PM
To: Shiau Chan (LKKAuto) <siewsc@lkkauto.com>
Cc: SUR <sur@lkkauto.com>; Thio Tse Kiat <tsekiat.thio@income.com.sg>; Teng Ken Leong <kenleong.teng@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear Shiau Chan,

The accident date should be 19/07/2019.

Sorry for any inconvenience caused.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at Income.com.sg/careers

in with you

PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

From: Shiau Chan (LKKAuto) [<mailto:siewsc@lkkauto.com>]
Sent: Thursday, 29 August 2019 3:35 PM
To: Cynthia Ang <Cynthia.Ang@income.com.sg>
Cc: SUR <sur@lkkauto.com>; Thio Tse Kiat <tsekiat.thio@income.com.sg>; Teng Ken Leong <kenleong.teng@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear Cynthia,

Kindly confirmed the accident date of SLG 586Y (Your Ref: MT/1054330-002) is 19/07/2019 or 20/07/2019.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto) <admin-d@lkkauto.com>

Sent: Thursday, 25 July, 2019 4:14 PM

To: 'Cynthia Ang' <Cynthia.Ang@income.com.sg>; assignments <assignments@lkkauto.com>

Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear Cynthia,

Noted with thanks.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Cynthia Ang [<mailto:Cynthia.Ang@income.com.sg>]

Sent: Thursday, 25 July 2019 4:05 PM

To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>

Cc: Cynthia Ang <Cynthia.Ang@income.com.sg>

Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Hi LKK,

Kindly refer below.

Thank you.

With Regards

Cynthia Ang

Admin Assistant

Motor Insurance

T +65 6430 7900

www.income.com.sg

income
made different



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify. Find out more at Income.com.sg/careers

in with you

From: Admin-D (LKKAuto) [mailto:admin-d@lkkauto.com]
Sent: Wednesday, 24 July 2019 4:59 PM
To: Cynthia Ang <Cynthia.Ang@income.com.sg>; assignments <assignments@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: Teng Ken Leong <kenleong.teng@income.com.sg>; Thio Tse Kiat <tsekiat.thio@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear Cynthia,

Thank you for the assignment.

Please be informed that SKP 40U (AUBURN AUTO) arrange to survey on 25/07/2019.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Cynthia Ang
Sent: Wednesday, 24 July 2019 11:38 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: Cynthia Ang <Cynthia.Ang@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear LKK,

Resend with following details.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at income.com.sg/careers

in with you

From: Cynthia Ang
Sent: Wednesday, 24 July 2019 9:47 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: Teng Ken Leong <kenleong.teng@income.com.sg>; Thio Tse Kiat <tsekiat.thio@income.com.sg>; Cynthia Ang

<Cynthia.Ang@income.com.sg>

Subject: TP CASES FARMED OUT TO LKK ON 24/07/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	OIC	Claim No.	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	OI Veh	DOA	Additional Remarks
1	Eric Tang	MT/1054041-002	SKP40U	AUBURN AUTO PTE LTD	176 SING MING DRIVE #04-18 SIN MING AUTOCARE SINGAPORE 575721	SAM NG /		SJX5746D	18/07/2019	
2	Helena Tan	MT/1054892-001	SLD8749H	COMFORTDELGRO ENGINEERING PTE LTD	205 BRADDELL ROAD EAST WING 3RD FLR SINGAPORE 579701	ANDREW / 63837656		SDQ6966L	21/07/2019	
3	Fiona Shen	MT/1054783-001	SLK1780A	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	carmen / 87990066	10:00-12:00	GBD9099L	12/07/2019	
4	Eng Huey Huey	MT/1053378-002	SLG3325P	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	CARM / 87990066	10:30-12:30	SMC4602S	13/07/2019	
5	Fiona Shen	MT/1054563-002	SLQ2069H	ESTEEM PERFORMANCE PTE LTD	385 SIN MING DRIVE VICOM INSPECTION CENTRE SINGAPORE 575718	SERENE CHEE / 87990066		SLK9926U	22/07/2019	
6	Jeff Lin	MT/1051997-002	SKF8917R	LAI HUAT MENG KEE MOTOR PTE LTD	160 SIN MING DRIVE #04-01 SIN MING AUTOCITY SINGAPORE 575722	DEBORAH LAI / 64538110		SJS5571S	05/07/2019	
7	Helena Tan	MT/1054532-002	SME7036X	LEONG AUTO PTE LTD	160 SIN MING DRIVE #02-13 SIN MING AUTOCITY	DANIEL TAN/CADY LEE / 9692 4113		GW3781E	23/07/2019	
8	Eng Huey Huey	MT/1052391-002	SMC660A	MOTOR IMAGE ENTERPRISES PTE LTD	19 LORONG 8 TOA PAYOH SINGAPORE 319255	DANIEL A JUDE / 86113195	10:00-12:00	SLT8341R	07/07/2019	
9	Jared Liu	MT/1054437-002	SMH6433Z	SKS AUTOMOBILE SOLUTION	176 SIN MING DRIVE #01-17 SIN MING AUTOCARE SINGAPORE 575721	MS YIWEN / 64550747		SME7134X	20/07/2019	
10	Eric Tang	MT/1054600-002	SMC7382G	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	STEVEN / 82636295		FBE9525T	17/07/2019	
11	Jeff Lin	MT/1054330-002	SLG586Y	VIN'S AUTOMOTIVE GROUP	160 SIN MING DRIVE #08-09 SIN MING DRIVE SINGAPORE 575722	RAYMOND TEO / 64532121		SLQ6072X	20/07/2019	

Please contact workshops.

Please revert to officer-in-charge after survey.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at Income.com.sg/careers



PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.



This email has been checked for viruses by AVG antivirus software.
www.avg.com

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

Shiau Chan (LKKAuto)

From: Admin @ VAuG <admin@vinsautogroup.com.sg>
Sent: Tuesday, 20 August 2019 2:58 PM
To: Shiau Chan (LKKAuto)
Cc: TG Lim (LKK Auto)
Subject: Re: SLG586Y - TP - DOA: 19/07/2019

Good afternoon,

Noted with thanks

Please proceed

Best Regards
Raymond Teo

On Tue, Aug 20, 2019 at 1:13 PM Shiau Chan (LKKAuto) <siewsc@lkkauto.com> wrote:

Dear Raymond,

WITHOUT PREJUDICE

Refer to the conversation this morning.

Please find the attached of estimate marking and the offer on repair cost should be \$16,185.36 and 8 repair days.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: TG Lim (LKK Auto) <TeowGuan@lkkauto.com>
Sent: Monday, 19 August 2019 12:27 PM
To: Admin @ VAuG <admin@vinsautogroup.com.sg>
Cc: Shiau Chan (LKKAuto) <siewsc@lkkauto.com>
Subject: RE: SLG586Y - TP - DOA: 19/07/2019

Shiau Chan (LKKAuto)

From: Admin @ VAuG <admin@vinsautogroup.com.sg>
Sent: Thursday, 15 August 2019 4:56 PM
To: TG Lim (LKK Auto)
Cc: SUR
Subject: SLG586Y - TP - DOA: 19/07/2019
Attachments: 20190815162902.pdf

Good afternoon,

Please check the attachment for the breakdown of the calculation

Parts: \$14129.84
Supplementary: \$604.00
Labour \$1880.00


Can we close the case at \$16613.84?

Thanks!
Best Regards
Raymond Teo



Sin Ming AutoCity
160 Sin Ming Drive
Singapore 575722
Showroom/Office: #03-03
Workshops: #08-08/09/10
Tel: 64532121 (4 lines)
Fax: 64599795
Website: www.vinsautogroup.com.sg
Email: admin@vinsautogroup.com.sg

Follow us on :



** w.e.f 15th May 2017, we have shifted location! **

** w.e.f 20th November 2017, we have changed our email address! **

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC
Owner ID: 752I

Vehicle Details

Vehicle No.: SLG586Y
Vehicle to be Exported: No
Intended Deregistration Date: 23 Jul 2019
Vehicle Make: MAZDA
Vehicle Model: MAZDA3 4-DOOR SEDAN 1.5L SP6EAT
Primary Colour: Red
Manufacturing Year: 2016
Engine No.: P520368317
Chassis No.: JM6BM42A8G0342752
Maximum Power Output: 88.0 kW (118 bhp)
Open Market Value: \$19,544.00
Original Registration Date: 19 Sep 2016
First Registration Date: 19 Sep 2016
Transfer Count: 0
Actual ARF Paid: \$14,544.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 18 Sep 2026
PARF Rebate Amount: \$10,908.00

Intended COE Rebate Details

COE Expiry Date: 18 Sep 2026
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$51,506.00
COE Rebate Amount: \$36,851.00
Total Rebate Amount: \$47,759.00

The information contained herein is correct as at 23 Jul 2019

OK

Dep 8,575/yr

MV 65,000/yr
PV 47,759/yr
NV 17,241/yr

TG Lim hml
26/7/19



CONNECTING CAR BUYERS & SELLERS.

We'll handle your loans, insurance & other paperwork for FREE.

[Find out more](#)


Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

Audi A5 Coupe 2.5A TFSI quattro



The Most Sleek Audi A5 In The Market. Low Mileage, Contact Us!
Direct Owner


[Browse by Category](#)
[Back \(1 2 3 4 5 6 \) Next >](#)
[Sort by Reg. Date](#)
[20 results/page](#)

106 vehicles

Mazda 3

Advanced Search

	Model	Price	Depreciation	Reg. Date	Eng. Cap	Mileage	Veh. Type	Status
Search Selection	Mazda 3	Any	Any	2016	Any	Any	Any	All
	Mazda 3 1.5A Sunroof Cheapest Unit In The Market. Elegant Blue, With Sunroof, Low Maintenance Cost, Very Well Maintained, Flexible In-house Loan Packages Available. Consignment Unit. Call To Arrange For Viewing. Posted: 03-Jun-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	-	N.A	29-Sep-2016	1,496 cc	-	Sedan	SOLD
	Mazda 3 1.5A Sunroof \$6k Driveway, In House Financing! Bank Loan Interest At Only 2.48%! Free 1 Year Engine And Gearbox Warranty! Free 1x Servicing! High Loan Approval Rate! Option For Long Term Leasing Available, Low Mileage, Sporty Look With Sunroof, I-STOP, I-ELOOP, Original P... Posted: 31-May-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	\$63,800	\$8,070 /yr	29-Sep-2016	1,496 cc	57,111 km	Sedan	Available
	Mazda 3 HB 2.0A 1 Owner Well Maintained, Service At Mazda. Interior With Many Carbon Fibre Panel And Carbon Steering. Contact Us For Viewing And Optional With RMS Ray Motorsports Warranty Coverage. Posted: 25-Jul-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	\$79,888	\$9,640 /yr	14-Sep-2016	1,998 cc	82,000 km	Hatchback	Available
	Mazda 3 1.5A Sunroof Graded A by STP Well Maintained, Excellent Condition, Well Taken Care Of By Previous Owner. Trade In/Loan Available! Hurry Call Or Visit Us Now For Further Details. Universe Motoring Posted: 20-Jul-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	\$64,800	\$8,290 /yr	06-Sep-2016	1,496 cc	42,000 km	Sedan	Available
	The Toyota Previa is the de facto MPV The Toyota Previa is an MPV that excels with its space, practicality and a level of luxury some may not reach. Find out more!							
	Mazda 3 1.5A Sunroof Best Deal In Town! Don't Miss These Great Offer While Purchasing Vehicle With Us! Come With 2 Year Third Party Warranty, Sunroof Model! Well Groomed & Maintained! Upholstery Black Leather Seats With Red Stitches. Agent Unit! Trade-In Welcome! Easy And Flexible... Motor-Way Credit Pte Ltd Posted: 10-Jul-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	-	N.A	06-Sep-2016	1,496 cc	-	Sedan	SOLD
	Mazda 3 1.5A Sunroof (FREE 2 Years Premium Warranty And \$500 Service Credit!) (Highest Spec With Sunroof) 100% Loan! Fuel Efficient And Spacious Seats. One Of The Most Popular Model In The Market! Fuel Efficient SkyActiv Engine. Luxury Black With Black Leather Interior!. Excellent Cond... Hamilton Autohub Pte Ltd. Posted: 01-Jul-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	\$69,188	\$8,900 /yr	06-Sep-2016	1,496 cc	60,000 km	Sedan	Available
	Mazda 3 1.5A Sunroof Very Popular Car! Powerful, Responsive Yet Fuel Efficient. Flexible Loan Packages Available With Attractive Interest Rates. Welcome All Trade In. Call Our Friendly Representatives For More Information Or For A Viewing Of The Car. Posted: 29-Jun-2019 Tags: 2016 Mazda 3, 2016 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda	\$84,555	\$8,250 /yr	06-Sep-2016	1,496 cc	62,726 km	Sedan	Available

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report: 22/07/2019 17:48
 Date Of Accident: 19/07/2019 22:35
 Exact Location Of Accident: ALONG PIE TOWARDS BKE
 Country/State of Loss: SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number: SLG586Y
Insured/Policyholder
 Name Of Registered Owner: ANG WAH SAN
 NRIC No: S1830752I
 Email Address: NOEMAIL
 Mobile Phone No: (LOCAL) +65-97596414
 Alternative Phone No: OTHERS-97596414

Vehicle Particulars

Manufacturer: MAZDA
 Model: 4 DOOR 1.5 SP

Exact Purpose for which vehicle was being used at time of accident:

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken: THIRD PARTY

Vehicle Category: PRIVATE CAR

Insurance Company

Name of Insurance Company: EQ INSURANCE COMPANY LTD
 Type Of Coverage: COMPREHENSIVE
 Fleet Policy: NO
 Policy Number: DMPPHQ18-006196
 Cover Note Number:

Driver

Name of Driver: ANG KI YONG
 NRIC No: S9820442C
 Date Of Birth: 28/06/1998
 Occupation: INDOOR
 Date Of Driving Pass: 21/12/2018
 Driving Experience: 0 YEAR AND 6 MONTH
 Gender: MALE
 Mobile Number: (LOCAL) +65-97596414
 Fax Number:
 Contact Number:
 EMail Address: NOEMAIL

Address	BLK 449 BUKIT PANJANG RING ROAD #14-571
Postcode	670449
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	CHILDREN
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	4
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : ANG WAH SAN
	GENDER: : MALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO ATTACHED STATEMENT RECORDED BY LILY - PROGRESSIVE CAR CARE PTE LTD 67415336

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLQ6072X
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	VEH B
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SKA8879T
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	VEH C
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number	SMK7620C
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	VEH D
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan


SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policymaker and/or the Authorized Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **rescind policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIB Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the signing of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available should:
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form and any other personal information provided by me or provided by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in the accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insured (owner/lessor/financier), the Advisory Authority of Singapore and any relevant government Agency/authority (such as the police), for the purposes of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries from;
 - (iv) administering my claims including the making of correspondence, statements, notices, reports or notices to me which could involve disclosure of certain personal data about me or bring about concerns of the same as well as on our external cover of envelopes/postal packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) All insurer(s) who have insured vehicle(s) involved in the accident and the Insurers' lawyer/fax firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) My Personal Information may be disclosed by any of the Insurers and/or G.A. to their third party service providers or agents (including their lawyers/fax firms) which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) My Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in private and all future claims.
- (e) No information so collected under (a) above may be shared / disclosed:
- (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, inquiries, law enforcement and government agencies as indispensably required for the purposes stated; or
- (ii) for complying with requirements under any regulations, laws or court orders.

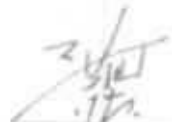
Policymaker's Signature
Date & Time


Driver's Signature
If driver is not the authorized driver
Date & Time


Approving Claims Personnel's Signature
Name
NRIC/PIN No.

Sketch Plan #2

SKETCH PLAN



D: SMK7620C
A: SMK761Y
B: SLQ602X
C: SKA879T

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On the 19th of July 2019, at about 2235 hrs. I was driving along PIE towards BKE. The vehicle SMK7620C suddenly stopped. I managed to stop in time as well. All of a sudden, I felt an impact from my rear. The impact caused my vehicle to move forward and hit onto the vehicle SMK7620C. After I alighted from my vehicle. I realized it was a 4 car chain collision. It was the vehicle SLQ602X hit onto my rear.

DECLARATION

(I/We declare the foregoing particulars are true to the best of my/our knowledge)


Reporting Officer's Signature
Date & Time


Driver's Signature
(If driver is not the person involved)
Date & Time


Reporting Officer's Signature
Name
Date & Time



AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

ESTIMATE COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1	pc	Front nose panel	\$	351.00	DD✓
1	pc	Front grille	\$	610.00	BR✓
1	pc	Front grille emblem	\$	46.00	NEC✓
2	pcs	Front grille chrome moulding	\$	184.00	?
1	pc	Front bumper	\$	1,082.00	DD✓
2	pcs	Front bumper fog lamp @ \$382.00	\$	764.00	BR✓
2	pcs	Front bumper fog lamp cover @ \$165.00	\$	330.00	BR✓
2	pcs	Front bumper signal light @ \$164.00	\$	328.00	?
2	pcs	Front bumper side retainer @ \$28.00	\$	56.00	BR✓
1	pc	Front bumper sponge	\$	165.00	?
1	pc	Front bumper reinforcement	\$	593.00	?
1	pc	Front bumper under cover	\$	121.00	?
10	pcs	Front bumper under cover clips @ \$5.00	\$	50.00	?
10	pcs	Front bumper clips @ \$3.00	\$	30.00	NEC✓
2	pcs	Front headlamp @ \$2357.00	\$	4,714.00	BR✓
1	pc	Front support panel	\$	492.00	?
1	pc	Front brace panel	\$	59.00	?
1	pc	Front no. plate	\$	40.00	SCR✓
1	pc	Rear boot lid	\$	1,004.00	DD✓
1	pc	Rear boot lid emblem	\$	74.00	NEC
1	pc	Rear boot lid "Mazda" name plate	\$	53.40	NEC
1	pc	Rear boot lid "Skyactive Technology" name plate	\$	68.60	NEC
2	pcs	Rear boot lid reflector @ \$466.00 LH-BR✓ RH?	\$	932.00	?
1	pc	Rear boot lid lock	\$	185.00	BR✓
2	pcs	Rear boot lid no. plate light @ \$49.70	\$	99.40	?
1	pc	Rear boot lid inner trim	\$	126.00	TN✓
10	pcs	Rear boot lid inner trim clips @ \$5.00	\$	50.00	NEC
2	pcs	Rear tail lamp @ \$960.00 LH BR, RH ?	\$	1,920.00	?
		Balance C/F	\$	14,527.40	

Vin's

AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

Balance B/F \$ 14,527.40

1	pc	Rear bumper		\$ 1,127.00	BR ✓
2	pcs	Rear bumper sensor @ \$193.00	200.00	\$ 72.00	SC ✓
1	pcs	Rear bumper towing cover @ \$21.90	21.90	\$ 43.80	BR ✓
2	pcs	Rear bumper reflector @ \$52.00		\$ 104.00	?
2	pcs	Rear bumper side retainer @ \$37.00		\$ 74.00	NECV
1	pc	Rear bumper reinforcement		\$ 563.00	?
10	pcs	Rear bumper clips @ \$3.00		\$ 30.00	NECV ✓
1	pc	Rear end panel		\$ 530.00	?
1	pc	Rear end panel inner trim		\$ 99.00	DL
1	pc	Rear LH fender inner trim		\$ 246.00	WT
1	pc	Rear spare tyre top cover		\$ 249.00	NNX
				\$ 18,365.20	
Less 20%				\$ (3,673.04)	
				\$ 14,692.16	

To refill air cond gas

To repair damages

To spray painting

\$ 150.00 ?
\$ 1,100.00 800.00
\$ 1,300.00 1,000.00
\$ 17,242.16

VIN'S MOTOR PTE LTD



Repair days 8

? photo
part by part repair

TG Lim M 97361577
24/7/19
1645 hrs

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vin's

AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

ESTIMATE COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1	pc	Front nose panel	\$	351.00	DD✓
1	pc	Front grille	\$	610.00	BR✓
1	pc	Front grille emblem	\$	46.00	NEC✓
2	pcs	Front grille chrome moulding	\$	184.00	? BR✓
1	pc	Front bumper	\$	1,082.00	DD✓
2	pcs	Front bumper fog lamp @ \$382.00	\$	764.00	BR✓
2	pcs	Front bumper fog lamp cover @ \$165.00	\$	330.00	BR✓
2	pcs	Front bumper signal light @ \$164.00	\$	328.00	? BR✓
2	pcs	Front bumper side retainer @ \$28.00	\$	56.00	BR✓
1	pc	Front bumper sponge	\$	165.00	? BR✓
1	pc	Front bumper reinforcement	\$	593.00	? DD✓
1	pc	Front bumper under cover	\$	121.00	? TN✓
10	pcs	Front bumper under cover clips @ \$5.00	\$	30.00	? ✓
10	pcs	Front bumper clips @ \$3.00	\$	30.00	NEC✓
2	pcs	Front headlamp @ \$2357.00	\$	4,714.00	BR✓
1	pc	Front support panel	\$	492.00	? BR✓
1	pc	Front brace panel	\$	59.00	? BR✓
1	pc	Front no. plate	\$	40.00	SCR✓
1	pc	Rear boot lid	\$	1,004.00	DD✓
1	pc	Rear boot lid emblem	\$	74.00	NEC✓
1	pc	Rear boot lid "Mazda" name plate	\$	53.40	NEC✓
1	pc	Rear boot lid "Skyactive Technology" name plate	\$	68.60	NEC✓
2	pcs	Rear boot lid reflector @ \$466.00	\$	932.00	? BR✓
1	pc	Rear boot lid lock	\$	185.00	BR✓
2	pcs	Rear boot lid no. plate light @ \$49.70	\$	99.40	? BR✓
1	pc	Rear boot lid inner trim	\$	126.00	TN✓
10	pcs	Rear boot lid inner trim clips @ \$5.00	\$	30.00	NEC✓
2	pcs	Rear tail lamp @ \$960.00	\$	1,920.00	? BR✓
		Balance C/F	\$	14,527.40	

Vin's

AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

Balance B/F

\$ 14,527.40

1	pc	Rear bumper		\$ 1,127.00	BR ✓
2	pcs	Rear bumper sensor @ \$193.00	200.00	\$ 722.00	SG ✓
1	pcs	Rear bumper towing cover @ \$21.90	2 L/H 21.90	\$ 43.80	BR ✓
2	pcs	Rear bumper reflector @ \$52.00		\$ 104.00	? BR ✓
2	pcs	Rear bumper side retainer @ \$37.00		\$ 74.00	NEC ✓
1	pc	Rear bumper reinforcement		\$ 563.00	? DD ✓
10	pcs	Rear bumper clips @ \$3.00		\$ 30.00	NEC ✓
1	pc	Rear end panel		\$ 530.00	? DD ✓
1	pc	Rear end panel inner trim		\$ 99.00	DL ✓
1	pc	Rear LH fender inner trim		\$ 246.00	WT ✓
1	pc	Rear spare tyre top cover		\$ 249.00	N NX
				\$ 18,365.20	
Less 20%				\$ (3,673.04)	
				\$ 14,692.16	

To refill air cond gas
To repair damages
To spray painting

\$ 150.00 ? 80.00 ✓
\$ 1,100.00 800.00
\$ 1,200.00 1,000.00
\$ 17,242.16

VIN'S MOTOR PTE LTD

Resurveyed on 25/7/19

1510 hrs on check items hmr
TGM

Repair days 8

? photo
part by part repair

TGM hmr 97361577
24/7/19
1645 hrs

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vin's

AUTOMOTIVE GROUP

Our Ref : TP/072019/3960

Accident date: 19/7/2019

Your Ref : SLQ6072X

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

SUPPLEMENTARY COST OF REPAIRS TO

Vehicle No. : SLG586Y

Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1 pc Rear boot lid reverse camera

Less: 20%

\$	755.00	BRV
\$	755.00	
\$	(151.00)	
\$	604.00	

VIN'S MOTOR PTE LTD



Resurvey for before paint
29/7/19 1236 hrs
Renee Lim

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Tax Invoice :

Date : 25/7/2019



AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

ESTIMATE COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1	pc	Front nose panel		\$	✓	351.00	DD✓
1	pc	Front grille		\$	✓	610.00	BR✓
1	pc	Front grille emblem		\$	✓	46.00	NEC✓
2	pcs	Front grille chrome moulding	X 2 @ 184.00 368.00	\$	✓	184.00	? BR✓
1	pc	Front bumper		\$	✓	1,082.00	DD✓
2	pcs	Front bumper fog lamp @ \$382.00		\$	✓	764.00	BR✓
2	pcs	Front bumper fog lamp cover @ \$165.00 @ 69.00	138.00	\$	✓	330.00	BR✓ 3359
2	pcs	Front bumper signal light @ \$164.00		\$	✓	328.00	? BR✓
2	pcs	Front bumper side retainer @ \$28.00		\$	✓	56.00	BR✓
1	pc	Front bumper sponge	✓ 97.40	\$	✓	165.00	? BR✓
1	pc	Front bumper reinforcement		\$	✓	593.00	? DD✓
1	pc	Front bumper under cover		\$	✓	121.00	? TN✓
10	pcs	Front bumper under cover clips @ \$5.00		\$	30.00	50.00	? ✓ NEC
10	pcs	Front bumper clips @ \$3.00		\$		30.00	NEC✓
2	pcs	Front headlamp @ \$2357.00		\$	✓	4,714.00	BR✓
1	pc	Front support panel		\$	✓	492.00	? BR✓
1	pc	Front brace panel		\$	✓	59.00	? BR✓
1	pc	Front no. plate		\$	✓	40.00	SCR✓
1	pc	Rear boot lid		\$	✓	1,004.00	DD✓
1	pc	Rear boot lid emblem		\$	✓	74.00	NEC✓
1	pc	Rear boot lid "Mazda" name plate		\$	✓	53.40	NEC✓
1	pc	Rear boot lid "Skyactive Technology" name plate		\$	✓	68.60	NEC✓
2	pcs	Rear boot lid reflector @ \$466.00	LH - BR✓ RH ? BR✓	\$	✓	932.00	? BR✓
1	pc	Rear boot lid lock		\$	✓	185.00	BR✓
2	pcs	Rear boot lid no. plate light @ \$49.70		\$	✓	99.40	? BR✓
1	pc	Rear boot lid inner trim		\$	✓	126.00	TN✓
10	pcs	Rear boot lid inner trim clips @ \$5.00		\$	30.00	50.00	? NEC✓
2	pcs	Rear tail lamp @ \$960.00	LH BR, RH ? BR✓	\$	✓	1,920.00	? BR✓
		Balance C/F	915.00	\$		14,527.40	

14321.80

Vin's

AUTOMOTIVE GROUP

Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
6453 2121 (4 lines) / 6458 1111 (24 hrs)
6459 9795 / 6459 0433
admin@vinsautogroup.com.sg
www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

Balance B/F

14321.80
\$ 14,527.40

1	pc	Rear bumper	MIBPD8-50-221ABB 104299170	\$ 1,127.00	BR ✓
2	pcs	Rear bumper sensor @ \$193.00	200.00 ✓	\$ 722.00	SHO ✓
1	pcs	Rear bumper towing cover @ \$21.90	L/H 21.90 ✓	\$ 43.80	BR ✓
2	pcs	Rear bumper reflector @ \$52.00		\$ 104.00	? BR ✓
2	pcs	Rear bumper side retainer @ \$37.00		\$ 74.00	NECV ✓
1	pc	Rear bumper reinforcement		\$ 563.00	? DDV ✓
10	pcs	Rear bumper clips @ \$3.00		\$ 30.00	NECV ✓
1	pc	Rear end panel	425.00	\$ 530.00	? DDV ✓
1	pc	Rear end panel inner trim		\$ 99.00	DL ✓
1	pc	Rear LH fender inner trim		\$ 246.00	WT ✓
1	pc	Rear spare tyre top cover		\$ 249.00	NNX
Less 20%				17126.70	\$ 18,365.20
				755.00	\$ (3,673.04)
				17881.70	\$ 14,692.16
To refill air cond gas				@20% 3576.34	\$ 150.00 ? 80.00 ✓
To repair damages				Parts 14305.36	\$ 1,100.00 800.00
To spray painting				Labour 1880.00	\$ 1,200.00 1000.00
Repair cost				16185.36	\$ 17,242.16 1880.00

VIN'S MOTOR PTE LTD

? photo
part by part repair

TG Lim M 97361577

24/7/19

1645 hrs

Resurvey on 25/7/19

1510 hrs on check items has
Repair days 8

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

17993.36

17846.16

Vin's

AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice :

Date : 25/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

SUPPLEMENTARY COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1 pc Rear boot lid reverse camera

Less: 20%

S	755.00
S	755.00
S	(151.00)
S	604.00

Too high
BRV

VIN'S MOTOR PTE LTD





AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

ESTIMATE COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1	pc	✓ Front nose panel	\$	351.00	DD ✓
✓ 1	pc	✓ Front grille	\$	610.00	BR ✓
1	pc	✓ Front grille emblem	\$	46.00	NEC ✓
2	pcs	✓ Front grille chrome moulding X 2	\$	184.00	? BR ✓ 364
1	pc	Front bumper	\$	1,082.00	DD ✓
2	pcs	Front bumper fog lamp @ \$382.00	\$	764.00	BR ✓
2	pcs	Front bumper fog lamp cover @ \$165.00	\$	330.00	BR ✓
2	pcs	Front bumper signal light @ \$164.00	\$	328.00	? BR ✓
2	pcs	Front bumper side retainer @ \$28.00	\$	56.00	BR ✓
1	pc	Front bumper sponge	\$	165.00	? BR ✓
1	pc	Front bumper reinforcement	\$	593.00	? DD ✓
1	pc	Front bumper under cover	\$	121.00	? TN ✓
10	pcs	Front bumper under cover clips @ \$5.00	\$	30.00	✓ 30.00
10	pcs	Front bumper clips @ \$3.00	\$	30.00	NEC ✓
2	pcs	Front headlamp @ \$2357.00	\$	4,714.00	BR ✓
1	pc	Front support panel	\$	492.00	? BR ✓
1	pc	Front brace panel	\$	59.00	? BR ✓
1	pc	Front no. plate	\$	40.00	SCR ✓
1	pc	Rear boot lid	\$	1,004.00	DD ✓
1	pc	Rear boot lid emblem	\$	74.00	NEC ✓
1	pc	Rear boot lid "Mazda" name plate	\$	53.40	NEC ✓
1	pc	Rear boot lid "Skyactive Technology" name plate	\$	68.60	NEC ✓
2	pcs	Rear boot lid reflector @ \$466.00	\$	932.00	? BR ✓
1	pc	Rear boot lid lock	\$	185.00	BR ✓
2	pcs	Rear boot lid no. plate light @ \$49.70	\$	99.40	? BR ✓
1	pc	Rear boot lid inner trim	\$	126.00	TN ✓
10	pcs	Rear boot lid inner trim clips @ \$5.00	\$	30.00	NEC ✓
2	pcs	Rear tail lamp @ \$960.00	\$	1,920.00	? BR ✓
		Balance C/F	\$	14,527.40	

Vin's
AUTOMOTIVE GROUP

A Sin Ming Autocity,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice:

Date : 23/7/2019

Balance B/F

\$ 14,527.40

1	pc	Rear bumper		\$ 1,127.00	BR ✓
2	pcs	Rear bumper sensor @ \$193.00	200.00	\$ 722.00	SC ✓ 200
2	pcs	Rear bumper towing cover @ \$21.90	21.90	\$ 43.80	BR ✓ 21.90
2	pcs	Rear bumper reflector @ \$52.00		\$ 104.00	BR ✓
2	pcs	Rear bumper side retainer @ \$37.00		\$ 74.00	NECV
1	pc	Rear bumper reinforcement		\$ 563.00	? DDV
10	pcs	Rear bumper clips @ \$3.00		\$ 30.00	NECV
1	pc	Rear end panel		\$ 530.00	? DDV
1	pc	Rear end panel inner trim		\$ 99.00	DL ✓
1	pc	Rear LH fender inner trim		\$ 246.00	WT ✓
1	pc	Rear spare tyre top cover		\$ 249.00	NINX X
				\$ 18,365.20	
Less 20%				\$ (3,673.04)	
				\$ 14,692.16	

To refill air cond gas
To repair damages
To spray painting

\$ 150.00 ? 80.00 ✓ 80
\$ 1,180.00 800.00 800
\$ 1,380.00 1,000.00 1,000
\$ 17,242.16

VIN'S MOTOR PTE LTD

Resurvey on 25/7/19

15/10/19 on check items hmr
TGLim

Repair days 8

? photo

part by part repair

TGLim via 97361577

24/7/19

1645 hrs

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- This party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vin's
AUTOMOTIVE GROUP

A Sin Ming Autody,
160 Sin Ming Drive #03-03
Singapore 575722
T 6453 2121 (4 lines) / 6458 1111 (24 hrs)
F 6459 9795 / 6459 0433
E admin@vinsautogroup.com.sg
W www.vinsautogroup.com.sg

Our Ref : TP/072019/3960
Accident date: 19/7/2019
Your Ref : SLQ6072X

Tax Invoice :

Date : 25/7/2019

MOTOR CLAIM DEPARTMENT
NTUC INCOME INSURANCE CO-OP LTD
75 Bras Basah Road
#05-00 NTUC Income Centre
Singapore 189557

SUPPLEMENTARY COST OF REPAIRS TO

Vehicle No. : SLG586Y
Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

1 pc Rear boot lid reverse camera

Less: 20%

\$	755.00	BRV
\$	755.00	
\$	(151.00)	
\$	604.00	

VIN'S MOTOR PTE LTD



Resurvey for before paint

29/7/19 1236 hrs

Rueu hie

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19013081/Bqd3e2

73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Date: 29-08-2019



ATTN: JEFF LIN

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLQ 6072X	Veh. Inspected	SLG 586Y
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1054330-002	Excess (\$)	0.00
Assign From	CYNTHIA ANG	Assign Date	24/07/2019

2. Vehicle Particulars & Condition

Make & Model	MAZDA 3 1.5	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	JM6BM42A8G0342752	Colour	RED
Odometer	48355 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/60 R16	YOKOHAMA	7 mm
L/H Front Tyre	205/60 R16	YOKOHAMA	7 mm
R/H Rear Tyre	205/60 R16	YOKOHAMA	7 mm
L/H Rear Tyre	205/60 R16	YOKOHAMA	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	19/07/2019	Inspect Date / Time	24/07/2019 (04:09 PM)
Survey held at	160 SIN MING DRIVE #08-09		
Repairer	VIN'S MOTOR PTE LTD		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLG 586Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT NOSE PANEL	DENTED	351.00	351.00
1	FRONT GRILLE	BROKEN	610.00	610.00
1	FRONT GRILLE EMBLEM	NECESSARY	46.00	46.00
2	FRONT GRILLE CHROME MOULDING @\$184.00	BROKEN	368.00	368.00
1	FRONT BUMPER	DENTED	1,082.00	1,082.00
2	FRONT BUMPER FOG LAMP @\$382.00	BROKEN	764.00	764.00
2	FRONT BUMPER FOG LAMP COVER @\$165.00	BROKEN	330.00	138.00
2	FRONT BUMPER SIGNAL LIGHT @\$164.00	BROKEN	328.00	328.00
2	FRONT BUMPER SIDE RETAINER @\$28.00	BROKEN	56.00	56.00
1	FRONT BUMPER SPONGE	BROKEN	165.00	97.40
1	FRONT BUMPER REINFORCEMENT	DENTED	593.00	593.00
1	FRONT BUMPER UNDER COVER	TORN	121.00	121.00
10	FRONT BUMPER UNDER COVER CLIPS @\$5.00	NECESSARY	50.00	30.00
10	FRONT BUMPER CLIPS @\$3.00	NECESSARY	30.00	30.00
2	FRONT HEADLAMP @\$2357.00	BROKEN	4,714.00	4,714.00
1	FRONT SUPPORT PANEL	BROKEN	492.00	492.00
1	FRONT BRACE PANEL	BROKEN	59.00	59.00
1	FRONT NO. PLATE	SCRATCHED	40.00	40.00
1	REAR BOOT LID	DENTED	1,004.00	1,004.00
1	REAR BOOT LID EMBLEM	NECESSARY	74.00	74.00
1	REAR BOOT LID "MAZDA" NAME PLATE	NECESSARY	53.40	53.40
1	REAR BOOT LID "SKYACTIVE TECHNOLOGY" NAME PLATE	NECESSARY	68.60	68.60
2	REAR BOOT LID REFLECTOR @\$466.00	BROKEN	932.00	932.00
1	REAR BOOT LID LOCK	BROKEN	185.00	185.00
2	REAR BOOT LID NO. PLATE LIGHT @\$49.70	BROKEN	99.40	99.40
1	REAR BOOT LID INNER TRIM	TORN	126.00	126.00
10	REAR BOOT LID INNER TRIM CLIPS @\$5.00	NECESSARY	50.00	30.00
2	REAR TAIL LAMP @\$960.00	BROKEN	1,920.00	1,830.00
1	REAR BUMPER	BROKEN	1,127.00	1,042.00
4	REAR BUMPER SENSOR @\$193.00	SHORTED-2PCS	772.00	200.00

Report Ref No. CS/INC19013081/Bqd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R

Page No.-2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BUMPER TOWING COVER @\$21.90	N/S BROKEN	43.80	21.90
2	REAR BUMPER REFLECTOR @\$52.00	BROKEN	104.00	104.00
2	REAR BUMPER SIDE RETAINER @\$37.00	NECESSARY	74.00	74.00
1	REAR BUMPER REINFORCEMENT	DENTED	563.00	563.00
10	REAR BUMPER CLIPS @\$3.00	NECESSARY	30.00	30.00
1	REAR END PANEL	DENTED	530.00	425.00
1	REAR END PANEL INNER TRIM	DISLODGE	99.00	99.00
1	REAR LH FENDER INNER TRIM	CUT	246.00	246.00
1	REAR SPARE TYRE TOP COVER	NOT NECESSARY	249.00	-
1	REAR BOOT LID REVERSE CAMERA (ADDITIONAL)	BROKEN	755.00	755.00
	LESS 20% DISCOUNT		-3,860.84	-3,576.34
			15,443.36	14,305.36
	LABOUR			
	TO REFILL AIR COND GAS.		150.00	80.00
	TO REPAIR DAMAGES.		1,100.00	800.00
	TO SPRAY PAINTING.		1,300.00	1,000.00
			2,550.00	1,880.00
GRAND TOTAL			17,993.36	16,185.36
RECOMMENDED COST OF REPAIRS (CONFIRMED)				16,185.36

Report Ref No. CS/INC19013081/Bqd3e2

LIM TEOW GUAN

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MinstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.