

ASSIGNMENT

From:

Date:

21/8/19

Estimated Cost:

Veh No:

SKJ 9136A.

Yr Regn:

2013, May.

Type: ☒ M.Cy / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Audi A3 SB

C.C. 1798

Colour:

white.

A/C:

Insured / Std / NI / NA

Sp. Reading

133968

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WAUZZ28P0CA122534

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size: F:

225/45R17.

R:

225/45R17.

BS: ☒ NUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

06

mm

R/Bal.

06

mm

L/Bal.

06

mm

L/Bal.

06

mm

D.O.A.

D.O.I.

21/08/19

Survey held at

Premium.

Des. of Damages: ☒ Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

SKJ 9136A

at Workshop m/s

Premium

of

55 Ubi Road 1

Insured:

Policy No.

2100340203

Claims No.

552007182856

24/8/19

Sum Insured:

Excess:

100 800

(Client's Record)

Make of Veh:

10.30cm (working)

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

11 Days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Date / Time

Action / Instruction

OD AIG.

SKJ 9136A - CC3/A19 No14701/Aqf302 DoA - 19/08/2019

22/8/19 @ 10.45am revert to Victor via Medimen.

MV: 581K

RV: 451K

Nett: 13K

RECEIVED 24 MAR 2020

22/8/19 @ 5.38pm 2nd revert to Victor via Medimen (repairer asking is \$16.5K)

26/8/19 @ 11.33am Victor informed they just only approve con at \$13K & they will pay \$1750 of \$3500 and the owner will to pay other \$1750 & excess.

Date/Time, File Pass to?



Prel. Report

Days Of Repair:

11

\$1750 & excess.

1)



Final Report

Resurvey No. of Trip:

1

Survey Fee:

200

Date/Time, File Return to?

2)

Add Fee:



Site Insp (\$)



Interview (\$)



Tech. Insp (\$)



Work end (\$)

Transportation:

3 + RS \$4

Phone:

Office:

11

TOTAL

211

Report Format:

MER-00

Lump Sum / T.B.B. is

14750

Mig 00 vehicle: SKJ 9136A Date: 19/08/19

26/8/19 @ 12:11pm Informed Troy ^{cfr not more than US \$16,500}
just only approve \$13K ³
8 Ex: \$800. MGA will top up \$1750 of \$3500.
The insured will pay the \$1750 @ before GST.

19/2/20 @ 4:12pm Email Carline, repair unit \$13000; repairer agreed
to repair at \$16500; Balance of \$3500 will be bear by
insured and insurance 50% each at \$1750.
Total \$17356.56, 54%.

Nivitha (LKK Auto)

From: Claims <claims@premiumauto.com.sg>
Sent: Monday, 19 August 2019 3:33 PM
To: 'Admin A'; 'Admin-D (LKKAuto)'; 'SUR'
Cc: 'Claims'
Subject: OD CLAIM FOR SKJ 9136 A ON 19/8/2019
Attachments: SKJ 9136 A - 19082019.PDF; SAftersales19081915330_0002.jpg;
SAftersales19081915330_0001.jpg

Dear All,

Kindly register OD claims for this vehicle. Attached is GIA report for your reference.

We will forward you the estimate once is available.

Please arrange survey on 21/8/2019, 10.30am. Vehicle is in workshop.

Best Regards,
Syafiq
Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Wednesday, 19 February 2020 4:12 PM
To: Carrine Leong; SUR
Cc: 'Boo seng yak'; 'Chang Chee Sing'; jlayee.yap@premiumauto.com.sg
Subject: RE: FINAL REVISION - SKJ9136A - OD AIG - SURVEYED 21 AUG 2019 RE-SURVEYED 19 SEP 2019

Dear Carrine,

WITHOUT PREJUDICE

Repair limit \$13,000.00.

Repairer agreed to repair at \$16,500.00.

Balance of \$3,500.00 will be bear by Insured and Insurance 50% each at \$1,750.00.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>

Sent: Tuesday, 19 November 2019 10:53 AM

To: Adrian Ling (LKKAUTO) <adrianling@lkkauto.com>; Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: 'Boo seng yak' <boojohnny@gmail.com>; 'Chang Chee Sing' <claims@premiumauto.com.sg>; jlayee.yap@premiumauto.com.sg

Subject: RE: FINAL REVISION - SKJ9136A - OD AIG - SURVEYED 21 AUG 2019 RE-SURVEYED 19 SEP 2019

Hi Adrian/Shiau Chan,

Revised estimate is attached.

We wish to inform you that we have repaired the above vehicle on Limit recommendation of \$16,500.00 @ 14 days and 2 sundays

Please let us have your approval to submit our final repair bill for early closure.

Thanks & Best Regard

Carrine Leong

Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183

e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	19 Aug 2019 15:29	Clim Veh Model Changed		[] Merimen Administrator
2	19 Aug 2019 15:29	Clim Created	Reg No: SKJ9136A, Policy No: 2100340203-06, Acct Date: 2019/08/19, Claim Type: SC, Insurer: A1 G Asia Pacific Insurance Pte. Ltd. (SG), Ins.Status => Notification. Created from SAS:MPA119108596	[I] Merimen Administrator
3	21 Aug 2019 15:03	Clim Registration Modified	Acct Time:09:50:00->09:00:00, Pol No:2100340203-06->2100340203, Init.Est.:>5,000 - 6,000.	[I] Abu Kassim, Noor Mariesa
4	21 Aug 2019 15:03	Clim Veh Model Changed	(202500) AUDI A3 1.8 TFSI (A).	[I] Abu Kassim, Noor Mariesa
5	21 Aug 2019 17:41	Clim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[] LEE SU THING
6	21 Aug 2019 17:41	Adj Clim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] LEE SU THING
7	21 Aug 2019 17:41	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] LEE SU THING
8	21 Aug 2019 17:41	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] LEE SU THING
9	21 Aug 2019 17:41	Adj Mandate Set	Approved:8000.00,Reinsp:Adj decides.	[A] LEE SU THING
10	21 Aug 2019 17:41	Clim Registration Modified	Rep:1137->200611.	[A] LEE SU THING
11	21 Aug 2019 17:41	Clim Veh Model Changed	(202500) -> (201401) AUDI A3 1.8 Sportback TFSI S-tronic (A).	[A] LEE SU THING
12	21 Aug 2019 17:41	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] LEE SU THING
13	22 Aug 2019 09:18	Clim Registration Modified	Excess: -> 800.00, 2F Remarks: -> Not Applicable. GST: -> 7.00.	[I] Azlan, Syazairdina
14	22 Aug 2019 09:58	Adj Rpt Initiated		[A] SHIAU CHAN
15	22 Aug 2019 09:58	Clim Dtl Modified	JPJ Reg. Date: -> 2013/05/27.	[A] SHIAU CHAN
16	22 Aug 2019 09:58	Clim Details Notified		[A] SHIAU CHAN
17	22 Aug 2019 10:45	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] SHIAU CHAN
18	22 Aug 2019 10:45	Adj Mandate Request	Cur.Req:0.00:DAMAGES CONSISTENT, PENDING REPAIR COST FROM REPAIRER. WE HAVE NOT AUTH ORISE REPAIR.	[A] SHIAU CHAN
19	22 Aug 2019 17:35	Adj Mandate Request Cancelled		[A] SHIAU CHAN
20	22 Aug 2019 17:37	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] SHIAU CHAN
21	22 Aug 2019 17:37	Adj Mandate Request	Cur.Req:24562.00:DAMAGES CONSISTENT, REPAIRER ASKING REPAIR COST AT \$16,500.00 ON LUM P SUM BASIS. (MARGIN OF REPAIR: \$13,101.00) WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
22	23 Aug 2019 11:29	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
23	23 Aug 2019 12:05	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/08/30, Mandate Remarks: Repair limit at \$13,000.00, Kindly check with repairer if they are able to repair, Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
24	23 Aug 2019 12:05	Adj Mandate Set	Approved:13000.00:Repair limit at \$13,000.00, Kindly check with repairer if they are able to repair, Re-inspection to be done for damage check and supplementary items / labour, Reinsp:Yes.	[I] Koh, Victor-CK
25	26 Aug 2019 09:24	Adj Mandate Request	Cur.Req:16500.00:According to the repairer, the owner Insist want to repair his vehicle and they counter propose again the repair cost at \$16,500 on Lump Sum basis to repair the vehicle. Kindly advise.	[A] SHIAU CHAN
26	26 Aug 2019 11:33	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2019/08/30, Mandate Remarks: Refer to email.	[I] Koh, Victor-CK

AUDIT TRAIL				
No.	On	Audit	Remarks	By
27	26 Aug 2019 11:33	Adj Mandate Set	Maintained:Refer to email.	[I] Koh, Victor-CK
28	22 Jan 2020 15:50	Adj Mandate Request	Cur.Req:14750.00:KINDLY APPROVE REPAIR COST OF \$14,750.00.	[A] SHIAU CHAN
29	19 Feb 2020 15:46	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2019/08/30. Mandate Remarks:	[I] Koh, Victor-CK
30	19 Feb 2020 15:46	Adj Mandate Set	Approved:14750.00:	[I] Koh, Victor-CK

Date From



Date To



Audit Type

None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Bill Type	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2253498	22 Aug 2019 09:58:16	OD/TP Case (Adjuster)	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SKJ9136A		11.77

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Azlan, Syazairdina

Date: 22 Aug 2019

Preliminary Advice

Vehicle No	: SKJ9136A	Accident Date	: 19/08/2019
Make	: AUDI A3	Policy No.	: 2100340203
Assignment Date	: 21/08/2019	Excess	: S\$800.00
Date of Inspection	: 21/08/2019	Est. Duration of Repair	: 9.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	33,710.00
Revised Amount	:S\$	18,518.00
Check Items (Estimated)	:S\$	6,044.00
Total	:S\$	24,562.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	44,899.00
Salvage Value	:S\$	
Margin for Repair	:S\$	13,101.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : REPAIRER ASKING REPAIR COST AT \$16,500.00 ON LUMP SUM BASIS.

Shiau Chan (LKKAUTO)

From: Claims <claims@premiumauto.com.sg>
Sent: Thursday, 22 August 2019 5:26 PM
To: Shiau Chan (LKKAUTO); nora.khai@premiumauto.com.sg
Cc: SUR; 'Claims Dept'
Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear Shiau Chan,

Due to the extensive damages the vehicle suffered, we would like to counter propose \$16,500.00 lump sum to repair the vehicle.

Your urgent approval is well appreciated.

Thanks

Best Regards,
TRoy Goh
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 198902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shiau Chan (LKKAUTO) [mailto:siewsc@lkkauto.com]
Sent: Thursday, 22 August 2019 10:33 AM
To: Claims; nora.khai@premiumauto.com.sg
Cc: SUR
Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear Syafiq,

Kindly advise whether your workshop able to repair the SKJ 9136A within repair limit \$13,000.00.

Best Regards,
Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Monday, 19 August 2019 3:33 PM
To: Admin A <admin-a@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear All,

Kindly register OD claims for this vehicle. Attached is GIA report for your reference.

We will forward you the estimate once is available.

Please arrange survey on 21/8/2019, 10.30am. Vehicle is in workshop.

Best Regards,
Syafiq
Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Monday, 26 August 2019 12:11 PM
To: Claims; nora.khai@premiumauto.com.sg
Cc: SUR
Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019
Attachments: SKJ9136A UNDERTAKING LETTER.pdf

Dear TRoy,

The message from insurance officer: **"Repair limit at \$13,000.00 is final. If Insured is insistent on repairing at Premium kindly obtain a written agreement of the amount \$16,500.00. AIG will pay \$1,750.00 of the balance \$3,500.00 and Insured will have to pay the other \$1,750.00 before Excess and GST."** and send back the undertaking letter as attached after signature and cop.

As instructed by our client, please proceed to repair the insured vehicle SKJ 9136A at repair cost not more than **\$16,500 on Lump Sum basis (Excess \$800/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Monday, 26 August 2019 9:05 AM
To: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>; nora.khai@premiumauto.com.sg
Cc: SUR <sur@lkkauto.com>
Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear Shiau Chan,

As per a short conversation with my client, client insisted want his car to be repair. We would like to counter propose again \$16,500 lump sum to repair the vehicle.

Thanks

Best Regards,

TRoy Goh

Claims Advisor

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shiau Chan (LKKAuto) [<mailto:siewsc@lkkauto.com>]

Sent: Friday, 23 August 2019 2:24 PM

To: Claims; nora.khai@premiumauto.com.sg

Cc: SUR

Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear TRoy,

As spoken with you.

Kindly advise whether your workshop able to repair SKJ 9136A within repair limit \$13,000.00 as instruction by insurance.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>

Sent: Thursday, 22 August 2019 5:26 PM

To: Shiau Chan (LKKAuto) <siewsc@lkkauto.com>; nora.khai@premiumauto.com.sg

Cc: SUR <sur@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>

Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear Shiau Chan,

Due to the extensive damages the vehicle suffered, we would like to counter propose \$16,500.00 lump sum to repair the vehicle.

Your urgent approval is well appreciated.

Thanks

Best Regards,

Troy Goh
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902273W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shiau Chan (LKKAuto) [<mailto:siewsc@lkkauto.com>]

Sent: Thursday, 22 August 2019 10:33 AM

To: Claims; nora.khai@premiumauto.com.sg

Cc: SUR

Subject: RE: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear Syafiq,

Kindly advise whether your workshop able to repair the SKJ 9136A within repair limit \$13,000.00.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>

Sent: Monday, 19 August 2019 3:33 PM

To: Admin A <admin-a@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: 'Claims' <claims@premiumauto.com.sg>

Subject: OD CLAIM FOR SKJ 9136 A ON 19/8/2019

Dear All,

Kindly register OD claims for this vehicle. Attached is GIA report for your reference.

We will forward you the estimate once is available.

Please arrange survey on 21/8/2019, 10.30am. Vehicle is in workshop.

Best Regards,

Syafiq

Claims Admin Assistant

Shiau Chan (LKKAuto)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Monday, 26 August 2019 11:33 AM
To: SUR
Cc: Fong, Andy-SY
Subject: SKJ9136A / OD / 55200218285G

Hi LKK,

Repair limit at \$13,000.00 is final. If Insured is insistent on repairing at Premium kindly obtain a written agreement of the amount \$16,500.00. AIG will pay \$1,750.00 of the balance \$3,5000.00 and Insured will have to pay the other \$1,750.00 before Excess and GST.

Alternatively you might advise repairer to quote the estimate under Premium Autocare which most likely will not exceed repair limit to help their client.

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	19 Aug 2019 15:29	Cim Veh Model Changed		[] Merimen Administrator
2	19 Aug 2019 15:29	Cim Created	Reg No: SKJ9136A, Policy No: 2100340203-06, Acct Date: 2019/08/19, Claim Type: SC, Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG), Ins.Status => Notification, Created from SAS:MPA119108596	[I] Merimen Administrator
3	21 Aug 2019 15:03	Cim Registration Modified	Acct Time:09:50:00->09:00:00, Pol No:2100340203-06->2100340203, Init.Est.->5,000 - 6,000.	[I] Abu Kassim, Noor Mariesa
4	21 Aug 2019 15:03	Cim Veh Model Changed	(202500) AUDI A3 1.8 TFSI (A).	[I] Abu Kassim, Noor Mariesa
5	21 Aug 2019 17:41	Cim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[] LEE SU THING
6	21 Aug 2019 17:41	Adj Cim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] LEE SU THING
7	21 Aug 2019 17:41	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] LEE SU THING
8	21 Aug 2019 17:41	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] LEE SU THING
9	21 Aug 2019 17:41	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] LEE SU THING
10	21 Aug 2019 17:41	Cim Registration Modified	Rep:1137->200611.	[A] LEE SU THING
11	21 Aug 2019 17:41	Cim Veh Model Changed	(202500) -> (201401) AUDI A3 1.8 Sportback TFSI S-tronic (A).	[A] LEE SU THING
12	21 Aug 2019 17:41	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] LEE SU THING
13	22 Aug 2019 09:18	Cim Registration Modified	Excess: -> 800.00, 2F Remarks: -> Not Applicable, GST: -> 7.00.	[I] Azlan, Syazairdina
14	22 Aug 2019 09:58	Adj Rpt Initiated		[A] SHIAU CHAN
15	22 Aug 2019 09:58	Cim Dtl Modified	JPJ Reg. Date: -> 2013/05/27.	[A] SHIAU CHAN
16	22 Aug 2019 09:58	Cim Details Notified		[A] SHIAU CHAN
17	22 Aug 2019 10:45	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] SHIAU CHAN
18	22 Aug 2019 10:45	Adj Mandate Request	Cur.Req:0.00:DAMAGES CONSISTENT. PENDING REPAIR COST FROM REPAIRER. WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
19	22 Aug 2019 17:35	Adj Mandate Request Cancelled		[A] SHIAU CHAN
20	22 Aug 2019 17:37	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/08/30	[A] SHIAU CHAN
21	22 Aug 2019 17:37	Adj Mandate Request	Cur.Req:24562.00:DAMAGES CONSISTENT. REPAIRER ASKING REPAIR COST AT \$16,500.00 ON LUMP SUM BASIS. (MARGIN OF REPAIR: \$13,101.00) WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
22	23 Aug 2019 11:29	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
23	23 Aug 2019 12:05	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/08/30, Mandate Remarks: Repair limit at \$13,000.00, Kindly check with repairer if they are able to repair, Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
24	23 Aug 2019 12:05	Adj Mandate Set	Approved:13000.00:Repair limit at \$13,000.00, Kindly check with repairer if they are able to repair, Re-inspection to be done for damage check and supplementary items / labour, Reinsp:Yes.	[I] Koh, Victor-CK
25	26 Aug 2019 09:24	Adj Mandate Request	Cur.Req:16500.00:According to the repairer, the owner Insist want to repair his vehicle and they counter propose again the repair cost at \$16,500 on Lump Sum basis to repair the vehicle. Kindly advise.	[A] SHIAU CHAN
26	26 Aug 2019 11:33	Adj Next Rpt Changed	Cur Rpt:Final Rpt. Cur Due Date:2019/08/30, Mandate Remarks: Refer to email.	[I] Koh, Victor-CK
27	26 Aug 2019 11:33	Adj Mandate Set	Maintained:Refer to email.	[I] Koh, Victor-CK

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2253498	22/08/2019 09:58	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SKJ9136A		11.77

Note: This document has not been finalised.**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Azian, Syazairdina

Date: 22 Aug 2019

Preliminary Advice

Vehicle No	: SKJ9136A	Accident Date	: 19/08/2019
Make	: AUDI A3	Policy No.	: 2100340203
Assignment Date	: 21/08/2019	Excess	: S\$800.00
Date of Inspection	: 21/08/2019	Est. Duration of Repair	: 9.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	33,710.00
Revised Amount	:S\$	18,518.00
Check Items (Estimated)	:S\$	6,044.00
Total	:S\$	24,562.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	44,899.00
Salvage Value	:S\$	
Margin for Repair	:S\$	13,101.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : PENDING REPAIR COST FROM REPAIRER.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Details	
Owner ID Type:	Singapore NRIC
Owner ID:	892J
Vehicle Details	
Vehicle No.:	SKJ9136A
Vehicle to be Exported:	Yes
Intended Deregistration Date:	21 Aug 2019
Vehicle Make:	AUDI
Vehicle Model:	A3 SPORTBACK 1.8 TFSI
Primary Colour:	White
Manufacturing Year:	2012
Engine No.:	CDA293330
Chassis No.:	WAUZZZ8P0CA122534
Maximum Power Output:	118.0 kW (158 bhp)
Open Market Value:	\$30,791.00
Original Registration Date:	27 May 2013
First Registration Date:	27 May 2013
Transfer Count:	0
Actual ARF Paid:	\$30,108.00
PARF Eligibility	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 May 2023
PARF Rebate Amount:	\$19,570.00
COE Details	
COE Expiry Date:	26 May 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$67,304.00
COE Rebate Amount:	\$25,329.00
Total Rebate Amount:	\$44,899.00

The information contained herein is correct as at 21 Aug 2019

OK



CONNECTING CAR BUYERS & SELLERS.
We'll handle your loans, insurance & other paperwork for FREE.

[Find out more](#)




Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#) | [Advertiser Login](#) | [3 Ways of Selling](#)

2005 Jaguar S-Type 2.5 Auto.



One Of The Best Looking
Jaguars Ever Designed.
Direct Owner. StarAd



Think One Automobile

**NEW & USED
COMMERCIAL VEHICLES**



Browse by Category  [Save Search](#) [Print](#) Sort by Date Posted  20 results/page 

5 vehicles | **Search** [Advanced Search](#) [Search](#) [View All](#)

Make  Model  Price  Depreciation  Reg Date  Eng Cap  Mileage  Veh Type  Status 

Search Selection	audi a3	Any	Any	2013	Any	Any	Any	Available
------------------	---------	-----	-----	------	-----	-----	-----	-----------



☐ **Audi A3 Sportback 1.4A TFSI** \$51,800 \$11,130 /yr 30-Mar-2013 1,390 cc 66,660 km Hatchback Available

\$0 Drive Away! New Arrival! Very Good Condition! Low Mileage Done! Hassle Free! 100% Accident Free! 100% Loan Approval! Bank Loan Or In House Loan Available! Original Condition! No Modification! Fast Yet Fuel Economic! Call Now To View The Car Before It's Sold!

Viking Motor Pte Ltd

 Posted: 19-Aug-2013 Tags: 2013 Audi A3, 2013 Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Used Audi



☐ **Audi A3 Sportback 1.8A TFSI** \$61,888 \$11,640 /yr 30-Aug-2013 1,798 cc 96,000 km Hatchback Available

Cheapest In The Market! Flexible Loan Options/High Trade-Ins Available! Sporty Yet Fuel Efficient Hot Hatchback, Meticulously Maintained Unit By Owner, Always Shelter Parked, Non-Smoking, Accident Free. Call Us Now For An Non-Obligatory Viewing! Strictly By Appointment...

Cars 88 Pte Ltd

 Posted: 27-Aug-2013 Tags: 2013 Audi A3, 2013 Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Used Audi



☐ **Audi A3 Sportback 1.4A TFSI S-tronic Ambiente** \$56,000 \$11,520 /yr 27-Nov-2013 1,395 cc 62,000 km Hatchback Available

This Sleek Yet Punchy Audi A3 Hatchback! Very Competitively Priced! Nice Registration Plate, Rare Beluga Brown Metallic, Well Maintained By Previous Owner With No Repairs Needed With Record! STA Evaluation Welcome! High Fuel Economy, Sharp Handling Paired With Tur...

Car Buyers Automotive Pte Ltd

 Posted: 17-Aug-2013 Tags: 2013 Audi A3, 2013 Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Used Audi



☐ **Audi A3 Sportback 1.4A TFSI S-tronic Ambition** \$58,989 \$11,830 /yr 10-Dec-2013 1,395 cc 40,000 km Hatchback Available

1 Meticulous Owner, Excellent Condition, Fully Maintained By Agent, Comes With A Comprehensive 120 Points Check And 6 Months Warranty And 1 Free Servicing Package From MBM Wheelpower. Low Mileage Done. Low Bank Interest Rate. In House Loan Finance Av...

 Posted: 16-Aug-2013 Tags: 2013 Audi A3, 2013 Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Used Audi



Car Buying



Car Selling



Car Ownership




Car Aftermarket



On The Move



Lifestyle



☐ **Audi A3 Sportback 1.4A TFSI S-tronic Ambition** \$53,800 \$10,630 /yr 10-Dec-2013 1,395 cc 90,000 km Hatchback Available

The Audi A3, A Popular Car Which You Will Want To Be Seen Driving In, With A Turbocharged 1.4-Litre Engine Under The Hood Producing 120bhp You Can Be Assured This Will Bring Out The Sportiness In You Without Compromising The Luxurious Feel. This Unit Is Well-Maintained...

 Posted: 27-Jul-2013 Tags: 2013 Audi A3, 2013 Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Audi A3, Used Audi

Save this search criteria, to get email alerts whenever a match is found.

[Save Search](#)

Make  Model  Price  Depreciation  Reg Date  Eng Cap  Mileage  Veh Type  Status 

For old advertisements, view [Expired ads](#)

20 results/page

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	19/08/2019 15:01
Date Of Accident	19/08/2019 09:50
Exact Location Of Accident	UPPER CHANGI ROAD NEAR BUS STOP TOWARD CITY
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKJ9136A
Insured/Policyholder	
Name Of Registered Owner	HENG KOK CHIANG
NRIC No	S1189892J
Email Address	HENG.KC@GMAIL.COM
Mobile Phone No	(LOCAL) +65-97378997
Alternative Phone No	OFFICE-67415438

Vehicle Particulars

Manufacturer	AUDI
Model	A3 SPORTSBACK 1.8T FSI
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100340203-06
Cover Note Number	

Driver

Name of Driver	HENG KOK CHIANG
NRIC No	S1189892J
Date Of Birth	20/08/1956
Occupation	INDOOR
Date Of Driving Pass	23/06/1982
Driving Experience	37 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-97378997
Fax Number	
Contact Number	OFFICE-67415438
Email Address	HENG.KC@GMAIL.COM

Address	27 UPPER SERANGOON VIEW #05-11
Postcode	534045
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS I WAS DRIVING ON UPPER CHANGI ROAD TOWARD CITY, WHEN I WAS CHANGING MY LANE SWITCHING TO SECOND LANE, SUDDENLY IN FRONT OF THE VEHICLE (SJY 6747 P) WAS STATIONARY IN THE TRAFFIC LIGHT, AFTER THAT I NOT ABLE TO APPLY THE BRAKE THEN HIT TO HER CAR BACKSIDE.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJY6747P
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.


19/08/19


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name: 
NRIC/IN No: 

Sketch Plan #2

SKETCH PLAN

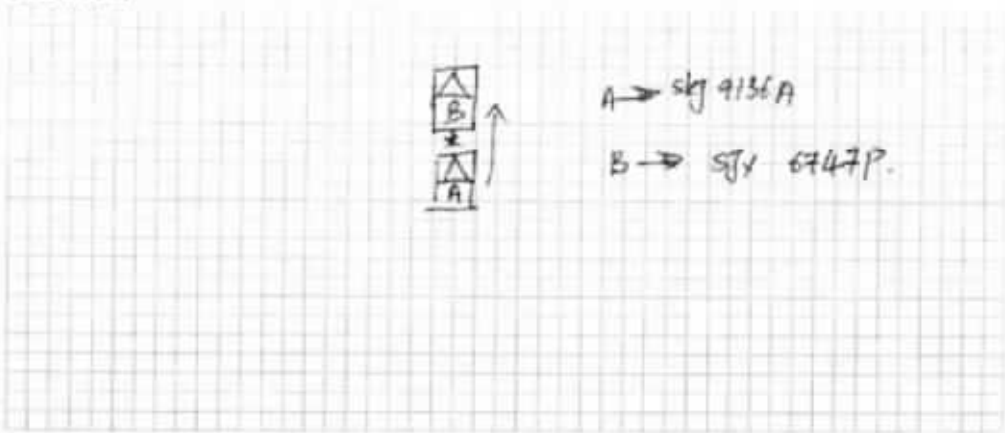


DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

As I was driving on upper chungi road toward city, when I was changing my lane switching to second lane, suddenly in front of the vehicle (skg 6747 P) was stationary in the Traffic light, after that I not able to apply the brake then hit to her car backside.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

 19/11/2019

Policyholder's Signature
Date & Time:

12.15 PM

Signature of Policyholder, 10

Driver's Signature
(if driver is not the policyholder)
Date & Time:



Reporting Officer's Signature
Name: Gita Chandra, Tony
NIC/FIN No: 115587454

Accident Photo



Accident Photo



Accident Photo



Accident Photo





CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : HENG KOK CHIANG
Period of Insurance : 27 May 2019 To 26 May 2020
Engine No. : CDA293330
Chassis No. : WAUZZZ8P0CA122534

Vehicle No. : SKJ9136A
Policy No. : 2100340203-06
Endorsement No. :
Issued Date : 26 Apr 2019

ABOUT THE COVER

Make/Model : AUDI A3 SPORTBACK 1.8 TFSI
Engine Capacity/Tonnage : 1,798.00 CC
Driver Restriction : NA
Person or Classes of Persons Entitled to Drive* :
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2013
Insuring with COE/PARF : Yes

a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business. This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$800 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

HENG KOK CHIANG - \$800 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408899 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: MayBank

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125200

PREMIUM LEASING - AP

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

Monik

AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

SRPLC

What can the 24-hour AIG Auto Emergency Hotline provide for you?

- Immediate assistance after an accident
- Emergency breakdown service
- Towing service (accident or non-accident related)
- Advice on Motor Claims procedures
- Medical Referral Assistance

If no one is injured in the accident:

- You are not required to make any police report.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s).
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

If the accident involves injuries or damage to government property & vehicles, foreign registered vehicles or non-injury hit & run case:

- Report the accident to the police, providing full details of the circumstances of the accident.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s), if applicable.
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

What should I do in the event of an accident?

- Keep calm and move your car to a safe place.
- Do not admit or discuss fault or blame with the other party(ies).
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.
- Submit Writ/Summons/Correspondences from third party(ies) to AIG immediately.

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number (65) 6419-3000 for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within 5 working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the **original** insurance policy and schedule issued by AIG, a copy of the Accident Report from **Audi Customer Service Centre** must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Popular Rent A Car Pte. Ltd.

Activation Hotline: 67428888

501 Guillemard Road Singapore 399840

Operation Hours: Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 4pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is **IMPORTANT** and **MUST** be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0991/2019/NS
Date : 20-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MR HENG KOK CHIANG
Address : 27 UPPER SERANGOON VIEW
#05-11
Singapore 534045
Telephone : HP +65 97378997
Type of Claim : Own Damage Claims
Policy No. : 2100340203-06
Vehicle No : **SKJ 9136 A**
Model Code : Audi A3 SB 1.0 TFSI
Model / Year : 27/5/2013
Engine No : CDA 293330
Chassis No : WAUZZZ8P0CA122534
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 19-Aug-19
Place of Accident : UPPER CHANGI ROAD NEAR BUS STOP TOWARD CITY

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKJ 9136 A

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
2	To remove and renew aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,200.00	✓
3	To dismantlew and renew front bumper, both front fenders, bonnet and both headlights. Renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 6,400.00	3250 ✓ 3000
4	To respray front bumper, both front fenders and bonnet.	\$ 4,000.00	2200 ✓
5	To carry out diagnostic checks.	S/N \$192.00	✓
TOTAL LABOUR CHARGES		: \$ 12,152.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No.SKJ 9136 A**

S/N	Parts Description	Damaged Parts & Prices		
			S/Nett	Remark
1	FRONT BUMPER COVER <i>Distal</i>	S	1,236.00	✓ 988.00
2	BUMPER FIXING PARTS <i>new</i>	S	164.00	+
3	FRONT BUMPER CARRIER <i>Best</i>	S	611.00	✓ 488.40
4	FRONT BUMPER SHOCK ABSORBER - LH / RH <i>Best</i>	2 S	400.00	? 319.20 ✓
5	FRONT BUMPER GUIDE SECTION - LH / RH <i>new</i>	2 S	70.00	+
6	RADIATOR GRILLE CLOSING ELEMENT <i>could</i>	2 S	1,359.00	— 1087.70
7	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>Missing</i>	2 S	466.00	— 373.80
8	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>new</i>	S	177.00	+
9	FOAM FILLER PIECE <i>could</i>	S	118.00	— 94
10	FENDER - LH / RH <i>but buckled Repair</i>	2 S	1,384.00	692 X
11	FENDER ATTACHMENT PARTS <i>new</i>	S	44.00	? X
12	FENDER BRACKET - LH / RH / CENTRE <i>new</i>	3 S	267.00	+
13	FENDER BRACE - LH / RH <i>new</i>	2 S	98.00	+
14	WHEEL HOUSING LINER - LH / RH <i>new</i>	2 S	316.00	+
15	WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT	NEC S	131.00	X
16	WHEEL HOUSING LINER - LH / RH <i>new</i>	2 S	242.00	+
17	RADIATOR GRILLE SPOILER - LH / RH FRONT <i>new</i>	2 S	102.00	+
18	BONNET <i>Buckled</i>	S	2,189.00	— 1751.20
19	BONNET ATTACHMENT PARTS <i>new</i>	S	88.00	? X
20	BONNET LID HINGE - LH / RH <i>new</i>	2 S	106.00	+
21	GAS FILLED STRUT <i>new</i>	S	109.00	+
SUB TOTAL SPARE PARTS		:	\$ 9,677.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SKJ 9136 A**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
22	BONNET CATCH HOOK <i>Bent</i>	S	85.00 + 67.52 ✓
23	BONNET LID LOCK CABLE <i>Not new</i>	S	44.00 +
24	BONNET LID LOCK CABLE <i>Not new</i>	S	44.00 +
25	BONNET LID LOCK CABLE <i>Not new</i>	S	44.00 +
26	BONNET LID LOCK WITH MICRO SWITCH <i>Not new</i>	S	196.00 ? X
27	MICRO SWITCH <i>Not new</i>	S	99.00 +
28	BONNET SEAL - FRONT <i>Not new</i>	S	97.00 ✓ 37.44
29	BONNET WATER BOX SEAL <i>Not new</i>	S	58.00 X
30	BONNET LOCK COVER - UPPER FRONT <i>Not new</i>	S	46.00 +
31	COOLANT RADIATOR LOCK CARRIER <i>cracked</i>	S	898.00 ✓ 713
32	A/C CONDENSER WITH FLUID RESERVOIR <i>Bent.</i>	S	514.00 ? 410.70 ✓
33	RADIATOR <i>Not new</i>	S	960.00 ? X
34	RADIATOR BUSH - LOWER <i>Not new</i>	S	18.00 ? X
35	RADIATOR BRACKET <i>Not new</i>	S	77.00 ? X
36	READY-MIX COOLANT <i>Not new</i>	4 S	84.00 ✓ 67.70
37	CHARGE AIR COOLER <i>Not new</i>	S	1,060.00 ? 848. ✓
38	RADIATOR TWIN FAN RING <i>Not new</i>	S	182.00 ? X
39	RADIATOR FAN - LH <i>Not new</i>	S	886.00 ? X
40	RADIATOR FAN - RH <i>Not new</i>	S	589.00 ? X
41	RADIATOR AIR GUIDE - LH / RH <i>Not new</i>	2 S	70.00 ? 55.20 ✓
SUB TOTAL SPARE PARTS		:	\$ 15,728.00

6051

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SKJ 9136 A

S/N	Parts Description	Damaged Parts & Prices		
			S/Nett	Remark
42	INTAKE AIR DUCT - RH <i>Not nec</i>	S	15.00	? x
43	AIR GUIDE CHANNEL <i>Byd</i>	3 S	47.00	? 37.48 ✓
44	INTAKE AIR DUCT <i>Byd</i>	S	14.00	? 11.12 ✓
45	HALOGEN TWIN HEADLIGHTS - LH / RH <i>cancel</i>	2 S	3,718.00	✓ 2974.40
46	HALOGEN FOG LAMP - LH / RH <i>cancel RH cancel</i>	2 S	474.00	+ 189.60 ✓
47	HEADLIGHT WASHER LIFT CYLINDER - LH / RH <i>Not nec</i>	2 S	384.00	? x
48	HEADLIGHT WASHER HOSE <i>nec</i>	5 S	179.00	+
49	FRONT NO. PLATE <i>Best</i>	S/N S	40.00	✓
50	HORN LOW / HIGH TONE <i>nec</i>	2 S	412.00	x
51	HORN SPRING SHACKLE <i>Not nec</i>	S	47.00	✓
52	SUNDRIES <i>Nec</i>	S	500.00	? 22.48 ✓
TOTAL SPARE PARTS		:	\$ 31,235.00	21550
TOTAL LABOUR CHARGES			\$ 12,152.00	
GRAND TOTAL			\$ 43,387.00	33710

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

33806 \$6

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

: Adrian King

Surveyed Date

: 21/08/19.0

Authorised Date

:

Excess Cost

:

Liability

:

Remarks

: Not Authorised, 09 Days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel: 6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Tel : (65) 6366 2323 Fax : (65) 6841 1183

GST Reg No. 19-9902271-W

Estimate No.	PA/OD/0991/2019/NS
Date	11-Sep-19
Service Advisor	Glory Tan
Pages	1 of 1
Regn No	SKJ 9136 A
Model No	Audi A3 SB 1.0 TFSI

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0991/2019/NS
Date	:	20-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	MR HENG KOK CHIANG
Address	:	27 UPPER SERANGOON VIEW #05-11 Singapore 534045
Telephone	:	HP +65 97378997
Type of Claim	:	Own Damage Claims
Policy No.	:	2100340203-06
Vehicle No	:	SKJ 9136 A
Model Code	:	Audi A3 SB 1.0 TFSI
Model / Year	:	27/5/2013
Engine No	:	CDA 293330
Chassis No	:	WAUZZZ8POCA122534
Mileage	:	
Date In	:	
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	19-Aug-19
Place of Accident	:	UPPER CHANGI ROAD NEAR BUS STOP TOWARD CITY

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKJ 9136 A

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
2	To remove and renew aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,200.00	✓
3	To dismantlew and renew front bumper, both front fenders, bonnet and both headlights. Renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 6,400.00	3250. 3000.
4	To respray front bumper, both front fenders and bonnet.	\$ 4,000.00	2200
5	To carry out diagnostic checks.	S/N \$192.00	✓
TOTAL LABOUR CHARGES		: <u>\$ 12,152.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKJ 9136 A

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
SK-1	FRONT BUMPER COVER Distalnd	S	1,236.00 ✓
2	BUMPER FIXING PARTS <i>new</i>	S	164.00 +
SK-3	FRONT BUMPER CARRIER <i>Best</i>	S	611.00 ✓
④	FRONT BUMPER SHOCK ABSORBER LH / RH <i>new</i>	2 S	400.00 ?
5	FRONT BUMPER GUIDE SECTION - LH / RH <i>new</i>	2 S	70.00 +
SK-6	RADIATOR GRILLE CLOSING ELEMENT <i>new</i>	2 S	1,359.00 ✓
SK-7	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>Missing new</i>	2 S	466.00 ✓
8	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	S	177.00 +
SK-9	FOAM FILLER PIECE <i>new</i>	S	118.00 ✓
10	FENDER - LH / RH <i>LH Buckled</i>	2 S	1,382.00 692
11	FENDER ATTACHMENT PARTS	S	44.00 ?
12	FENDER BRACKET - LH / RH / CENTRE <i>new</i>	3 S	267.00 +
13	FENDER BRACE - LH / RH <i>new</i>	2 S	98.00 +
14	WHEEL HOUSING LINER - LH / RH <i>new</i>	2 S	316.00 ✓
15	WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT	NEC S	131.00 ✓
16	WHEEL HOUSING LINER - LH / RH <i>new</i>	2 S	242.00 ✓
17	RADIATOR GRILLE SPOILER - LH / RH FRONT <i>new</i>	2 S	102.00 ✓
SK-18	BONNET <i>Buckled</i>	S	2,189.00 ✓
19	BONNET ATTACHMENT PARTS	S	88.00 ?
20	BONNET LID HINGE - LH / RH <i>new</i>	2 S	106.00 +
21	GAS FILLED STRUT <i>new</i>	S	109.00 +
SUB TOTAL SPARE PARTS		: \$	9,677.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKJ 9136 A

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
(22)	BONNET CATCH HOOK <i>can</i>	\$ 85.00	+
23	BONNET LID LOCK CABLE <i>all</i>	\$ 44.00	+
24	BONNET LID LOCK CABLE <i>all</i>	\$ 44.00	+
25	BONNET LID LOCK CABLE	\$ 44.00	+
26	BONNET LID LOCK WITH MICRO SWITCH ?	\$ 196.00	?
27	MICRO SWITCH <i>can</i>	\$ 99.00	+
SK-28	BONNET SEAL - FRONT <i>2 can</i>	\$ 97.00	✓
29	BONNET WATER BOX SEAL <i>can</i>	\$ 58.00	+
30	BONNET LOCK COVER - UPPER FRONT <i>can</i>	\$ 46.00	+
SK-31	COOLANT RADIATOR LOCK CARRIER <i>cracked</i>	\$ 898.00	✓
SK-(32)	A/C CONDENSER WITH FLUID RESERVOIR <i>bt?</i>	\$ 514.00	?
-33	RADIATOR ?	\$ 960.00	?
34	RADIATOR BUSH - LOWER ?	\$ 18.00	?
35	RADIATOR BRACKET ?	\$ 77.00	?
36	READY-MIX COOLANT <i>can</i>	\$ 84.00	✓
(37)	CHARGE AIR COOLER <i>can</i>	\$ 1,060.00	?
38	RADIATOR TWIN FAN RING ?	\$ 182.00	?
39	RADIATOR FAN - LH ?	\$ 886.00	?
40	RADIATOR FAN - RH ?	\$ 589.00	?
LH SK-41	RADIATOR AIR GUIDE - LH / RH ? <i>can</i>	\$ 70.00	?
SUB TOTAL SPARE PARTS		\$ 15,728.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKI 9136 A

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
42	INTAKE AIR DUCT - RH ?	\$ 15.00	?
43	AIR GUIDE CHANNEL ? can	3 \$ 47.00	?
44	INTAKE AIR DUCT ? can	\$ 14.00	?
45	HALOGEN TWIN HEADLIGHTS - LH / RH can	2 \$ 3,718.00	✓
46	HALOGEN FOG LAMP - LH RH can	2 \$ 474.00	+
47	HEADLIGHT WASHER LIFT CYLINDER - LH / RH ?	2 \$ 384.00	?
48	HEADLIGHT WASHER HOSE new	5 \$ 179.00	+
49	FRONT NO. PLATE Bent	S/N \$ 40.00	✓
50	HORN LOW / HIGH TONE new	2 \$ 412.00	X
51	HORN SPRING SHACKLE Not in	\$ 47.00	✓
52	SUNDRIES ?	\$ 500.00	?
TOTAL SPARE PARTS		\$ 31,235.00	
TOTAL LABOUR CHARGES		\$ 12,152.00	
GRAND TOTAL		\$ 43,387.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian King
Surveyed Date : 21/08/19.0
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 09 Days

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Shiau Chan (LKKAuto)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Monday, 18 November 2019 3:58 PM
To: Adrian Ling (LKKAuto); Shiau Chan (LKKAuto); SUR
Cc: 'Boo seng yak'; 'Chang Chee Sing'; jiayee.yap@premiumauto.com.sg
Subject: FINAL REVISION - SKJ9136A - OD AIG - SURVEYED 21 AUG 2019

Hi Adrian/Shiau Chan,

We wish to inform you that we have repaired the above vehicle on Limit recommendation of \$16,500.00

Please let us have your approval to submit our final repair bill for early closure.

Thanks & Best Regard
Carrine Leong
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 198902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183

e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0991/2019/NS
Date : 20-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian,

We took 14 days and 2 Sunday to
repair this vehicle - 19/11/19 Carine

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MR HENG KOK CHIANG
Address : 27 UPPER SERANGOON VIEW
#05-11
Singapore 534045
Telephone : HP + 65 97378997
Type of Claim : Own Damage Claims
Policy No. : 2100340203-06
Vehicle No : **SKJ 9136 A**
Model Code : Audi A3 SB 1.0 TFSI
Model / Year : 27/5/2013
Engine No : CDA 293330
Chassis No : WAUZZZ8P0CA122534
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 19-Aug-19
Place of Accident : UPPER CHANGI ROAD NEAR BUS STOP TOWARD CITY

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKJ 9136 A

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy	S/N	\$ 360.00	\$ 360.00
2	To remove and renew aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and reacc	S/N	\$ 1,200.00	\$ 1,200.00
3	To dismantiew and renew front bumper, both front fenders, bonnet and both headlights. Renew front lock carrier and align to position. Re-organise crash management components		\$ 6,400.00	\$ 3,250.00
4	To respray front bumper, both front fenders and bonnet.		\$ 4,000.00	\$ 2,200.00
5	To carry out diagnostic checks.	S/N	\$192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	\$ 12,152.00	\$ 7,202.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SKJ 9136 A

S/N	Parts Description	<u>Damaged Parts & Prices</u>	
		S/Nett	Remark
1	FRONT BUMPER COVER	\$ 1,236.00	\$ 988.80
2	BUMPER FIXING PARTS	\$ 164.00	
3	FRONT BUMPER CARRIER	\$ 611.00	\$ 488.40
4	FRONT BUMPER SHOCK ABSORBER - LH / RH	2 \$ 400.00	\$ 319.20
5	FRONT BUMPER GUIDE SECTION - LH / RH	2 \$ 70.00	
6	RADIATOR GRILLE CLOSING ELEMENT	2 \$ 1,359.00	\$ 1,087.20
7	FRONT BUMPER AIR GUIDE GRILLE - LH / RH	2 \$ 466.00	\$ 372.80
8	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	\$ 177.00	
9	FOAM FILLER PIECE	\$ 118.00	\$ 94.00
10	FENDER - LH / RH	2 \$ 1,384.00	
11	FENDER ATTACHMENT PARTS	\$ 44.00	
12	FENDER BRACKET - LH / RH / CENTRE	3 \$ 267.00	
13	FENDER BRACE - LH / RH	2 \$ 98.00	
14	WHEEL HOUSING LINER - LH / RH	2 \$ 316.00	
15	WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT	NEC \$ 131.00	
16	WHEEL HOUSING LINER - LH / RH	2 \$ 242.00	
17	RADIATOR GRILLE SPOILER - LH / RH FRONT	2 \$ 102.00	
18	BONNET	\$ 2,189.00	\$ 1,751.20
19	BONNET ATTACHMENT PARTS	\$ 88.00	
20	BONNET LID HINGE - LH / RH	2 \$ 106.00	
21	GAS FILLED STRUT	\$ 109.00	
SUB TOTAL SPARE PARTS		: \$ 9,677.00	\$ 5,101.60

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No.SKJ 9136 A**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 5,101.60
22	BONNET CATCH HOOK	\$	85.00	\$ 67.52
23	BONNET LID LOCK CABLE	\$	44.00	
24	BONNET LID LOCK CABLE	\$	44.00	
25	BONNET LID LOCK CABLE	\$	44.00	
26	BONNET LID LOCK WITH MICRO SWITCH	\$	196.00	
27	MICRO SWITCH	\$	99.00	
28	BONNET SEAL - FRONT	\$	97.00	\$ 77.04
29	BONNET WATER BOX SEAL	\$	58.00	
30	BONNET LOCK COVER - UPPER FRONT	\$	46.00	
31	COOLANT RADIATOR LOCK CARRIER	\$	898.00	\$ 718.00
32	A/C CONDENSER WITH FLUID RESERVOIR	\$	514.00	\$ 410.80
33	RADIATOR	\$	960.00	
34	RADIATOR BUSH - LOWER	\$	18.00	
35	RADIATOR BRACKET	\$	77.00	
36	READY-MIX COOLANT	4 \$	84.00	\$ 67.20
37	CHARGE AIR COOLER	\$	1,060.00	\$ 848.00
38	RADIATOR TWIN FAN RING	\$	182.00	
39	RADIATOR FAN - LH	\$	886.00	
40	RADIATOR FAN - RH	\$	589.00	
41	RADIATOR AIR GUIDE - LH / RH	2 \$	70.00	\$ 55.20
	SUB TOTAL SPARE PARTS	:	\$ 15,728.00	\$ 7,345.36

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SKJ 9136 A

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 7,345.36
42	INTAKE AIR DUCT - RH		\$ 15.00	
43	AIR GUIDE CHANNEL	3	\$ 47.00	\$ 37.44
44	INTAKE AIR DUCT		\$ 14.00	\$ 11.12
45	HALOGEN TWIN HEADLIGHTS - LH / RH	2	\$ 3,718.00	\$ 2,974.40
46	HALOGEN FOG LAMP - LH / RH	2	\$ 474.00	\$ 189.60
47	HEADLIGHT WASHER LIFT CYLINDER - LH / RH	2	\$ 384.00	
48	HEADLIGHT WASHER HOSE	5	\$ 179.00	
49	FRONT NO. PLATE	S/N	\$ 40.00	\$ 40.00
50	HORN LOW / HIGH TONE	2	\$ 412.00	
51	HORN SPRING SHACKLE		\$ 47.00	
52	SUPPLEMENTARY		\$ 122.00	\$ 96.56
53	SUNDRIES		\$ 500.00	\$ 22.48
TOTAL SPARE PARTS		:	\$ 31,357.00	\$ 10,716.96
TOTAL LABOUR CHARGES			\$ 12,152.00	\$ 7,202.00
GRAND TOTAL			\$ 43,509.00	\$ 17,918.96

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0991/2019/NS

11-Sep-19

Glory Tan

1 of 1

SKJ 9136 A

Audi A3 SB 1.0 TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	Coolant hose with quick release coupling.	\$ 93.00	\$ 74.08
2	Sign "Caution" sticker	\$ 13.00	\$ 9.76
3	Air cond sticker	\$ 16.00	\$ 12.72
		\$ 122.00	\$ 96.56
TOTAL		\$ 122.00	

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SKJ 9136 A

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0991/2019/NH

From
Telephone +65 -
Telefax +65 -
Mobile +65 -
Our Dept
Email

23-Mar-2020

Date
Total Pages

Dear Sir,

RE: INSURANCE CLAIM FOR SKJ 9136 A, Audi A3 SB 1.8T FSI.

With reference to the above-mentioned vehicle, no. **SKJ 9136 A**, claimant, **Mr. Heng Kok Chiang**, please find the related document per attached.

1. A copy of the Original invoice no. 85014992 – S\$ 14,926.50.
2. A copy of the Discharge Voucher duly signed by client.

Premium Automobiles Pte Ltd,
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.


Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG Insurance – SKJ 9136 A

Premium Automobiles Pte Ltd



Audi Centre Singapore

281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre

281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre

55 Ubi Road 1
Singapore 408889
Main Telephone 6388 2323
Main Telefax 6841 1163

Customer Service

Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 17:28

Company Reg.No.199902271W

GST Reg.No.199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85014992 Date: 19/03/2020 Order: SKJ9136A Term: 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SKJ9136A (V 17898)

Regn Date: 27/05/2013

Mileage: 133970

WIP No: 64588

Model: A3 SPORTBACK 1.8T FSI 8PAB6G

Chassis: WAUZZZ8P0CA122534

Engine: CDA 293330

DEPT: U

You have been assisted by: UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
S	SUBLET	To carry out contractual LIMIT repair basis as agreed	16,500.00	1.00	16,500.00
Q	EXC	Insurance Excess/Liability	-800.00	1.00	-800.00
Q	EXC	50% CONTRIBUTION OF REPAIR COST	-1750.00	1.00	-1750.00

Parts 0.00
Labour 0.00
Sublet 16,500.00
Menus 0.00
Lubricant 0.00

Sub- Total 13,950.00

7% GST 976.50

Grand Total 14,926.50



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SKJ 9136 A

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0991/2019/TG
28 September 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 SPORTBACK 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8P0CA122534
Vehicle Regn No. : SKJ 9136 A
Vehicle Mileage : 133968 KM
Vehicle Owner : Mr. Heng Kok Chiang
Certificate No : 2100340203-06
Own Damage Excess : S\$ 856.00 (Inclusive 7% GST)
Accident Date : 19/08/2019
Place : Upper Changi Road Near Bus Stop Toward City
Repair Cost : \$ 14,926.50
WIP No. : 64588
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :

Time :

Date :


10.00 AM
28 Sept 2019

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	21 Aug 2019		21 Aug 2019 17:41 Edit Adj Rpt	S\$14,750.00 Edit Estimates	S\$14,750.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: HENG KOK CHIANG , ID: S11898923, Tel: +6597378997, Email: HENG.KC@GMAIL.COM			[Created by Insurer]						
Vehicle Reg. No.:	SKJ9136A	Date of Loss:	19/08/2019 09:00 - :59 [74 Months and 23 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 5520021828SG	Policy/Cover Note No.:	2100340203 (Comprehensive)						
		Excess:	S\$800.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Azlan, Syazairdina] syazairdina.azlan@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 30/08/2019]								
Driver/Custodian:	HENG KOK CHIANG (62 / Male) , NRIC: S11898923, Tel: +6597378997 Email: HENG.KC@GMAIL.COM								
ASSOCIATED MAIL RECEIVED									
			View All	Compose Case Mail					
- AIG_SG (19/02/2020): Alert - Adj Mandate Approved (S\$14750.00) - SKJ9136A - Claim Handler: Azlan, Sya... - AIG_SG (26/08/2019): Alert - Adj Mandate Maintained - SKJ9136A - Claim Handler: Azlan, Syazairdina - AIG_SG (23/08/2019): Alert - Adj Mandate Approved (S\$13000.00) - SKJ9136A - Claim Handler: Azlan, Sya... - AIG_SG (22/08/2019): SKJ9136A / OD / 19/08/2019 / Coverage & Excess update									
ALL ASSOCIATED TASKS									
			View All	Search Tasks					
			Create New Task	Complete					
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SKJ9136A (5520021828SG)
 OD
 Aug 19 2019 9:00AM
 [HENG KOK CHIANG]
 Premium Automobiles Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View			View in Browser		
Assessment Reports															1 per page					
No	Finalized On		LKK Auto Consultants Pte Ltd (HQ)													Thumbnail	Print			
1	22/08/19 10:45		Adjuster Immediate Advice													Load HTM				
2	22/08/19 17:37		Adjuster Immediate Advice													Load HTM				
Photos/Images															3 per page					
No	Relabel/Reorder		LKK Auto Consultants Pte Ltd (HQ)													Thumbnail	Print			
1	22/08/19 09:56		General View													Load JPG				
2	22/08/19 09:56		Chassis Number													Load JPG				
3	22/08/19 09:56		General View													Load JPG				
4	22/08/19 09:56		General View													Load JPG				
5	22/08/19 09:56		General View													Load JPG				
6	22/08/19 09:56		General View													Load JPG				
7	22/08/19 09:56		General View													Load JPG				
8	22/08/19 09:56		General View													Load JPG				
9	22/08/19 09:56		General View													Load JPG				
10	22/08/19 09:56		General View													Load JPG				
11	22/08/19 09:56		General View													Load JPG				
12	22/08/19 09:56		General View													Load JPG				
13	22/08/19 09:56		General View													Load JPG				
14	22/08/19 09:56		General View													Load JPG				
15	22/08/19 09:56		General View													Load JPG				
16	22/08/19 09:56		General View													Load JPG				
17	22/08/19 09:56		General View													Load JPG				
18	22/08/19 09:56		General View													Load JPG				
19	22/08/19 09:56		General View													Load JPG				
20	22/08/19 09:56		General View													Load JPG				
21	22/08/19 09:56		General View													Load JPG				
22	22/08/19 09:56		General View													Load JPG				
23	22/08/19 09:56		General View													Load JPG				
24	22/08/19 09:56		General View													Load JPG				
25	22/08/19 09:56		General View													Load JPG				
26	22/08/19 09:56		General View													Load JPG				
27	22/08/19 09:56		General View													Load JPG				
28	22/08/19 09:56		General View													Load JPG				
29	22/08/19 09:56		General View													Load JPG				
30	22/08/19 09:56		General View													Load JPG				
31	22/08/19 09:56		General View													Load JPG				
32	22/08/19 09:56		General View													Load JPG				
33	22/08/19 09:56		General View													Load JPG				
34	22/08/19 09:56		General View													Load JPG				

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
35	22/08/19 09:56	General View	 Load JPG	☒
36	22/08/19 09:56	General View	 Load JPG	☒
37	22/08/19 09:56	General View	 Load JPG	☒
38	22/08/19 09:56	General View	 Load JPG	☒
39	22/08/19 09:56	General View	 Load JPG	☒
40	22/08/19 09:56	General View	 Load JPG	☒
41	22/08/19 09:56	General View	 Load JPG	☒
42	22/08/19 09:56	General View	 Load JPG	☒
43	22/08/19 09:56	General View	 Load JPG	☒
44	22/08/19 09:56	General View	 Load JPG	☒
45	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
46	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
47	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
48	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
49	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
50	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
51	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
52	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
53	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
54	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
55	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
56	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
57	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
58	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
59	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
60	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
61	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
62	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
63	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
64	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
65	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
66	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
67	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
68	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
69	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
70	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
71	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
72	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
73	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
74	22/01/20 13:35	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	22/08/19 09:55	Singapore Accident Statement	 Load PDF	
2	22/08/19 09:55	Certificate of Insurance	 Load PDF	
3	22/08/19 09:55	Driver's Driving License	 Load PDF	
4	22/08/19 09:55	ESTIMATE	 Load PDF	
5	22/01/20 15:50	REVISED ESTIMATE	 Load PDF	
6	25/03/20 09:30	Workshop Invoice	 Load PDF	
7	25/03/20 09:30	Discharge Voucher	 Load PDF	
8	25/03/20 09:35	Supplementary	 Load PDF	

Linked Accident Report Documents

View View in Browser

Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	04/09/19 01:55	Accident Statement		Load HTML

Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	19/08/19 15:23	Accident Photo		Load JPG ☒
2	19/08/19 15:23	Accident Photo		Load JPG ☒
3	19/08/19 15:23	Accident Photo		Load JPG ☒
4	19/08/19 15:23	Accident Photo		Load JPG ☒
5	19/08/19 15:23	Accident Photo		Load JPG ☒
6	19/08/19 15:23	Accident Photo		Load JPG ☒
7	19/08/19 15:23	Accident Photo		Load JPG ☒
8	19/08/19 15:23	Accident Photo		Load JPG ☒
9	19/08/19 15:23	Accident Photo		Load JPG ☒
10	19/08/19 15:23	Accident Photo		Load JPG ☒
11	19/08/19 15:23	Accident Photo		Load JPG ☒
12	19/08/19 15:23	Accident Photo		Load JPG ☒
13	19/08/19 15:23	Accident Photo		Load JPG ☒
14	19/08/19 15:23	Accident Photo		Load JPG ☒
15	19/08/19 15:23	Accident Photo		Load JPG ☒
16	19/08/19 15:23	Accident Photo		Load JPG ☒
17	19/08/19 15:23	Accident Photo		Load JPG ☒
18	19/08/19 15:23	Accident Photo		Load JPG ☒
19	19/08/19 15:23	Accident Photo		Load JPG ☒
20	19/08/19 15:23	Accident Photo		Load JPG ☒
21	19/08/19 15:23	Accident Photo		Load JPG ☒
22	19/08/19 15:23	Accident Photo		Load JPG ☒
23	19/08/19 15:23	Accident Photo		Load JPG ☒
24	19/08/19 15:23	Accident Photo		Load JPG ☒
25	19/08/19 15:23	Accident Photo		Load JPG ☒
26	19/08/19 15:23	Accident Photo		Load JPG ☒

Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	19/08/19 15:26	Sketch Plan		Load JPG ☒
2	19/08/19 15:26	Sketch Plan #2		Load JPG ☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd

(Co. Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19014701/AQF3

Date: 25/03/2020

REFERENCE

Insured/Claimant: HENG KOK CHIANG Policy No: 2100340203
Date of Loss: 19/08/2019 Nature of Claim: OD Claim No: 5520021828SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKJ9136A
Make & Model: AUDI A3, 1.8 Sportback TFSI S-tronic (A) Engine No: CDA293330
Reg. Date: 27/05/2013 (Man. Year: 2012) Chassis No: WAUZZZ8P0CA122534
Colour: White Odometer: 133968 km
Engine Capacity: 1798 cc
Market Value/New Car Price: S\$58,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/45 R17 Rear Tyre Size: 225/45 R17
Front Left Side: Dunlop 6 mm Rear Left Side: Dunlop 6 mm
Front Right Side: Dunlop 6 mm Rear Right Side: Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	21,654.56	12,466.96	9,187.60	42.43
Miscellaneous Items	0.00	0.00	0.00	
Labour	12,152.00	7,202.00	4,950.00	40.73
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	33,806.56	19,668.96	14,137.60	41.82
Approved Total (Overridden) (S\$)		14,750.00		
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	33,006.56	13,950.00	19,056.56	57.74
+ GST 7.00/7.00% (S\$)	2,310.46	976.50	1,333.96	57.74
Nett Amount (S\$)	35,317.02	14,926.50	20,390.52	57.74

INSPECTION

Date of Assignment: 21/08/2019
Date Inspected: 21/08/2019 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 11.0 days

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

SPECIAL REMARKS

Repair limit \$13,000.00.

Repairer agreed to repair at \$16,500.00.

Balance of \$3,500.00 will be bear by Insured and Insurance 50% each at \$1,750.00.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*TOP UP FROM INSURANCE		-	*1,750.00 FS
2	1	*FRONT BUMPER COVER	Distorted	1,236.00 FS	*988.80 FS
3	1	*BUMPER FIXING PARTS	Not Necessary	164.00 FS	*- FS
4	1	*FRONT BUMPER CARRIER	Bent	611.00 FS	*488.40 FS
5	2	*FRONT BUMPER SHOCK ABSORBER - LH / RH	Bent	400.00 FS	*319.20 FS
6	2	*FRONT BUMPER GUIDE SECTION - LH / RH	Not Necessary	70.00 FS	*- FS
7	2	*RADIATOR GRILLE CLOSING ELEMENT	Cracked	1,359.00 FS	*1,087.20 FS
8	2	*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	Missing	466.00 FS	*372.80 FS
9	1	*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Not Necessary	177.00 FS	*- FS
10	1	*FOAM FILLER PIECE	Cracked	118.00 FS	*94.00 FS
11	2	*FENDER - LH / RH	Repair	1,384.00 FS	*- FS
12	1	*FENDER ATTACHMENT PARTS	Not Necessary	44.00 FS	*- FS
13	3	*FENDER BRACKET - LH / RH / CENTRE	Not Necessary	267.00 FS	*- FS
14	2	*FENDER BRACE - LH / RH	Not Necessary	98.00 FS	*- FS
15	2	*WHEEL HOUSING LINER - LH / RH	Not Necessary	316.00 FS	*- FS
16	1	*WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT	Not Necessary	131.00 FS	*- FS
17	2	*WHEEL HOUSING LINER - LH / RH	Not Necessary	242.00 FS	*- FS
18	2	*RADIATOR GRILLE SPOILER - LH / RH FRONT	Not Necessary	102.00 FS	*- FS
19	1	*BONNET	Buckled	2,189.00 FS	*1,751.20 FS
20	1	*BONNET ATTACHMENT PARTS	Not Necessary	88.00 FS	*- FS
21	2	*BONNET LID HINGE - LH / RH	Not Necessary	106.00 FS	*- FS
22	1	*GAS FILLED STRUT	Not Necessary	109.00 FS	*- FS
23	1	*BONNET CATCH HOOK	Bent	85.00 FS	*67.52 FS
24	1	*BONNET LID LOCK CABLE	Not Necessary	44.00 FS	*- FS
25	1	*BONNET LID LOCK CABLE	Not Necessary	44.00 FS	*- FS
26	1	*BONNET LID LOCK CABLE	Not Necessary	44.00 FS	*- FS
27	1	*BONNET LID LOCK WITH MICRO SWITCH	Not Necessary	196.00 FS	*- FS
28	1	*MICRO SWITCH	Not Necessary	99.00 FS	*- FS
29	1	*BONNET SEAL - FRONT	Necessary	97.00 FS	*77.04 FS
30	1	*BONNET WATER BOX SEAL	Not Necessary	58.00 FS	*- FS
31	1	*BONNET LOCK COVER - UPPER FRONT	Not Necessary	46.00 FS	*- FS
32	1	*COOLANT RADIATOR LOCK CARRIER	Cracked	898.00 FS	*718.00 FS
33	1	*A/C CONDENSER WITH FLUID RESERVOIR	Bent	514.00 FS	*410.80 FS
34	1	*RADIATOR	Not Necessary	960.00 FS	*- FS
35	1	*RADIATOR BUSH - LOWER	Not Necessary	18.00 FS	*- FS
36	1	*RADIATOR BRACKET	Not Necessary	77.00 FS	*- FS
37	4	*READY-MIX COOLANT	Necessary	84.00 FS	*67.20 FS
38	1	*CHARGE AIR COOLER	Dented	1,060.00 FS	*848.00 FS
39	1	*RADIATOR TWIN FAN RING	Not Necessary	182.00 FS	*- FS
40	1	*RADIATOR FAN - LH	Not Necessary	886.00 FS	*- FS
41	1	*RADIATOR FAN - RH	Not Necessary	589.00 FS	*- FS
42	2	*RADIATOR AIR GUIDE - LH / RH	Deformed	70.00 FS	*55.20 FS
43	1	*INTAKE AIR DUCT - RH	Not Necessary	15.00 FS	*- FS
44	3	*AIR GUIDE CHANNEL	Damaged	47.00 FS	*37.44 FS
45	1	*INTAKE AIR DUCT	Damaged	14.00 FS	*11.12 FS
46	2	*HALOGEN TWIN HEADLIGHTS - LH / RH	Cracked	3,718.00 FS	*2,974.40 FS
47	1	*HALOGEN FOG LAMP - LH / RH	O/S Cracked	474.00 FS	*189.60 FS
48	2	*HEADLIGHT WASHER LIFT CYLINDER - LH / RH	Not Necessary	384.00 FS	*- FS
49	5	*HEADLIGHT WASHER HOSE	Not Necessary	179.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
50	1	*FRONT NO. PLATE	Bent	40.00 FS	*40.00 FS
51	2	*HORN LOW / HIGH TONE	Not Necessary	412.00 FS	*- FS
52	1	*HORN SPRING SHACKLE	Not Necessary	47.00 FS	*- FS
53	1	*SUNDRIES	Necessary	500.00 FS	*22.48 FS
54	1	*COOLANT HOSE WITH QUICK RELEASE COUPLING	Cut	74.08 FS	*74.08 FS
55	1	*SIGN CAUTION STICKER	Necessary	9.76 FS	*9.76 FS
56	1	*AIR COND STICKER	Necessary	12.72 FS	*12.72 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$)	21,654.56	12,466.96
---------------------------	------------------	------------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
2	TO REMOVE AND RENEW AIRCOND CONDENSER, CHARGED AIR COOLER, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,200.00	1,200.00
3	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	6,400.00	3,250.00
4	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS AND BONNET	New	4,000.00	2,200.00
5	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
Gross Labour Cost (S\$)			12,152.00	7,202.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >