

ASS: REC. BY:

REF:

MIG CC3 / AIG 1904964 / Asf3²

ASSIGNMENT

From:

Date:

11/10/2019

Estimated Cost:

☒ OD / ☐ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SME 365S

at Workshop n/s

Premium

of

55 ubi Road 1

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

JBA \$1,600/-

(Client's Record)

Make of Veh:

1pm (waiting)

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

160K.

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

12 days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SME365S

Yr Regn: 2018 / Sept.

Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or

Make:

Audi A5 SB

c.c 1984

Colour

Black

A/C: Insured / Std / NI / NA

Sp. Reading

7247.

T/Radio: Insured / Std / NI / NA

Eng/No:

WAUZZZF54JA127802

C/No:

Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orModi: Nil / ☒ S/Rim / ☐ STD A/Rim or

Tyre Size:

F: 245/40R18

R: 245/40R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental.

Front

Rear

R/Bal.

06

mm

R/Bal.

06

mm

L/Bal.

06

mm

L/Bal.

06

mm

D.O.A.

D.O.I.

11/10/18.

Survey held at

Premium.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear o/s.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

OD AIG.

SME 365S - CC3 / AIG 19013515 / Asf3

D.O.A - 27/07/2019

11/10/19

@ 15:49 pm revised PA to AIG via memo.

11/10/19

@ 15:53 pm mandate requested authorize repair to AIG via memo.

15/10/19

@ 16:53 pm mandate approved by Victor Koh via memo.

15/10/19

@ 17:16 pm informed CIA to Syed Az Gaper via email.

P/P \$15,213.84 @ 12 days Confirmed with Mr. Boo. (\$9,298.16 Red-38%)

Date/Time, File Pass to?



Preli. Report

Days Of Repair:

12

1)

28/02/20



Final Report

Resurvey No. of Trip:

Date/Time, File Return to?

2)

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invt (\$



Weekend (\$

Survey Fee:

Transportation:

3 x RS. \$

Photos:

Other:

TOTAL

Report Form:

Lump Sum (P/P): \$15,213.84 P/P

Nivitha (LKK Auto)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 8 October 2019 6:32 PM
To: 'Admin-D (LKKAuto)'; 'Admin A'; 'SUR'
Cc: 'Claims'
Subject: OD CLAIM FOR SME 365 S ON 8/10/2019
Attachments: SME 365 S - 08102019.PDF

Dear All,

Kindly register OD claim for this vehicle. Attached is the GIA report for your reference.

We will forward you the estimate once it is available.

Please arrange survey on 11/10/2019, 1pm. Owner waiting.

Best Regards,
Syafiq
Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Wednesday, 22 January 2020 4:00 pm
To: Boo seng yak
Cc: Adrian Ling (LKKAuto); SUR; Carrine Leong; jiajee.yap@premiumauto.com.sg; Chang Chee Sing
Subject: RE: FINAL REVISION - SME365S - OD AIG - SURVEYED 11 OCT 19

Dear Mr. Boo,

Confirmed final fig of \$ 15,213.84 @ 12 days of repairs before excess \$ 1,600/- & GST.

Kindly expedite the discharge voucher and tax invoice to us for close case.

"Wishing you a Happy and Prosperous Lunar New Year"



Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>
Sent: Thursday, 16 January 2020 2:55 pm
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; SUR <sur@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; jiajee.yap@premiumauto.com.sg; Chang Chee Sing <claims@premiumauto.com.sg>
Subject: FINAL REVISION - SME365S - OD AIG - SURVEYED 11 OCT 19

Hi Adrian and all,

Revised estimate is attached.

Please confirm repair cost of \$15,213.84 @ 12 days exclude 2 Sundays.

Your early closure is well appreciated.

Re: OD CLAIM FOR SME 365 S ON 8/10/2019

Shirley Hiew (LKK Auto)

Tue 15/10/2019 5:16 PM

To: Claims <claims@premiumauto.com.sg>

Cc: SUR <sur@lkkauto.com>

1 attachments (717 KB)

ESTIMATE.pdf;

Hi Syafiq,

As instructed by our client, please proceed to repair the insured vehicle **SME 365S (Excess S 1,600/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>

Sent: Friday, 11 October 2019 5:49 PM

To: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; Admin A <admin-a@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: 'Claims' <claims@premiumauto.com.sg>

Subject: RE: OD CLAIM FOR SME 365 S ON 8/10/2019

Dear Shirley,

As requested attached is the interview and undertaking letter.

Best Regards,

Syafiq

Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

View Received Message

This mail is associated with :

***SME365S (0075653297SG)**

OD

Oct 8 2019 12:30PM

[PIERRE LEMOINE]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on **15/10/2019 16:53 PM**.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$16605.00) - SME365S - Claim Handler: Khoo, Kay-Eng

Approved:16605.00:Re-Inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 11 Oct 2019

Preliminary Advice

Vehicle No	: SME365S	Accident Date	: 08/10/2019
Make	: AUDI A5	Policy No.	: 1800110100-01
Assignment Date	: 11/10/2019	Excess	: S\$0.00
Date of Inspection	: 11/10/2019	Est. Duration of Repair	: 12 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	24,512.00
Revised Amount	:S\$	16,605.00
Check Items (Estimated)	:S\$	763.00
Total	:S\$	17,368.00

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	160,000.00
COE / PARF Rebate	:S\$	65,056.00
Salvage Value	:S\$	
Margin for Repair	:S\$	94,944.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/10/2019 17:25
Date Of Accident	08/10/2019 12:30
Exact Location Of Accident	PARAGON PARKING
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SME365S
Insured/Policyholder	
Name Of Registered Owner	PIERRE LEMOINE
Passport No/FIN	G3007848P
Email Address	PIERRELSING@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96559935
Alternative Phone No	OFFICE-96559935

Vehicle Particulars

Manufacturer	AUDI
Model	A5 SPORTBACK 2.0 TFS
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800110100-01
Cover Note Number	

Driver

Name of Driver	PIERRE LEMOINE
Passport No/FIN	G3007848P
Date Of Birth	29/12/1968
Occupation	INDOOR
Date Of Driving Pass	29/12/2015
Driving Experience	3 YEARS AND 9 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96559935
Fax Number	
Contact Number	OFFICE-96559935
Email Address	PIERRELSING@GMAIL.COM

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature

Date & Time:

8/10/2019
16:35

0400001-000000000000000000

Driver's Signature

(if driver is not the policyholder)

Date & Time:



Reporting Centre Personnel's Signature

Name:

Chia Hui Hong, Tan

NRIC/FIN No.: 88888888

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Foreign Identification Number
Owner ID:	848P
Vehicle Details	
Vehicle No.:	SME365S
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Oct 2019
Vehicle Make:	AUDI
Vehicle Model:	A5 SB 2.0 TFSI S TRONIC (DESIGN)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	CVK067189
Chassis No.:	WAUZZZF54JA127802
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$40,480.00
Original Registration Date:	14 Sep 2018
First Registration Date:	14 Sep 2018
Transfer Count:	0
Actual ARF Paid:	\$48,672.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Sep 2028
PARF Rebate Amount:	\$36,504.00
Intended COE Rebate Details	
COE Expiry Date:	13 Sep 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$32,001.00
COE Rebate Amount:	\$28,552.00
Total Rebate Amount:	\$65,056.00

The information contained herein is correct as at 11 Oct 2019

OK

Accident Photo



Accident Photo



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 15226

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1225/2019/NS
Date : 10-Oct-19

Vehicle NOT IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Pierre Lemoine
Address : 7 Ocean Way
#03-27
Singapore 098370
Telephone : (HP) +65 96559935
Type of Claim : Own Damage Claims
Policy No. : 1800110100-01
Vehicle No : **SME 365 S**
Model Code : Audi A5 SB 2.0 TFS
Model / Year : 14/9/2018
Engine No : CVK 067189
Chassis No : WAUZZZF54JA127802
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 8-Oct-19
Place of Accident : Paragon Parking

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 365 S

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendations
1	To remove and transfer rear parking aid and rear lid kick sensor. Check function	S/N \$ 360.00	✓
2	To renew 1/4 glass to facilitate fender renewal.	S/N \$ 300.00	✓
3	To install rear windscreen solar film.	S/N \$ 400.00	✓
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N \$ 1,400.00	✓
5	To remove and reinstall rear seat, back rest, hat tray, abcd pilar trims, luggage compartment trims,. Dislodge roof liner and disengage curtain airbag etc.	S/N \$ 1,400.00	✓
SUB LABOUR CHARGES		: \$ 3,860.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 365 S

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendations
6	To dismantle rear bumper and rear lid. Cut out and weld rhs rear fender. To renew rear bumper. Re-organise crash management components. Reinstall all parts removed. ✓ ✓ ✓	\$ 6,400.00	3000
7	To respray rear bumper, rhs rear fender, door entrances, roof channel, drain panel and end panelling. To carry out stone chip treatment and joint sealer works. ✓	\$ 4,400.00	2200
8	To carry out diagnostic check.	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ <u>14,852.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SME 365 S

S/N	Parts Description		Damaged Parts & Prices		Remarks
			S/Nett		
1	REAR BUMPER <i>Rebnd</i>		\$ 2,311.00	✓	1848.80
2	REAR BUMPER FIXING PARTS <i>new</i>		\$ 150.00	+	
3	FRONT BUMPER SECURING STRIP <i>Re new</i>	NEC	\$ 203.00	?	X
4	REAR BUMPER CHROME TRIM <i>new</i>		\$ 928.00	+	
5	REAR LIGHT REFLECTOR - RH <i>new</i>		\$ 38.00	✓	
6	LED TAIL LIGHT - RH <i>Combined</i>		\$ 1,044.00	✓	835.20
7	TAIL LIGHT TRIM - RH <i>new</i>		\$ 27.00	+	
8	REAR BUMPER GUIDE SECTION - RH <i>Re new</i>		\$ 40.00	?	X
9	REAR BUMPER UPPER GUIDE SECTION - RH <i>Re new</i>		\$ 20.00	?	X
10	REAR PARKING AID SENSOR - INNER / OUTER <i>new</i>		\$ 231.00	+	
11	REAR PARKING AID SEAL RING <i>new</i>	4	\$ 12.00	+	
12	REAR FENDER - RH <i>Dented</i>		\$ 2,285.00	✓	1828.00
13	SIDE WINDOW - RH <i>new</i>		\$ 653.00	✓	522.40
14	REAR WHEEL HOUSING LINER - RH <i>new</i>		\$ 256.00	+	
15	REAR WHEEL HOUSING LINER ATTACHMENT PARTS <i>new</i>		\$ 82.00	+	
16	ACRYLIC SEALANT	S/N	\$ 180.00	✓	
17	CAVITY WAX	S/N	\$ 140.00	✓	
18	STONE CHIP	S/N	\$ 180.00	✓	
19	METAL FILLER POWDER	S/N	\$ 280.00	✓	
20	1/4 GLASS SEALANT	S/N	\$ 100.00	✓	
21	SUNDRIES <i>Nec</i>		\$ 500.00	?	✓ 47.44
TOTAL SPARE PARTS			\$ 9,660.00		
TOTAL LABOUR CHARGES			\$ 14,852.00		
GRAND TOTAL			\$ 24,512.00		

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

:

Adrian Ling

Surveyed Date

:

11/10/19

Authorised Date

:

Excess Cost

:

Liability

:

Remarks

:

Not Authorised, 12 Days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel: 6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP : 15226

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1225/2019/NS
Date : 10-Oct-19

Vehicle NOT IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Hi Adrian

12 days exclude 2 Sundays - ok jb

16-Jan-20

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Pierre Lemoine
Address : 7 Ocean Way
#03-27
Singapore 098370
Telephone : (HP) +65 96559935
Type of Claim : Own Damage Claims
Policy No. : 1800110100-01
Vehicle No : **SME 365 S**
Model Code : Audi A5 SB 2.0 TFS
Model / Year : 14/9/2018
Engine No : CVK 067189
Chassis No : WAUZZZF54JA127802
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 8-Oct-19
Place of Accident : Paragon Parking

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 365 S

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendations
1	To remove and transfer rear parking aid and rear lid kick sensor. Check function	S/N \$	360.00	\$ 360.00
2	To renew 1/4 glass to facilitate fender renewal.	S/N \$	300.00	\$ 300.00
3	To install rear windscreen solar film.	S/N \$	400.00	\$ 400.00
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N \$	1,400.00	\$ 1,400.00
5	To remove and reinstall rear seat, back rest, hat tray, abcd pilar trims, luggage compartment trims,. Dislodge roof liner and disengage curtain airbag etc.	S/N \$	1,400.00	\$ 1,400.00
SUB LABOUR CHARGES		:	\$ 3,860.00	\$ 3,860.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 365 S

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendations
			\$ 3,860.00
	<i>c/f</i>		
6	To dismantle rear bumper and rear lid. Cut out and weld rhs rear fender. To renew rear bumper. Re-organise crash management components. Reinstall all parts removed.	\$ 6,400.00	\$ 3,000.00
7	To respray rear bumper, rhs rear fender, door entrances, roof channel, drain panel and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 4,400.00	\$ 2,200.00
8	To carry out diagnostic check.	S/N \$ 192.00	\$ 192.00
	TOTAL LABOUR CHARGES	\$ 14,852.00	\$ 9,252.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SME 365 S

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remarks
1	REAR BUMPER	\$ 2,311.00	\$ 1,848.80
2	REAR BUMPER FIXING PARTS	\$ 150.00	
3	FRONT BUMPER SECURING STRIP	NEC \$ 203.00	
4	REAR BUMPER CHROME TRIM	\$ 928.00	
5	REAR LIGHT REFLECTOR - RH	\$ 38.00	
6	LED TAIL LIGHT - RH	\$ 1,044.00	\$ 835.20
7	TAIL LIGHT TRIM - RH	\$ 27.00	
8	REAR BUMPER GUIDE SECTION - RH	\$ 40.00	
9	REAR BUMPER UPPER GUIDE SECTION - RH	\$ 20.00	
10	REAR PARKING AID SENSOR - INNER / OUTER	\$ 231.00	
11	REAR PARKING AID SEAL RING	4 \$ 12.00	
12	REAR FENDER - RH	\$ 2,285.00	\$ 1,828.00
13	SIDE WINDOW - RH	\$ 653.00	\$ 522.40
14	REAR WHEEL HOUSING LINER - RH	\$ 256.00	
15	REAR WHEEL HOUSING LINER ATTACHMENT PARTS	\$ 82.00	
16	ACRYLIC SEALANT	S/N \$ 180.00	\$ 180.00
17	CAVITY WAX	S/N \$ 140.00	\$ 140.00
18	STONE CHIP	S/N \$ 180.00	\$ 180.00
19	METAL FILLER POWDER	S/N \$ 280.00	\$ 280.00
20	1/4 GLASS SEALANT	S/N \$ 100.00	\$ 100.00
21	SUNDRIES	\$ 500.00	\$ 47.44
TOTAL SPARE PARTS		\$ 9,660.00	\$ 5,961.84
TOTAL LABOUR CHARGES		\$ 14,852.00	\$ 9,252.00
GRAND TOTAL		\$ 24,512.00	\$ 15,213.84

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SME 365 S

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/1225/2019/NH

19th February 2020

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SME 365 S, Audi A5 SB 2.0 TFSI.

With reference to the above-mentioned vehicle, no. **SME 365 S**, claimant, **Mr. Pierre Lemoine**, please find the related document per attached.

1. A copy of the Original invoice no. 85014859 – S\$ 14,566.81.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SME 365 S

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 18:12

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014859 Date : 18/02/2020 Order : SME0365S Term : 30	Account: A0006 (T O) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SME0365S (V 39291) Regn Date: 14/09/2018 Mileage: 8210 WIP No.: 15226

Model: A5 SPORTBACK 2.0 TFSI S tronic Chassis: WAUZZZF54JA127802 Engine: CVK 067189 Dept: U

You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
Q	EXC	M: 8888 Insurance Excess/Liability	-1600.00	1.00	-1,600.00
S	BODYWORK	M: TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR.CHECK FUNCTION.	360.00	1.00	360.00
S	BODYWORK	M: TO RENEW 1/4 GLASS TO FACILITATE FENDER RENEWAL	300.00	1.00	300.00
S	BODYWORK	M: TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHT,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT	1400.00	1.00	1,400.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR SEAT,BACK REST, HAT TRAY,ABCD PILLAR TRIM,LUGGAGE COMPARTMENT TRIMS.DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG	1400.00	1.00	1,400.00
S	BODYWORK	M: TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND WELD RHS REAR FENDER.TO RENEW REAR BUMPER.REORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	3000.00	1.00	3,000.00
S	BODYWORK	M: TO RESPRAY REAR BUMPER,RHS REAR FENDER, DOOR ENTRANCES AND END PANELLING.TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.	2200.00	1.00	2,200.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
S	BODYWORK	M: TO SUPPLY ACRYLIC SEALANT,CAVITY WAX, STONE CHIP,METAL FILLER POWDER AND 1/4 GLASS SEALANT.	880.00	1.00	880.00
Q	OTHERS	M:	400.00	1.00	400.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 18:12

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014859 Date: 18/02/2020 Order: SME0365S Term: 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No: SME0365S (V 39291) Regn Date: 14/09/2018 Mileage: 8210 WIP No.: 15226

Model: A5 SPORTBACK 2.0 TFSI S tronic Chassis: WAUZZZF54JA127802 Engine: CVK 067189 Dept: U

You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
		BNP - TO INSTALL REAR WINDSCREEN SOLAR FILM			
X	A8W6807067N GRU	COVER (LAST)	Less 020%	1.00	2311.00
X	A8W6945092J	TAIL LIGHT (LAST)	Less 020%	1.00	1044.00
X	A8W6807454	(SK) GUIDE AP	Less 020%	1.00	39.40
X	A8W6807890	GUIDE AP	Less 020%	1.00	19.90
X	A8W8809838	(A) (SK) SUBPART 17/10	Less 020%	1.00	2285.00
X	A8W8845298F NVB	SIDE WINDO	Less 020%	1.00	653.00

Parts 5,081.84
Labour 400.00
Sublet 9,732.00
Menus 0.00
Lubricant 0.00

Sub-Total 13,613.84

7% GST 952.97

Grand Total 14,566.81



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SME 365 S

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/1225/2019/TG
10 Dec 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

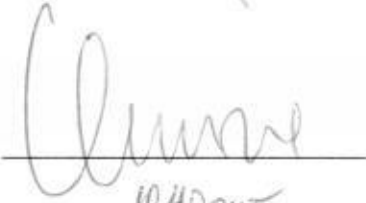
RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi S5 SB 2.0 TFSI
Vehicle Chassis No. : WAUZZZF54JA127802
Vehicle Regn No. : **SME 365 S**
Vehicle Mileage : 8210 KM
Vehicle Owner : Mr. Pierre Lemoine
Certificate No : 1800110100-01
Own Damage Excess : \$ 1712.00 (Inclusive GST)
Accident Date : 08/10/2019
Place : Paragon Parking
Repair Cost : S\$ 14,586.81
WIP No. : 15226
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : 10.40 am.
Date : 10/12/2019

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	14 Oct 2019		11 Oct 2019 15:05 Edit Adj Rpt	S\$15,213.84 Edit Estimates	S\$15,213.84 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS		[Created by insurer]							
Insured:	PIERRE LEMOINE , ID: G3007848P, Tel: +6596559935, Email: PIERRELSING@GMAIL.COM								
Vehicle Reg. No.:	SME365S	Date of Loss:	08/10/2019 12:00 - :59 [12 Months and 24 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 0075653297SG	Policy/Cover Note No.:	1800110100-01 (Comprehensive)						
		Excess:	S\$1,600.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Khoo, Kay-Eng - 6419 1026] Kay-Eng.Khoo@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 22/10/2019]								
Driver/Custodian:	PIERRE LEMOINE (50 / Male), NRIC: G3007848P, Tel: +6596559935 Email: PIERRELSING@GMAIL.COM								
ASSOCIATED MAIL RECEIVED		View All Compose Case Mail							
- AIG_SG (15/10/2019): Alert - Adj Mandate Approved (S\$16605.00) - SME365S - Claim Handler: Khoo, Kay-E... - AIG_SG (14/10/2019): SME365S / OD / 08/10/2019 / Coverage & Excess update									
ALL ASSOCIATED TASKS		View All Search Tasks Create New Task Complete							
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SME365S (0075653297SG)**
OD

Oct 8 2019 12:30PM
[PIERRE LEMOINE]
Premium Automobiles Pte Ltd

Upload Documents	Upload Photos	Compose New Letter	Upload Video	Upload Audio	View View In Browser ▼
Assessment Reports					1 per page ▼ ☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	11/10/19 15:49	Adjuster Immediate Advice	1	Load HTM	
Photos/Images					3 per page ▼ ☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	11/10/19 15:56	General View	1	Load JPG	☒
2	11/10/19 15:56	General View	1	Load JPG	☒
3	11/10/19 15:56	General View	1	Load JPG	☒
4	11/10/19 15:56	General View	1	Load JPG	☒
5	11/10/19 15:56	General View	1	Load JPG	☒
6	11/10/19 15:56	General View	1	Load JPG	☒
7	11/10/19 15:56	General View	1	Load JPG	☒
8	11/10/19 15:56	General View	1	Load JPG	☒
9	11/10/19 15:56	General View	1	Load JPG	☒
10	11/10/19 15:56	General View	1	Load JPG	☒
11	11/10/19 15:56	General View	1	Load JPG	☒
Documentation					1 per page ▼ ☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	11/10/19 15:49	SME 365S GIA.pdf	1	Load PDF	
2	11/10/19 15:49	DRIVING.pdf	1	Load PDF	
3	11/10/19 15:49	CI.pdf	1	Load PDF	
4	11/10/19 15:49	ESTIMATE.pdf	1	Load PDF	
5	11/10/19 17:54	INTERVIEW FORM.pdf	1	Load PDF	
6	11/10/19 17:54	UNDERTAKING LETTER.pdf	1	Load PDF	
7	22/01/20 16:05	ESTIMATE MARKED.pdf	1	Load PDF	
8	02/03/20 16:40	DISCHARGE VOUCHER	1	Load PDF	
9	02/03/20 16:40	WORKSHOP INVOICE	1	Load PDF	

Linked Accident Report Documents

					View View In Browser ▼
Assessment Reports					1 per page ▼ ☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	06/12/19 18:43	Accident Statement	1	Load HTM	
2	06/12/19 18:47	Accident Statement	1	Load HTM	
3	06/12/19 18:47	Accident Statement	1	Load HTM	
4	06/12/19 18:49	Accident Statement	1	Load HTM	
Photos/Images					3 per page ▼ ☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	08/10/19 18:30	Accident Photo	1	Load JPG	☒

Assessment Reports			1 per page ▼	✓
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
2	08/10/19 18:30	Accident Photo	 Load JPG	✓
3	08/10/19 18:30	Accident Photo	 Load JPG	✓
4	08/10/19 18:30	Accident Photo	 Load JPG	✓
5	08/10/19 18:30	Accident Photo	 Load JPG	✓
6	08/10/19 18:30	Accident Photo	 Load JPG	✓
7	08/10/19 18:30	Accident Photo	 Load JPG	✓
8	08/10/19 18:30	Accident Photo	 Load JPG	✓
9	08/10/19 18:30	Accident Photo	 Load JPG	✓
10	08/10/19 18:30	Accident Photo	 Load JPG	✓
11	08/10/19 18:30	Accident Photo	 Load JPG	✓
12	08/10/19 18:30	Accident Photo	 Load JPG	✓
13	08/10/19 18:30	Accident Photo	 Load JPG	✓
14	08/10/19 18:30	Accident Photo	 Load JPG	✓
15	08/10/19 18:30	Accident Photo	 Load JPG	✓
Documentation			1 per page ▼	✓
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	08/10/19 17:35	Sketch Plan	 Load JPG	✓
2	08/10/19 17:35	Sketch Plan #2	 Load JPG	✓

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer
 Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19017964/ASF3S2

Date: 02/03/2020

REFERENCE

Insured/Claimant:	PIERRE LEMOINE	Policy No:	1800110100-01	Claim No:	0075653297SG
Date of Loss:	08/10/2019	Nature of Claim:	OD		

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SME365S	Engine No:	CVK067189
Make & Model:	AUDI A5, 2.0 SPORTBACK (A)	Chassis No:	WAUZZZF54JA127802
Reg. Date:	14/09/2018 (Man. Year: 2018)	Odometer:	7247 km
Colour:	Black		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$160,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	245/40 R18	Rear Tyre Size:	245/40 R18
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,660.00	5,961.84	3,698.16	38.28
Miscellaneous Items	0.00	0.00	0.00	
Labour	14,852.00	9,252.00	5,600.00	37.71
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	24,512.00	15,213.84	9,298.16	37.93
- Excess (S\$)	1,600.00	1,600.00	0.00	0.00
(S\$)	22,912.00	13,613.84	9,298.16	40.58
+ GST 7.00/7.00% (S\$)	1,603.84	952.97	650.87	40.58
Nett Amount (S\$)	24,515.84	14,566.81	9,949.03	40.58

INSPECTION

Date of Assignment:	11/10/2019		Premium Automobiles Pte Ltd (UBI)
Date Inspected:	11/10/2019	Inspected At:	55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	12.0 days		

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed	2,311.00 FS	*1,848.80 FS
2	1		*REAR BUMPER FIXING PARTS	Not Necessary	150.00 FS	*- FS
3	1		*FRONT BUMPER SECURING STRIP	Not Necessary	203.00 FS	*- FS
4	1		*REAR BUMPER CHROME TRIM	Not Necessary	928.00 FS	*- FS
5	1		*REAR LIGHT REFLECTOR - RH	Not Necessary	38.00 FS	*- FS
6	1		*LED TAIL LIGHT - RH	Cracked	1,044.00 FS	*835.20 FS
7	1		*TAIL LIGHT TRIM - RH	Not Necessary	27.00 FS	*- FS
8	1		*REAR BUMPER GUIDE SECTION - RH	Not Necessary	40.00 FS	*- FS
9	1		*REAR BUMPER UPPER GUIDE SECTION - RH	Not Necessary	20.00 FS	*- FS
10	1		*REAR PARKING AID SENSOR - INNER / OUTER	Not Necessary	231.00 FS	*- FS
11	4		*REAR PARKING AID SEAL RING	Not Necessary	12.00 FS	*- FS
12	1		*REAR FENDER - RH	Dented	2,285.00 FS	*1,828.00 FS
13	1		*SIDE WINDOW - RH	Necessary	653.00 FS	*522.40 FS
14	1		*REAR WHEEL HOUSING LINER - RH	Not Necessary	256.00 FS	*- FS
15	1		*REAR WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	82.00 FS	*- FS
16	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
17	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
18	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
19	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
20	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
21	1		*SUNDRIES	Necessary	500.00 FS	*47.44 FS
F=Franchise part. S=SpcNett.						
Total Parts (S\$)					9,660.00	5,961.84

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION.	New	360.00	360.00
2	TO RENEW 1/4 GLASS TO FACILITATE FENDER RENEWAL.	New	300.00	300.00
3	TO INSTALL REAR WINDSCREEN SOLAR FILM.	New	400.00	400.00
4	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT.	New	1,400.00	1,400.00
5	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC.	New	1,400.00	1,400.00
6	TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND WELD RHS REAR FENDER. TO RENEW REAR BUMPER. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	New	6,400.00	3,000.00
7	TO RESPRAY REAR BUMPER, RHS REAR FENDER, DOOR ENTRANCES, ROOF CHANNEL, DRAIN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.	New	4,400.00	2,200.00
8	TO CARRY OUT DIAGNOSTIC CHECK.	New	192.00	192.00
Gross Labour Cost (S\$)			14,852.00	9,252.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >