

Autosprint Pte Ltd
24 Leng Kee Road, #07-01/02 Leng
Kee AutoPoint
159096

Insurer Reference: TP CLAIM - SH 8529 M
Repairer Reference: TP CLAIM - SH 8529 M
Date calculated: 15/02/2020 10:57 AM

Full Report
Registration: SMG 4586 J
Printed: 15/02/2020 10:57 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	India International Insurance
Printed by:	Auto Sprint	Currency:	SGD
Claim Reference:	TP CLAIM - SH 8529 M	Date of Incident:	12/02/20
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	PRIUS C
Sub Model:	BASE MODEL
Model Sheet Number:	70 4P 01
Registration:	SMG 4586 J
VIN number:	ZVW00029138
Odometer:	


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

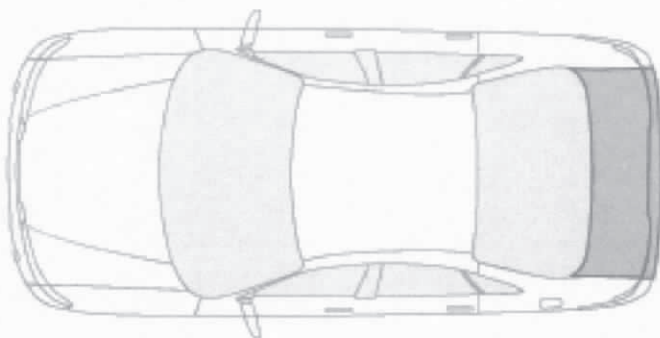

Labour

Time Base 10 WU/h

Price = 50.00 SGD/h

Code	Description	WU	Price SGD
B290	RENEW REAR END PANEL (BUMPER REMOVED) INCLUDES: BOTH REAR LAMPS, FLOOR MAT BOOT COMPARTMENT AND ALL TRIMS IN REPAIR AREA REMOVE AND REFIT	39.0	195.00
B420	RENEW REAR BUMPER INCLUDES: BUMPER AND ALL REQUIRED ATTACHED PARTS R + R	6.0	30.00
B450	R + R REAR SEAT CUSHION CPL	4.0	20.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		4.90	49.0
Total of Labour			245.00

Paint

Paint Work **SYSTEM AZT** Time Basis 10 WU/h

Code	Description	WU	Price SGD
	END PANEL NEW PART PAINTING	18.0	
	REAR BUMPER NEW PART PAINT K1R	9.0	

Paint Material Per Part

Code	Description	Price SGD
2711	END PANEL NEW PART PAINTING	17.04
2581	REAR BUMPER NEW PART PAINT K1R	34.90

Labour Cost - Paint

	Factor	50.00 SGD/h	Hrs	WU	Price SGD
	Time Paint			27.0	
	Preparation Main Work Metal		1.70	17.0	85.00
	Preparation Comp. Work Plastic		0.30	3.0	15.00
Total		10 WU/h	4.70	47.0	235.00

Material Cost - Paint

	Price SGD
New Part Painting	17.04
New Part Painting - Plastic K1R	34.90
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	79.04

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01/01	Price SGD
2711	END PANEL	58307 52600	Repair		230.00
2617	L/R UPP BUMPER BRKT	52576 52160	?		50.00
2618	R/R UPP BUMPER BRKT	52575 52180	?		50.00
2581	REAR BUMPER	52159 52981	de		280.00

Code	Description	Part Number	Supplier	Price SGD
4986	RR LUGG COMPART TRIM	64716 52170C0	X	95.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			705.00
u: Used parts	Addition(+10.00%)			70.50
	Total			775.50

Extras

Code	Description	Price SGD
1000	REAR BUMPER CLIP 0 <i>mu</i>	40 70.00*
	Total Extras	70.00

Final Calculation

	SGD	SGD
Parts		
Addition(+10.00%)	705.00	
Total Parts	70.50	775.50
Labour Time Base 10 WU/h		
Total 49.0 WU X 50.00 SGD/h	245.00	
Total of Labour		245.00
Total Of Extras		70.00
Paint Work Time Base 10 WU/h		
Labour Cost 47.0 WU X 50.00 SGD/h	235.00	
Material Cost	79.04	
Total Paint Including Material		314.04
Repair Cost Excludes GST		1,404.54
GST (+7.0%)		98.32
Repair Cost Included GST		1,502.86

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Rasul
Hp 90010068

3 days

7/1

18/02/2020 @ 1115

Resy before paint

Email: rasul@lkkauto.com