

ASS. REC. BY:

REF:

A/G/ 2000 3119Ka3

C

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

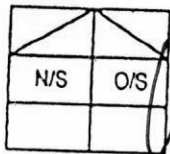
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 09 days Res.: Yes or NoLum Sum: 1.81 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMR 33547 Yr Regn: 01, 20Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make: Hyundai Avante c.c. 1591Colour: M. Silver A/C: Insured / Std / NI / NASp. Reading: 14565 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KM1HD841CM2U 010783Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orMod: Nil / S/Rim / STD / Rim orTyre Size: F: 195/85R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Nexen

Front

Rear

R/Bal. 8 mmR/Bal. 8 mmL/Bal. 8 mmL/Bal. 8 mmD.O.A. 6/4/20D.O.I. 13/4/2020

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop oro/s body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

28/5 89548.08 sms & confirm

Date/Time, File Pass to?

☐ : Prell. Report

Days Of Repair: _____

1)

☐ : Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Date: 09.04.2020

Vehicle No: SMR5354Y

Model: HYUNDAI AVANTE 1.6 GLS

Chassis: KMHD841CMLU010783-2019

Reg.Year: 2020

Third Party Insurer: AIG

Third Party Veh No: GBH371M

Date of Accident: 06.04.2020

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	FRONT DOOR RH	1		Rt \$1,467.50
2	FRONT DOOR OUTER HANDLE RH	1		Br \$121.60
3	FRONT DOOR OUTER HANDLE BASE RH	1		mi \$105.70
4	FRONT DOOR OUTER HANDLE COVER RH	1		mr \$45.00
5	FRONT DOOR CYLINDER KEYLOCK RH	1		mr \$240.00
6	FRONT DOOR INNER TRIM CLIPS RH	10	\$6.50	nn \$65.00
7	FRONT DOOR FRAME PROTECTIVE STICKER RH	1		nn \$40.00
8	FRONT DOOR POWER WINDOW GEAR ASSY RH	1		sn \$1,150.10
9	FRONT DOOR WINDOW GLASS RH	1		sn \$485.50
10	FRONT DOOR GLASS OUTER MOULDING RH	1		sn \$79.50
10	REAR DOOR RH	1		Rt \$1,476.80
11	REAR DOOR INNER LOCK RH	1		nn \$257.20
12	REAR DOOR OUTER HANDLE RH	1		ng \$121.60
13	REAR DOOR OUTER HANDLE INNER BASE RH	1		sr \$105.70
14	REAR DOOR FRAME PROTECTIVE STICKER RH	1		nn \$40.00
15	REAR DOOR INNER TRIM CLIPS RH	10	\$6.50	nn \$65.00
16	REAR QUARTER PANEL RH	1		Rt \$1,852.50
17	REAR QUARTER PANEL INNER TRIM COVERING CLIPS	12	\$6.80	nn \$81.60
18	REAR ALLOY RIM RH	1		del \$895.20
19	REAR AXLE BEAM ASSY	1		sn \$2,025.00
20	REAR WHEEL BEARING ASSY RH	1		sn \$402.70
21	REAR TAIL LAMP RH	1		Br \$482.50
22	REAR TAIL LAMP PANEL RH	1		R \$338.20
23	REAR BUMPER	1		ng \$980.00
24	REAR BUMPER SIDE BRACKET RH	1		pi \$58.00
25	REAR FENDER INNER LINER RH	1		R \$328.60
26	REAR BUMPER CLIPS	8	\$5.80	nn \$46.40
27	REAR BUMPER LOWER LAMP RH	1		sn \$476.00
28	REAR BUMPER LOWER LAMP GARNISH	1		sn \$596.30
29	REAR WINDSCREEN GLASS	1		sh \$945.00
30	REAR WINDSCREEN RUBBER	1		nn \$120.00
31	REAR BOOT	1		REPAIR
32	REAR QUARTER PANEL LOWER SILL MEMBER RH	1		REPAIR
33	RUNNING BOARD PANEL RH	1		REPAIR
SUB TOTAL				\$15,494.20
LESS 20%				-\$3,098.84
PARTS TOTAL				\$12,395.36

Head office

6 Kung Chong Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1011

Branch

551 Upper Thomson Road Singapore 574415
Tel: (+65) 6452 6868 | Fax: (+65) 6452 9223



Date: 09.04.2020
 Vehicle No: SMR5354Y
 Model: HYUNDAI AVANTE 1.6 GLS
 Chassis: KMHD841CMLU010783-2019
 Reg.Year: 2020

Third Party Insurer: AIG
 Third Party Veh No: GBH371M
 Date of Accident: 06.04.2020

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	REAR WINDSCREEN SEALANT	1		\$80.00
2	REAR WINDSCREEN STOPPER	2	\$15.00	\$30.00
3	REAR WINDSCREEN DECAL STICKER	1		\$20.00
			S/N TOTAL	\$130.00

4052
—
✓

LABOUR CHARGES:

LABOUR CHARGES TO REMOVE, REPLACE, REPAIR, READJUST REAR ACCIDENT AREAS & ETC.

9001
\$1,000.00

LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT FRONT DOOR RH, REAR DOOR RH, REAR QUARTER PANEL RH, REAR BUMPER, REAR BOOT LID, RUNNING BOARD PANEL RH & ETC.

11001
\$1,300.00

LABOUR CHARGES TO REMOVE & REINSTALLED FRONT & REAR DOOR INNER MECHANISM & ETC. BACK TO ORIGINAL OPERATIONS.

\$240.00 1201

LABOUR CHARGES TO CHECK WIRING & DOOR CENTRAL LOCKING SYSTEM & ETC.

\$80.00 301

LABOUR CHARGES TO REMOVE, REFIX, REPLACE REAR WINDSCREEN GLASS, REAR WINDSCREEN SEALANT & ETC.

\$120.00 ✓

LABOUR CHARGES TO REMOVE, REPLACE & READJUST REAR ABSORBER, REAR AXLE BEAM ASSY, REAR WHEEL BEARING & ETC.

NN \$350.00 X

LABOUR CHARGES TO REMOVE & REPLACE REAR ALLOY RIM RH & ETC.

\$80.00 201

TO WHEEL ALIGNMENT & BALANCING.

\$80.00 601

TO DIAGNOSE FAULTY CODE & RESET MEMORY.

NN \$120.00 X

LABOUR TOTAL \$3,370.00

TingAn

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

TOTAL \$15,895.36

Head office

6 Kung Chong Road Singapore 159143
 Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Acknowledged by Repairer

Branch

9A Serangoon North Ave 5 Singapore 554500
 Tel: (+65) 6484 9919 | Fax: (+65) 6481 1011

Branch

551 Upper Thomson Road Singapore 574415
 Tel: (+65) 6452 6868 | Fax: (+65) 6452 9223



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	074E
Vehicle Details	
Vehicle No.:	SMR5354Y
Vehicle to be Exported:	Yes
Intended Deregistration Date:	22 Apr 2020
Vehicle Make:	HYUNDAI
Vehicle Model:	AD AVANTE 1.6 GLS (A)
Primary Colour:	Silver
Manufacturing Year:	2019
Engine No.:	G4FGKU475282
Chassis No.:	KMHD841CMLU010783
Maximum Power Output:	93.8 kW (125 bhp)
Open Market Value:	\$12,892.00
Original Registration Date:	13 Jan 2020
First Registration Date:	13 Jan 2020
Transfer Count:	0
Actual ARF Paid:	\$12,892.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	12 Jan 2030
PARF Rebate Amount:	\$9,669.00
Intended COE Rebate Details	
COE Expiry Date:	12 Jan 2030
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$30,000.00
COE Rebate Amount:	\$24,000.00
Total Rebate Amount:	\$33,669.00

The information contained herein is correct as at 06 Apr 2020

OK