


MBM WHEELPOWER PTE. LTD.

YOUR REF.: GBG6272G

OUR REF.: GBE3181R

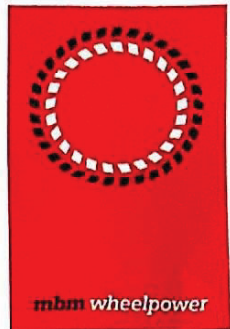

TO: AIG ASIA PACIFIC INSURANCE PTE. LTD.

CC: MOTOR CLAIMS DEPARTMENT

FAX:

DATE: 21/4/2020
FROM: LEE SHIRLEY
FAX: 6452 5333
CONTACT: 8686 5188
MAKE & MODEL: LAND ROVER DEFENDER 90
HARD TOP
CHASSIS NO.: SALLDWN7FA477658
ENGINE NO.: 150615173513DT224
YEAR MADE: 2015
ACCIDENT DATE: 17 April 2020

Not with hold
LLimp B?
Recovery After Paint
Hennessy
96910663
Folow

ESTIMATE FOR VEHICLE NO.: GBE3181R

NO.	DESCRIPTION	PART NO.	QTY.	LIST PRICE
1	STEP & BUMPER - REAR	STC50269AA	1	\$ 2,730.00 ✓
2	STEP - REAR PAD	LR065834	1	\$ 750.00 ?
3	STEP - PLATE	LR065833	1	\$ 530.00 —
4	REAR TAIL LAMP	LR008913	1	\$ 500.00 —
5	REAR TAIL LAMP BASE	LR009773	1	\$ 110.00 —
6	REAR TAIL LAMP WIRING	LR010368	1	\$ 210.00 ?
7	REAR TAIL LAMP SCREW	DA606059L	2	? ?
8	REAR TAIL LAMP SCREW	DA608044L	2	? ?
9	REAR TAIL LAMP NUT-LOKUT	RTC3745	2	\$ 18.00 C
10	REAR FOG LAMP	LR008975	1	\$ 550.00 C
11	REAR FOG LAMP BASE	LR009773	1	\$ 110.00 —
12	REAR FOG LAMP SCREW	LR010398	2	? ?
13	REAR FOG LAMP SCREW	DA608044L	2	? ?
14	REAR FOG LAMP NUT-LOKUT	RTC3745	2	\$ 18.00
15	REAR INDICATOR	LR009792	1	\$ 130.00 ✓
16	REAR INDICATOR WIRING	LR009711	1	\$ 280.00 ?
17	REAR LAMP	LR048200	1	\$ 110.00 —
18	REAR LAMP FLASHER	LR048187	1	\$ 110.00 —
19	REAR LAMP BULB (12V)	264591	1 X NN	
20	REAR LAMP BULB HOLDER	XBP100180	1 X NN	
21	REAR LAMP BULB HARNESS EXTENSION	STC1188	2 X NN	
22	REAR LICENCE PLATE LAMP	XBP100180	1 \$	\$ 1,300.00 X
23	REAR LICENCE PLATE LAMP BULB (12V)	575312	1 ?	
24	REAR LICENCE PLATE LAMP SCREW	SH105552	2 X NN	
25	REAR LICENCE PLATE LAMP- PLINTH	345597	1 X NN	
26	REAR LICENCE PLATE LAMP- GROMMET	235113	1 X NN	
27	REAR LICENCE PLATE LAMP- HARNESS	YND100050	1 X NN	
28	REAR LICENCE PLATE LAMP- WASHER	WM702001L	2 X NN	

MBM WHEELPOWER PTE. LTD.
160 SIN MING DRIVE, #06-02
SIN MING AUTOCITY
t 6262 8888 f 6452 5333
COMPANY REG. NO.: 200204110W

29	REAR LICENCE PLATE LAMP- NUT - HEXAGONAL	NH105041L	2	54x		
30	REAR LAMP GUARDS- FIXED	VUB504110	2	\$	CM 1,200.00	✓
31	REAR END DOOR HINGES LOWER & MIDDLE	LR075817	2	\$	560.00	?
32	REAR END DOOR HINGES SCREW	BYG000060	12	X		
33	REAR END DOOR HINGES WASHER	WA108056	12	X		
34	REAR END DOOR HINGES NUT	NH108041L	12	X		
35	REAR END DOOR HINGES BOLT	BYG500120	12	X		
36	REAR END DOOR HINGES NUT PLATE	BFP710040	2	?		
37	PANEL - RH LOWER BODY SIDE	ALA710510	1	\$	Bu 2,210.00	✓
38	PANEL - RH BODY SIDE ASSEMBLY-REAR	ALA711140	1	\$	Bu 3,400.00	✓
39	PANEL - REAR END RH	STC1854	1	\$	530.00	?
40	PLATE-FLOOR	LR032943	1	\$	2,500.00	?
41	REAR ANGLE MOUNTING	AQR710020	1	\$	1,050.00	?
42	RIVET	RU612373L	24	me		
43	REAR WHEELARCH	ALO710010	1	\$	Bu 800.00	✓
44	REAR WHEELARCH RIVET	MWC9918PMA	12	?		
45	FUEL TANK GROMMET	WLR00020	1	?		
46	FUEL TANK HOSE - FILLER FUEL	WLH100570	1	?		
47	FUEL TANK CLIP - HOSE - WORM - DRIVE	PYC102070	1	?		
48	FUEL TANK HOSE - VENT FUEL TANK	LR016190	1	?		
49	FUEL TANK DECAL "DIESEL"	WLE00020	1	me		
TOTAL: \$					19,706.00	
LESS 10%: \$					(1,970.60)	
PARTS TOTAL: \$					17,735.40	

SPECIAL NETT

BODY SEALANT

EMBLEM "70KM/H"

CERAMIC COATING

\$ Bu 280.00
\$ me 12.50 20.00
\$ 500.00 ?

LABOUR

TO REMOVE, REFIT & REPAIR AFFECTED DAMAGED PARTS

TO CHECK & RECONNECT ALL NECESSARY WIRING

TO CONDUCT ALL WHEEL COMPUTERISED ALIGNMENT

TO APPLY ANTI RUST COATING

TO MOUNT ON CAR-O-LINER TO STRAIGHTEN REAR MAIN CHASSIS

TO REMOVE, RENEW & REFIT REAR UPHOLSTERY TO FACILITATE REPAIR

TO REMOVE AND INSTALL DIESEL TANK TO FACILITATE REPAIR

TO SPRAY PAINT ON THE AFFECTED AREAS

\$ 1000 1,800.00
\$ 200 100.00
\$ un 150.00 X
\$ 600 250.00
\$ un 500.00 X
\$ un 250.00 X
\$ 800 250.00
\$ 750 1,000.00

TOTAL: \$ 22,835.40

7% GST: \$ 1,598.48

GRAND TOTAL: \$ 24,433.88

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

MBM WHEELPOWER PTE. LTD.
160 SIN MING DRIVE, #06-02
SIN MING AUTOCITY
t 6262 8888 f 6452 5333