


Section A - Accident Details

Registration Number	SHC4740K
Case Reference Number	TAX/08/20/2041
Registration Date	22/1/2016
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	JUSTIN CHUA YONG TIAN
Type of Accident	Side Swipe
Accident Date and Time	17/8/2020 1:51 PM
Accident Reported Date and Time	17/8/2020 3:04 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24107863
Special Instruction to ARC,if any	BP / RIGHT PORTION
Prepared Date and Time	18/8/2020 8:52 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

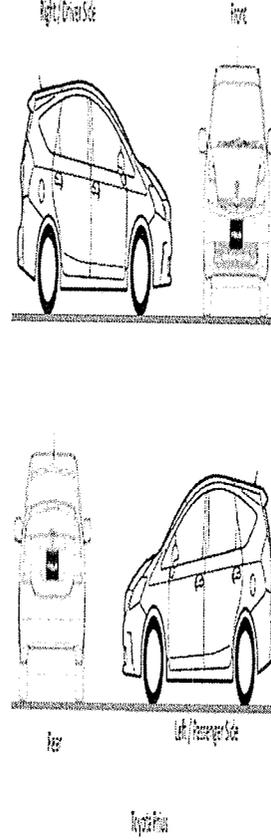

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$676.00	\$200.00
Total Spray Cost	\$2,430.00	\$800.00
Total Spare Part Cost	\$3,319.83	\$150.66
Total Other Cost	\$340.00	\$30.00
TOTAL COST	\$6,765.83	\$1,180.66
Lump Sum Total	\$6,750.00	\$1,200.00 (L/S)
Number of Repair Days	6.0	3.0
Prepared / Adjusted By	Kim Ming Chin	Sun Pin (LKK) / Sompo
ARC / Surveyor Sign Off Date	18/08/2020 4:30 PM	18/08/2020 4:15 PM
Signature		
Remarks	9454.20	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-2008-0344	Invoice Number	
Quotation Date	28.08.2020	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	\$676.00	\$200.00
Total Labour	\$676.00	\$200.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT FENDER RH	\$378.00	\$200.00
TO RESPRAY FRONT DOOR RH	\$378.00	\$200.00
TO RESPRAY REAR DOOR RH	\$378.00	\$200.00
TO RESPRAY ROCKER PANEL MOULDING	\$180.00	\$0.00
TO RESPRAY REAR FENDER RH	\$378.00	\$200.00
RESPRAY WHEEL CAP	\$180.00	\$0.00
TO RESPRAY REAR BUMPER	\$378.00	\$0.00
RESPRAY MIRROR COVER RH	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$2,430.00	\$800.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$30.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$340.00	\$30.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		53801-47050	FENDER FRT/RH	1.00	\$723.40	100.00	\$0.00	Replace	Repair ✓
		75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.93	Replace	Replace ✓
	BODY RH	75851-47900	MOULDING BODY, RH	0.00	\$673.60	0.00	\$0.00	Replace	Not Given X
	BODY RH	67001-47070	DOOR FRT/RH	1.00	\$894.40	100.00	\$0.00	Replace	Repair ✓
	VE	81730-52090	MIRROR LAMP RH	0.00	\$65.30	0.00	\$0.00	Replace	Not Given X
	BODY RH	8791547070A1	COVER, OUTER MIRROR, RH	0.00	\$107.40	0.00	\$0.00	Replace	Not Given X
		52159-47905	BUMPER REAR	0.00	\$458.60	0.00	\$0.00	Replace	Not Given X
	BODY RH	67003-47080	DOOR RR/RH	1.00	\$954.50	100.00	\$0.00	Replace	Repair ✓
			STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace ✓
		69210-74030	DOOR OUTER HANDLE FRT/RH	0.00	\$370.80	0.00	\$0.00	Replace	Not Given X
			PIXEL STICKER	1.00	\$60.00	0.00	\$60.00	Replace	Replace ✓
			PIXEL STICKER	0.00	\$60.00	0.00	\$0.00	Replace	Not Given X

		61604-47090	FENDER RR/RH	1.00	\$766.80	100.00	\$0.00	Replace	Repair ✓
			STICKER DECAL SMRT	1.00	\$7.80	0.00	\$7.80	Replace	Replace ✓
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace ✓
		42602-47060	CAP SUB-ASSY, WHEEL	0.00	\$174.10	0.00	\$0.00	Replace	Not Given ✓
Total					\$5,450.20		\$188.33		

Added Spare Parts / Material Usage After Surveyor Signed off									
Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

188.33 /

-20%

+ 150.66 /
 + 200.00 /

+ 830.00 /

1180.66 /

L/s \$1200 /

3 days