


**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SME 95 X**

| S/N                             | NATURE OF JOBS                                                                                                                                                            | ESTIMATED CHARGES    | SURVEYOR'S RECOMMENDATIONS |
|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|----------------------------|
| 1                               | TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.                                             | S/N \$ 360.00        | <del>///</del> //          |
| 2                               | TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS. | S/N \$ 1,200.00      | ✓ //                       |
| 3                               | TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.                                                                                                    | S/N \$ 700.00        | <del>500</del> ✓           |
| 4                               | TO RENEW FRONT WINDSCREEN.                                                                                                                                                | S/N \$ 480.00        | ✓ //                       |
| 5                               | TO INSTALL SOLAR FILM FOR FRONT WINDSCREEN.                                                                                                                               | \$ 400.00            | ✓ //                       |
| <b>SUB TOTAL LABOUR CHARGES</b> |                                                                                                                                                                           | <b>: \$ 3,140.00</b> |                            |

**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SME 95 X**

| S/N                             | NATURE OF JOBS                                                                         | ESTIMATED CHARGES     | SURVEYOR'S RECOMMENDATIONS |
|---------------------------------|----------------------------------------------------------------------------------------|-----------------------|----------------------------|
| 6                               | TO REMOVE AND RENEW FRONT WINDSCREEN FOIL AND RESET SYSTEM.                            | S/N \$ 300.00         | ✓ / ✓                      |
| 7                               | TO CARRY OUT WATER SEEPAGE TEST FOR FRONT WINDSCREEN.                                  | S/N \$ 200.00         | ✓ / ✓                      |
| 8                               | TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS.   | \$ 5,600.00           | 3250 / ✓                   |
| 9                               | TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS, BONNET, HINGES AND BOTH UPPER A-PILLARS.  | \$ 5,400.00           | 2400 / ✓                   |
| 10                              | TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION AND RENEW ACCORDING TO DAMAGE. | S/N \$ 280.00         | ✓ / ✓                      |
| <b>SUB TOTAL LABOUR CHARGES</b> |                                                                                        | <b>: \$ 11,780.00</b> |                            |



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SME 95 X**


| S/N                         | NATURE OF JOBS                                                                                                                                              | ESTIMATED CHARGES      | SURVEYOR'S RECOMMENDATIONS |
|-----------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------|----------------------------|
| 11                          | TO REMOVE AND TRANSFER REAR LID'S CONVENIENCE LOCK SYSTEM AND WIRE HARNESS FOR TAIL LIGHTS.                                                                 | S/N \$ 280.00          | / /                        |
| 12                          | TO DISLodge AND TRANSFER REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT.                               | S/N \$ 480.00          | / /                        |
| 13                          | TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID. CUT OUT AND WLED REAR END PANELLING. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED. | \$ <del>4,200.00</del> | 3000 /                     |
| 14                          | TO RESPRAY REAR BUMPER, REAR LID, HINGES AND REAR END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.                                  | \$ <del>3,100.00</del> | 2200 /                     |
| 15                          | TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE,                                                                                                                | S/N \$ 280.00          | X nn                       |
| 16                          | TO RENEW REAR EXHAUST SILENCER AND CENTRE SILENCER.                                                                                                         | S/N \$ 480.00          | / /                        |
| 17                          | TO CARRY OUT PRE AND POST DIAGNOSTIC CHECK.                                                                                                                 | S/N \$ 384.00          | / /                        |
| <b>TOTAL LABOUR CHARGES</b> |                                                                                                                                                             | <b>: \$ 24,124.00</b>  |                            |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## **MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X**


| S/N PARTS DESCRIPTION                                | QTY      | DAMAGED PARTS & PRICES<br>S/NETT | REMARKS |
|------------------------------------------------------|----------|----------------------------------|---------|
| 1 FRONT REINFORCEMENT BEAM <i>bt ✓</i>               |          | \$ 795.00                        | 636     |
| 2 FRONT BUMPER FOAM FILLER PIECE <i>? xsvl</i>       |          | \$ 189.00                        | x       |
| 3 FRONT BUMPER FOAM FILLER PIECE COVER <i>? xsvl</i> |          | \$ 122.00                        | x       |
| 4 FRONT FENDER - LH/RH <i>bt ✓</i>                   | 2        | \$ 1,702.00                      | 1360.80 |
| 5 FRONT FENDER ATTACHMENT PARTS <i>rac ✓</i>         |          | \$ 72.00                         | 55.36   |
| 6 FRONT FENDER OUTER BRACKET - LH/RH <i>bt ✓</i>     | 2        | \$ 78.00                         | 61.44   |
| 7 FRONT FENDER INNER BRACKET - LH/RH <i>bt ✓</i>     | 2        | \$ 56.00                         | 43.68   |
| 8 FRONT FENDER BRACE - LH/RH <i>? bt ✓</i>           | 2        | \$ 192.00                        | 76.48   |
| 9 RADIATOR GRILLE <i>Lrb ✓</i>                       |          | \$ 4,880.00                      | 3904    |
| 10 RADIATOR GRILLE COVER <i>can ✓ ? xsvl</i>         |          | \$ 184.00                        | x       |
| 11 RADIATOR GRILLE CLOSING ELEMENT <i>ca ✓</i>       |          | \$ 191.00                        | 152.40  |
| 12 RADIATOR GRILLE INNER COVER - LH/RH <i>? xsvl</i> | 2        | \$ 182.00                        | ✓       |
| 13 BONNET <i>buc ✓</i>                               |          | \$ 3,134.00                      | 2507.20 |
| 14 BONNET ATTACHMENT PARTS <i>? xsvl</i>             |          | \$ 165.00                        | x       |
| 15 BONNET LID HINGE - LH/RH <i>bt ✓</i>              | 2        | \$ 124.00                        | 97.76   |
| 16 BONNET GAS FILLED STRUT <i>? xsvl</i>             |          | \$ 104.00                        | x       |
| 17 BONNET CATCH HOOK <i>ms ✓</i>                     |          | \$ 90.00                         | 71.28   |
| 18 BONNET STRIKER - LH/RH <i>bt ✓</i>                | 2        | \$ 220.00                        | 175.20  |
| 19 BONNET EDGE PROTECTION <i>ms ✓</i>                |          | \$ 28.00                         | 22      |
| 20 FRONT FENDER SIDE COVER - LH/RH <i>? xsvl</i>     | 2        | \$ 82.00                         | x       |
| <b>SUB TOTAL SPARE PARTS</b>                         | <b>:</b> | <b>\$ 12,590.00</b>              |         |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X


| S/N PARTS DESCRIPTION                                        | QTY      | DAMAGED PARTS & PRICES<br>S/NETT | REMARKS |
|--------------------------------------------------------------|----------|----------------------------------|---------|
| 21 BONNET CATCH HOOK <i>bt/</i>                              |          | \$ 63.00                         | 50.32   |
| 22 BONNET LID LOCK <i>bt/</i>                                | 2        | \$ 427.00                        | 341.60  |
| 23 BONNET BOWDEN CABLE - CENTRE <i>? cut/</i>                |          | \$ 58.00                         | 46.00   |
| 24 BONNET LID LOCK CABLE <i>? Xon</i>                        |          | \$ 74.00                         | X       |
| 25 PLENUM CHAMBER COVER <i>cut/</i>                          |          | \$ 179.00                        | 143.20  |
| 26 BONNET SOUND ABSORBER <i>de/</i>                          |          | \$ 219.00                        | 175.20  |
| 27 SIGNAL HORN RETAINER - LH HIGH TONE <i>? for</i>          |          | \$ 200.00                        | X       |
| 28 SIGNAL HORN RETAINER - RH LOW TONE <i>? for</i>           |          | \$ 200.00                        | X       |
| 29 WHEEL HOUSING LINER - LH/RH <i>X son</i>                  | 2        | \$ 338.00                        | X       |
| 30 WHEEL HOUSNIG LINER ATTACHMENT PARTS <i>Xm</i>            |          | \$ 89.00                         | X       |
| 31 LED HEADLIGHT - LH/RH <i>bro/</i>                         | 2        | \$ 10,910.00                     | 8128    |
| 32 MAIN LIGHT ELECTRONICS POWER MODULE - LH/RH <i>? bro/</i> | 2        | \$ 1,516.00                      | 1212.80 |
| 33 LED WITH HEAT SINK - LH/RH <i>? can/</i>                  | 2        | \$ 1,466.00                      | 1172.80 |
| 34 LIGH CONTROL SYSTEM CONTROL UNIT <i>? short/</i>          | 2        | \$ 1,114.00                      | 891.20  |
| 35 HEADLIGHT HOSE - LH/RH <i>? cut Xon</i>                   | 2        | \$ 80.00                         | X       |
| 36 LIFT CYLINDER - LH/RH <i>? Xon</i>                        | 2        | \$ 284.00                        | X       |
| 37 LIFT CYLINDER HOSE <i>?</i>                               |          | \$ 68.00                         | X       |
| 38 LOCK CARRIER <i>can/</i>                                  |          | \$ 727.00                        | 581.60  |
| 39 AIRCON CONDENSER <i>bt/</i>                               |          | \$ 529.00                        | 422.80  |
| 40 RADIATOR <i>? bt/</i>                                     |          | \$ 951.00                        | 760.40  |
| <b>SUB TOTAL SPARE PARTS</b>                                 | <b>:</b> | <b>\$ 19,492.00</b>              |         |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X


| S/N PARTS DESCRIPTION                             | QTY  | DAMAGED PARTS & PRICES | REMARKS  |
|---------------------------------------------------|------|------------------------|----------|
| S/NETT                                            |      |                        |          |
| 41 ADDITIONAL RADIATOR ? <i>bt</i> ✓              | \$   | 859.00                 | 686.80   |
| 42 READY MIX COOLANT <i>rec</i> ✓                 | \$   | 95.00                  | 75.52    |
| 43 RADIATOR FAN ? <i>xsn</i>                      | \$   | 1,265.00               | X        |
| 44 RADIATOR AIR GUIDE - LH/RH <i>cut</i> ✓        | 2 \$ | 50.00                  | 38.88    |
| 45 RADIATOR AIR GUIDE - UPPER CENTRE <i>cut</i> ✓ | \$   | 12.00                  | 9.44     |
| 46 AIR INTAKE AIR DUCT COVER <i>scr</i> ✓         | \$   | 29.00                  | 22.72    |
| 47 AIR INTAKE AIR INLET ? <i>cut</i> ✓            | 2 \$ | 56.00                  | 44.48    |
| 48 AIR INTAKE AIR GUIDE ? <i>cut</i> ✓            | \$   | 20.00                  | 15.36    |
| 49 AIR INTAKE WATER DRAINAGE HOSE ? <i>xsn</i>    | \$   | 33.00                  | X        |
| 50 AIR INTAKE INLET DUCT ? <i>cut</i> ✓           | \$   | 66.00                  | 52.32    |
| 51 INTER COOLER GASKET ? <i>xsn</i>               | \$   | 14.00                  | X        |
| 52 AIR INTAKE AIR FILTER <i>scr</i> ✓             | \$   | 272.00                 | 217.20   |
| 53 AIR INTAKE MANIFOLD - OUTER ? <i>xsn</i>       | \$   | 139.00                 | X        |
| 54 AIR INTAKE MANIFOLD - INNER ? <i>xsn</i>       | \$   | 666.00                 | X        |
| 55 AIR INTAKE MANIFOLD INNER SEAL ? <i>xsn</i>    | \$   | 14.00                  | X        |
| 56 CHARGE AIR COOLER <i>xsn</i>                   | \$   | 752.00                 | X        |
| 57 CHARGE AIR COOLER SEAL <i>xsn</i>              | \$   | 14.00                  | X        |
| 58 CHARGE AIR COOLER SEAL <i>xsn</i>              | \$   | 14.00                  | X        |
| 59 THROTTLE VALVE CONTROL ELEMENT <i>xsn</i>      | \$   | 754.00                 | X        |
| 60 THROTTLE VALVE SEAL <i>xsn</i>                 | \$   | 17.00                  | X        |
| SUB TOTAL SPARE PARTS                             |      | \$                     | 5,141.00 |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X


| S/N PARTS DESCRIPTION                                 | QTY      | DAMAGED PARTS & PRICES<br>S/NETT | REMARKS        |
|-------------------------------------------------------|----------|----------------------------------|----------------|
| 61 FUSE BOX COVER <i>de</i>                           |          | \$ 48.00                         | <i>38.24</i>   |
| 62 CENTAL ELECTRICAL SYSTEM HOUSING <i>? xsu</i>      |          | \$ 83.00                         | <i>X</i>       |
| 63 FUSE AND RELAY BOX <i>? xsu</i>                    |          | \$ 357.00                        | <i>X</i>       |
| 64 REFRIGERANT LINE <i>? xsu</i>                      |          | \$ 619.00                        | <i>X</i>       |
| 65 REFRIGERANT LINE <i>? xsu</i>                      |          | \$ 475.00                        | <i>X</i>       |
| 66 WINDSCREEN <i>ca</i>                               |          | \$ 1,072.00                      | <i>857.60</i>  |
| 67 RAIN SENSOR GEL FOIL <i>nee</i>                    |          | \$ 137.00                        | <i>109.20</i>  |
| 68 INTERIOR MIRROR SPRING CLIP <i>? xsu</i>           |          | \$ 21.00                         | <i>X</i>       |
| 69 REAR BUMPER <i>de</i>                              |          | \$ 2,070.00                      | <i>1656.00</i> |
| 70 REAR BUMPER LOCKING MECHANISM - LH/RH <i>? xsu</i> | 2        | \$ 28.00                         | <i>X</i>       |
| 71 WHEEL HOUSING LINER ADAPTER - LH/RH <i>? xsu</i>   | 2        | \$ 76.00                         | <i>X</i>       |
| 72 REAR LIGHT REFLECTOR - LH/RH <i>? xsu</i>          | 2        | \$ 82.00                         | <i>X</i>       |
| 73 REAR REINFORCEMENT BEAM <i>? bt</i>                |          | \$ 603.00                        | <i>482</i>     |
| 74 REAR BUMPER BRACKET - LH <i>ca</i>                 |          | \$ 27.00                         | <i>21.44</i>   |
| 75 REAR BUMPER BRACKET - RH <i>ca</i>                 |          | \$ 29.00                         | <i>22.48</i>   |
| 76 REAR BUMPER GUIDE SECTION - LH/RH <i>? xsu</i>     | 2        | \$ 134.00                        | <i>X</i>       |
| 77 REAR PARKING AID SENSOR - INNER/OUTER <i>? xsu</i> | 2        | \$ 726.00                        | <i>387.20</i>  |
| 78 REAR PARKING AID SEAL RING <i>nee</i>              | 4        | \$ 14.00                         | <i>11.20</i>   |
| 79 REAR BUMPER WIRING SET <i>? xsu</i>                |          | \$ 515.00                        |                |
| 80 REAR LID <i>bt</i>                                 |          | \$ 3,404.00                      | <i>2723.20</i> |
| <b>SUB TOTAL SPARE PARTS</b>                          | <b>:</b> | <b>\$ 10,520.00</b>              |                |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X


| S/N                   | PARTS DESCRIPTION                            | QTY | DAMAGED PARTS & PRICES |         |
|-----------------------|----------------------------------------------|-----|------------------------|---------|
|                       |                                              |     | S/NETT                 | REMARKS |
| 81                    | REAR LID ATTACHMENT PARTS ? X n              |     | \$ 295.00              | X       |
| 82                    | REAR LID HINGE - LH/RH ? X sn                | 2   | \$ 512.00              | X       |
| 83                    | REAR LID FLAP GASKET ne                      |     | \$ 205.00              | 114.00  |
| 84                    | REAR LID LOCK STRIKER X sn                   |     | \$ 50.00               | X       |
| 85                    | REAR LID LOCK X sn                           |     | \$ 189.00              | X       |
| 86                    | PACKING ADHESIVE ne                          |     | \$ 19.00               | 14.88   |
| 87                    | AUDI EMBLEM ne                               |     | \$ 138.00              | 110     |
| 88                    | A3 INSCRIPTION ne                            |     | \$ 99.00               | 79.04   |
| 89                    | TFSI INSCRIPTION ne                          |     | \$ 99.00               | 79.04   |
| 90                    | REAR CROSS PANEL TRIM ? X sn                 |     | \$ 155.00              |         |
| 91                    | REAR SILENCER bt photo                       |     | \$ 720.00              | 576     |
| 92                    | REAR SILENCER DUAL CLIP ne                   |     | \$ 59.00               | 46.96   |
| 93                    | EXHAUST SYSTEM RETAINER ne                   | 2   | \$ 83.00               | 65.92   |
| 94                    | FRONT SILENCER ? bt                          |     | \$ 489.00              | 390.80  |
| 95                    | FRONT SILENCER DUAL CLIP - LH/RH ? ne        | 2   | \$ 118.00              | 93.92   |
| 96                    | EXHAUST SYSTEM RETAINER ? X sn               |     | \$ 38.00               | X       |
| 97                    | REAR CROSS PANEL bt                          |     | \$ 360.00              | 287.60  |
| 98                    | CROSS PANEL REINFORCEMENT bt                 |     | \$ 733.00              | 586.40  |
| 99                    | REAR CROSS PANEL CONNECTING PLATE - LH/RH ne | 2   | \$ 290.00              | 231.20  |
| 100                   | LED TAIL LIGHT - LH/RH X sn                  | 2   | \$ 1,754.00            | X       |
| SUB TOTAL SPARE PARTS |                                              | :   | \$ 6,405.00            |         |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N                  | PARTS DESCRIPTION                           | QTY | DAMAGED PARTS & PRICES |              | REMARKS                        |
|----------------------|---------------------------------------------|-----|------------------------|--------------|--------------------------------|
|                      |                                             |     | S/NETT                 |              |                                |
| 101                  | LED LICENSE PLATE LIGHT <i>X su</i>         | 2   | \$                     | 202.00       |                                |
| 102                  | REAR EXHAUST SILENCER CHROME TIPS <i>4/</i> |     | \$ 528                 | 400.00       | } prices<br>To be<br>confirmed |
| 103                  | REAR BUMPER LOWER DIFFUSER <i>cm/</i>       |     | \$ 1584                | 1,200.00     |                                |
| 104                  | FRONT BUMPER <i>de/</i>                     |     | \$ 1452                | 1,100.00     |                                |
| 105                  | FRONT WINDSCREEN SEALANT <i>u/</i>          | S/N | \$                     | 200.00/      |                                |
| 106                  | FRONT NO PLATE <i>cm/</i>                   | S/N | \$                     | 80.00/       |                                |
| 107                  | REAR NO PLATE <i>? su</i>                   | S/N | \$                     | 80.00 X      |                                |
| 108                  | METAL FILLER POWDER <i>me/</i>              | S/N | \$                     | 280.00/      |                                |
| 109                  | STONE CHIP <i>h/</i>                        | S/N | \$                     | 180.00/      |                                |
| 110                  | CAVITY WAX <i>m/</i>                        | S/N | \$                     | 140.00/      |                                |
| 111                  | ACRYLIC SEALANT <i>m/</i>                   | S/N | \$                     | 180.00/      |                                |
| 112                  | SUNDRIES <i>? me/</i>                       |     | \$                     | 400.00 83.92 |                                |
| TOTAL SPARE PARTS    |                                             | :   | \$                     | 58,590.00    |                                |
| TOTAL LABOUR CHARGES |                                             | :   | \$                     | 24,124.00    |                                |
| GRAND TOTAL          |                                             | :   | \$                     | 82,714.00    |                                |

ALL CHARGES ARE INCLUSIVE OF GST

LEGEND:

REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED  
SPARE PARTS ARE SPECIAL NETT.

# PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183  
Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



## Supplementary Estimate

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 / Fax: 6256 4315

**Estimate No.**  
**Date**  
**Service Advisor**  
**Pages**  
**Regn No**  
**Model No**

PA/OD/0045/2021/NS  
18-Jan-21  
CHANG  
1 of 1  
SME 95 X  
AUDI A3 SEDAN 1.0 TFSI

| Quantity           | Description                                                                                                                                      | Unit Price          | Amount       |
|--------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|--------------|
| <b>Labours</b>     |                                                                                                                                                  |                     |              |
| 1                  | TO CARRY OUT FIRST MEASUREMENT TEST ON CAR-O-LINER S/N                                                                                           | \$ 800.00           | plush? ✓     |
| 2                  | TO PLACE AND SET UP VEHICLE ON CAR-O-LINER TO FACILITATE REPAIR S/N                                                                              | \$ 1,800.00         | plush? ✓     |
| 3                  | TO CUT OUT AND WELD BOTH FRONT FENDER TOP SUPPORTS. TO REPAIR SPARE WHEEL HOUSING AND RE-ALIGN REAR CHASSIS FRAMES BACK TO ORIGIN SPECIFICATION. | \$ 3,500.00         | 2500 ✓       |
| 4                  | TO RESPRAY BOTH FRONT FENDER TOP SUPPORTS SPARE WHEEL HOUSING AND BOTH REAR CHASSIS FRAMES.                                                      | \$ 3,000.00         | 1500 ✓       |
| 5                  | TO RENEW RHS FRONT RIM WITH TYRE AND CARRY OUT WHEEL ALIGNMENT. S/N                                                                              | \$ 280.00           | ✓            |
| <b>Parts</b>       |                                                                                                                                                  |                     |              |
| 1                  | FRONT FENDER TOP SUPPORT CLOSING ELEMENT - LH/RH                                                                                                 | \$ 148.00           | bt / 116.56  |
| 2                  | FRONT FENDER SUPPORT CONNECTING PLATE - LH/RH                                                                                                    | \$ 658.00           | st / 525.28  |
| 3                  | RADIATOR BRACKET - LH/RH                                                                                                                         | \$ 82.00            | na / 65.28   |
| 4                  | RADIATOR LOWER BUSH - LH/RH                                                                                                                      | \$ 19.00            | na / 15.04   |
| 5                  | WASH WATER RESERVOIR                                                                                                                             | \$ 206.00           | de / 164.40  |
| 6                  | ALUMINIUM RIM - RH FRONT                                                                                                                         | \$ 1,166.00         | sea / 932.80 |
| 7                  | TYRE - RH FRONT                                                                                                                                  | \$ 300.00           | sea / 285    |
| <b>GRAND TOTAL</b> |                                                                                                                                                  | <b>\$ 11,959.00</b> |              |

*Per*  
18/01/2021

For Premium Automobiles Pte Ltd



Authorised Signature



# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N PARTS DESCRIPTION                           | QTY      | DAMAGED PARTS & PRICES |                  | REMARKS |
|-------------------------------------------------|----------|------------------------|------------------|---------|
|                                                 |          | S/NETT                 |                  |         |
| 1 FRONT REINFORCEMENT BEAM <i>bt/</i>           |          | \$                     | 795.00           |         |
| 2 FRONT BUMPER FOAM FILLER PIECE <i>?</i>       |          | \$                     | 189.00           |         |
| 3 FRONT BUMPER FOAM FILLER PIECE COVER <i>?</i> |          | \$                     | 122.00           |         |
| 4 FRONT FENDER - LH/RH <i>bt/</i>               | 2        | \$                     | 1,702.00         |         |
| 5 FRONT FENDER ATTACHMENT PARTS <i>rac/</i>     |          | \$                     | 72.00            |         |
| 6 FRONT FENDER OUTER BRACKET - LH/RH <i>bt/</i> | 2        | \$                     | 78.00            |         |
| 7 FRONT FENDER INNER BRACKET - LH/RH <i>bt/</i> | 2        | \$                     | 56.00            |         |
| 8 FRONT FENDER BRACE - LH/RH <i>bt/</i>         | 2        | \$                     | 192.00           |         |
| 9 RADIATOR GRILLE <i>bro/</i>                   |          | \$                     | 4,880.00         |         |
| 10 RADIATOR GRILLE COVER <i>and/</i>            |          | \$                     | 184.00           |         |
| 11 RADIATOR GRILLE CLOSING ELEMENT <i>ca/</i>   |          | \$                     | 191.00           |         |
| 12 RADIATOR GRILLE INNER COVER - LH/RH <i>?</i> | 2        | \$                     | 182.00           |         |
| 13 BONNET <i>bue/</i>                           |          | \$                     | 3,134.00         |         |
| 14 BONNET ATTACHMENT PARTS <i>?</i>             |          | \$                     | 165.00           |         |
| 15 BONNET LID HINGE - LH/RH <i>bt/</i>          | 2        | \$                     | 124.00           |         |
| 16 BONNET GAS FILLED STRUT <i>?</i>             |          | \$                     | 104.00           |         |
| 17 BONNET CATCH HOOK <i>ms/</i>                 |          | \$                     | 90.00            |         |
| 18 BONNET STRIKER - LH/RH <i>bt/</i>            | 2        | \$                     | 220.00           |         |
| 19 BONNET EDGE PROTECTION <i>ms/</i>            |          | \$                     | 28.00            |         |
| 20 FRONT FENDER SIDE COVER - LH/RH <i>?</i>     | 2        | \$                     | 82.00            |         |
| <b>SUB TOTAL SPARE PARTS</b>                    | <b>:</b> | <b>\$</b>              | <b>12,590.00</b> |         |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N PARTS DESCRIPTION                                           | QTY      | DAMAGED PARTS & PRICES |               |
|-----------------------------------------------------------------|----------|------------------------|---------------|
|                                                                 |          | S/NETT                 | REMARKS       |
| 21 BONNET CATCH HOOK <i>bt</i> ✓                                |          | \$ 63.00               |               |
| 22 BONNET LID LOCK <i>bt</i> ✓                                  | 2        | \$ 427.00              |               |
| 23 BONNET BOWDEN CABLE - CENTRE <i>? cut</i> ✓                  |          | \$ 58.00               |               |
| 24 BONNET LID LOCK CABLE <i>?</i>                               |          | \$ 74.00               |               |
| 25 PLENUM CHAMBER COVER <i>cut</i> ✓                            |          | \$ 179.00              |               |
| 26 BONNET SOUND ABSORBER <i>da</i> ✓                            |          | \$ 219.00              |               |
| 27 SIGNAL HORN RETAINER - LH HIGH TONE <i>?</i>                 |          | \$ 200.00              |               |
| 28 SIGNAL HORN RETAINER - RH LOW TONE <i>?</i>                  |          | \$ 200.00              |               |
| 29 WHEEL HOUSING LINER - LH/RH <i>X</i>                         | 2        | \$ 338.00              |               |
| 30 WHEEL HOUSING LINER ATTACHMENT PARTS <i>X</i>                |          | \$ 89.00               |               |
| 31 LED HEADLIGHT - LH/RH <i>bro</i> ✓                           | 2        | \$ 10,910.00           |               |
| 32 MAIN LIGHT ELECTRONICS POWER MODULE - LH/RH <i>? short</i> ✓ | 2        | \$ 1,516.00            | <i>Report</i> |
| 33 LED WITH HEAT SINK (LH/RH) <i>? short</i> ✓                  | 2        | \$ 1,466.00            | <i>Report</i> |
| 34 HIGH CONTROL SYSTEM CONTROL UNIT <i>? short</i> ✓            | 2        | \$ 1,114.00            | <i>Report</i> |
| 35 HEADLIGHT HOSE - LH/RH <i>?</i>                              | 2        | \$ 80.00               |               |
| 36 LIFT CYLINDER - LH/RH <i>?</i>                               | 2        | \$ 284.00              |               |
| 37 LIFT CYLINDER HOSE <i>?</i>                                  |          | \$ 68.00               |               |
| 38 LOCK CARRIER <i>cr</i> ✓                                     |          | \$ 727.00              |               |
| 39 AIRCON CONDENSER <i>bt</i> ✓                                 |          | \$ 529.00              |               |
| 40 RADIATOR <i>? bt</i> ✓                                       |          | \$ 951.00              |               |
| <b>SUB TOTAL SPARE PARTS</b>                                    | <b>:</b> | <b>\$ 19,492.00</b>    |               |

# PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N PARTS DESCRIPTION                             | QTY          | DAMAGED PARTS & PRICES |                 | REMARKS |
|---------------------------------------------------|--------------|------------------------|-----------------|---------|
|                                                   |              | S/NETT                 |                 |         |
| 41 ADDITIONAL RADIATOR ? <i>ht</i> ✓              |              | \$                     | 859.00          |         |
| 42 READY MIX COOLANT <i>see</i> ✓                 |              | \$                     | 95.00           |         |
| 43 RADIATOR FAN ?                                 |              | \$                     | 1,265.00        |         |
| 44 RADIATOR AIR GUIDE - LH/RH <i>cut</i> ✓        | 2            | \$                     | 50.00           |         |
| 45 RADIATOR AIR GUIDE - UPPER CENTRE <i>cut</i> ✓ |              | \$                     | 12.00           |         |
| 46 AIR INTAKE AIR DUCT COVER <i>see</i> ✓         |              | \$                     | 29.00           |         |
| 47 AIR INTAKE AIR INLET ? <i>ca</i> ✓             | <del>1</del> | \$                     | 56.00           |         |
| 48 AIR INTAKE AIR GUIDE ? <i>ca</i> ✓             |              | \$                     | 20.00           |         |
| 49 AIR INTAKE WATER DRAINAGE HOSE ?               |              | \$                     | 33.00           |         |
| 50 AIR INTAKE INLET DUCT ? <i>see</i> ✓           |              | \$                     | 66.00           |         |
| 51 INTER COOLER GASKET ?                          |              | \$                     | 14.00           |         |
| 52 AIR INTAKE AIR FILTER <i>see</i> ✓             |              | \$                     | 272.00          |         |
| 53 AIR INTAKE MANIFOLD - OUTER ?                  |              | \$                     | 139.00          |         |
| 54 AIR INTAKE MANIFOLD - INNER ?                  |              | \$                     | 666.00          |         |
| 55 AIR INTAKE MANIFOLD INNER SEAL ?               |              | \$                     | 14.00           |         |
| 56 CHARGE AIR COOLER X                            |              | \$                     | 752.00          |         |
| 57 CHARGE AIR COOLER SEAL X                       |              | \$                     | 14.00           |         |
| 58 CHARGE AIR COOLER SEAL X                       |              | \$                     | 14.00           |         |
| 59 THROTTLE VALVE CONTROL ELEMENT X               |              | \$                     | 754.00          |         |
| 60 THROTTLE VALVE SEAL X                          |              | \$                     | 17.00           |         |
| <b>SUB TOTAL SPARE PARTS</b>                      | <b>:</b>     | <b>\$</b>              | <b>5,141.00</b> |         |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N PARTS DESCRIPTION                             | QTY | DAMAGED PARTS & PRICES |          | REMARKS          |
|---------------------------------------------------|-----|------------------------|----------|------------------|
|                                                   |     | S/NETT                 |          |                  |
| 61 FUSE BOX COVER <i>de</i>                       |     | \$                     | 48.00    |                  |
| 62 CENTAL ELECTRICAL SYSTEM HOUSING <i>?</i>      |     | \$                     | 83.00    |                  |
| 63 FUSE AND RELAY BOX <i>?</i>                    |     | \$                     | 357.00   |                  |
| 64 REFRIGERANT LINE <i>?</i>                      |     | \$                     | 619.00   |                  |
| 65 REFRIGERANT LINE <i>?</i>                      |     | \$                     | 475.00   |                  |
| 66 WINDSCREEN <i>ca</i>                           |     | \$                     | 1,072.00 |                  |
| 67 RAIN SENSOR GEL FOIL <i>new</i>                |     | \$                     | 137.00   |                  |
| 68 INTERIOR MIRROR SPRING CLIP <i>?</i>           |     | \$                     | 21.00    |                  |
| 69 REAR BUMPER <i>de</i>                          |     | \$                     | 2,070.00 |                  |
| 70 REAR BUMPER LOCKING MECHANISM - LH/RH <i>?</i> | 2   | \$                     | 28.00    |                  |
| 71 WHEEL HOUSING LINER ADAPTER - LH/RH <i>?</i>   | 2   | \$                     | 76.00    |                  |
| 72 REAR LIGHT REFLECTOR - LH/RH <i>?</i>          | 2   | \$                     | 82.00    |                  |
| 73 REAR REINFORCEMENT BEAM <i>bt</i>              |     | \$                     | 603.00   |                  |
| 74 REAR BUMPER BRACKET - LH <i>ca</i>             |     | \$                     | 27.00    |                  |
| 75 REAR BUMPER BRACKET - RH <i>ca</i>             |     | \$                     | 29.00    |                  |
| 76 REAR BUMPER GUIDE SECTION - LH/RH <i>?</i>     | 2   | \$                     | 134.00   |                  |
| 77 REAR PARKING AID SENSOR - INNER/OUTER <i>?</i> | 2   | \$                     | 726.00   |                  |
| 78 REAR PARKING AID SEAL RING <i>new</i>          | 4   | \$                     | 14.00    |                  |
| 79 REAR BUMPER WIRING SET <i>?</i>                |     | \$                     | 515.00   |                  |
| 80 REAR LID <i>bt</i>                             |     | \$                     | 3,404.00 |                  |
| SUB TOTAL SPARE PARTS                             |     | :                      | \$       | <u>10,520.00</u> |

# PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG



## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N                   | PARTS DESCRIPTION                            | QTY | DAMAGED PARTS & PRICES |          |
|-----------------------|----------------------------------------------|-----|------------------------|----------|
|                       |                                              |     | S/NETT                 | REMARKS  |
| 81                    | REAR LID ATTACHMENT PARTS ?                  |     | \$                     | 295.00   |
| 82                    | REAR LID HINGE - LH/RH ?                     | 2   | \$                     | 512.00   |
| 83                    | REAR LID FLAP GASKET ne                      |     | \$                     | 205.00   |
| 84                    | REAR LID LOCK STRIKER X                      |     | \$                     | 50.00    |
| 85                    | REAR LID LOCK X                              |     | \$                     | 189.00   |
| 86                    | PACKING ADHESIVE ne                          |     | \$                     | 19.00    |
| 87                    | AUDI EMBLEM ne                               |     | \$                     | 138.00   |
| 88                    | A3 INSCRIPTION ne                            |     | \$                     | 99.00    |
| 89                    | TFSI INSCRIPTION ne                          |     | \$                     | 99.00    |
| 90                    | REAR CROSS PANEL TRIM ?                      |     | \$                     | 155.00   |
| 91                    | REAR SILENCER bt photo                       |     | \$                     | 720.00   |
| 92                    | REAR SILENCER DUAL CLIP ne                   |     | \$                     | 59.00    |
| 93                    | EXHAUST SYSTEM RETAINER ne                   | 2   | \$                     | 83.00    |
| 94                    | FRONT SILENCER ? bt                          |     | \$                     | 489.00   |
| 95                    | FRONT SILENCER DUAL CLIP - LH/RH ? ne        | 2   | \$                     | 118.00   |
| 96                    | EXHAUST SYSTEM RETAINER ?                    |     | \$                     | 38.00    |
| 97                    | REAR CROSS PANEL bt                          |     | \$                     | 360.00   |
| 98                    | CROSS PANEL REINFORCEMENT bt                 |     | \$                     | 733.00   |
| 99                    | REAR CROSS PANEL CONNECTING PLATE - LH/RH ne | 2   | \$                     | 290.00   |
| 100                   | LED TAIL LIGHT - LH/RH X                     | 2   | \$                     | 1,754.00 |
| SUB TOTAL SPARE PARTS |                                              | :   | \$                     | 6,405.00 |

# PREMIUM AUTOMOBILES



100, UBI ROAD 1, SINGAPORE 408699  
TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

## MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SME 95 X

| S/N                  | PARTS DESCRIPTION                           | QTY | DAMAGED PARTS & PRICES |           | REMARKS                            |
|----------------------|---------------------------------------------|-----|------------------------|-----------|------------------------------------|
|                      |                                             |     | S/NETT                 |           |                                    |
| 101                  | LED LICENSE PLATE LIGHT                     | 2   | \$                     | 202.00    |                                    |
| 102                  | REAR EXHAUST SILENCER CHROME TIPS <i>lt</i> |     | \$                     | 528.00    | } <i>Ramp</i><br><i>18/01/2021</i> |
| 103                  | REAR BUMPER LOWER DIFFUSER <i>cm</i>        |     | \$                     | 1,584.00  |                                    |
| 104                  | FRONT BUMPER <i>de</i>                      |     | \$                     | 1,452.00  |                                    |
| 105                  | FRONT WINDSCREEN SEALANT                    | S/N | \$                     | 200.00    |                                    |
| 106                  | FRONT NO PLATE                              | S/N | \$                     | 80.00     |                                    |
| 107                  | REAR NO PLATE                               | S/N | \$                     | 80.00     |                                    |
| 108                  | METAL FILLER POWDER                         | S/N | \$                     | 280.00    |                                    |
| 109                  | STONE CHIP                                  | S/N | \$                     | 180.00    |                                    |
| 110                  | CAVITY WAX                                  | S/N | \$                     | 140.00    |                                    |
| 111                  | ACRYLIC SEALANT                             | S/N | \$                     | 180.00    |                                    |
| 112                  | SUNDRIES                                    |     | \$                     | 400.00    |                                    |
| TOTAL SPARE PARTS    |                                             | :   | \$                     | 59,454.00 |                                    |
| TOTAL LABOUR CHARGES |                                             | :   | \$                     | 24,124.00 |                                    |
| GRAND TOTAL          |                                             | :   | \$                     | 83,578.00 |                                    |

ALL CHARGES ARE INCLUSIVE OF GST

LEGEND:


REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED

SPARE PARTS ARE SPECIAL NETT.

# PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



## Supplementary Estimate - 2

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 / Fax: 6256 4315


**Estimate No.**  
**Date**  
**Service Advisor**  
**Pages**  
**Regn No**  
**Model No**

PA/OD/0045/2021/NS  
16-Feb-21  
CHANG  
1 of 1  
SME 95 X  
AUDI A3 SEDAN 1.0 TFSI

| Quantity           | Description                        | Unit Price      | Amount |
|--------------------|------------------------------------|-----------------|--------|
| <u>Parts</u><br>1  | REAR STOWAGE COMPARTMENT <i>CR</i> | \$ 59.00        | 46.56  |
| <b>GRAND TOTAL</b> |                                    | <b>\$ 59.00</b> |        |

For Premium Automobiles Pte Ltd

*Paul*  
16/02/2021

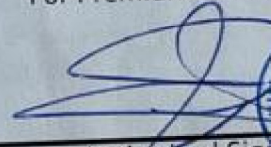
  
Authorised Signature 

# PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



## Supplementary Estimate - 2

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0045/2021/NS

15-Mar-21

GLORY

1 of 1

SME 95 X

AUDI A3 SEDAN 1.0 TFSI

| Quantity          | Description                           | Unit Price | Amount |
|-------------------|---------------------------------------|------------|--------|
| <u>Parts</u><br>1 | FRONT NUMBER PLATE HOLDER <i>cm</i> ✓ | \$ 594.00  | SVC    |
| GRAND TOTAL       |                                       | \$ 594.00  |        |

For Premium Automobiles Pte Ltd

\_\_\_\_\_  
Authorised Signature