

ASS. REC. BY:

REF: C72/21001998/Kt

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop n/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 857k

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 26 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time Action / Instruction

1 / Battery Flat

Date/Time, File Pass to?

☐ : Prell. Report1) _____
Date/Time, File Return to?☐ : Final Report

2) _____

Report Format :

Lump Sum / I.B.I: (\$ _____)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S - RS. \$ _____

Fees

Others

TOTAL

Veh No: SLF 73210 Yr Regn: 09.16.Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or _____

Make: Honda Vezel c.c. 1496Colour: M. Black A/C: ☐ Insured / ☐ Std / ☐ NI / ☐ NASp. Reading: _____ T/Radio: ☐ Insured / ☐ Std / ☐ NI / ☐ NA

Eng/No: _____

C/No: RU3 1210200Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ BurntSteering: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ Inorder / ☐ Jammed / ☐ Leaked / ☐ Burnt orModl: ☐ Nil / ☐ S/Rlm / ☐ STD A/Rlm orTyre Size: Avado 215/60R16R: Dun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 9 mmR/Bal. 3 mmL/Bal. 9 mmL/Bal. 3 mmD.O.A. 10/1/21D.O.I. 10/2/2021

Survey held at _____

Des. of Damages: ☐ Frt / ☐ Rear / ☐ O/S / ☐ N/S / ☐ UIC / ☐ Rooftop orM, O/S Frt & O/S RearThe UIC / Chassis frame & Body Structure affected due to collision. ☒

Goldbell Engineering Pte Ltd
8 Tuas Ave 18, Singapore
638892

Insurer Reference: SLF7321D
Repairer Reference: SLF7321D
Date calculated: 09/02/2021 10:19 AM

Full Report
Registration: SLF7321D
Printed: 09/02/2021 10:20 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Kon Yin Siew	Currency:	SGD
Claim Reference:	SLF7321D	Date of Incident:	10/01/21
Estimated Repair Time:	30	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer: HONDA
Model: VEZEL/HR-V RU1/5
Sub Model: BASE MODEL
Model Sheet Number: 35 VE 01
Registration: SLF7321D
VIN number:
Odometer:

Model Specs

FROM MODEL 2016
1496CCM 97KW
BASECOAT CLEAR

MIRROR WITH TIP FUNC
6-SPEED GEARBOX

FOG LAMPS
SIDE AIRBAGS

LED HEADLAMP
PREPARE OFF VEHICLE

Not Authorized
11 Lmp @
Preparing After Pain
26 days
Ex @ 2000h


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

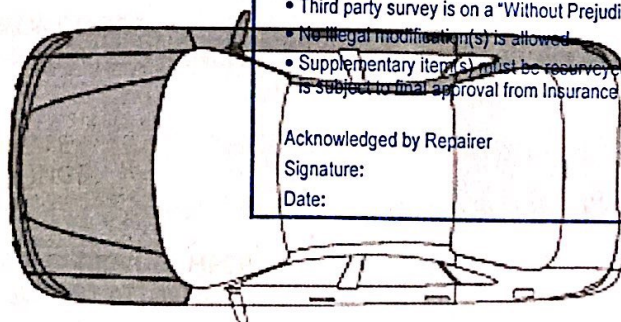

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
4213A7	ALIGN FRONT TOE		4.0	16.80
NO NUMBER	RENEW FRONT PANEL		32.0	134.40
NO NUMBER	RENEW L/F WHEELHOUSE		40.0	168.00
NO NUMBER	RENEW LEFT FRONT WHEELHOUSE		32.0	134.40
NO NUMBER	RENEW L/F UPPER WHEELHOUSE REINFORCEMENT		28.0	117.60
NO NUMBER	RENEW L/F SIDE MEMBER ASS		48.0	201.60
NO NUMBER	RENEW R/F SIDE MEMBER INN REINF		5.0	21.00
8101A2B	RENEW FRONT BUMPER		15.0	63.00
813110)	RENEW RADIATOR GRILLE		4.0	16.80
812100	RENEW BONNET		11.0	46.20
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE			
8121B6)	R + R L/BONNET SEAL		3.0	12.60
8121B7)	R + R R/BONNET HINGE		3.0	12.60
NO NUMBER	R + R BOTH FRONT WINGS (BUMPER REMOVED)		17.0	71.40
	INCLUDES: R + R FRONT HEADLAMPS, SILL COVER AND REQUIRED ATTACHED PARTS.			
831120	R + R WINDSCREEN		26.0	109.20
	INCLUDES: FRT AIR GRILLE, WIPER ARM AND REQUIRED TRIMS REMOVE AND REFIT			
740115)	R + R WIPER LINKAGE		2.0	8.40
7421B0)	R + R WASHER RESERVOIR		2.0	8.40
8131B3	R + R L/ENGINE COMPARTMENT PROTECTION		3.0	12.60
8131B4	R + R R/ENGINE COMPARTMENT PROTECTION		3.0	12.60
8141A7	R + R RIGHT ROOF MOULDING		2.0	8.40
842100)	R + R HEADLINING		9.0	37.80
8551B7 ZAX	R + R REAR CENTRE SEAT BELT		1.0	4.20
7521B6)	R + R L/F SIDE AIRBAG SENSOR		3.0	12.60
854175)	R + R L/R SEAT BELT		1.0	4.20
8361B9	R + R R/F UPPER DOOR FRAME SEAL		4.0	16.80
8381A0	R + R R/R WEATHERSTRIP		2.0	8.40
7521B7)	R + R R/F SIDE AIRBAG SENSOR		3.0	12.60
8161A0	RENEW R/F DOOR		34.0	142.80
	INCLUDES: R + R RIGHT FRONT DOOR, ATTACHED PARTS REFIT AND IF NECES RENEW. ADJUST R/F DOOR.			
844100	RENEW R/F DOOR TRIM		4.0	16.80
819107	R + R R/F DOOR STRIKER PLATE		2.0	8.40
8161B0)	R + R RIGHT FRONT DOOR HINGE		1.0	4.20
NO NUMBER	RENEW R/R SIDE PANEL		75.0	315.00
8111A5	RENEW REAR BUMPER		7.0	29.40
	INCLUDES: REMOVE AND REFIT REAR BUMPER, BUMPER CORNERS AND REQUIRED ATTACHED PARTS.			
823100)	R + R REAR DOOR		5.0	21.00
8571G4	R + R RIGHT LOWER A-PILLAR TRIM		1.0	4.20
8571B7	R + R LEFT UPPER B-PILLAR TRIM		3.0	12.60
8571B8	R + R RIGHT UPPER B-PILLAR TRI		3.0	12.60
8491A8)	R + R L/UPPER C-PILLAR TRIM		2.0	8.40
848140	R + R REAR END PANEL TRIM		2.0	8.40

Code	Description	WU	Price SGD
8521D0	R + R R/F SEAT	4.0	16.80
751108)	R + R RIGHT SIDE AIRBAG	5.0	21.00
855185	R + R L/F SEAT BELT BUCKLE	5.0	21.00
865185	R + R R/F SEAT BELT BUCKLE	5.0	21.00
NO NUMBER	R + R LEFT REAR SEAT BENCH	1.0	4.20
NO NUMBER	R + R RIGHT REAR SEAT BENCH	1.0	4.20
NO NUMBER	R + R RIGHT REAR SEAT REST	2.0	8.40
8551A8)	R + R L/R SEAT BELT BUCKLE	1.0	4.20
8551A9)	R + R R/R SEAT BELT BUCKLE	1.0	4.20
841100 ZAX	RENEW DASHBOARD	31.0	130.20
754110)	R + R PASSENGER AIRBAG	3.0	12.60
611100)	R + R HEATER HOUSING	28.0	117.60
710100	R + R BATTERY	3.0	12.60
751100)	R + R AIRBAG CONTROL UNIT	6.0	25.20
1211BU	R + R AIR CLEANER CPL	4.0	16.80
112101	R + R RIGHT ENGINE BRACKET	9.0	37.80
112104)	R + R TRANSMISSION BRACKET	6.0	25.20
114100)	R + R RADIATOR	10.0	42.00
1151A2)	R + R L/FAN MOTOR	1.0	4.20
6171A5)	R + R RIGHT RADIATOR FAN MOTOR	1.0	4.20
1151A1)	R + R L/FAN BLADE	1.0	4.20
6171A8)	R + R RIGHT RADIATOR FAN BLADE	1.0	4.20
616100)	R + R CONDENSER	2.0	8.40
616156)	R + R CONDENSER-EVAPORATOR HOSE	3.0	12.60
616185)	R + R CONDENSER-/COMPRESSOR HOSE	5.0	21.00
6161C9)	R + R COMPRESSOR-/EVAPORATOR HOSE	5.0	21.00
6161C2)	R + R AIR CONDITIONING PIPE	4.0	16.80
620020	DRAIN + REFILL AIR CONDITIONING	7.0	29.40
NO NUMBER	DETACH + REFIT L/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	DETACH + REFIT R/FR BRAKE CALIPER	1.0	4.20
416175)	RENEW FRONT AXLE SUPPORT	15.0	63.00
5131C0)	RENEW STEERING GEAR	9.0	37.80
416117)	R + R BOTH FR/LOWER CONTROL ARMS	4.0	16.80
NO NUMBER	R + R LEFT FRONT SHOCK ABSORBER	4.0	16.80
NO NUMBER	R + R RIGHT FRONT SHOCK ABSORBER	4.0	16.80
414125)	DIS + ASS L/F SHOCK ABSORBER/COIL SPRING	3.0	12.60
414130)	DIS + ASS R/F SHOCK ABSORBER/COIL SPRING	3.0	12.60
4151A8)	RENEW L/F STEERING KNUCKLE	15.0	63.00
4151A7)	RENEW R/F STEERING KNUCKLE	15.0	63.00
413160)	R + R LEFT FRONT ABS SENSOR	1.0	4.20
413161)	R + R RIGHT FRONT ABS SENSOR	1.0	4.20
219131)	R + R LEFT FRONT DRIVE SHAFT CPL	6.0	25.20
219132)	R + R RIGHT FRONT DRIVE SHAFT CPL	3.0	12.60
4211A6	R + R L/F WHEEL	2.0	8.40
4211A6	R + R R/F WHEEL	2.0	8.40
4211F3)	R + R AND BALANCE L/F TYRE	4.0	16.80
4211F4)	R + R AND BALANCE R/F TYRE	4.0	16.80
4161A0	R + R REAR AXLE	24.0	100.80
4211F3)	R + R L/R TYRE AND BALANCE	4.0	16.80
4211F4)	R + R R/R TYRE AND BALANCE	4.0	16.80
NN	RH ROOF LINING AIRB R&R / NEW PARTS	20 30.0*	126.00
1001	REMOVE&REFIX ENGINE ENGINE	50 100.0*	420.00
1002	REMOVE&REFIX GEARBOX GEARBOX	60.0* ?	252.00
1118	R/F WHEELHOUSE REPAIR	30 50.0*	210.00
1120	R/F WHEELHOUSE REINF REPAIR	20 30.0*	126.00

Code	Description	WU	Price SGD
1168	R/F UP W-HOUSE REINF REPAIR	20 20.0*	126.00
1202	R/F SIDE MEMBER CPL REPAIR	40 80.0*	336.00
1311	COWL PANEL REPAIR	30.0* ?	126.00
1782	R/R DOOR REPAIR	20.0* X	84.00
2931	BOOTLID/TAILGATE REPAIR	10 20.0*	84.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		117.20	1,172.0
Alignment			
Measuring Work		0.40	4.0
Total of Labour			4,939.20

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - BASECOAT CLEAR	WU	Price SGD
	BONNET NEW PART PAINTING	21.0	
	L/F WING NEW PART PAINTING	9.0	
	R/F WING NEW PART PAINTING	9.0	
	FRONT PANEL CPL SURFACE PAINT	6.0	
	L/F WHEELHOUSE SURFACE PAINT	6.0	
	L/F WHEELHOUSE REINF SURFACE PAINT	5.0	
	L/F UP W-HOUSE REINF SURFACE PAINT	5.0	
	L/F SIDE MEMBER CPL SURFACE PAINT	6.0	
	RIGHT FRONT DOOR NEW PART PAINTING	17.0	
	R/R SIDE PANEL NEW PART PAINTING	25.0	
	FRONT BUMPER NEW PART PAINT K1R	10.0	
	RAD GRILLE COVER NEW PART PAINT K1R	5.0	
	R/F DOOR OUT HANDLE NEW PART PAINT K1R	3.0	
	R/DOOR MIRROR COVER NEW PART PAINT K1R	3.0	
	R/R BUMPER CORNER NEW PART PAINT K1R	4.0	
	R/R DOOR REPAIR PAINTING >50%	24.0	
	BOOTLID/TAILGATE REPAIR PAINTING >50%	30.0	
	R/F WHEELHOUSE SURFACE PAINT	6.0	
	R/F WHEELHOUSE REINF SURFACE PAINT	5.0	
	R/F UP W-HOUSE REINF SURFACE PAINT	5.0	
	R/F SIDE MEMBER CPL SURFACE PAINT	6.0	
	COWL PANEL SURFACE PAINT	6.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	65.53
0741	L/F WING NEW PART PAINTING	16.00
0742	R/F WING NEW PART PAINTING	16.00
1009	FRONT PANEL CPL SURFACE PAINT	11.21
1117	L/F WHEELHOUSE SURFACE PAINT	12.70
1119	L/F WHEELHOUSE REINF SURFACE PAINT	8.22
1167	L/F UP W-HOUSE REINF SURFACE PAINT	8.47
1201	L/F SIDE MEMBER CPL SURFACE PAINT	13.70
1482	RIGHT FRONT DOOR NEW PART PAINTING	49.54
3482	R/R SIDE PANEL NEW PART PAINTING	32.45
0283	FRONT BUMPER NEW PART PAINT K1R	43.30

Paint Material Per Part

Code	Description	Price SGD
0424	RAD GRILLE COVER NEW PART PAINT K1R	11.32
1566	R/F DOOR OUT HANDLE NEW PART PAINT K1R	0.98
1746	R/DOOR MIRROR COVER NEW PART PAINT K1R	3.44
2588	R/R BUMPER CORNER NEW PART PAINT K1R	10.33
1782	R/R DOOR REPAIR PAINTING >50%	31.60
2931	BOOTLID/TAILGATE REPAIR PAINTING >50%	45.82
1118	R/F WHEELHOUSE SURFACE PAINT	12.70
1120	R/F WHEELHOUSE REINF SURFACE PAINT	8.22
1168	R/F UP W-HOUSE REINF SURFACE PAINT	8.47
1202	R/F SIDE MEMBER CPL SURFACE PAINT	13.70
1311	COWL PANEL SURFACE PAINT	9.96

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		216.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	24.60	246.0

Material Cost - Paint

	Price SGD
New Part Painting	179.52
New Part Painting - Plastic K1R	69.37
Repair Painting	77.42
Surface-/Blend Paint	107.35
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	471.26

Spare Parts

				prices as at 2015-06-01/01	
Code	Description	Part Number	Part Source	Price SGD	
0257	FRONT NUMBER PLATE	KNPL3	Original	50.00	mir
0283	FRONT BUMPER	71101T8NT00ZZ	Original	230.00	mir
0340	FRT BUMPER SUPPORT	71130T8NT00ZZ	Original	210.00	mir
0343	L/BUMPER CORNER	71190T7A000	Original	15.00	CM
	BRKT				
0344	R/BUMPER CORNER	71140T7A000	Original	15.00	CM
	BRKT				
0345	L/F AIR DUCT	71116T8NT50	Original	35.00	mir
0346	R/F AIR DUCT	71111T8NT50	Original	35.00	mir
0351	LOWER FRONT GRILLE	71103T7JH00	Original	68.00	mir
0391	FRONT SPOILER	71110T7A000	Original	295.00	mir
0410	GRILLE	71121T8NT50	Original	225.00	mir
0411	UP/CVR RADIAT GRILLE	71129T7JH00	Original	60.00	mir
0413	RAD GRILLE BRACKET	71150T7JH00	Original	30.00	mir
0415	L/RAD-GRILLE BRACKET	71152T7A000	Original	15.00	mir
0416	R/RAD-GRILLE BRACKET	71151T7JH00	Original	15.00	mir
0424	RAD GRILLE COVER	71122T8NT50	Original	55.00	mir
0431	GRILLE BADGE	75700TA0A00	Original	25.00	mir

Code	Description	Part Number	Part Source	Price SGD	
0471	BONNET	60100T8NT00ZZ	Original	Ry 460.00	✓
0475	L/BONNET HINGE	60170T8NT01ZZ	Original	Dij 38.00	✓
0476	R/BONNET HINGE	60120T8NT01ZZ	Original	Dij 38.00	✓
0481	BONNET INSULATION	74141T7YT00	Original	CM 88.00	✓
0492	BONNET LOCK	74120T7WA01	Original	Ry 80.00	✓
0495	BONNET STAY	74145T7A000	Original	mi 25.00	✓
0500	BONNET CABLE	74130T8NT01	Original	Tn 23.00	✓
0511	L/BONNET SEAL	74192T7JH00	Original	Cut 20.00	✓
0512	R/BOONET SEAL	74142T7JH00	Original	Cu 20.00	✓
0561	L/F HEADLAMP CPL	33150T7SE11	Original	Bu 980.00	✓
0562	R/F HEADLAMP CPL	33100T7SE11	Original	mi 980.00	✓
0637	L/F FOG LAMP	33950SLEJ51	Original	mi 150.00	✓
0638	R/F FOG LAMP	33900SLEJ51	Original	mi 150.00	✓
0649	L/FOG LAMP COVER	71106T7JH00	Original	mi 25.00	✓
0650	R/FOG LAMP COVER	71105T7JH00	Original	mi 25.00	✓
0741	L/F WING	60260T8NT00ZZ	Original	Bu 225.00	✓
0742	R/F WING	60210T8NT00ZZ	Original	Ry 225.00	✓
0787	L/WING MOULDING	74157T7MH01	Original	mi 163.00	✓
0788	R/WING MOULDING	74107T7MH01	Original	mi 163.00	✓
0841	L/F WHEELHOUSE COVER	74150T8NT10	Original	Dij 89.00	✓
0842	R/F WHEELHOUSE COVER	74100T8NT10	Original	mi 89.00	✓
1009	FRONT PANEL CPL	60400T8NT00ZZ	Original	Ry 380.00	✓
1117	L/F WHEELHOUSE	60750T8N305ZZ	Original	Ry 205.00	✓
1119	L/F WHEELHOUSE REINF	04684T8NT00ZZ	Original	Ry 95.00	✓
1167	L/F UP W-HOUSE REINF	60710T8NT10ZZ	Original	Ry 95.00	✓
1201	L/F SIDE MEMBER CPL	60910T8NT00ZZ	Original	Ry 500.00	✓
1296	R/F INN S-MEMB REINF	60848T9AT00ZZ	Original	Ry 45.00	✓
1395	COWL	74200T8NT00	Original	168.00	?
1415	L/WINDSCREEN MLDG	73125T7A003	Original	me 30.00	✓
1416	R/WINDSCREEN MLDG	73125T7A003	Original	me 30.00	✓
1423	LWR FRT SCREEN SEAL	77466SV4000	Original	me 30.00	✓
1432	UPP WINDSCREEN MLDG	73150T7A003	Original	me 45.00	✓
1435	FILLER NECK	76805T8NT01	Original	not 35.00	✓
1436	WASHER RESERVOIR	76841T8NT01	Original	my CM 65.00	✓
1437	W-SCREEN WASHER PUMP	76846TF0013	Original	45.00	?
1443	WASHER RESERVOIR CAP	76802SK7003	Original	me 15.00	X
1461	WIPER LINKAGE CPL	76530T8NT01	Original	150.00	?
1482	RIGHT FRONT DOOR	67010T7YT00ZZ	Original	Ry 600.00	✓
1488	R/F UPPER DOOR HINGE	67410T9AT01ZZ	Original	Ry 35.00	✓
1496	R/F LOWER DOOR HINGE	67420T9AT01ZZ	Original	Ry 35.00	✓
1506	R/F DOOR CHECK	72340T7A003	Original	Dij 42.00	✓
1510	R/F DOOR SEAL	72324T7A003	Original	me 15.00	✓
1512	R/F LOWER DOOR SEAL	72326T7AJ01	Original	me 15.00	✓
1514	R/ROOF SEAL	72325T7JH01	Original	me 85.00	✓
1548	R/WINDOW REGULATOR	72210T7WA11	Original	312.00	?
1566	R/F DOOR OUT HANDLE	72140T9AT11ZB	Original	Dij 250.00	✓
1570	DOOR LOCK CYLINDER	72145T7A003	Original	me 60.00	X
1578	R/F DOOR LOCK	72110T0AJ02	Original	R 210.00	X
1582	R/F STRIKER PLATE	72135SDAA01	Original	R 20.00	X
1598	R/F WINDOW CHANNEL	72235T7A003	Original	45.00	?
1662	R/F WINDOW MOULDING	72410T7A003	Original	Bu 38.00	✓

Code	Description	Part Number	Part Source	Price SGD	
1712	R/F DOOR TRIM	83502T8NT81ZA	Original	375.00	?
1738	R/DOOR MIRROR	76208T8CT01	Original	450.00	✓
1746	R/DOOR MIRROR COVER	76201T7JH01ZL	Original	65.00	✓
2583	REAR BUMPER	71501T8NT00	Original	510.00	✓
2588	R/R BUMPER CORNER	71502T7JH00ZZ	Original	85.00	✓
2620	R/R OUT BUMPER BRKT	71593T7A000	Original	15.00	✓
3296	R/R REFLECTOR	33505T7AJ01	Original	35.00	X
3482	R/R SIDE PANEL	04636T8NT00ZZ	Original	580.00	✓
3672	R/R S-PANEL MOULDING	74410T7MH01	Original	150.00	✓
3676	R/R WHEELHOUSE CVR	74552T8RT00	Original	89.00	?
4325	PASSENGER AIRBAG	77820T7AJ80	Original	850.00	✓
4331	INSTRUMENT PANEL	77100T8NT10ZA	Original	610.00	✓
4411	HEATER BLOWER	79305T9AT82	Original	280.00	?
4415	HEATER HOUSING	79106T8NQ41	Original	280.00	?
4465	CONDENSER	80110T7A003	Original	410.00	✓
4481	COND/COMPRESSOR	80315T7A003	Original	115.00	✓
	HOSE			95.00	?
4482	COND/EVAPORATOR	80341T7AJ01	Original	65.00	?
	PIPE			132.00	?
4483	COMPR/EVAP TUBE	80311T7AJ01	Original	550.00	✓
4484	AIR CON PIPE	80321T7AJ01	Original	138.00	✓
4608	R/SIDE AIRBAG	78050T5HH21	Original	138.00	✓
4613	L/F S/AIRBAG SENSOR	77970T6AJ11	Original	140.00	?
4614	R/F S/AIRBAG SENSOR	77970T6AJ11	Original	140.00	?
4653	L/F SEAT BELT LOCK	04816T8CM00ZA	Original	140.00	?
4654	R/F SEAT BELT LOCK	04813T8CM00ZA	Original	140.00	?
4835	L/R SEAT BELT BUCKLE	82855T8NQ01ZA	Original	140.00	?
4836	R/R SEAT BELT LOCK	82455T8NQ01ZA	Original	480.00	?
4840	REAR CTR SEAT BELT	82480T8NQ01ZA	Original	480.00	✓
4841	L/R SEAT BELT	82850T8NQ01ZA	Original	480.00	✓
4842	R/R SEAT BELT	82450T8NQ01ZA	Original	68.00	?
4942	R/UPP A-PILLAR TRIM	84101T8NT01ZA	Original	80.00	?
4950	R/LWR B-PILLAR TRIM	84121T8NT01ZA	Original	33.00	?
4952	R/UPP B-PILLAR TRIM	84111T8NQ01ZA	Original	560.00	✓
4957	HEADLINING	83200T8NT11ZA	Original	518.00	?
7011	FRT ASSEMBLY SUPPORT	50200T7A023	Original	890.00	?
7035	L/F DRIVE SHAFT	44306T7YT93	Original	890.00	?
7036	R/F DRIVE SHAFT	44305T7YT93	Original	215.00	✓
7053	L/LOWER CONTROL ARM	51360T7JH01	Original	215.00	✓
7054	R/LOWER CONTROL ARM	51350T7JH01	Original	165.00	✓
7081	L/F STEERING KNUCKLE	51216T8N000	Original	165.00	✓
7082	R/F STEERING KNUCKLE	51211T8N000	Original	275.00	✓
7087	L/F SHOCK ABSORBER	51621T8PT02	Original	275.00	✓
7088	R/F SHOCK ABSORBER	51611T8PT02	Original	23.00	✓
7091	L/SUPPORT BEARING	51688SYY004	Original	23.00	✓
7092	R/SUPPORT BEARING	51688SYY004	Original	20.00	?
7101	L/F DAMPER STOP	51686T8NT01	Original	20.00	?
7102	R/F DAMPER STOP	51686T8NT01	Original	300.00	✓
7201	L/F WHEEL	42700T8CT91	Original	300.00	✓
7202	R/F WHEEL	42700T8CT91	Original	150.00	802.00
7227	L/F TYRE	215/60 R 16 .. H	Original	150.00	802.00
7228	R/F TYRE	215/60 R 16 .. H	Original	75.00	?
7245	L/F ABS SENSOR	57455T7A003	Original	75.00	?
7246	R/F ABS SENSOR	57450T7A003	Original	150.00	✓
7261	FRONT STABILISER	51300T7A003	Original	55.00	?
7271	L/F OUT STABI MNTG	51325T7A003	Original		

Code	Description	Part Number	Part Source	Price SGD	
7272	R/F OUT STABI MNTG	51320T7A003	Original	55.00	?
7300	STEERING GEAR	53400T7ST02	Original	920.00	?
7311	L/TIE ROD BALL JOINT	53560T7J003	Original	35.00	?
7312	R/TIE ROD BALL JOINT	53540T7J003	Original	35.00	?
7438	R/F AIRBAG SENSOR	77930T6AJ21	Original	138.00	✓
7440	AIRBAG CONTROL UNIT	77960T7SQ81	Original	690.00	✓
7442	CONTACT RING	77900T5AJ21	Original	210.00	✓
7445	DRIVER AIRBAG	77810T9AT82ZA	Original	980.00	✓
7761	RADIATOR	1901050T902	Original	850.00	✓
7762	FILLER TUBE HOSE	1905150T000	Original	95.00	?
7763	FILLER PIPE	1905050T901	Original	95.00	?
7767	L/FAN SHROUD	1901550T901	Original	85.00	✓
7768	R/FAN SHROUD	38615R1AA02	Original	75.00	✓
7773	LWR RADIATOR HOSE	1950250T901	Original	25.00	?
7776	UPPER RADIATOR HOSE	1950150T901	Original	25.00	?
7787	EXPANSION TANK	19101R1AA00	Original	35.00	✓
7789	L/FAN MOTOR	19030R1AA03	Original	220.00	?
7790	R/FAN MOTOR	38616R1AA01	Original	190.00	?
7793	L/RADIATOR FAN	19020R1AA01	Original	50.00	?
7794	R/RADIATOR FAN	38611R1AA02	Original	45.00	?
8388	FILTER INLET HOSE	1725250T000	Original	60.00	✓
8390	FILTER INTAKE PIPE	1725150T000	Original	60.00	✓
8395	AIR FILTER ELEMENT	17136REJW00	Original	35.00	?
8401	AIR FILTER COVER	172105R1J01	Original	65.00	?
8402	AIR FILTER HOUSING	172015R1J01	Original	145.00	?
8665	R/ENGINE BRACKET	50620T7A003	Original	95.00	?
8780	ENGINE INSULATION	74111T7JH00	Original	85.00	?
8781	L/INN WHEELHOUSE	74165T7JH00	Original	45.00	?
	CVR				
8782	R/INN WHEELHOUSE	74115T7JH00	Original	75.00	?
	CVR				
8918	GEARBOX BRACKET	50850T7G913	Original	225.00	?
9081	REAR AXLE	42100T8NT01	Original	720.00	?
9201	L/R SHOCK ABSORBER	52611T8PT02	Original	225.00	?
9202	R/R SHOCK ABSORBER	52611T8PT02	Original	225.00	?
9231	L/R SUPPORT BEARING	52691TG1T00	Original	40.00	?
9232	R/R SUPPORT BEARING	52691TG1T00	Original	40.00	?
9251	L/R S/ABSORBER STOP	52670T5AJ02	Original	20.00	?
9252	R/R S/ABSORBER STOP	52670T5AJ02	Original	20.00	?
9551	L/R WHEEL	42700T8CT91	Original	300.00	✓
9552	R/R WHEEL	42700T8CT91	Original	300.00	✓
9565	L/R TYRE	215/60 R 16 .. H	Original	150.00	✓
9566	R/R TYRE	215/60 R 16 .. H	Original	150.00	309.00
9629	BATTERY	31500TS4T21	Original	180.00	✓
9631	BATTERY TRAY	31521T7AH00	Original	15.00	✓
9632	BATTERY PROTEC COVER	31531T5A003	Original	25.00	✓
9646	LOW TONE HORN	38100T7AJ01	Original	45.00	✓
1000	RH ROOF LINING AIRB	AIR BAG	Original	680.00	✓
1003	ALARM BUZZER	ALARM BUZZER	Original	50.00	?
1004	AIR FILTER DUCT	AIR FILTER	Original	50.00	?
f: OEM Parts				0.00	
n: Non-OEM Parts				31,814.00	
u: Used parts					
Savings					
Subtotal					
Total				31,814.00	

Extras

Code	Description	Price SGD
1005	FRONT BUMPER SENSOR	350.00* 7
1006	FRONT BUMPER CLIPS	30.00* —
1007	BONNET INSULATOR CLIPS	50.00* —
1008	FENNER INNER SHEILD CLIPS	30.00* —
Total Extras		460.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	31,814.00	31,814.00
Labour Time Base 10 WU/h		
Total 1,172.0 WU X 42.00 SGD/h	4,922.40	
Alignment		
Measuring Work	16.80	
Total of Labour		4,939.20
Total Of Extras		460.00
Paint Work Time Base 10 WU/h		
Labour Cost 246.0 WU X 42.00 SGD/h	1,033.20	
Material Cost	471.26	
Total Paint Including Material		1,504.46
Repair Cost Excludes GST		38,717.66
GST (+7.0%)		2,710.24
Repair Cost Included GST		41,427.90

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 03/02/2021 16:27 (SGT)
Date of Accident 10/01/2021 04:00 (SGT)
Exact Location of Accident Alexandra Rd, Singapore
Additional Location Information -
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLF7321D

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner HAMSTER CAR RENTAL PTE LTD
Company Reg No 2XXXXX175G
Email Address LUSIONT96@GMAIL.COM
Mobile Phone No (Phone) +65-90396265
Alternative Phone No (Home) +65-90396265

VEHICLE PARTICULARS

Manufacturer Honda
Model Vezel
Variant -
Exact purpose for which vehicle was being used at time of accident -
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private hire

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMHCSNA00004132000
Cover Note Number -

DRIVER

Name of Driver BEN SOH SHEE YONG
NRIC No SXXXX690C
Date Of Birth 10/07/1994
Occupation Outdoor

Date Of Driving Pass	20/12/2014
Driving experience	6 YEARS AND 1 MONTH
Gender	Male
Mobile Number	(Phone) +65-88289865
Alt. Phone Number	-
Email Address	BENSOH94@GMAIL.COM
Address	BLK 17A TELOK BLANGAH CRESCENT
Address complement	#08-274
Postcode	091017
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Hit by fallen tree / Other objects
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	1
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other material or property damaged?	No
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Traffic Police
Police Station Phone No	(Phone) +65-65470000
Alt. Police Station Phone No	(Fax) +65-65474900
Police Station Address	10 Ubi Avenue 3 Singapore 408865
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	BEN SOH SHEE YONG
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

175G

Vehicle Details

Vehicle No.:

SLF7321D

Vehicle to be Exported:

Yes

Intended Deregistration Date:

03 Feb 2021

Vehicle Make:

HONDA

Vehicle Model:

VEZEL 1.5X HYBRID CVT ABS D/AIRBAG 2WD

Primary Colour:

Black

Manufacturing Year:

2016

Engine No.:

LEB5910211

Chassis No.:

RU31210200

Maximum Power Output:

112.0 kW (150 bhp)

Open Market Value:

\$28,222.00

Original Registration Date:

07 Sep 2016

First Registration Date:

07 Sep 2016

Transfer Count:

2

Actual ARF Paid:

\$5,000.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

06 Sep 2026

PARF Rebate Amount:

\$3,750.00

Intended COE Rebate Details

COE Expiry Date:

06 Sep 2026

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$49,156.00

COE Rebate Amount:

\$27,486.00

Total Rebate Amount:

\$31,236.00

The information contained herein is correct as at 03 Feb 2021

OK