

ASS. REC. BY:

TUM

REF:

CS/CT121003044/Btf3

Dease

ASSIGNMENT

From:

Date: 10/3/2021

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: GBG 3504H

at Workshop m/s Deam Autopro

of 160 Sinking Dr # 01-14

Insured:

Policy No. DMCVSNA00072432001

Claims No. SNM210201259/C02/LWCCT

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

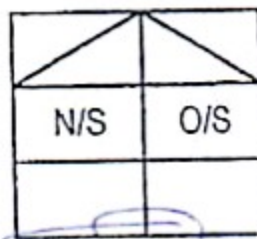

Bal. or Market Value: 53,000/-

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 6 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS WP

Vehicle: IN / OUT

Date: Person Contacted:

Veh No:

GBG 3504H

Yr Regn: 21/7/2017

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Nissan NV350

c.c. 2488

Colour:

White

A/C: Insured / Std / NI / NA

Sp. Reading:

168178

T/Radio: Insured / Std / NI / NA

Eng/No:

JD25419971A

C/No:

JN1MC2E2620008283

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195/80/15 Dunlop

R: 195/15 Teurader

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Dunlop, frt, Teurader, rear

Front

Rear

R/Bal. 5 mm

R/Bal. 5 mm

L/Bal. 5 mm

L/Bal. 5 mm

D.O.A. 5/3/2021

D.O.I. 10/3/2021

Survey held at

Deam Autopro

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Range 6,000/- - 7,000/-

Recommended COR is \$6,300/- ✓
(Red: 16,140. 47; 71%)

MV 53,000/-

PV 25,575/-

NV 27,425/-

TUM
10/3/2021

Date/Time, File Pass to?



Preli. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair: 6

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS SI

Photos

Others

TOTAL

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Week end (\$

Rep. Format:

TP

Lump Sum / L.B. / C

6300/-

SS0221360002 / S & H Motor Pte Ltd
ENTRY DATE & TIME: 06/03/2021 13:26 (SGT)
SUBMITTED BY: Wong Kee Nyuk
VERSION: 1 (06/03/2021 13:26 (SGT))

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	06/03/2021 13:26 (SGT)
Date of Accident	05/03/2021 09:20 (SGT)
Exact Location of Accident	Toh Guan Rd E, Singapore
Additional Location Information	along Toh Guan Road East
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBG3504H
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Hew Transportation Pte Ltd
Company Reg No	AXXXXXXX167W
Email Address	sales@hewtransportation.com
Mobile Phone No	(Phone) +65-81380635
Alternative Phone No	(Home) +65-81380635

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv350
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Commercial vehicle

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMCVSNW00009252102
Cover Note Number	-

DRIVER

Name of Driver	Malik Shamas Aslam
NRIC No	SXXXX078E

Date Of Driving Pass	22/03/2013
Driving experience	8 YEARS
Gender	Male
Mobile Number	(Phone) +65-81380635
Alt. Phone Number	-
Email Address	sales@hewtransportation.com
Address	22 Sin Ming Lane #06-88 Midview City
Address complement	-
Postcode	573969
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Jurong West Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18002689999
Alt. Police Station Phone No	(Fax) +65-62672438
Police Station Address	700 Corporation Road Singapore 649818
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

refer attached police report.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBE385P
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	

SJE : _____ Vehicle Nos : **GBG 3504 H**
 Date of Survey : _____ Model : **Nissan NV350**
 Date of ReSurvey: _____ After-Paint: _____ Year : _____
 Contacts : _____ Chassis No : _____

*** AGREED Cost Of Repair and Repair Day/s with SJE ***

Amount: _____ Working Day: _____

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$	
1	Tailgate	1	\$ 2,195.00	\$ 2,195.00 1399.20	DDV
2	Tailgate logo	1	\$ 98.50	\$ 98.50 75.00	NEC
3	Tailgate emblem 'NV350'	1	\$ 78.00	\$ 78.00 ✓ 78.00	✓
4	Tailgate emblem 'URVAN'	1	\$ 75.68	\$ 75.68 ✓ 75.68	✓
5	Tailgate outer chrome garnish	1	\$ 449.20	\$ 449.20 ✓ 449.20	BRV
6	Tailgate outer handle	1	\$ 277.10	\$ 277.10	NSX
7	Tailgate hinge	2	\$ 125.00	\$ 250.00	NDX
8	Tailgate inner lock	1	\$ 289.90	\$ 289.90 198.60	JMV
9	Tailgate lock actuator	1	\$ 381.45	\$ 381.45	NDX
10	Tailgate lock striker	1	\$ 68.10	\$ 68.10	NDX
11	Tailgate hydraulic damper	2	\$ 221.10	\$ 442.20	NDX
12	Tailgate weatherstrip	1	\$ 282.90	\$ 282.90 137.50	TN ✓
13	Tailgate inner trim board	1	\$ 204.00	\$ 204.00	NSX
14	Tailgate windscreen	1	\$ 1,309.00	\$ 1,309.00 ✓ 1,309.00	BRV
15	Tailgate windscreen moulding	1	\$ 182.25	\$ 182.25	NSX
16	Tailgate windscreen wiper arm	1	\$ 186.30	\$ 186.30	NDX
17	Tailgate windscreen wiper motor	1	\$ 428.60	\$ 428.60	NDX
18	Tailgate windscreen wiper garnish	1	\$ 123.50	\$ 123.50	NDX
19	Rear number plate lamp	2	\$ 58.00	\$ 116.00	NDX
20	Rear wing mirror	1	\$ 332.00	\$ 332.00	NDX
21	Rear bumper	1	\$ 641.00 ✓ 641.00	\$ 641.00 ✓ 641.00	DDV
22	Rear bumper side retainer	2	\$ 122.10	\$ 244.20	NNX
23	Rear bumper lower bracket	4	\$ 84.25	\$ 337.00	NSX
24	Rear bumper step panel	1	\$ 398.10	\$ 398.10 346.00	DDV
25	Rear end panel centre	1	\$ 581.45	\$ 581.45 ✓ 581.45	DDV
26	Rear end panel side	2	\$ 287.72	\$ 575.44	NDX
27	Rear end panel top garnish	1	\$ 262.80	\$ 262.80	NDX
28	Spare tyre bracket	1	\$ 269.30	\$ 269.30	NDX
29	Rear floor panel	1	\$ 3,204.00	\$ 3,204.00	NDX
30	Taillamp	2	\$ 481.00 224.80	\$ 962.00 224.80	BRV
				Parts Sub Total :	\$ 15,244.97
				Discount	\$ 1,524.50
				PARTS TOTAL :	\$ 13,720.47

5515.43

551.54

@ 10%

4963.89

10%

SJE : _____
 Date of Survey : _____
 Date of ReSurvey: _____
 Contacts : _____

Vehicle Nos : **GBG 3504 H**
 Model : **Nissan NV350**
 Year : _____
 Chassis No : _____

Supplementary Report

* AGREED Cost Of Repair and Repair Day/s with SJE *

Amount: _____

Working Day: _____

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$
1	Tailgate third brake light	1	\$ 184.00	\$ 184.00
Parts Sub Total :				\$ 184.00
10% Discount				\$ 18.40
PARTS TOTAL :				\$ 165.60

CRA ✓

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$
1	Tailgate third brake light seal	1	\$ 50.00	\$ 50.00
SPECIAL NETT TOTAL :				\$ 50.00

NEC

Resurvey
 TCU in line
 11/3/2021
 1100hrs
 Min

PARTS TOTAL : \$ 165.60
 SPECIAL NETT TOTAL : \$ 30.00 50.00
 GRAND TOTAL : \$ 195.60 215.60

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$	
1	Sundries	1	\$ 80.00	\$ 80.00	NNX
2	Tailgate sealant	1	\$ 100.00	\$ 60.00 100.00	NECV
3	Tailgate outer chrome garnish clips	1	\$ 50.00	\$ 30.00 50.00	NECV
4	Tailgate inner trim board clips	1	\$ 50.00	\$ 30.00 50.00	NECV
5	Tailgate windscreen inner seal	1	\$ 120.00	\$ 40.00 120.00	NECV
6	Tailgate windscreen sealant	1	\$ 100.00	\$ 60.00 100.00	NECV
7	Tailgate windscreen primer and cleaner	1	\$ 60.00	\$ -60.00	NNX
8	Tailgate sticker '70 km/h'	1	\$ 30.00	\$ 20.00 30.00	
9	Tailgate sticker '8 PAX'	1	\$ 30.00	\$ 20.00 30.00	NECV
10	Tailgate sticker	1	\$ 380.00	\$ 180.00 380.00	
11	Rear bumper clips	1	\$ 50.00	\$ 30.00 50.00	NECV
12	Rear bumper step panel sealant	1	\$ 100.00	\$ 100.00	NNX
13	Reverse sensor	2	\$ 250.00	\$ 200.00 500.00	SCV
14	Rear end panel centre sealant	1	\$ 100.00	\$ 40.00 100.00	NECV
15	Rear end panel side sealant	2	\$ 100.00	\$ -200.00	NNX
16	Rear floor panel sealant	1	\$ 100.00	\$ 100.00	NNX
17	Rear floor bed top board	1	\$ 1,600.00	\$ 1,600.00	NNX
18	Taillamp seal	2	\$ 60.00	\$ 30.00 120.00	NECV
19	Taillamp clips	2	\$ 50.00	\$ 20.00 100.00	NECV
20	Rear number plate	1	\$ 80.00	\$ 40.00 80.00	DDV
SPECIAL NETT TOTAL :				\$ 800.00 3,950.00	

Nos.	LABOUR	S\$	
1	R&R tailgate component	\$ 80.00 200.00	/
2	R&R reverse sensor	\$ 60.00 100.00	/
3	R&R rear windscreen	\$ 120.00 250.00	/
4	R&R rear floor bed top board	\$ 300.00	XNN
5	Check wiring	\$ 30.00 100.00	/
6	Conduct water leak test	\$ 120.00	XNN
7	Upholstery	\$ 300.00	NNX
8	Panel beating	\$ 800.00 1,600.00	/
9	Rust proofing	\$ 60.00 200.00	/
10	Spray painting	\$ 800.00 1,600.00	/
LABOUR TOTAL :		\$ 1,950.00 4,770.00	

survey Resurvey
 10/3/2021 11/3/2021
 10 38hrs 1045 hrs
 Lin TGLin TGLin Me

PARTS TOTAL : \$ 13,720.47
 SPECIAL NETT TOTAL : \$ 3,950.00
 LABOUR TOTAL : \$ 4,770.00
 GRAND TOTAL : \$ 22,440.47

Lump sum repair
 Repair days 6

PARTS 5129.49
 SN 830.00
 LABOUR 1950.00
 7909.49
 @ 20% 1581.90
 6327.59

L/S 6,300/2

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: