

ASS. REC. BY: SteveREF: CS/CT121003861/F3

Ev

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

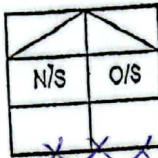
Insured: GBL 8383EPolicy No. DMCVSNW00023252100Claims No. SNM21D201585C02/IRENE

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bel. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBJ4508A Yr Regn: 22/4/19
Type: M.Car / M.Cycle / Bus / ☒ Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Nissan NT350 c.c. 2488Colour: Grey A/C: Insured / Std / NI / NASp. Reading: 77704 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JNIMC2E2620031031

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195R15CR: 1BS / ☒ DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front ☐ mm ☐ mmR/Bal. 5 mmL/Bal. 5 mmD.O.A. 9/3/21 D.O.I. 26/1/22Survey held at Efficient MotorsDes. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

MY-64 K30/3/22 Steve informed LS \$3700 (red 5543.67, 59%)

Date/Time, File Pass to?

☐ : Prell. Report

1)

Date/Time, File Return to?

☐ : Final Report2) 30/3/22-typistReport Format: MerimenLump Sum I+B.H. (\$) 3700Days Of Repair: 4Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S + RS. \$

Photos

Others

TOTAL

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

EFFICIENT MOTOR & ENGINEERING WORKS PTE LTD

56 LOYANG WAY # 06-07 ENTERPRISE BUILDING SINGAPORE 508775

VEHICLE NO : GBJ4508A
MAKE & MODEL : NV350 PANEL VAN 2.5 SMT 5DR
CHASSIS NO : JN1MC2E26Z0031031

DATE : 24 MAR 2021
CLAIM TYPE : TP CLAIM
D.O.A : 09 MAR 2021

TO : CHINA TAIPING

ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS

S/No.	QTY	DESCRIPTION	CONDITION / REMARKS	UNIT LIST PRICE	TOTAL LIST PRICE
1	1	REAR BUMPER	(Pth)	\$ 667.20	\$ 667.20
2	6	REAR BUMPER SIDE CLIP LH/RH	X	\$ 12.10	\$ 72.60
3	1	REAR BUMPER STEP PANEL	X	\$ 252.30	\$ 252.30
4	1	REAR END PANEL OUTER	X R	\$ 360.90	\$ 360.90
5	1	TAILGATE		\$ 2,280.00	\$ 2,280.00
6	1	TAILGATE LOCK LOWER	X	\$ 528.60	\$ 528.60
7	1	TAILGATE LOCK UPPER		\$ 178.80	\$ 178.80
8	1	TAILGATE LOCK COVER		\$ 84.00	\$ 84.00
9	1	TAILGATE LOCK ACTUATOR	X	\$ 408.40	\$ 408.40
10	1	TAILGATE WEATHERSTRIP	TN	\$ 228.00	\$ 228.00
11	1	TAILGATE CHROME GARNISH		\$ 535.70	\$ 535.70
12	2	TAILGATE STAY LH/RH	X	\$ 215.90	\$ 431.80
13	1	TAILGATE LOGO	MC	\$ 115.20	\$ 115.20
14	1	TAILGATE EMBLEM "NV350 URBAN"	MC	\$ 156.00	\$ 156.00
15	2	TAIL LAMP LH/RH	X	\$ 288.40	\$ 576.80
				\$ 6,311.50	\$ 6,876.30

TOTAL PRICE \$ 6,876.30
LESS 10% \$ 687.63
SUB TOTAL PRICE \$ 6,188.67

S/No.	QTY	DESCRIPTION	CONDITION / REMARKS	UNIT S/NETT	TOTAL S/NETT
1	1	REAR BUMPER CLIPS	MC	\$ 50.00	\$ 50.00
2	1	70 KM/H STICKER	MC	\$ 20.00	\$ 20.00
3	1	REVERSE SENSOR	Shld	\$ 200.00	\$ 200.00
4	1	REAR NO. PLATE	X	\$ 45.00	\$ 45.00
5	1	REAR WINDSCREEN SEALANT	MC	\$ 80.00	\$ 80.00
6	1	PAN PACIFIC METAL PLATE	MC	\$ 80.00	\$ 80.00
7	1	REAR PANEL CHECKER PLATE	X	\$ 80.00	\$ 80.00

TOTAL S/NETT \$ 555.00

Labour Charges

1	To cut/weld panels, panel beat & align tailgate, remove & replace damaged parts.	\$ 1,000.00	400
2	To apply anti rust coat and Tuff Kote repaired areas.	\$ 50.00	30
3	To check and rectify lighting & wiring.	\$ 50.00	30
4	To remove & replace reverse sensor.	\$ 100.00	30
5	To Spray painting for Rear Portions & affected areas.	\$ 1,000.00	400
6	To remove & transfer tailgate components.	\$ 150.00	50
7	To remove and replace rear windscreen glass.	\$ 150.00	100

TOTAL LABOUR

\$ 2,500.00

Total Cost of Repairs

\$ 9,243.67

(Total parts + Total S/Nett + Total Labour Cost)

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before after spray painting
- To display damage I part/d and resurvey
- Parts prices are subject to market price
- Third party survey is on a "Without prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be surveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company
Owner ID: 635R

Vehicle Details

Vehicle No.: GBJ4508A
Vehicle to be Exported: No
Intended Deregistration Date: 24 Mar 2021
Vehicle Make: NISSAN
Vehicle Model: NV350 PANEL VAN 2.5 5MT 5DR
Primary Colour: Grey
Manufacturing Year: 2019
Engine No.: YD25046870B
Chassis No.: JN1MC2E26Z0031031
Maximum Power Output: -
Open Market Value: \$25,557.00
Original Registration Date: 22 Apr 2019
First Registration Date: 22 Apr 2019
Transfer Count: 0
Actual ARF Paid: \$1,278.00

Intended PARF Rebate Details

PARF Eligibility: No
PARF Eligibility Expiry Date: -
PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 21 Apr 2029
COE Category: C - Goods Vehicle & Bus
COE Period(Years): 10
QP Paid: \$27,010.00
COE Rebate Amount: \$21,816.00
Total Rebate Amount: \$21,816.00

The information contained herein is correct as at 24 Mar 2021

OK