

ASS. REC. BY:

REF: CC3/AIG21005953/Avc

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. 7210029039

Claims No. 9516187402SG

Sum Insured: _____ Excess: 300

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SLA1899U Yr Regn: 2021 March.

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A3 C.C. 999

Colour: Red. A/C: Insured / Std / Nil / NA

Sp. Reading: 1871 T/Radio: Insured / Std / Nil / NA

Eng/No: _____

C/No: WAUZZZ8V4LA007272

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55 R16.

R: 205/55 R16.

☒ BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 06 mm

L/Bal. 06 mm

D.O.A. 18/05/21.

Survey held at Premium (Berio).

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Front N/S, O/S.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

00 AIG.

MV: 130K
PV: 61.9K.
Nett: 68.1K.

Now Car Price ≈ 148K.

25/5/21 Submit uneconomical Total Loss

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2) 25/5/21-Typist

Report Format: _____

Lump Sum / L.B.I. (\$) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Insp (\$)☐ Weekend (\$)

Survey Fee: _____

Transportation: _____

8+P.S. \$

Photo: _____

Other: _____

Total: _____

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	17/05/2021 17:55 (SGT)
Date of Accident	15/05/2021 15:34 (SGT)
Exact Location of Accident	Sembawang Road, Singapore
Additional Location Information	NEXT TO MASJID AHMAD IBRAHIM MOSQUE TOWARDS THOMSON ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLA1899U
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	CHIA ZHIAO, ABEL
NRIC No	SXXXX451B
Email Address	ABELCHIAZH@GMAIL.COM
Mobile Phone No	(Phone) +65-86114475
Alternative Phone No	+65-91139192

VEHICLE PARTICULARS

Manufacturer	Audi
Model	A3
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	999

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	7210029039
Cover Note Number	-

DRIVER

Name of Driver	CHIA ZHIAO, ABEL
----------------	------------------

NRIC No	SXXXX451B
Date Of Birth	07/09/1991
Occupation	Indoor
Date Of Driving Pass	28/12/2011
Driving experience	9 YEARS AND 5 MONTHS
Gender	Male
Mobile Number	(Phone) +65-86114475
Alt. Phone Number	+65-91139192
Email Address	ABELCHIAZH@GMAIL.COM
Address	308 ANG MO KIO AVE 1
Address complement	#16-411
Postcode	561308
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	Yes
Was any other material or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

I WAS DRIVING STRAIGHT ALONG SEMBAWANG ROAD TOWARDS THOMSON ROAD ON THE MOST RIGHT LANE. VEHICLE SLN7136E CAME OUT FROM SPRINGSIDE ROAD (MINOR ROAD) AND DID NOT KEEP IN THE PROPER LANE. SHE THEN CUT INTO MY LANE WHEN I WAS JUST BEHIND HER.

MY VEHICLE THEN HIT THE CURB ON THE REAR RIGHT RIM AND THE WHOLE CAR SWERVED TO THE LEFT SIDE OF THE ROAD AND HIT THE LEFT CURB ON THE ROAD. VEHICLE THEN STOPPED.

FRONT PART OF THE CAR WAS SMASHED AND REAR RIGHT RIM WAS DAMAGED AS A RESULT.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLN7136E
Vehicle Manufacturer	Honda

Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	CHI ZHIHAO, ABEL
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SLA1899U
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	Yes

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

 17/5/21
12:58 PM


Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time



Witnessed by Reporting Centre Personnel Tony Foong

Sketch Plan

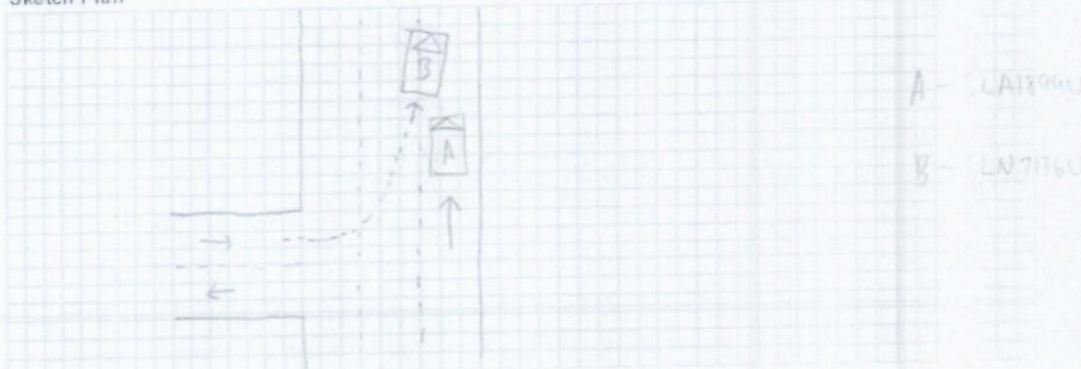

Describe Circumstances of the Accident

I was driving straight along Sembawang road towards Thomson road on the most right lane.

Vehicle SLN 7136 E came out from spring side road (near road) and did not keep in the proper lane. She then cut into my lane when I was just behind her.

My vehicle then hit the curb on the rear right corner & the whole car swerved to the left side of the road & hit the left curb on the road. Vehicle then stopped.

Front part of the car was smashed & rear right corner damaged as a result.

Declaration

We declare the foregoing particulars are true in every respect.

 17/5/21
Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0422/2021/TF
DATE : 18-May-21
WIP : 27777

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 18/5/21

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR CHIA ZHIHAO, ABEL
ADDRESS : BLK 308A AMK AVE 1
#16-411
SINGAPORE 561308
TELEPHONE : HP +65 86114475
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 7210029039
VEHICLE NO : **SLA 1899 U**
MODEL CODE : A3 SEDAN 1.0 TFSI
MODEL YEAR : 24/3/2021
ENGINE NO : CHZ C34752
CHASSIS NO : WAUZZZ8V4LA007272
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 15-May-21
PLACE OF ACCIDENT : ALONG SEMBAWANG ROAD

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLA 1899 U

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO TOW AND RECOVER VEHICLE FROM SCENE OF ACCIDENT.	S/N	AIG	X.
2	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR O-LINER.	S/N \$	800.00	✓
3	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$	360.00	✓
4	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	S/N \$	1 200.00	✓
5	TO REMOVE CENTER CONSOLE, INSTRUMENT PANELS AND CLUSTERS. RENEW DASHBOARD, BOTH FRONTAL AIRBAGS, SLIP RING. TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING, BOTH CURTAIN AIR BAGS AND KNEE AIRBAG.	S/N \$	3,600.00	✓
6	TO REMOVE AND REINSTALL ENGINE ASSY WITH GEARBOX ASSY TO FACILLITATE CAR O-LINER REPAIRS.	S/N \$	2,800.00	✓
SUB-TOTAL LABOUR CHARGES		:	\$ 7,760.00	

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLA 1899 U

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO REMOVE AND REINSTALL FRONT SUSPENSION ASSY WITH SUBFRAME TO FACILLITATE CAR O-LINER REPAIRS. INSPECT FOR DAMAGES AND RENEW IF NECESSARY.	S/N \$	2,400.00	✓
8	TO PLACE VEHICLE ON CAR O-LINER.	S/N \$	1,800.00	✓
9	TO REMOVE AND TRANSFER LHS FRONT DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N \$	350.00 280.	
10	TO RENEW FRONT WINDSCREEN.	S/N \$	480.00	✓
11	TO INSTALL SOLAR FILM FOR FRONT WINDSCREEN.	S/N \$	400.00	✓
12	TO RENEW FRONT WINDSCREEN SENSOR FOIL. TO RESET SYSTEM.	S/N \$	300.00	?
13	TO CARRY OUT WATER SEEPAGE TEST FOR FRONT WINDSCREEN.	S/N \$	200.00 150.	
SUB-TOTAL LABOUR CHARGES		:	\$ 5,930.00	

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLA 1899 U

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
14	TO RENEW GEARBOX MECHATRONIC AND OTHER ENGINE COMPONENTS. TO CARRY OUT CALIBRATION.	S/N \$	980.00	7,
15	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$	700.00	250
16	TO DISMANTLE FRONT BUMPER, BONNET, BOTH FRONT FENDERS, BOTH HEADLIGHTS AND LHS FRONT DOOR. CUT OUT AND REWELD LHS FENDER SUPPORT AND CLOSING ELEMENT AND LHS A-PILLAR WITH LHS SILL PANEL. ALIGN BOTH FRONT CHASSIS FRAMES TO SPECIFICATION OF ORIGIN. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE FRONT CRASH MANAGEMENT.	\$	11,200.00	7500.
17	✓ TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS, BONNET, HINGES, LHS A-PILLAR, LHS SILL PANEL, LHS FRONT FENDER TOP SUPPORT AND LHS FRONT DOOR. TO CARRY OUT JOINT SEALANT WORK AND STONE CHIP TREATMENT.	\$	7,000.00	4360. 7 x 550 = 3850. Fender Top Support : 350. Hinge x 2 = 80 x 2 = 160. 4360.
18	TO RENEW BOTH FRONT RIM, RHS REAR RIM. TO RENEW LHS FRONT TYRE. TO CARRY OUT PRE/ POST WHEEL ALIGNMENT CHECK.	S/N \$	600.00	✓
19	TO REAPPLY PAINT COATING ON AFFECTED AREA.	S/N	TBC	?
20	TO CARRY OUT PRE-REPAIR DIAGNOSTIC CHECK AND POST-REPAIR DIAGNOSTIC CHECK.	S/N \$	384.00	✓
TOTAL LABOUR CHARGES		:	\$ 34,554.00	

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted.</i>	1	\$ 1,987.00	✓
2	FRONT BUMPER FIXING PARTS <i>New</i>	1	\$ 187.00	✓
3	FRONT BUMPER GUIDE SECTION - LH / RH <i>LH Damaged</i>	2	\$ 78.00	39.
4	FRONT BUMPER LOWER CENTER GRILLE <i>Cracked</i>	1	\$ 160.00	✓
5	FRONT BUMPER LOWER CLOSING ELEMENT <i>Cracked</i>	1	\$ 536.00	✓
6	FRONT BUMPER CLOSING ELEMENT - LH <i>Missing</i>	1	\$ 297.00	✓
7	FRONT BUMPER COVER TRIM - LH <i>Missing</i>	1	\$ 163.00	✓
8	FRONT WHEEL HOUSING LINER ADAPTER - LH <i>Missing</i>	1	\$ 38.00	✓
9	RADIATOR GRILLE <i>Cracked.</i>	1	\$ 1,406.00	✓
10	RADIATOR GRILLE CLOSING ELEMENT <i>?</i>	1	\$ 191.00	✓
11	FRONT BUMPER AIR GUIDE GRILLE - LH <i>Missing</i>	1	\$ 188.00	✓
12	FRONT BUMPER FOAM FILLER PIECE <i>Cracked</i>	1	\$ 189.00	✓
13	FRONT BUMPER REINFORCEMENT <i>Dented</i>	1	\$ 795.00	✓
14	FRONT BUMPER REINFORCEMENT COVER <i>?</i>	1	\$ 122.00	✓
15	HORN - LH <i>Missing</i>	1	\$ 200.00	✓
16	A/C STICKER <i>3m</i>	1	\$ 8.00	✓
17	CAUTION STICKER <i>3m</i>	1	\$ 14.00	✓
18	FRONT WHEEL HOUSING LINER - LH <i>torn</i>	1	\$ 169.00	✓
19	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS <i>new</i>	1	\$ 89.00	✓
20	FRONT BONNET <i>Distorted</i>	1	\$ 3,134.00	✓
SUB TOTAL SPARE PARTS			\$ 9,951.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT BONNET ATTACHMENT PARTS <i>Not in</i>	1	\$ 165.00	<i>x.</i>
22	FRONT BONNET HINGE - LH / RH <i>Best.</i>	2	\$ 124.00	<i>✓</i>
23	FRONT BONNET ABSORBER <i>Not in</i>	1	\$ 104.00	<i>x.</i>
24	FRONT BONNET CATCH HOOK TOP <i>Best</i>	1	\$ 90.00	<i>✓</i>
25	FRONT BONNET STRIKER - LH / RH <i>Not in Best</i>	2	\$ 220.00	<i>Not in ✓</i>
26	FRONT BONNET EDGE PROTECTION <i>Damaged</i>	1	\$ 28.00	<i>✓</i>
27	FRONT FENDER TOP COVER - LH <i>Not in</i>	1	\$ 41.00	<i>✓</i>
28	FRONT BONNET CATCH HOOK BOTTOM <i>Not in</i>	1	\$ 63.00	<i>x.</i>
29	FRONT BONNET LOCK <i>Not in Damaged</i>	2	\$ 427.00	<i>218.50.</i>
30	FRONT BONNET LOCK SWITCH CONNECTOR <i>?</i>	1	\$ 13.00	<i>?</i>
31	FRONT BONNET BOWDEN CABLE - CENTER <i>?</i>	1	\$ 58.00	<i>?</i>
32	FRONT BONNET BOWDEN CABLE COVER <i>?</i>	1	\$ 10.00	<i>?</i>
33	FRONT BONNET SOUND ABSORBER <i>Completed</i>	1	\$ 219.00	<i>✓</i>
34	FRONT PLENUM CHAMBER <i>Crushed</i>	1	\$ 179.00	<i>✓</i>
35	FRONT LOCK CARRIER <i>Crushed</i>	1	\$ 727.00	<i>✓</i>
36	A/C CONDENSER <i>?</i>	1	\$ 529.00	<i>?</i>
37	REFRIGERANT LINE - CONDENSER > CUT - OFF POINT <i>Not in</i>	1	\$ 619.00	<i>x</i>
38	REFRIGERANT LINE - COMPRESSOR > CONDENSER <i>Not in</i>	1	\$ 475.00	<i>x</i>
39	REFRIGERANT LINE - COMPRESSOR > CUT - OFF POINT <i>Not in</i>	1	\$ 518.00	<i>x</i>
40	A/C BRACKET <i>?</i>	1	\$ 19.00	<i>?</i>
SUB TOTAL SPARE PARTS		:	\$ 4,628.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	RADIATOR GRILLE <i>crushed</i>	1	\$ 951.00	✓
42	ADDITIONAL COOLER ?	1	\$ 859.00	?
43	RADIATOR BRACKET - UPPER ?	2	\$ 82.00	?
44	RADIATOR BUSH ?	2	\$ 19.00	?
45	COOLANT <i>New</i>	6	\$ 269.00	✓
46	RADIATOR FAN HOUSING <i>not in</i>	1	\$ 1,265.00	x
47	RADIATOR AIR GUIDE - LH / UPPER CENTRE <i>LH crushed</i>	2	\$ 37.00	18.50
48	AIR FILTER <i>new</i>	1	\$ 275.00	+
49	TOP AIR DUCT <i>new</i>	1	\$ 56.00	+
50	TOP AIR DUCT COVER <i>new</i>	1	\$ 29.00	+
51	TOP AIR DUCT AIR GUIDE <i>new</i>	1	\$ 20.00	+
52	WATER DRINAGE HOSE <i>new</i>	1	\$ 33.00	+
53	TOP AIR GUIDE <i>new</i>	1	\$ 66.00	+
54	INTAKE SEAL	1	\$ 14.00	+
55	INTAKE PIPE	1	\$ 139.00	+
56	INTAKE MANIFOLD	1	\$ 666.00	+
57	INTAKE MANIFOLD SEAL <i>new</i>	1	\$ 14.00	+
58	ACTIVATED CHARCOAL CONTAINER ?	1	\$ 439.00	?
59	FRONT FENDER - LH / RH <i>LH Drilled, RH Buckle</i>	\$	1,702.00	✓
60	FRONT FENDER RIVET <i>new</i>	10	\$ 33.00	✓
SUB TOTAL SPARE PARTS		:	\$ 6,968.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
61	FRONT FENDER ATTACHMENT PARTS	1	\$ 72.00	
62	FRONT FENDER TOP FRONT BRACKET - LH / RH <i>LH Distorted</i>	2	78.00 39	
63	FRONT FENDER TOP REAR BRACKET - LH / RH <i>- LH Distorted</i>	2	56.00 28	
64	FRONT FENDER BRACE - LH / RH <i>LH Distorted</i>	2	192.00 96	
65	FRONT FENDER CLOSING ELEMENT - LH / RH <i>LH Distorted</i>	2	66.00 33	
66	FRONT FENDER INSULATION - LH / RH ?	2	86.00 ?	
67	FRONT WHEEL HOUSING LINER SEAL - LH / RH ?	2	68.00 ?	
68	FRONT HEADLIGHT - LH / RH <i>LH smashed</i>	2	10,910.00 5455	
69	FRONT HEADLIGHT POWER MODULE - LH ?	1	758.00 ?	
70	FRONT HEADLIGHT HEAT SINK - LH ?	1	733.00 ?	
71	FRONT HEADLIGHT CONTROL UNIT - LH ?	1	557.00 ?	
72	FRONT HEADLIGHT HOSE - LH ?	1	40.00 ?	
73	FRONT HEADLIGHT LIFT CYLINDER - LH / RH <i>LH missing</i>	2	284.00 142	
74	FRONT HEADLIGHT LIFT CYLINDER HOSE ?	1	68.00 ?	
75	FRONT HEADLIGHT WATER PUMP <i>cracked</i>	1	155.00 ✓	
76	FRONT WINDSCREEN WATER PUMP <i>cracked</i>	1	125.00 ✓	
77	WASH WATER RESERVIOR <i>Distorted</i>	1	206.00 ✓	
78	WASH WATER RESERVIOR WATER FILTER <i>Missing</i>	1	21.00 ✓	
79	WASH WATER RESERVIOR TOP COVER <i>Not Nee</i>	1	21.00 X	
80	FRONT FENDER CLOSING ELEMENT - LH FRONT <i>Distorted</i>	1	72.00 ✓	
SUB TOTAL SPARE PARTS			\$ 14,568.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
81	SIDE MEMBER - LH <i>Missing Distal d</i>	1	\$ 408.00	✓
82	FRONT WHEEL HOISING - LH <i>Distal Distal d</i>	1	\$ 1,395.00	✓
83	A-PILLER INNER - LH ?	1	\$ 537.00	?
84	FUSE HOUSING COVER C.	1	\$ 83.00	✓
85	FUSE TOP COVER <i>Del d</i>	1	\$ 48.00	✓
86	FUSE HOUSING CLOSING ELEMENT ?	1	\$ 24.00	?
87	RELAY BOX ?	1	\$ 357.00	?
88	UNDER COBER NOISE INSULATION <i>Poru</i>	1	\$ 290.00	✓
89	FRONT WINDSCREEN <i>cracked</i>	1	\$ 1,072.00	✓
90	FRONT WINDSCREEN RAIN SENSOR FOIL <i>new</i>	1	\$ 137.00	✓
91	REAR VIEW MIRROR SPRING CLIP <i>new</i>	1	\$ 21.00	+
92	PRIMER <i>new</i>	1	\$ 20.00	✓
93	FRONT WATER DEFLECTOR STRIP - LH / RH <i>LH Missing</i>	2	\$ 186.00	93.
94	FRONT DOOR - LH <i>Ryis</i>	1	\$ 3,039.00	x.
95	FRONT DOOR OUTER SEAL - LH <i>new</i>	1	\$ 161.00	+
96	BONDING AGENT	1	\$ 49.00	+
97	CLEANING SOLUTION	1	\$ 68.00	+
98	APPLICATOR	1	\$ 8.00	+
99	FRONT DOOR CATCH - LH	1	\$ 105.00	+
100	FRONT DOOR WINDOW SLOT SEAL STRIP - LH <i>new</i>	1	\$ 309.00	+
SUB TOTAL SPARE PARTS			\$ 8,317.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
101	FRONT WINDOW GUIDE TRIM STRIP - LH <i>new</i>	1	\$ 257.00	<i>+</i>
102	SECTIONAL PART - LH <i>Buckled -</i>	1	\$ 4,118.00	<i>✓</i>
103	STEERING WHEEL AIRBAG	1	\$ 3,421.00	<i>✓</i>
104	FRONT PASSENGER AIRBAG UNIT	1	\$ 4,414.00	<i>✓</i>
105	HEAD AIRBAG UNIT - LH / RH	2	\$ 3,726.00	<i>✓</i>
106	KNEE AIRBAG UNIT	1	\$ 1,863.00	<i>✓</i>
107	AIRBAG CRASH SENSOR	3	\$ 1,167.00	<i>✓</i>
108	AIRBAG CONTROL UNIT	1	\$ 1,647.00	<i>✓</i>
109	STEERING WHEEL <i>lt</i>	1	\$ 2,374.00	<i>✓</i>
110	DASHBOARD <i>torn</i>	1	\$ 4,259.00	<i>✓</i>
111	DASHBOARD AIR CENT - CENTRE ?	1	\$ 151.00	<i>?</i>
112	DASHBOARD SPEAKER COVER ?	1	\$ 94.00	<i>?</i>
113	HEADLINER <i>crumpled.</i>	1	\$ 1,771.00	<i>✓</i>
114	FRONT SEATBELT TENSIONER - LH / RH <i>Activated</i>	2	\$ 2,206.00	<i>✓</i>
115	FRONT SEATBELT HEIGHT ADJUSTER - LH / RH <i>new</i>	2	\$ 383.00	<i>✓</i>
116	A-PILLAR TRIM - LH ?	1	\$ 161.00	<i>?</i>
117	A-PILLAR TRIM - LH RIGHT UPPER ?	1	\$ 161.00	<i>?</i>
118	B-PILLAR TRIM - UPPER LH / RH	2	\$ 434.00	<i>✓</i>
119	C-PILLAR TRIM - UPPER LH / RH <i>new</i>	2	\$ 302.00	<i>✓</i>
120	D-PILLAR TRIM - UPPER LH / RH	2	\$ 232.00	<i>+</i>
SUB TOTAL SPARE PARTS			\$ 33,141.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
121	FRONT HANDER - LH / RH ?	2	\$ 283.00	?
122	REAR HANDER - LH / RH ?	2	\$ 284.00	?
123	WHEEL RIM - FRONT LH / RH / REAR RH <i>ut</i>	3	\$ 3,498.00	✓
124	FRONT CONTROL ARM - LH / RH <i>LH Bent.</i>	2	\$ 746.00	373.
125	FRONT STABILIZER - LH ?	1	\$ 395.00	?
126	FRONT WHEEL BEARING HOUSING - LH / RH ?	2	\$ 1,158.00	?
127	FRONT WHEEL BEARING - LH / RH ?	2	\$ 956.00	?
128	FRONT GUIDE JOINT - LH / RH ?	2	\$ 248.00	?
129	FRONT COUPLING ROD - LH / RH ?	2	\$ 195.00	?
130	FRONT SHOCK ABSORBER - LH / RH ?	2	\$ 517.00	?
131	FRONT SHOCK ABSORBER COIL SPRING - LH ?	1	\$ 21.00	?
132	FRONT SHOCK ABSORBER DUST COVER - LH ?	1	\$ 40.00	?
133	FRONT SHOCK ABSORBER STRUT MOUNT ?	1	\$ 122.00	?
134	FRONT SHOCK ABSORBER STRUT BEARING ?	1	\$ 46.00	?
135	FRONT SHOCK ABSORBER RUBBER STOPPER ?	1	\$ 54.00	?
136	DRIVE SHAFT - LH / RH <i>LH Rd</i>	2	\$ 4,422.00	2211
137	STEERING RACK ?	1	\$ 4,964.00	?
138	STEERING BOX REPAIR SET ?	1	\$ 46.00	?
139	TRACK ROD ?	2	\$ 183.00	?
140	TIR ROD END - LH / RH ?	2	\$ 244.00	?
SUB TOTAL SPARE PARTS		:	\$ 18,422.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLA 1899 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
141	ASSEMBLY CARRIER ?	1	\$ 1,000.00 ?	
142	CARRIER RUBBER BUSHES ?	1	\$ 112.00 ?	
143	GEARBOX MOUNTING - LH ?	1	\$ 259.00 ?	
144	ASSEMBLY CARRIER BOLTS ?	6	\$ 51.00 ?	
145	GEARBOX MOUNTING CONSOLE - LH ?	1	\$ 189.00 ?	
146	GEARBOX MOUNTING SUPPORT - LH ?	1	\$ 23.00 ?	
147	LOWER ENGINE MOUNTING - CENTER ?	1	\$ 90.00 ?	
148	MECHATRONIC ?	1	\$ 3,977.00 ?	
149	GEARBOX ?	1	\$ 17,189.00 ?	
150	TRANSMISSION FLUID ?	1	\$ 62.00 ?	
151	FLOOR COVER - LH FRONT ?	1	\$ 12.00 ?	
152	UNDERBODY TRIM - LH <i>del d</i>	1	\$ 170.00 ✓	
153	FRONT NO. PLATE <i>me</i>	S/N	\$ 60.00 ✓	
154	FRONT WINDSCREEN SEALANT <i>me</i>	S/N	\$ 200.00 ✓	
155	ACRYLIC SEALANT ?	S/N	\$ 180.00 ✓	
156	GRAVITY WAX <i>me</i>	S/N	\$ 140.00 ✓	
157	STONE CHIP	S/N	\$ 180.00 ✓	
158	METAL FILLER POWDER <i>me</i>	S/N	\$ 280.00 ✓	
159	FRONT TYRE - LH <i>ut</i>	S/N	\$ 285.00 ✓	
160	SUNDRIES ?		\$ 600.00 ?	
TOTAL SPARE PARTS		:	\$ 121,054.00	
TOTAL LABOUR CHARGES		:	\$ 34,554.00	
GRAND TOTAL		:	\$ 155,608.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME : *Adrian Lim*
SURVEYED DATE : *18/05/21.*
AUTHORISED DATE :
EXCESS COST :
LIABILITY :
REMARKS : *Not Authorised, 30 Days*

PLEASE NOTE : THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle**

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	451B
Vehicle Details	
Vehicle No.:	SLA1899U
Vehicle to be Exported:	No
Intended Deregistration Date:	18 May 2021
Vehicle Make:	AUDI
Vehicle Model:	A3 SEDAN 1.0 TFSI S TRONIC (LED)
Primary Colour:	Red
Manufacturing Year:	2019
Engine No.:	CHZC34752
Chassis No.:	WAUZZZ8V4LA007272
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$22,086.00
Original Registration Date:	24 Mar 2021
First Registration Date:	24 Mar 2021
Transfer Count:	0
Actual ARF Paid:	\$22,921.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Mar 2031
PARF Rebate Amount:	\$17,190.00
Intended COE Rebate Details	
COE Expiry Date:	23 Mar 2031
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$44,589.00
COE Rebate Amount:	\$43,905.00
Total Rebate Amount:	\$61,095.00

The information contained herein is correct as at 18 May 2021

OK



audi a3

Available Year ▼

Vehicle Type ▼

Dealer Type ▼

☒ Past Models☐ Current Models

Home » New Cars » Past Cars » Audi Past Cars » Audi A3 Sedan

Recommended for you



The Audi A3 gets a plug-in hybrid drivetrain



Production of the Audi A3 Sportback begins



The new Audi A3 Saloon



Bald tyres are road hazards

» View More

Featured Merchants



Past Car

Models no longer being sold by local distributors.

Model unavailable since May 2021

Audi A3 Sedan

Overview

Pricing

Photos

Research

Reviews

Specs

Features

Similar

Accessories

Promo

Submit a Review

Report Error

Share



Distributor

Premium Automobiles

Hotline

68362223

Message us on Facebook

Built in

Hungary (launched 2014, facelifted Jan-2017)

Successor

Audi A3 Sedan Mild Hybrid (2021)

Pricelist

06-May Pricelist

Select Another Date ▼

Download Brochure

USER RATINGS:

(13 reviews)

» View All Available Audi Models

» View All Past Audi Models

Submodel

Last Recorded Price

Fuel Economy

Power

Transmission

Detailed Info

1.4 TFSI S tronic (A)

\$142,480 (Nov 2018)

20.4km/L

148bhp

7-speed (A) S tronic

Specs | Features

1.4 TFSI S-tronic Attraction (A)

\$137,800 (Dec 2016)

20km/L

125bhp

7-speed (A) S-tronic

Specs | Features

1.4 TFSI S-tronic Ambiente (A)

\$142,600 (Mar 2016)

20km/L

123bhp

7-speed (A) S-tronic

Specs | Features

1.0 TFSI S tronic (A)

\$151,460 (May 2021)

21.3km/L

114bhp

7-speed (A) S tronic

Specs | Features

Facelifted on Jan-2017

- Read facelift article

1.4 TFSI S-tronic Ambiente Plus (A)

\$159,750 (Dec 2016)






20km/L

125bhp

7-speed (A) S-tronic

Specs | Features

Photos & Reviews

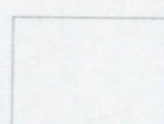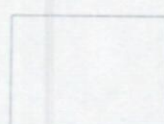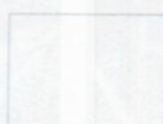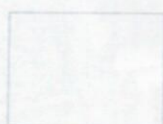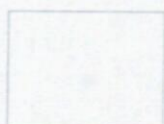

+ View All 14 Audi A3 Sedan Photos

Car Review - Audi A3 Sedan 1.4 TFSI S-tronic Ambiente (A)

The Audi A3 sedan looks smart inside and out, drives exceptionally well and is positively frugal, distinguishing itself from the rest in its segment.

The Audi A3 Sedan was facelifted on Mar 2017.

Read our review of the facelifted version.

The Good

- » It makes you look unique
- » It's well-mixed in practicality and style
- » You can door-handle it like a madman and feel rewarded

The Bad

- » Not as frugal as the Sportback



Compare

CONSUMER REVIEWS

Reasonably priced car!