

ASS. REC. BY:

REF:

TM/21070930/KVC

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: SDZ 4830K

Policy No. MU002212

Claims No. M2104910

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

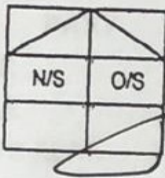

Bal. or Market Value: \$20,217.92

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 08 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No:

Site 5470H

Yr Regn:

12, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Perrett Longitude

c.c

1995

Colour

M-White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

626818

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC

280955

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: M / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Pirelli

Front

Rear

R/Bal.

J

mm

R/Bal.

7

mm

L/Bal.

J

mm

L/Bal.

7

mm

D.O.A.

22/10/21

D.O.I.

23/10/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rear o/s

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

7/10/21 to Rmmt

\$20,217.92

LTA \$15,558

Bal 4,659.92

28/10/21

Submit uneconomical Total Loss BV:\$20,217.92 (est) LTA:\$15,558.00 NV:\$4659.92

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 28/10/21-typist

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS - SI

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5470H**AAD2110-***Not Authorised
C/Lyn &*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

25 OCT 2021**SHC5470H**

VF1ABL15AUC280955

RENAULT

LATITUDE

22/10/2021

TOKIO

18/12/2014

PART	
1 BUMPER COVER REAR	
1 BUMPER LOWER REAR	
1 BUMPER BRACKET CTR REAR	
1 BUMPER BRACKET SIDE RH REAR	
1 BUMPER REFLECTOR RH	
1 BUMPER RETAINER RH REAR	
1 BUMPER BRACKET SIDE LH REAR	
1 BUMPER RETAINER LH REAR	
1 BUMPER BEAM REAR	
1 FENDER PANEL REAR RH	
1 WHEELARCH REAR RH	
1 OUTER PANEL REAR (End Panel)	
1 OUTER PANEL REAR (End Panel)TRIM	
1 BOOT REAR	
1 BOOT REFLECTOR LAMP LH	
1 BOOT BADGE 'RENAULT'	
1 BOOT BADGE	
1 BOOT HINGE LH	
1 BOOT HINGE RH	
1 BOOT STRUT LH	
1 BOOT STRUT RH	
1 BOOT LOCK	
1 BOOT LOCK CATCH	
1 BOOT FINISHER	
1 EXHAUST REAR	
1 EXHAUST CAP REAR	

LIST

\$	R	561.70	✓
\$	R	411.90	✓
\$	L	98.10	X
\$	D	82.10	✓
\$	CM	16.60	✓
\$	D	59.80	✓
\$	L	80.80	X
\$	L	54.20	X
\$	R	547.80	✓
\$	Bu	1,933.20	✓
\$	L	275.40	X
\$	R	745.80	✓
\$	DL	404.56	✓
\$	B71 Bu	1,677.20	✓
\$	L	277.70	X
\$	R	82.40	✓
\$	R	95.80	✓
\$	R	254.20	X
\$	R	254.20	X
\$	L	145.10	X
\$	L	145.10	X
\$	R	246.60	X
\$	R	41.70	X
\$	L	344.70	X
\$	R	5,263.60	3500sn
\$	DL	125.40	✓
\$		8,836.66	
10% \$		883.67	

Trans-cab Auto Services Pte Ltd

AAD2110-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5470H

\$	7,952.99
----	----------

Special Nett

1SET PARKING AID	\$	700.00	400.00
1SET REAR BUMPER CLIP	\$	66.00	—
1 FENDER CLIP	\$	60.00	X
1SET BUMPER BRACKET CTR CLIP	\$	33.00	X
1SET BUMPER BRACKET SIDE CLIP RH RR	\$	10.00	X
1SET BUMPER RETAINER RH CLIP RR	\$	20.00	X
1SET BUMPER BRACKET SIDE CLIP LH RR	\$	10.00	X
1SET BUMPER RETAINER CLIP LH RR	\$	20.00	X
1SET BUMPER LOWER REAR CLIP	\$	66.00	—
1 REAR BOOT STICKER 'Trans-cab'	\$	80.00	30.00
1 REAR BOOT STICKER '6555-3333'	\$	80.00	30.00
2 WINDSCREEN SEALANT	\$	150.00	40.00
1 WINDSCREEN MOULDING	\$	200.00	X
1 WINDSCREEN INNER SPONGE SEAL	\$	130.00	30.00
TOTAL	\$	1,625.00	
TOTAL PARTS	\$	9,577.99	

LABOUR

Putty And Spray Painting Of The Affected Portion.	\$	3,000.00	880.00
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	3,000.00	1200.00
To Rust-Proofing Of The Affected Areas.	\$	170.00	90.00
To reinstall rear bumper parking sensor.	\$	170.00	60.00
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	60.00
To repair and realign rear exhaust pipe.	\$	170.00	80.00

Trans-cab Auto Services Pte Ltd

AAD2110-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5470H

To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.

\$ *Renew* 170.00 X

To transfer of rear end panel fittings, attachment and perform water seepage test.

\$ 170.00 *100%*

To transfer of rear windscreen fittings and conduct water seepage test.

\$ 170.00 *120%*

To check steering geometry and computer wheel alignment

\$ *220* 220.00 X

To Check Electrical Lighting Concerned.

\$ 170.00 *20%***TOTAL \$ 7,580.00****Over All Total \$ 25,110.99****(LUMP SUM)****Repair Days***20 DAYS*
8 days

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

PQP Paid:

COE Rebate Amount:

Total Rebate Amount:

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle is exported, whichever is earlier.

The information contained herein is correct as at 22 Oct 2021

Company

878K

SHC5470H

Yes

22 Oct 2021

RENAULT

LATITUDE 2.0L DCI AUTO D/AB 4DR

Red

2014

M9R8839C002346

VF1ABL15AUC280955

127.0 kW (170 bhp)

\$19,998.00

18 Dec 2014

18 Dec 2014

0

\$12,498.00

Yes

17 Dec 2022

\$8,123.00

17 Dec 2022

A - Car up to 1600cc & 97kW (130bhp)

8

\$51,668.00

\$7,435.00

\$15,558.00

OK