

ASS. RECD. BY:

Steve

CC# / ASM / 9109953 / ea3

ASSIGNMENT

From:

Date:

Estimated Cost:

OP / TP / VS / PRS / OD / RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remarks: The veh had commenced its repair at the time of inspection.

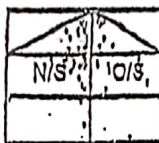

Est. or Market Value:

IDAC Accident Report

Consistent? : Yes or No

SIA / PR Sent

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Sum Sum:

%

3 Val.: Yes or No

QA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SKE668IM

Yr Regn:

23/3/12

Type: M/C / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Maker:

Toyota Prius

C.B.

Colour:

White

A/C: Insured / Std / NI / H

Sp. Reading

167913

T/Radio: Insured / Std / NI / H

Eng/No:

JTDK03B-3A91905481

On/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Locked / Burnt or

Brake: In order / Jammed / Locked / Burnt or

Mod: Nil / 3/Rim / STD A/Rim or

Tyre Size:

185/55R15

Ri

BS / DUN / EXN/VA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

4

mm

Rear

R/Bal.

4

mm

L/Bal.

4

mm

U/Bal.

4

mm

D.O.A.

23/10/21

D.O.I.

27/10/21

Survey held at

J-E-W Auto

Des. of Damages: Frt / Rear / O/S / M/S / VIC / Roof/ or

Rear R.H.

The U/S / Chassis frame / Body Structure affected due to collision

Date / Time

Action / Instruction

Site/Time, File, Possibility

☐

Prell. Report

☐

Final Report

Site/Time, File, Return to?

Days Of Repair:

Resurvey No. of Trips:

Survey Fee:

Transportation:

S + RS: \$

Private

Others

TOTAL

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Insp (\$

☐

Witness (\$

Signature:

Stamp/Date/Time

Estimation

Date

Vehicle SKE 6681 M

Make/Model TOYOTA PRIUS C

Chassis No. JTDKD3B3X01005481

No.	Description	Unit	Unit Price	Amount
	Parts Replacment			
1	TAILGATE X	1	\$ 998.20	\$ 998.20
2	TAILGATE WINDSCREEN MOULDING X	1	\$ 211.00	\$ 211.00
3	TAILGATE LOGO - TOYOTA / Nic	1	\$ 59.00	\$ 59.00
4	TAILGATE EMBLEM - TOYOTA / Nic	1	\$ 63.00	\$ 63.00
5	TAILGATE EMBLEM - PRIUS C / Nic	1	\$ 65.00	\$ 65.00
6	TAILGATE EMBLEM - HYBRID / Nic	1	\$ 71.00	\$ 71.00
7	TAILGATE INNER TRIM X	1	\$ 452.00	\$ 452.00
8	TAILGATE WEATHERSTRIP / TN	1	\$ 231.00	\$ 231.00
9	TAIL LAMP RH / RR	1	\$ 457.00	\$ 457.00
10	TAIL LAMP LOWER BRACKET RH / RR	1	\$ 211.00	\$ 211.00
11	TAIL LAMP PANEL RH / R	1	\$ 412.00	\$ 412.00
12	REAR BUMPER / DD	1	\$ 465.10	\$ 465.10
13	REAR BUMPER REVERSE SENSOR L+R / Shunt	2	\$ 267.00	\$ 534.00
14	REAR BUMPER RETAINER RH / RR	1	\$ 213.00	\$ 213.00
15	REAR BUMPER REINFORCEMENT BAR / DD	1	\$ 455.00	\$ 455.00
16	REAR FENDER RH / DD	1	\$ 875.00	\$ 875.00
17	REAR FENDER INNER TRIM RH X	1	\$ 411.00	\$ 411.00
18	REAR FENDER COWLING RH / TN	1	\$ 312.00	\$ 312.00
19	END PANEL / R	1	\$ 615.00	\$ 615.00
20	END PANEL TOP GARNISH X	1	\$ 342.00	\$ 342.00
21	SPAREWHEEL PANEL TOP BOARD X	1	\$ 459.00	\$ 459.00
22	EXHAUST PIPE X	1	\$ 899.00	\$ 899.00
23	EXHAUST MOUNTING X	1	\$ 72.00	\$ 72.00
24	EXHAUST HEAT SHIELD X	1	\$ 310.00	\$ 310.00
			Total	\$ 9,192.30
			Less 25%	\$ 2,298.08
			Total	\$ 6,894.23

	S/Nett Items			
1	TAILGATE INNER TRIM CLIPS X	1	100	\$ 100.00
2	TAIL LAMP CLIPS X	1	50	\$ 50.00
3	TAIL LAMP PANEL SEALANT X	1	80	\$ 80.00
4	REAR BUMPER CLIPS / Nic	1	100	\$ 100.00
5	REAR FENDER SEALANT / Nic	1	150	\$ 150.00
6	REAR FENDER INNER TRIM CLIPS X	1	100	\$ 100.00
7	REAR FENDER COWLING CLIPS X / Nic	1	100	\$ 100.00

8	END PANEL SEALANT ✓	1	150	\$	150.00
9	END PANEL TOP GARNISH CLIPS ✓	1	100	\$	100.00
			Total	\$	930.00

	LABOUR				
1	PANEL BEATING ON AFFECTED AREAS	1	1600	\$	1,600.00
2	SPRAY PAINT ON AFFECTED AREAS	1	1200	\$	1,200.00
3	TO RNR REAR WINDSCREEN	1	300	\$	X 300.00
4	TO RNR REAR EXHAUST	1	250	\$	X 250.00
5	TO CHECK WIRING AND TAIL LAMP FUNCTION	1	150	\$	30 150.00
6	TO RNR REAR INNER TRIM AND UPHOISTERY	1	400	\$	60 400.00
7	TO CHECK WATER LEAK	1	150	\$	30 150.00
8	TO PERFORM DIAGNOSTIC AND CLEAR FAULTS	1	600	\$	X 600.00
9	TO RNR REAR TAILGATE MECHANISM	1	300	\$	X 300.00
10	TO RNR REAR REVERSE SENSOR AND CHECK FUNCTION	1	150	\$	30 150.00
11	TO PERFORM RUST PROOFING	1	200	\$	30 200.00
			Total Labour	\$	5,300.00
			Parts Replacement Amount	\$	7,824.23
			Total Amount	\$	13,124.23

Steve (LKK)
27/10/21, 11:00am

WRL RL
L/S
My AL RJ
6 djs

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts provided to confirmation
- Third party on "Without Prejudice" basis
- No claim
- Supplier liability is subject to final approval from insurance company

Acknowledged by Repairer

Signature:

Date: