


ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 (OD) TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: SJX 9914K
 at Workshop m/s: Car City
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: ?
 (Client's Record)
 Make of Veh: _____

Veh No: SJX 9914K Yr Regn: 28/6/10
 Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or CAI
 Make: BMW 523i cc 2487
 Colour: Black A/C: Insured / Std / NI / NA
 Sp Reading: 82411 T/Radio: Insured / Std / NI / NA
 Eng/No: _____

(Policy Condition)
 Remark: The veh had commenced its
 repair at the time of inspection.



Bal. or Market Value: 30k.
 IDAC Accident Rport: Consistent? : Yes or No
 GIA / PR Seen: Consistent? : Yes or No
 Est. Repairs: 7 days Res: Yes or No
 Lum Sum: _____ % 3 Val: Yes or No

C/No: WBAFP32030C543925
 Gen Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 225/55R17
 R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or
 Front 6 Rear 6
 R/Bal. _____ mm R/Bal. _____ mm
 L/Bal. 6 mm L/Bal. 6 mm
 D.O.A. 12/1/12 D.O.I. 19/1/12
 Survey held at _____

CA REV / REP. / 24 HRS 132J
 Date: _____ Person Contacted: LIA 12/03
 Vehicle: IN / OUT

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
LP.
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction
rep fixed
car used 27-6-2015 Be/3yr. 7ml.
not 517897

Date/Time. File Pass to? : Preli. Report
 : Final Report

Days Of Repair:
 Resurvey No. of Trip:

Survey Fee:
 Transportation:
) _ \$ + RS _ \$
) Photos
) Others
)
 TOTAL

Date/Time. File Return to? 2)
 Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech. Invs (\$)
 : Weekend (\$)

Report Format :
 Lump Sum / I.B.I. (\$))

3rd Submit

Car City Auto Centre Pte Ltd
#01-198, Blk 9006 Tampines Street
93,
528840

Insurer Reference: SJX5914K
Repairer Reference: OD/21043
Date calculated: 17/11/2021 10:21 AM

Full Report
Registration: SJX5914K
Printed: 17/11/2021 10:21 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	HO TOO BOON	Currency:	SGD
Claim Reference:	SJX5914K	Date of Incident:	12/11/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	BMW		
Model:	5 SERIES F10		
Sub Model:	523 I		
Model Sheet Number:	01 42 01		
Registration:	SJX5914K		
VIN number:	WBAFP32030C543925		
Odometer:	82411		
Model Specs			
FR PRODUCTION START	AIR CON AUTO 2-ZONES	COMFORT ACCESS SYST	XENON HEADLAMPS
INTER LIGHT AMBIENCE	HEADLAMP WASHERS	DAKOTA LEATHER TRIM	ELEC/SEAT ADJ MEMORY
AUTO TAILGATE CONTR	DIP REAR VIEW MIRROR	FRT/RR PARK DIST CON	2.5 LTR 150KW
8-GEAR AUTOMATIC	TYRES 225/55 YR 17	WHEELS 8J X 17 ALLOY	INT MOULDING BLACK
VERSION HOT COUNTRY	TYRE W/FLAT RUNNING	TWO COAT PEARL/MICA	

*not allowed
llll*

*2/3
take photo after repair*

*7 days.
Excess?*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All
Underbody

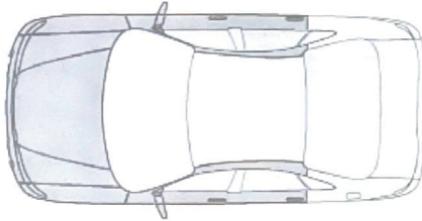

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm	Condition
------------	---	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
NO NUMBER	ALIGN BODY SHELL		6.0	21.00
NO NUMBER	ANCHOR VEHICLE ON STRAIGHTENING SYSTEM		12.0	42.00
NO NUMBER	RENEW L/F WING BRACKET REAR		1.0	3.50
NO NUMBER	RENEW R/F WING BRACKET REAR		1.0	3.50
41 35 610	RENEW L/F SIDE PANEL BRACKET		2.0	7.00
41 35 610	RENEW R/F SIDE PANEL BRACKET		2.0	7.00
NO NUMBER	RENEW L/F SIDE PANEL REAR UPPER BRACKET		1.0	3.50
NO NUMBER	RENEW R/F SIDE PANEL REAR UPPER BRACKET		1.0	3.50
NO NUMBER	RENEW L/F SIDE PANEL REAR LOWER BRACKET		1.0	3.50
NO NUMBER	RENEW R/F SIDE PANEL REAR LOWER BRACKET		1.0	3.50
41 35 560)	RENEW BOTH FRONT WINGS		1.0	3.50
51 64 511)	R + R FRONT PANEL SUPPORT		25.0	87.50
51 64 533	RENEW BOTH FRONT PANEL SUPPORTS (FRT BUMPER SUPPORT REMOVED) INCLUDES: HEADLAMP, AIR GUIDE		1.0	3.50
			21.0	73.50

Code	Description	WU	Price SGD
	RADIATOR AND DEFORMATION ELEMENT		
	REMOVE AND REFIT		
NO NUMBER	RENEW R/F SIDE PANEL FRONT LOWER BRACKET	1.0	3.50
51 23 621)	R + R BOTH BONNET LOCKS	3.0	10.50
NO NUMBER	R + R BONNET CABLE	4.0	14.00
51 23 711)	R + R BONNET CABLE	1.0	3.50
51 11 656	R + R FRONT BUMPER	9.0	31.50
51 11 566	R + R BOTH FRONT BUMPER CARRIERS	7.0	24.50
51 11 551	R + R FRONT UPPER BUMPER CARRIER	4.0	14.00
51 11 561	R + R LOWER FRONT BUMPER CARRIER	5.0	17.50
51 11 773)	RENEW L/LWR IMPACT ELEMENT	1.0	3.50
51 11 773)	RENEW R/LWR IMPACT ELEMENT	1.0	3.50
51 11 592	REMOVE/REFIT FRONT BUMPER BAR TRIM (WITH FRONT BUMPER BAR REMOVED)	6.0	21.00
66 20 610	ADD/WORK PARK DISTANCE CONTROL	4.0	14.00
51 64 521)	RENEW REAR CONNECTING STRUT (REMOVED)	3.0	10.50
	INCLUDES: CONVERT SUSPENSION CROSS BRACE		
63 10 514	ALIGN FRONT FOG LAMPS	2.0	7.00
61 71 561)	R + R WATER RESERVOIR	4.0	14.00
63 12 524	RENEW L/HEADLAMP (REMOVED)	4.0	14.00
63 12 524	RENEW R/HEADLAMP (REMOVED)	4.0	14.00
41 61 510	R + R BONNET	4.0	14.00
41 61 503	REPLACE BONNET (WITH BONNET REMOVED)	10.0	35.00
41 61 571)	RENEW L/BONNET HINGE	3.0	10.50
41 61 572)	RENEW R/BONNET HINGE	3.0	10.50
51 76 530	R + R REAR BONNET SEAL	1.0	3.50
NO NUMBER	R + R BONNET SEAL	1.0	3.50
51 23 900)	R + R L/HINGE ACTUATOR	2.0	7.00
51 23 900)	R + R R/HINGE ACTUATOR	2.0	7.00
51 43 570	R + R L/F LOWER DOOR PILLAR TRIM	5.0	17.50
51 43 575	R + R R/F LOWER DOOR PILLAR TRIM	4.0	14.00
51 71 947	R + R L/SILL PANEL COVER	6.0	21.00
51 71 947	R + R R/SILL PANEL COVER	6.0	21.00
52 14 697	R + R L/REAR PANEL FRONT	1.0	3.50
52 14 697	R + R R/REAR PANEL FRONT	1.0	3.50
52 14 892	R + R L/F HEADREST	2.0	7.00
52 14 892	R + R R/F HEADREST	2.0	7.00
67 31 570)	R + R LEFT HEADREST MOTOR	2.0	7.00
67 31 570)	R + R RIGHT HEADREST MOTOR	2.0	7.00
NO NUMBER	RENEW CONTROL UNIT BOX	7.0	24.50
NO NUMBER	R + R CONDENSER-/EVAPORATOR PIPE	4.0	14.00
NO NUMBER	R + R CONDENSOR / COMPRESSOR PIPE	5.0	17.50
NO NUMBER	R + R EVAPORATOR PIPE	6.0	21.00
NO NUMBER	R + R COMPRESSOR / EVAPORATOR PIPE	8.0	28.00
64 50 510	DRAIN/REFILL AIR CONDITIONING	6.0	21.00
17 11 546)	R + R RADIATOR SUPPORT	3.0	10.50
17 11 510	R + R RADIATOR	16.0	56.00
NO NUMBER	R + R POWER STEERING OIL COOLER	4.0	14.00
64 53 551)	R + R AIR CONDITIONING CONDENSER	3.0	10.50
17 11 501)	RENEW RADIATOR (REMOVED)	1.0	3.50
NO NUMBER	RENEW LOWER WATER HOSE	4.0	14.00
11 53 765	R + R UPPER WATER HOSE	1.0	3.50
NO NUMBER	RENEW WATER HOSE	2.0	7.00

Code	Description	WU	Price SGD
17 11 550	R + R OVERFLOW TANK	4.0	14.00
NO NUMBER	RENEW WATER HOSE	3.0	10.50
13 71 500	R + R INTAKE FILTER HOUSING	2.0	7.00
00 00 556	VEHICLE CHECK (BY VEHICLE DIAGNOSTIC SYSTEM)	3.0	10.50
61 00 980	VEHICLE TEST AND QUICK DELETION	2.0	7.00
61 00 730	PROGRAM AND CODE CONTROL UNIT/S (AFTER VEHICLE TEST)	4.0	14.00
1201	L/F ENGINE CARRIER REPAIR	35.0* ?	122.50
1202	R/F ENGINE CARRIER REPAIR	35.0* ?	122.50
1213	L/F CHASSIS LEG REAR REPAIR	25.0* ?	87.50
1214	R/ENGINE CARRIER RR REPAIR	25.0*	87.50
1481	LEFT FRONT DOOR REPAIR	25.0* X	87.50
1482	RIGHT FRONT DOOR REPAIR	25.0* X	87.50
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	38.10	457.0
	Total of Labour		1,599.50

Paint

Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
99 68 529	FRONT BUMPER PAINTING STAGE 2	16.0	56.00
LE 0313	FRT TOWING EYE COVER PAINTING STAGE 2	2.0	7.00
99 61 529	BONNET PAINTING STAGE 2	30.0	105.00
LE 0633	L/WASHER NOZZLE TRIM PAINTING STAGE 2	2.0	7.00
LE 0634	R/WASHER NOZZLE TRIM PAINTING STAGE 2	2.0	7.00
99 35 519	L/F WING PAINTING STAGE 2	8.0	28.00
99 35 519	R/F WING PAINTING STAGE 2	8.0	28.00
LE 1017	FRT CONNECTING STRUT PAINTING STAGE 2	2.0	7.00
LE 1018	RR CONNECTING STRUT PAINTING STAGE 2	2.0	7.00
L 0343	L/OUT U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
L 0344	R/OUT U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
L 0345	L/INN U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
L 0346	R/INN U-SONIC SENDER PAINTING STAGE 1	1.0	3.50
99 80 535	L/F WHEELHOUSE PAINTING STAGE 1	16.0	56.00
99 80 535	R/F WHEELHOUSE PAINTING STAGE 1	16.0	56.00
99 51 538	LEFT FRONT DOOR PAINTING STAGE 1	9.0	31.50
99 51 538	RIGHT FRONT DOOR PAINTING STAGE 1	9.0	31.50
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE	21.0	73.50
	Total Paint	Hrs 12.30	WU 147.0
			Price SGD 514.50

Material Cost - Paint
 New Part Painting
 Surface-/Blend Paint
 Material-constant Metal
Total

Price SGD
226.50
159.03
13.47
399.00

Spare Parts

				prices as at 2021-11-17	
Code	Description	Part Number	Part Source		Price SGD
0260	FRT NO PLATE BRKT	51 13 7 200 711	Original		0.00
0283	FRONT BUMPER COVER	51 11 7 285 961	Original		1,400.00 ✓
0303	FRT BUMPER GRILLE	51 11 7 285 950	Original	Dis	65.00 ✓
0305	L/AIR INTAKE TRIM	51 11 7 231 859	Original	Torn	34.00 X
0306	R/AIR INTAKE TRIM	51 11 7 231 860	Original	17	34.00 X
0307	L/BUMPER AIR GRILLE	51 11 7 200 699	Original	47	70.00 X
0308	R/BUMPER AIR GRILLE	51 11 7 200 700	Original	17	70.00 X
0313	FRT TOWING EYE COVER	51 11 7 246 868	Original	Torn	45.00 ✓
0325	L/F AIR DUCT	51 74 7 200 789	Original		50.00 ?
0326	R/F AIR DUCT	51 74 7 200 790	Original	Dis	50.00 ✓
0329	L/F DEFORMATION ELEM	SEE GUIDE NO. 0333	Original		75.00 ✓
0330	R/F DEFORMATION ELEM	SEE GUIDE NO. 0333	Original		75.00 ?
0331	L/F ADAPTER PLATE	51 11 7 186 513	Original	Dis	50.00 ✓
0332	R/F ADAPTER PLATE	51 11 7 186 514	Original	Dis	50.00 ✓
0333	FRT UPP BUMPER SUPP	51 11 7 200 705	Original	Dis	700.00 ✓
0334	FRT LWR BUMPER SUPP	51 11 7 203 078	Original	Dis	150.00 ?
0336	FRT UPP BUMPER SUPP	SEE GUIDE NO. 0333	Original		
0337	L/F LWR DEFORM ELEM	51 11 7 158 873	Original		100.00 ?
0338	R/F LWR DEFORM ELEM	51 11 7 158 874	Original		100.00 ?
0340	FRT UPP IMPACT DAMP	51 11 7 200 707	Original	Torn	55.00 ✓
0341	L/F MEMBER SUPPORT	51 11 7 158 893	Original		55.00 ?
0342	R/F MEMBER SUPPORT	51 11 7 158 894	Original		55.00 ?
0343	L/OUT U-SONIC SENDER	66 20 9 233 044	Original	17	350.00 X
0344	R/OUT U-SONIC SENDER	66 20 9 233 044	Original	17	350.00 X
0345	L/INN U-SONIC SENDER	66 20 9 233 044	Original	17	350.00 X
0346	R/INN U-SONIC SENDER	66 20 9 233 044	Original	17	350.00 X
0361	FRT SENSOR BRKT SET	51 11 2 208 723	Original	17	55.00 ✓
0367	L/F VENT DUCT	51 74 7 200 797	Original	17	50.00 ?
0368	R/F VENT DUCT	51 74 7 200 798	Original	17	50.00 ?
0415	L/F GRILLE	51 13 7 203 649	Original	one	120.00 ✓
0416	R/F GRILLE	51 13 7 203 650	Original	one	120.00 ✓
0431	GRILLE BADGE	51 14 7 057 794	Original	17	70.00 ✓
0463	L/F SUSPN BUFFER	51 23 7 162 448	Original		10.00 ?
0464	R/F SUSPN BUFFER	51 23 7 162 448	Original		10.00 ?
0465	BONNET ADJUSTER	51 76 7 183 752	Original		6.00 ?
0471	BONNET	41 61 7 207 194	Original	3 in 2	2,200.00 ✓
0475	L/BONNET HINGE	41 61 7 207 199	Original	17	70.00 X
0476	R/BONNET HINGE	41 61 7 207 200	Original	17	70.00 X
0481	SOUND INSULATION	51 48 6 989 301	Original	Dis	200.00 ✓
0483	L/GUIDE	51 23 7 184 435	Original	17	55.00 X
0484	R/GUIDE	51 23 7 184 436	Original	Dis	55.00 ✓
0491	L/UPPER LOCK	51 23 7 183 763	Original	17	65.00 X
0492	R/UPPER LOCK	51 23 7 183 764	Original	17	65.00 ✓
0494	SAFETY LATCH	51 23 7 183 765	Original	17	38.00 ✓

Code	Description	Part Number	Part Source	Price SGD
0497	L/F BONNET STRUT	51 23 7 206 644	Original	117 100.00 X
0498	R/F BONNET STRUT	51 23 7 206 644	Original	117 100.00 X
0501	CABLE LEVER	51 23 9 114 001	Original	TR1 35.00
0502	CONTROL BRACKET	51 23 9 114 003	Original	SM 22.00
0503	L/BONNET LOCK	51 23 7 206 453	Original	117 175.00 X
0504	R/BONNET LOCK	51 23 7 183 762	Original	TR1 175.00
0505	L/BONNET CABLE	51 23 7 183 773	Original	TR1 37.00
0506	CTR BONNET CABLE	51 23 7 255 801	Original	37.00 ?
0525	L/R BONNET SEAL	51 76 7 206 569	Original	RM 15.00
0526	R/R BONNET SEAL	51 76 7 206 570	Original	RM 15.00
0527	BONNET FRT GASKET	51 76 7 206 521	Original	42.30 ?
0561	LEFT HEADLAMP ASSY	63 11 7 343 911	Original	2,650.00 ?
0562	RIGHT HEADLAMP ASSY	63 11 7 343 914	Original	SR2 2,650.00
0567	L/INN H-LAMP LED-MOD	63 12 7 262 731	Original	117 480.00 X
0568	R/INN H-LAMP LED-MOD	63 12 7 262 731	Original	SM 480.00
0577	L/F LED INDICATOR	63 11 7 271 901	Original	117 360.00 X
0578	R/F LED INDICATOR	63 11 7 271 902	Original	SM 360.00
0593	L/F HEADLAMP BRACKET	41 35 7 207 209	Original	117 30.00 X
0594	R/F HEADLAMP BRACKET	41 35 7 207 210	Original	TR1 30.00
0595	L/F S/PANEL BRKT FRT	41 35 7 207 203	Original	30.00 ?
0596	R/F S/PANEL BRKT FRT	41 35 7 207 204	Original	30.00 ?
0597	L/F CTR S/PANEL BRKT	41 35 7 207 205	Original	30.00 ?
0598	R/F CTR S/PANEL BRKT	41 35 7 207 206	Original	30.00 ?
0599	L/F S/PANEL BRKT RR	41 35 7 207 207	Original	30.00 ?
0600	R/F S/PANEL BRKT RR	41 35 7 207 208	Original	30.00 ?
0601	L/SPACER BRACKET	51 11 7 207 931	Original	117 10.00 X
0602	R/SPACER BRACKET	51 11 7 207 932	Original	RM 10.00
0603	L/SIDE PANEL BRACKET	41 21 7 111 355	Original	30.00 ?
0604	R/SIDE PANEL BRACKET	41 21 7 111 355	Original	30.00 ?
0605	L/R UPP S/PANEL BRKT	41 35 7 240 501	Original	30.00 ?
0606	R/R UPP S/PANEL BRKT	41 35 7 240 502	Original	30.00 ?
0607	L/R LWR S/PANEL BRKT	41 00 9 624 949	Original	30.00 ?
0608	R/R LWR S/PANEL BRKT	41 00 9 624 949	Original	30.00 ?
0609	L/F S/PANEL BRKT RR	41 35 7 240 503	Original	30.00 ?
0610	R/F S/PANEL BRKT RR	41 35 7 240 504	Original	30.00 ?
0612	R/F LWR S/PANEL BRKT	41 35 7 240 499	Original	30.00
0623	TUBE	61 67 7 178 742	Original	45.00
0625	L/F WASHER JET	61 67 7 377 667	Original	117 150.00 X
0626	R/F WASHER JET	61 67 7 377 668	Original	DS 150.00
0631	L/WASHER JET CARRIER	51 11 7 200 791	Original	117 10.00 X
0632	R/WASHER JET CARRIER	51 11 7 200 792	Original	TR1 10.00
0633	L/WASHER NOZZLE TRIM	51 11 7 246 869	Original	117 45.00 X
0634	R/WASHER NOZZLE TRIM	51 11 7 246 870	Original	DS 45.00
0637	L/F FOG LAMP	63 17 7 216 885	Original	117 235.00 X
0638	R/F FOG LAMP	63 17 7 216 886	Original	117 235.00 X
0672	R/GAS DISCHARGE LAMP	63 21 7 217 509	Original	335.00 ?
0741	L/F WING	41 35 5 A03 261	Original	RM 550.00 X
0742	R/F WING	41 35 5 A03 262	Original	SR2 550.00
0747	L/F SUPPORT	51 76 7 019 803	Original	117 250.00 X
0748	R/F SUPPORT	51 76 7 019 804	Original	117 250.00 X
0842	R/F W-HOUSE CVR FRT	51 71 7 186 728	Original	120.00 ?
0844	R/F W-HOUSE RR COVER	51 71 7 186 724	Original	120.00 ?
0845	L/F LIP	51 75 7 312 829	Original	70.00 ?
0846	R/F LIP	51 75 7 312 830	Original	70.00 ?

Code	Description	Part Number	Part Source	Price SGD
0849	L/F WHEELHOUSE COVER	51 71 7 187 043	Original	11 10.00 X
0850	R/F WHEELHOUSE COVER	51 71 7 187 044	Original	Des 10.00 ✓
1009	RADIATOR AIR GUIDE	51 74 7 200 787	Original	550.00?
1016	FRT LOWER AIR GUIDE	51 74 8 049 708	Original	100 50.00
1017	FRT CONNECTING STRUT	51 64 7 200 689	Original	170.00?
1018	RR CONNECTING STRUT	51 64 4 868 863	Original	90.00?
1020	R/F PANEL SUPPORT	51 64 7 187 096	Original	130.00?
1187	L/F PANEL SUPPORT	51 64 7 200 793	Original	130.00?
1188	R/F PANEL SUPPORT	51 64 7 200 794	Original	130.00?
1435	LEVELLING SWITCH	17 13 7 553 919	Original	20.00?
1436	FLUID RESERVOIR	61 66 7 269 667	Original	125.00?
1437	WASHER PUMP	67 12 6 934 160	Original	90.00?
1439	FILLER PIPE	61 66 7 203 270	Original	80.00?
4465	CONDENSER	64 53 6 805 452	Original	1,000.00 ✓
4481	COMPR/CONDENSER PIPE	64 53 9 251 510	Original	230.00?
4482	SUCTION LINE	64 53 9 378 003	Original	590.00?
4483	COND/EVAPORATOR PIPE	64 50 9 190 502	Original	250.00?
4485	EVAPORATOR PIPE	64 53 9 201 927	Original	235.00?
4597	L/F SEAT HEADREST	52 10 7 236 827	Original	685.00 X
4598	R/F SEAT HEADREST	52 10 7 236 827	Original	685.00 X
4603	L/F HEADREST TRIM	52 10 7 264 591	Original	120.00 X
4604	R/F HEADREST TRIM	52 10 7 264 591	Original	120.00 X
4611	L/HEADREST MOTOR	52 10 9 155 767	Original	310.00 X
4612	R/HEADREST MOTOR	52 10 9 155 768	Original	310.00 X
7489	POWER STEERING HOSE	17 21 7 573 259	Original	215.00?
7761	RADIATOR	17 11 8 669 005	Original	1,000.00?
7768	UPP RADIATOR BRACKET	17 11 7 573 265	Original	50.00?
7769	RADIATOR FRAME	17 11 7 573 264	Original	190.00?
7773	LWR RADIATOR HOSE	17 12 7 610 704	Original	50.00?
7774	RETURN PIPE	17 12 7 578 403	Original	150.00?
7775	CENTRE RADIATOR HOSE	17 12 7 592 651	Original	60.00?
7776	UPPER RADIATOR HOSE	17 12 7 578 399	Original	95.00?
7787	EXPANSION TANK	17 13 7 647 284	Original	190.00?
7788	CONTAINER COVER	17 11 7 639 021	Original	25.00?
7789	ELECTRIC FAN CPL	17 42 8 509 740	Original	1,265.00?
8143	AIR CLEANER BOOT	13 71 7 590 595	Original	120.00?
8145	AIR DUCT FILTER	13 71 7 590 594	Original	30.00?
8391	FUEL PUMP	13 71 7 590 593	Original	500.00?
8403	AIR FILTER INT PIPE	13 71 7 590 592	Original	30.00?
8405	INLET FLANGE AIR FIL	13 71 7 577 471	Original	30.00?
8407	INLET FLANGE AIR FIL	13 71 7 577 469	Original	30.00?
8780	ENG ROOM PROTECTION	51 75 7 185 113	Original	190.00?
8781	L/ENG ROOM PROTECT	51 75 7 185 167	Original	50.00?
8782	R/ENG ROOM PROTECT	51 75 7 185 168	Original	50.00?
9645	LOW TONE HORN	61 33 7 279 782	Original	80.00?
9646	HIGH TONE HORN	61 33 7 279 781	Original	80.00?
9662	LOWER BOX	12 90 7 555 186	Original	250.00?
9664	CU BOX AIR CHANNEL	12 90 7 580 414	Original	55.00?
9680	TEMPERATURE SENSOR	65 81 6 936 953	Original	65.00?

Savings

0.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Subtotal	30,465.30
Fixed Sundry Parts Price	100.00
Total	30,565.30

Extras

Code	Description	Price SGD
1000	ANTI-FREEZE ANTI-FREEZE	20.00*
1001	AIR-CON GAS AIR-CON GAS	50.00*
1002	CHECK WIRING CHECKING WIRING	100.00*
1003	FRONT NUMBER PLATE AND HOLDER	35.00*
1004	READ AND CLEAR FAULT CODE	300.00*
	Total Extras	505.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	30,465.30	
Total Parts	100.00	30,565.30
Labour Time Base 12 WU/h		
Total 457.0 WU X 42.00 SGD/h	1,599.50	
Total of Labour		1,599.50
Total Of Extras		505.00
Paint Work Time Base 12 WU/h		
Labour Cost 147.0 WU X 42.00 SGD/h	514.50	
Material Cost	399.00	
Total Paint Including Material		913.50
Repair Cost Excludes GST		33,583.30
GST (+7.00%)		2,350.83
Repair Cost Included GST		35,934.13

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	132J
Vehicle Details	
Vehicle No.:	SJX5914K
Vehicle to be Exported:	No
Intended Deregistration Date:	19 Nov 2021
Vehicle Make:	B.M.W.
Vehicle Model:	523I 2.5 AT ABS D/AB 2WD 4DR GAS/D
Primary Colour:	Black
Manufacturing Year:	2010
Engine No.:	04657391N52B25AF
Chassis No.:	WBAFP32030C543925
Maximum Power Output:	150.0 kW (201 bhp)
Open Market Value:	\$37,309.00
Original Registration Date:	28 Jun 2010
First Registration Date:	28 Jun 2010
Transfer Count:	2
Actual ARF Paid:	\$37,309.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jun 2025
COE Category:	B - Car (1601cc & above)
COE Period(Years):	5
PQP Paid:	\$16,784.00
COE Rebate Amount:	\$12,103.00
Total Rebate Amount:	\$12,103.00
Message	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 19 Nov 2021

Live more, *emit less*
with DBS Green Car Loan
(EIR 3.20% p.a. is based on a 7 year loan tenure.)

1.68%
TTCs apply

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

12/2017 Elntra GLS S \$57800, \$880 Monthly at 1.88%



\$318 Monthly only, 1.88% By
GV CARs FINANCING. \$0
Downpayment. PHV/210
Welcome.
GV Automobile Centre StarAd

AutoInn
As. Insurances For Car Buyers

click here to view
our **PRISTINE USED CARS**
at **GREAT PRICES**

Browse by Category

« Back (1 2 3 4) Next »

Sort by Date Posted

20 results/page

66 vehicles



bmw 523

Advanced Search

Search

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

Search Selection

bmw 523 Any Any > 10 year(s) old Any Any Any Available



BMW 5 Series 523i (COE till 08/2030) **\$85,800** \$9,770 /yr 29-Nov-2010 2,497 cc 139,000 km Luxury Available

Premium Drive Quality Tastefully Enhanced! \$15k Savings From Branded Upgrades Goes To Next Lucky Owner! Maintained Diligently Wi...

Le Motor Enterprise

Posted: 19-Nov-2021 Tags: 2010 BMW 523i, BMW 523i, BMW, 523i

PREMIUM AD



BMW 5 Series 523i Highline (New 10-yr COE) **\$98,800** \$9,870 /yr 16-Nov-2011 2,497 cc 133,000 km Luxury Available

100% Loan Available, Immediate Approval, Supreme White, Very Well Maintained. Stock Condition, 100% Accident-Free, All Original Par...

Straits Euro Motors Pte Ltd

Posted: 19-Nov-2021 Tags: 2011 BMW 523i, BMW 523i, BMW, 523i

PREMIUM AD



BMW 5 Series 523i Highline (COE till 09/2031) **\$95,800** \$9,710 /yr 30-Sep-2011 2,497 cc 112,000 km Luxury Available

\$0 Downpayment At Only 3.98%! 2 Years Warranty On Engine And Gearbox! Rare Sight Of A Black Leather Interior On A BMW 523i! Full...

San Hub Bee (S) Pte Ltd

Posted: 18-Nov-2021 Tags: 2011 BMW 523i, BMW 523i, BMW, 523i

PREMIUM AD



BMW 5 Series 523i (COE till 05/2031) **\$86,800** \$9,160 /yr 12-May-2011 2,497 cc 95,869 km Luxury Available

Promo 2.88% Interest Rate COE Loan! 1 Careful Owner! Doorstep Car Viewing Are Available! Low Depreciation! Bank And In-House Full...

Posted: 18-Nov-2021 Tags: 2011 BMW 523i, BMW 523i, BMW, 523i

GET YOUR COE RENEWAL LOAN

Is your COE expiring? Let us help you renew it!

Getting your COE renewed is easy, fast and affordable. We'll help you renew your COE and get a loan for it. Get the cheapest loan in town and an approval in 2 days without effort! Enquire today.



BMW 5 Series 523i (COE till 12/2030) **\$83,800** \$9,220 /yr 22-Dec-2010 2,497 cc - Luxury Available

United Motoring Pte Ltd

Posted: 18-Nov-2021 Tags: 2010 BMW 523i, BMW 523i, BMW, 523i



BMW 5 Series 523i Highline (COE till 08/2030) **\$83,777** \$9,530 /yr 24-Jun-2011 2,497 cc 120,000 km Luxury Available

Facelifted Model, Original Low Mileage, Lots Of Wear And Tear Had Been Replaced, 100% Accident Free, Still Have 1 Year Warranty Co...

HTS Motor

Posted: 18-Nov-2021 Tags: 2011 BMW 523i, BMW 523i, BMW, 523i

Compare

19-Nov-21