

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SJY8264C
Repairer Reference: M3904 / SJY8264C
Date calculated: 05/01/2022 5:52 PM

Full Report
Registration: SJY8264C
Printed: 05/01/2022 5:52 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Siew Meng Hui	Currency:	SGD
Claim Reference:	SJY8264C	Date of Incident:	23/12/21
Estimated Repair Time:	16	Hire Car Start:	
Actual Repair Days:	16	Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HONDA		
Model:	CIVIC (FD)		
Sub Model:	BASE MODEL		
Model Sheet Number:	35 48 01		
Registration:	SJY8264C		
VIN number:	JHMFD1630AS200066		
Odometer:			
Model Specs			
AIR CONDITIONING	1.8 LTR 103 KW	5 SPEED GEARBOX	TWO COAT METALLIC

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All
 Underbody

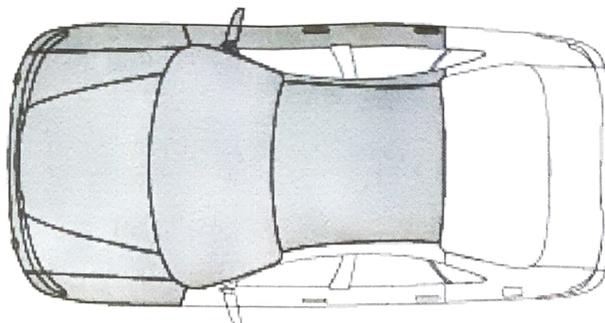

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
C0103-000)	FRONT VEHICLE ALIGNMENT W/O ADJUSTMENT		5.0	21.00
71101-SNB	RENEW COMPLETE FRONT BUMPER INCLUDES: FRONT BUMPER CPL AND R + R RADIATOR GRILLE.		6.0	25.20
71125-SNB)	R + R RADIATOR GRILLE BRACKET		1.0	4.20
17SNA-601	RENEW BONNET INCLUDES: R + R AND ADJUST BONNET		6.0	25.20
17SNC-601)	R + R LEFT BONNET HINGE (BONNET REMOVED)		1.0	4.20
17SNC-601)	R + R RIGHT BONNET HINGE (BONNET REMOVED)		1.0	4.20
74120-SNB	R + R BONNET LOCK		3.0	12.60
74130-SNA)	R + R BONNET RELEASE CABLE (WHEEL HOUSING INSERT REMOVED)		5.0	21.00
NO NUMBER	R + R BONNET STAY		1.0	4.20
74111-SNA	R + R LOWER ENGINE PROTECTION		3.0	12.60
76841-SNB)	R + R FRONT WIPER RESERVOIR (BUMPER REMOVED)		2.0	8.40

Code	Description	WU	Price SGD
60261-SNB	R + R L/F WING INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER	10.0	42.00
60260-SMG	R + R R/F WING (BUMPER REMOVED) DOES NOT INCLUDE: R + R WHEELHOUSE COVER AND HEADLAMP	7.0	29.40
04602-SNA	R + R FRONT UPPER CROSSMEMBER	2.0	8.40
76530-SNA)	R + R WIPER LINKAGE	3.0	12.60
76505-SNA)	R + R WINDSCREEN WIPER MOTOR (FRONT COWL PANEL TRIM REMOVED)	4.0	16.80
74260-SNA)	R + R FIREWALL INSULATION	11.0	46.20
NO NUMBER	R + R OUTER FRONT WALL DAMPING	5.0	21.00
72410-SNA	R + R R/F DOOR CHANNEL MOULDING	2.0	8.40
73350-SNA	R + R R/F DOOR SEAL	6.0	25.20
72810-SNA	R + R RIGHT REAR DOOR WEATHERSTRIP	6.0	25.20
73111-SNB	R + R WINDSCREEN INCLUDES: R + R ROOF MOULDINGS, WIPER ARMS, COWL GRILLE, INSIDE MIRROR AND ALL NECESSARY TRIMS	32.0	134.40
73330-SNA)	R + R LEFT FRONT QTR WINDOW GLASS	6.0	25.20
73330-SNA)	R + R RIGHT FRONT QTR WINDOW GLASS	6.0	25.20
77100-SNA	RENEW INSTRUMENT PANEL INCLUDES: R + R INSTRUMENT PANEL AND CONVERT ALL ATTACHED PARTS	37.0	155.40
79106-SNA)	R + R HEATER UNIT (INSTRUMENT PANEL REMOVED)	14.0	58.80
72315-SNA	R + R R/FR DOOR FRAME SEALING	2.0	8.40
31500-SNA	R + R BATTERY	2.0	8.40
38250-SNA	R + R FUSE BOX	8.0	33.60
NO NUMBER	DETACH + REFIT FRONT WIRING HARNESS	26.0	109.20
32110-RNA)	R + R FRONT WIRING HARNESS	18.0	75.60
32600-SNA	R + R GROUND STRAP	2.0	8.40
32410-SNC	R + R STARTER CABLE	5.0	21.00
37820-RNA)	R + R INJECTION CONTROL UNIT	6.0	25.20
18120-RNA	R + R CATALYST HEAT SHIELD	2.0	8.40
18181-RNA	R + R CATALYST HEAT SHIELD	4.0	16.80
37830-RNA	R + R INTAKE MANIFOLD PRESSURE SENSOR	3.0	12.60
NO NUMBER	R + R CRANK SHAFT POSITION SENSOR	3.0	12.60
16450-RNA)	RENEW INJECTION NOZZLE/S	9.0	37.80
19030-RTA)	R + R FAN MOTOR	1.0	4.20
19015-RNA)	R + R BLOWER MOTOR BRACKET	2.0	8.40
19501-RNA)	R + R UPPER RADIATOR HOSE	1.0	4.20
19505-RNA)	R + R CONNECTOR PIPE	6.0	25.20
17202-RNA	R + R AIR FILTER HOUSING	3.0	12.60
17100-RNA)	R + R INTAKE MANIFOLD	8.0	33.60
36531-RNA	R + R FRONT LAMBDA PROBE	3.0	12.60
13810-RNA)	R + R CRANKSHAFT PULLEY INCLUDES: R + R FAN BELT	3.0	12.60
31100-RNA)	R + R ALTERNATOR	3.0	12.60
30520-RNA	R + R FRONT IGNITION COILS	2.0	8.40
15810-RNA)	R + R VTEC VALVE	7.0	29.40
31170-RNA)	R + R BELT TENSIONER	2.0	8.40
1201C7)	R + R TEMPERATURE SENSOR	2.0	8.40
15100-RNA)	R + R OIL PUMP DRIVE	10.0	42.00

Code	Description	WU	Price SGD
15400-RTA	R + R OIL FILTER	3.0	12.60
12310-RNA	R + R VALVE COVER/GASKET	7.0	29.40
50820-SVA	R + R R/F UPPER ENGINE CARRIER MOUNTING	6.0	25.20
17100-RNA)	RENEW INTAKE MANIFOLD REMOVED	2.0	8.40
42700-SNA)	R + R LEFT FRONT WHEEL	2.0	8.40
51601-SNA)	R + R L/F SUSPENSION STRUT CPL	6.0	25.20
51601-SNA)	R + R L/F R/F SUSPENSION STRUT(ADD/WORK)	3.0	12.60
51605-SNA)	DISS/ASS L/F SUSPENSION STRUT REMOVED	4.0	16.80
42700-SNA)	R + R RIGHT FRONT WHEEL	2.0	8.40
51601-SNA)	R + R R/F SUSPENSION STRUT CPL	6.0	25.20
51605-SNA)	DISS/ASS R/F SUSPENSION STRUT	4.0	16.80
01469-SNA	R + R BRAKE BOOSTER	26.0	109.20
	INCLUDES: R + R MASTER BRAKE CYLINDER AND BLEED BRAKE SYSTEM		
57450-SNA)	R + R R/FRONT ABS SENSOR (WHEEL REMOVED)	3.0	12.60
57110-SNA)	R + R ABS MODULE (WITHOUT BLEEDING)	8.0	33.60
80341-SNA)	R + R COMPRESSOR PIPE	6.0	25.20
80316-SNA)	R + R COMPRESSOR/EVAPORATOR PIPE	4.0	16.80
38611-RNA	R + R AIR CONDITIONING FAN	2.0	8.40
80311-SNA)	R + R COMPRESSOR-/EVAPORATOR HOSE	2.0	8.40
80321-SNA)	R + R CONNECTING TUBE	3.0	12.60
NO NUMBER	REFILL + VENT AIR CONDITIONING	8.0	33.60
NO NUMBER	ADJUST FRONT CAMBER	2.0	8.40

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	43.00	430.0	1,806.00
Alignment			
Measuring Work	0.70	7.0	29.40
Total of Labour			1,835.40

Paint

Paint Work	SYSTEM AZT	Time Basis	10 WU/h
Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	17.0	
	L/F WING NEW PART PAINTING	11.0	
	R/F WING NEW PART PAINTING	11.0	
	FRONT BUMPER NEW PART PAINT K1R	12.0	
	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
	FRONT PANEL CPL SURFACE PAINT	6.0	
	L/F WHEELHOUSE SURFACE PAINT	6.0	
	R/F WHEELHOUSE SURFACE PAINT	6.0	
	COWL PANEL SURFACE PAINT	5.0	
	FIREWALL PANEL SURFACE PAINT	5.0	
	L/F SILL PANEL SURFACE PAINT	5.0	
	R/F SILL PANEL SURFACE PAINT	5.0	
	LEFT A-PILLAR SURFACE PAINT	4.0	
	RIGHT A-PILLAR SURFACE PAINT	4.0	
	LEFT B-PILLAR SURFACE PAINT	5.0	
	RIGHT B-PILLAR SURFACE PAINT	5.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	47.47
0741	L/F WING NEW PART PAINTING	23.22
0742	R/F WING NEW PART PAINTING	23.22
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	32.79
1009	FRONT PANEL CPL SURFACE PAINT	11.95
1117	L/F WHEELHOUSE SURFACE PAINT	11.21
1118	R/F WHEELHOUSE SURFACE PAINT	11.21
1311	COWL PANEL SURFACE PAINT	6.47
1321	FIREWALL PANEL SURFACE PAINT	6.47
2111	L/F SILL PANEL SURFACE PAINT	5.73
2112	R/F SILL PANEL SURFACE PAINT	5.73
2229	LEFT A-PILLAR SURFACE PAINT	3.24
2230	RIGHT A-PILLAR SURFACE PAINT	3.24
2291	LEFT B-PILLAR SURFACE PAINT	5.48
2292	RIGHT B-PILLAR SURFACE PAINT	5.48

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h	131.0	
Time Paint		21.0	88.20
Preparation Main Work Metal		5.0	21.00
Preparation Comp. Work Plastic	10 WU/h	157.0	659.40
Total			

Material Cost - Paint

	Price SGD
New Part Painting	93.91
New Part Painting - Plastic K1R	55.10
Repair Painting	32.79
Surface-/Blend Paint	76.21
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	285.11

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
7241	ABS HYDRO AGGREGATE	57110SNAA54	Original	/ BPT	2,760.00
7242	ABS UNIT BRACKET	57115SNAA00	Original		100.00
4485	AIR CON BLOWER FAN	38611RNAA01	Original		60.00
4487	AIR CON FAN MOTOR	38616RNAA01	Original		255.00
4489	AIR CON FAN SHROUD	38615RNAA01	Original		105.00
8402	AIR FILTER LWR HSG	17202RNAA00	Original	BNT	42.00
8142	AIR FLOW METER	37980RNAA01	Original	BNT	230.00
8389	AIR FLOW METER HOSE	17225RNAA00	Original	BNT	25.00
8411	ALTERNATOR	31100RNAA01	Original	BNT	700.00
8437	BELT TENSION BRACKET	31175RNA000	Original		72.00
0471	BONNET	60100SNB000ZZ	Original	BNT	385.00
0500	BONNET CABLE	74130SNBE01ZA	Original	BNT	55.00
0481	BONNET INSULATION	74141SNB000	Original	BNT	72.00

Code	Description	Part Number	Part Source	Price SGD
0492	BONNET LOCK	74120SNBE11	Original	BNT 66.00 ✓
0495	BONNET STAY	74145SNA00	Original	BNT 36.00 ✓
7515	BRAKE MASTER CYL	46100SNA003	Original	240.00 ?
7505	BRAKE POWER CONTROL	01469SNB010	Original	700.00 ?
8485	CAMSHAFT SENSOR	37510RNAA01	Original	110.00 ?
4481	COMPR/CONDENSER TUBE	80316SNA001	Original	BNT 170.00 ✓
4483	COND/EVAPORATOR PIPE	80341SNA013	Original	BNT 180.00 ✓
4484	CONNECTION TUBE	80321SNA003	Original	BNT 180.00 ✓
1395	COWL PANEL GRILLE	74200SNAU00	Original	BNT 300.00 ✓
8482	CRANKSHAFT SENSOR	37500RAAA01	Original	110.00 ?
7941	CYLINDER HEAD COVER	12310RNAA01	Original	BNT 220.00 ✓
8428	DRIVE BELT TENSIONER	31170RNAA04	Original	175.00 ?
9633	EARTH CABLE	32600SNA000	Original	BNT 160.00 ✓
1004	ENG ECU COVER	FRONT	Original	BNT 22.00 ✓
9586	ENGINE CABLE HARNESS	32110RNAY03	Original	BNT 0.00 ✓
4482	EVAP/COMPRESSOR HOSE	80312SNA003	Original	BNT 0.00 ✓
7787	EXPANSION TANK	19101RNAA01	Original	36.00 ?
7788	EXPANSION TANK CAP	19102RNAA00	Original	17.00 ?
7780	EXPANSION TANK HOSE	19104RNAA00	Original	18.00 ?
7767	FAN SHROUD	19015RNAA02	Original	BNT 85.00 ✓
7777	FILLING HOSE	19051RNAA01	Original	BNT 17.00 ✓
1322	FIREWALL TRIM	74260SNAU00	Original	BNT 60.00 ✓
0432	FRONT BADGE BRACKET	71124SNB003	Original	55.00 ?
0283	FRONT BUMPER	04711SNB010ZZ	Original	BNT 220.00 ✓
8476	FRONT SPARK PLUG SET	9807B561BW	Original	BNT 120.00 ✓
9585	FRONT WIRING HARNESS	32200SNBT50	Original	BNT 2,160.00 ✓
1413	FRT SCREEN MNTG KIT		Original	NEC 0.00 ✓
1410	FRT SCREEN SEAL KIT	04731SNA000	Original	NEC 36.00 ✓
9661	FUSE BOX	38250SNAC11	Original	BNT 600.00 ✓
0411	GRILL BRACKET	71125SNB000	Original	50.00 ?
0412	GRILLE	71121SNB003	Original	BNT 110.00 ✓
0431	GRILLE BADGE	75700S9AG00	Original	NEC 22.00 ✓
9639	IGNITION COIL 1	30520RNAA01	Original	115.00
9640	IGNITION COIL 2	30520RNAA01	Original	BNT 115.00
9641	IGNITION COIL 3	30520RNAA01	Original	115.00
9642	IGNITION COIL 4	30520RNAA01	Original	115.00
8135	INJECTION RAIL	16620RNAA01	Original	220.00
8551	INJECT NOZZLE CYL 1	16450RNAA01	Original	300.00
8552	INJECT NOZZLE CYL 2	16450RNAA01	Original	300.00
8553	INJECT NOZZLE CYL 3	16450RNAA01	Original	300.00
8554	INJECT NOZZLE CYL 4	16450RNAA01	Original	300.00
9666	INJ SYSTEM CONT UNIT	37820RNAY36	Original	2,520.00 ?
9589	INSTR PNL CABLE HARN	32117SNBM20	Original	1,800.00 ?
4331	INSTRUMENT PANEL	77100SNAU11ZG	Original	660.00 ?
8227	INTAKE MANIF COVER	17101RNAA00	Original	72.00 ?
8241	INTAKE MANIF GASKET	17105RNAA01	Original	25.00 ?
8221	INTAKE MANIFOLD	17100RNAA00	Original	230.00 ?
8228	INTAKE VALVE	17150RNAA01	Original	260.00 ?
8226	INT MANIFOLD ADAPTER	17210RNAA01	Original	420.00 ?
8484	INT MANIF PRESS SENS	37830RNAA01	Original	220.00 ?
8481	KNOCKING SENSOR	30530RNAA01	Original	200.00 ?

Code	Description	Part Number	Part Source	Price SGD
0475	L/BONNET HINGE	60170SNAA00ZZ	Original	BNT 42.00 ✓
1393	L/COWL PANEL GRILLE	74220SNAU00	Original	BNT 60.00 ✓
7105	L/F DAMPER BUFFER	51722SNA905	Original	BNT 25.00 ✓
1453	L/FR WIPER ARM	76610SNBE03	Original	? BNT 72.00 ✓
1741	L/F SIDE WINDOW SEAL	73375SNA003	Original	NEC 50.00 ✓
0749	L/F W-HOUSE PROTECT	74207SNAA01	Original	BT 36.00 ✓
0741	L/F WING	60261SNB000ZZ	Original	BNT 195.00 ✓
1457	L/F WIPER BLADE	76630SNAU02	Original	BNT 50.00 ✓
2427	L/ROOF MOULDING	73168SNA013	Original	BNT 145.00 ✓
1755	L/R SIDE WINDOW SEAL	73332SNA000	Original	NEC 0.00 ✓
7101	L/S-ABSORB BOOT	51403SNA305	Original	22.00 ?
1733	L/SIDE WDW MNTG KIT		Original	NEC 36.00 ✓
7091	L/SUPPORT BEARING	51920SVBA03	Original	? NEC 60.00 ✓
3861	L/S WINDOW BOND KIT	08CRCX016N0		NEC 0.00 ✓
7095	L/UPP SPRING SEAT	51726SNAG01	Original	? 55.00 ✓
8809	LAMBDA PROBE	36531RNAA01	Original	BNT 230.00 ✓
8780	LOWER ENGINE COVER	74111SNAA00	Original	? 72.00
8824	LWR CAT HEAT PROTECT	18181RNAA00	Original	BNT 50.00 ✓
7773	LWR RADIATOR HOSE	19502RNAA01	Original	? 25.00
1414	MOUNTING CLAMP	91568SDAA01	Original	? 0.00
1731	MOUNTING CLAMP	73334SFA000	Original	? 0.00
1732	MOUNTING CLAMP	73334SFA000	Original	? 0.00
7943	OIL CAP	15610PFB000	Original	BNT 22.00 ✓
8085	OIL DIPSTICK	15650RNAA00	Original	BNT 22.00 ✓
8041	OIL FILTER	15400RBAF01	Original	BNT 10.00 ✓
8483	OIL PRESSURE SENSOR	37241RNAA01	Original	60.00
8051	OIL PUMP	15100R1AA01	Original	? 240.00
1324	OUT FIREWALL INSUL	74251SNAU00	Original	220.00
0476	R/BONNET HINGE	60120SNAA00ZZ	Original	42.00
1394	R/COWL PANEL GRILLE	74210SNAU00	Original	BNT 60.00 ✓
8621	R/ENGINE BRACKET	50625SVAA00	Original	BNT 110.00 ✓
8679	R/ENGINE MOUNTING	50820SNBJ02	Original	BNT 195.00 ✓
7246	R/F ABS SENSOR	57450SNA003	Original	? BNT 180.00 ✓
7106	R/F DAMPER BUFFER	51722SNA905	Original	25.00 ?
1778	R/F DOOR FRAME SEAL	72315SNAA02ZE	Original	BNT 110.00 ✓
1510	R/F DOOR SEAL	72310SNAA01	Original	BNT 72.00 ✓
0562	R/F HEADLAMP CPL	33101SNBD01	Original	BNT 700.00 ✓
0318	R/F OUT BUMPER BRKT	71193SNB003	Original	BNT 18.00 ✓
1454	R/FR WIPER ARM	76600SNBE03	Original	BNT 72.00 ✓
1742	R/F SIDE WINDOW SEAL	73335SNA003	Original	BNT 50.00 ✓
0750	R/F W-HOUSE PROTECT	74206SNAA01	Original	BNT 36.00 ✓
1662	R/F WINDOW MOULDING	72410SNAA01	Original	BNT 110.00 ✓
0742	R/F WING	60211SNB000ZZ	Original	BNT 195.00 ✓
1458	R/F WIPER BLADE	76620SNAU02	Original	BNT 55.00 ✓
1810	R/R DOOR SEAL	72810SNAA01	Original	BNT 72.00 ✓
2428	R/ROOF MOULDING	73158SNA013	Original	BNT 145.00 ✓
1756	R/R SIDE WINDOW SEAL	73332SNA000	Original	0.00
7102	R/S-ABSORB BOOT	51402SNA305	Original	22.00
0708	R/SIDE REPEATER LAMP	34301S5HT02	Original	12.00
1734	R/SIDE WDW MNTG KIT		Original	36.00
7092	R/SUPPORT BEARING	51920SVBA03	Original	60.00
3862	R/S WINDOW BOND KIT	08CRCX016N0		0.00
0526	R/UPP HEADLAMP GSKT	74121SNAA00	Original	NEC 18.00 ✓
7096	R/UPP SPRING SEAT	51726SNAG01	Original	55.00 ?
0842	R/WHEELHOUSE SHELL	74101SNAA10	Original	BNT 66.00 ✓
7793	RADIATOR FAN	38611RTA004	Original	50.00 ✓

Code	Description	Part Number	Part Source	Price SGD
7789	RADIATOR FAN MOTOR	19030RTA004	Original	255.00?
0410	RADIATOR GRILLE TRIM	71122SNB003	Original	90.00?
7779	RADIATOR INTAKE HOSE	19050RNAA02	Original	60.00?
8623	RIGHT ENGINE SUPPORT	50880SNAA02	Original	BWT 110.00 ✓
9635	STARTER CABLE	32410SNC000	Original	600.00?
8438	TENSION DISC	31190RL2G01	Original	66.00?
7881	THERMOST WATER TUBE	19505RNAA00	Original	55.00?
8149	THROTTLE VALVE HSG	16400RNAA01	Original	1,080.00?
1409	UPP/WINDSCREEN SEAL	73126SNAA00	Original	NFC 18.00 ✓
8825	UPP CAT HEAT PROTECT	18120RNAA00	Original	BWT 60.00 ✓
7776	UPPER RADIATOR HOSE	19501RNAA01	Original	25.00?
1423	UPP WINDSCREEN MLDG	73150SNA003	Original	NFC 50.00 ✓
8433	V-BELT	56992RNAA04	Original	NFC 60.00?
8341	VTEC VALVE	15810RNAA01	Original	255.00?
1417	WARNING NOTE	78527S04E80	Original	0.00?
1435	WASHER RESERVOIR	76841SNBC01	Original	BWT 70.00 ✓
1443	WASHER RESERVOIR	76802SJD003	Original	BWT 18.00 ✓
	CAP			
1434	WASH RES FILLER NECK	76805SNA003	Original	BWT 22.00 ✓
8486	WATER TEMP SENSOR	37870PLC004	Original	55.00?
1401	WINDSCREEN	73111SNBJ30	Original	BWT 1,440.00 ✓
1411	WINDSCREEN BOND KIT	08CRCX016N0	Original	NFC 0.00 ✓
1002	WIPER ARM COVER RH	FRONT	Original	NFC 10.00 ✓
1461	WIPER LINKAGE CPL	76530SNAU02	Original	NFC 180.00 ✓
1450	WIPER MOTOR	76505SNAU02	Original	BWT 220.00 ✓
1437	W-SCREEN WASHER	76806SL0E11	Original	55.00?
	PUMP			

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	28,642.00
Total	28,642.00

Extras

Code	Description	Price SGD
1000	WINDSCREEN SEALANT FRONT	NFC 60.00* ✓
1001	BUMPER CLIPS FRONT	NFC 50.00* ✓
1003	FDR INR SHIELD CLIPS FRONT	NFC 20.00* ✓
Total Extras		130.00

Final Calculation

	SGD	SGD
Parts	28,642.00	
Total Parts		28,642.00
Labour Time Base 10 WU/h		
Total 430.0 WU X 42.00 SGD/h	1,806.00	
Alignment		
Measuring Work	29.40	
Total of Labour		1,835.40
Total Of Extras		130.00
Paint Work Time Base 10 WU/h		
Labour Cost 157.0 WU X 42.00 SGD/h	659.40	
Material Cost	285.11	
Total Paint Including Material		944.51
Repair Cost Excludes GST		31,551.91
GST (+7.00%)		2,208.63
Repair Cost Included GST		33,760.54
Deductions (Excludes GST)		
Deduction For Excess	-750.00	
Total Of Deductions (Excludes GST)		-750.00
Grand Total Excludes GST		30,801.91
GST (+7.00%)		2,156.13
Grand Total Included GST		32,958.04

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

NAZ LKK

7/1/2022 1030

LI

14 Days

CHECK ITEM PHOTOS

AFTER REPAIR PHOTOS

→ need to check repair limit.

NAZ@lkkauto.com

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: