

Ass. Rec. By:

REF:

CC3/AIG22002282/Avc

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. **2100455992**

Claims No. **7692880192SG**

Sum Insured: _____ Excess: **1000**

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SKA 4680A** Yr Regn: **2016, March**

Type: **M.Car** / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **Audi Q7** C.C. **1984**

Colour: **Black** A/C: Insured / Std / NI / NA

Sp. Reading: **65954** T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: **WAUZZZ4M26D028722**

Gen. Cond: **Good** / Fair / Poor / Burnt

Steering: **Inorder** / Jammed / Leaked / Burnt or

Brake: **Inorder** / Jammed / Leaked / Burnt or

Modi: Nil / **S/Rim** / STD A/Rim or

Tyre Size: F: **255/55R19**

R: **255/55R19**

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / **PIR** / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. **06** mm R/Bal. **06** mm

L/Bal. **06** mm L/Bal. **06** mm

D.O.A. **8/3/2022** D.O.I. **10/03/22**

Survey held at: **Premium (Berio)**

Des. of Damages: **Frt** / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
17/3/22	Submit uneconomical T/L- MV:\$140k LTA:\$76,868 NV: \$63,132
	revised fig \$122,785 check items \$25,376
	MV: 140K
	PV: 76.9K
	Nett: 63.1K

Date/Time, File Pass to?

☐ : Prel. Report
☐ : Final Report

Days Of Repair: **28**

1) _____
Date/Time, File Return to?

2) **17/3/22-typist**

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Test. Invt (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Photos _____

Other _____

Report Format: _____

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/03/2022 18:56 (SGT)
Date of Accident	08/03/2022 15:45 (SGT)
Exact Location of Accident	109 Bukit Batok West Ave 6, Singapore 650109
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKA4680A
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	GOH CHERN HUP
NRIC No	SXXXX792E
Email Address	CHERNHUP@HOTMAIL.COM
Mobile Phone No	(Phone) +65-94783728
Alternative Phone No	+65-93663025

VEHICLE PARTICULARS

Manufacturer	Audi
Model	Q7
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1984

INSURANCE COMPANY

Name of Insurance Company	AIG Asia Pacific Insurance Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	2100455992-05
Cover Note Number	-

DRIVER

Name of Driver	TAN SEE HWA
NRIC No	SXXXX584A

Date Of Birth	25/06/1981
Occupation	Indoor
Date Of Driving Pass	10/03/2001
Driving experience	21 YEARS
Gender	Female
Mobile Number	(Phone) +65-93663025
Alt. Phone Number	-
Email Address	SHTAN81@GMAIL.COM
Address	BLK 142 BUKIT BATOK ST 11
Address complement	#06-13
Postcode	650142
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Spouse
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Major/Minor Rd
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

I WAS TURNING RIGHT OF THE CAR PARK AND HIT THE ONCOMING VEHICLE.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKE6700S
Vehicle Manufacturer	Audi
Vehicle Model	Q7
Vehicle Variant	-
Vehicle Colour	Brown
Vehicle Category	Private car
Name of Driver	MR YIM
Contact Number	-
Address	-
Address complement	-

Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

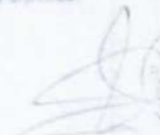

IMPORTANT NOTICE

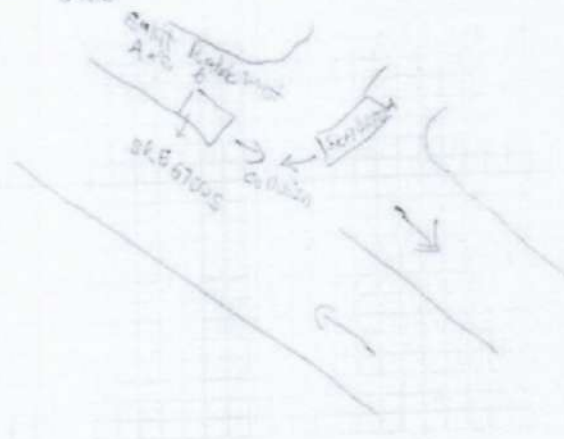
1. Please report correctly the details of the accident to speed up the claims process.
2. The Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation of a fact may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or disclosed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to any person who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident are collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which may involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelope and postboxes); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 - (b) collectively the "Purposes")
 - (c) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (d) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

 8/3/2022
 1745hr
 Policyholder's Signature / Date & Time

Sketch Plan

 8/3/2022
 1745hr
 Driver's Signature (If driver is not the policyholder) / Date & Time


 Witnessed by Reporting Person
 Personnel 



Describe Circumstances of the Accident

I was turning right of the car park, and hit the oncoming vehicle.

Declaration

I/We declare the foregoing particulars are true in every respect.

 8/3/2012
1745 hr
Policyholder's Signature / Date & Time

 8/3/2012
1745 hr
Driver's Signature (If driver is not the policyholder) / Date & Time

 
Witnessed by Reporting Officer
Personnel: Chang Juel Sing
1700

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0181/2022/JT
DATE : 9-Mar-22
WIP : 15169

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 10/3/22

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR GOH CHERN HUP
ADDRESS : BLK 142 BUKIT BATOK ST 11
#06-13
SINGAPORE 650142
TELEPHONE : HP +65 94783728
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 2100455992-05
VEHICLE NO : **SKA 4680 A**
MODEL CODE : AUDI Q7 2.0 TFSI S
MODEL YEAR : 16/3/2016
ENGINE NO : CYR 002367
CHASSIS NO : WAUZZZ4M2GD028722
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 8-Mar-22
PLACE OF ACCIDENT : 109 BUKIT BATOK WEST AVE 6

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SKA 4680 A

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	S/N \$ 480.00 ✓	
2	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 900.00 500. ✓	
3	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. TO CARRY OUT PRESSURISE, VACUUM AND REGAS.	S/N \$ 2,000.00 ✓	
4	TO REMOVE AND CENTER CONSOLE, INSTRUMENT PANELS AND CLUSTERS. RENEW DASHBOARD, BOTH FRONTAL AIRBAGS, SLIP RING. RENEW SEAT BELTS, CONTROL UNIT, PILLAR TRIMS AND BOTH CURTAIN AIRBAGS.	S/N \$ 3,600.00 ✓	
5	TO REMOVE AND REINSTALL ENGINE ASSY WITH GEARBOX ASSY TO FACILITATE CAR O-LINER REPAIRS. INSPECT FOR DAMAGES	S/N \$ 2,800.00 ✓	
6	TO RENEW ALTERNATOR, THROTTLE BODY AND OTHER ENGINE COMPONENTS.	S/N \$ 980.00 ?	
7	TO REMOVE AND REINSTALL FRONT SUSPENSION ASSY WITH SUBFRAME TO FACILITATE CAR O-LINER REPAIRS. INSPECT FOR DAMAGES AND RENEW IF NECESSARY.	S/N \$ 2,400.00 ✓	
SUB TOTAL LABOUR CHARGES		: \$ 13,160.00	



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SKA 4680 A

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
8	TO DISMANTLE LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAYING OF LHS FRONT DOOR.	S/N \$ 280.00	✓
9	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR O-LINER.	S/N \$ 800.00	✓
10	TO PLACE VEHICLE ON CAR O-LINER TO FACILITATE THE REPAIR.	S/N \$ 2,400.00	✓
11	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDER AND BOTH HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. TO CUT OUT AND WELD BOTH FRONT FENDER TOP SUPPORT AND BOTH FRONT CHASSIS FRAME COVER PLATES AND BOTH FRONT CHASSIS FRAME. TO ALIGN BACK BOTH CHASSIS MEMBERS INTO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PART REMOVED	\$ 19,000.00	7200.
12	TO RESPRAY FRONT BUMPER, BOTH FRONT BUMPER LOWER SPOILERS, BONNET, HINGES, BOTH FRONT FENDERS, BOTH FRONT FENDER TOP SUPPORT, BOTH FRONT CHASSIS FRAME WITH COVERS, BOTH UPPER A-PILLARS, LHS FRONT DOOR, DOOR COVER AND BOTH FRONT WHEEL ARCH TRIMS.	\$ 11,000.00	5000 6x600 = 3600 Hinge x 2 = 200 Lower Spoiler x 2 = 150 x 2 = 300 Chassis member x 2 = 500 Wheel Arch x 2 = 400 5000
13	TO CARRY OUT ALUMINIUM PRIMER WORKS.	S/N \$ 980.00	✓
SUB TOTAL LABOUR CHARGES		: \$ 34,460.00	



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SKA 4680 A

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
14	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE.	S/N \$	280.00	✓
15	TO CARRY OUT WHEEL ALIGNMENT.	S/N \$	240.00	✓
16	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK.	S/N \$	384.00	✓
TOTAL LABOUR CHARGES		:	\$	48,524.00



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted</i>	1	\$ 2,896.00	✓
2	FRONT BUMPER FIXNG PARTS <i>new</i>	1	\$ 468.00	✓
3	FRONT BUMPER TOWING EYE <i>Damaged</i>	1	\$ 44.00	✓
4	FRONT BUMPER AIR GUIDE - LH / RH <i>Distorted</i>	2	\$ 150.00	✓
5	FRONT BUMPER END CAP - RH	1	\$ 40.00	✓
6	FRONT BUMPER CLOSING ELEMENT - UPPER CENTER <i>Smashed</i>	1	\$ 309.00	✓
7	FRONT BUMPER GRILLE - LOWER CENTER <i>Smashed</i>	1	\$ 230.00	✓
8	FRONT BUMPER UNDERRUN BAR <i>Distorted</i>	1	\$ 899.00	✓
9	FRONT BUMPER CLOSING ELEMENT - LOWER <i>Distorted</i>	1	\$ 235.00	✓
10	FRONT BUMPER SPOILER - LH / RH <i>Distorted</i>	2	\$ 470.00	✓
11	FRONT BUMPER SPOILER - LH / RH OUTER <i>?</i>	2	\$ 98.00	?
12	RADIATOR GRILLE <i>Smashed</i>	1	\$ 2,741.00	✓
13	RADIATOR GRILLE COVER <i>Distorted</i>	1	\$ 81.00	✓
14	RADIATOR GRILLE INNER COVER <i>Smashed</i>	1	\$ 69.00	✓
15	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>Distorted</i>	2	\$ 664.00	✓
16	FRONT BUMPER END CAP - RH <i>Distorted</i>	1	\$ 38.00	✓
17	SPRING CLIP - LH / RH <i>new</i>	8	\$ 8.00	✓
18	RADIATOR GRILLE SPOILER - LH / RH INNER <i>Smashed</i>	2	\$ 128.00	✓
19	FRONT BUMPER FOAM FILLER PIECE <i>Distorted</i>	1	\$ 192.00	✓
20	FRONT BUMPER REINFORCEMENT BEAM	1	\$ 1,025.00	✓
SUB TOTAL SPARE PARTS		:	\$ 10,785.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	FRONT BUMPER SUPPORT - LH / RH <i>Distorted</i>	2	\$ 81.00	✓
22	FRONT BUMPER GUIDE SECTION - LH / RH <i>Distorted</i>	2	\$ 100.00	✓
23	FRONT BUMPER TOP COVER <i>Distorted</i>	1	\$ 146.00	✓
24	AIR COND STICKER <i>3 New</i>	1	\$ 9.00	✓
25	CAUTION STICKER	1	\$ 16.00	✓
26	FRONT PARKING AID SNEsor - INNER / OUTER <i>3 Missing</i>	4	\$ 976.00 732.	
27	FRONT PARKING AID SENSOR SEAL RING <i>or</i>	4	\$ 10.00	✓
28	FRONT BUMPER WIRING SET <i>?</i>	1	\$ 702.00	?
29	HORN - LH / RH <i>RH Banged</i>	2	\$ 480.00 240.	
30	FRONT FENDER - LH / RH <i>Distorted</i>	2	\$ 3,638.00	✓
31	FRONT FENDER ATTACHMENT PARTS <i>New</i>	1	\$ 79.00	X.
32	FRONT FENDER BRACE - LH / RH <i>Bent</i>	2	\$ 240.00	✓
33	FRONT FENDER BRACKET - LH / RH <i>Bent</i>	2	\$ 144.00	✓
34	FRONT FENDER CLOSING ELEMENT - LH / RH <i>?</i>	2	\$ 74.00	?
35	FRONT FENDER BRACKET END - LH / RH <i>?</i>	2	\$ 136.00	?
36	FRONT WHEEL HOUSING LINER - LH / RH <i>to n</i>	2	\$ 520.00	✓
37	REAR WHEEL HOUSING LINER - LH / RH <i>New</i>	2	\$ 520.00	X.
38	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS <i>AP</i>	1	\$ 191.00	X.
39	BONNET <i>Distorted</i>	1	\$ 7,032.00	✓
40	BONNET ATTACHMENT PARTS <i>New</i>	1	\$ 233.00	X.
SUB TOTAL SPARE PARTS			: \$ 15,327.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	BONNET HINGE - LH / RH <i>Best</i>	2	\$ 186.00	✓
42	BONNET HINGE COVER - LH / RH <i>Neu</i>	2	\$ 12.00	✓
43	BONNET ABSORBER <i>Dang d</i>	1	\$ 154.00	✓
44	BONNET IMPACT PROTECTION <i>Neu</i>	1	\$ 119.00	✓
45	BONNET SEAL - LH / RH <i>Neu</i>	2	\$ 136.00	✓
46	HEADLIGHT COVER - LH / RH <i>Del d</i>	2	\$ 228.00	✓
47	FENDER TOP COVER - RH <i>Del d</i>	1	\$ 50.00	✓
48	BONNET STRIKER - LH / RH <i>Best</i>	2	\$ 262.00	✓
49	BONNET BOWDEN CABLE <i>Tam d</i>	1	\$ 64.00	✓
50	BONNET LOCK MICRO-SWITCH <i>Dang d</i>	2	\$ 484.00	✓
51	BONNET LOCK CABLE <i>Dang d</i>	1	\$ 96.00	✓
52	BONNET RELEASE CABLE COVER <i>Dang d</i>	1	\$ 11.00	✓
53	BONNET RELEASE LEVER <i>Dang d</i>	1	\$ 16.00	✓
54	BONNET LOCK CABLE <i>Tam d</i>	1	\$ 125.00	✓
55	BONNET SOUND ABSORBER <i>X4</i>	1	\$ 400.00	✓
56	WATER BOX SOUND ABSORBER - UPPER <i>?</i>	1	\$ 115.00	?
57	HEADLIGHT MOUNTING - LH / RH <i>Smashed</i>	2	\$ 264.00	✓
58	HEADLIGHT - LH / RH <i>RH Smashed, LH cut d</i>	2	\$ 21,320.00	✓
59	HEADLIGHT CONTROL UNIT - LH / RH <i>?</i>	2	\$ 1,680.00	?
60	HEADLIGHT FAN <i>?</i>	2	\$ 855.00	?
SUB TOTAL SPARE PARTS		:	\$ 26,577.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
61	HEADLIGHT POWER MODULE ?	2	\$ 1,680.00 ?	
62	HEADLIGHT HOSE - LH / RH ?	2	\$ 90.00 ?	
63	LIFT CYLINDER - LH / RH <i>RH could</i>	2	\$ 434.00 217.	
64	LIFT CYLINDER HOSE ?	1	\$ 113.00 ?	
65	LIFT CYLINDER UPPER HOSE ?	1	\$ 204.00 ?	
66	LIFT CYLINDER PUMP <i>new</i>	1	\$ 171.00 <i>+</i>	
67	WINDSCREEN WASHER SYSTEM PUMP <i>new</i>	1	\$ 137.00 <i>+</i>	
68	WASH WATER RESERVOIR <i>new</i>	1	\$ 240.00 <i>+</i>	
69	WATER FILLER NECK <i>new</i>	1	\$ 65.00 <i>+</i>	
70	LIFT CYLINDER STRAINER <i>new</i>	1	\$ 29.00 <i>x</i>	
71	LIFT CYLINDER END CAP <i>new</i>	1	\$ 24.00 <i>+</i>	
72	LOCK CARRIER <i>Smashed.</i>	1	\$ 1,335.00 ✓	
73	RADIATOR SIDE MEMBER - LH / RH ?	2	\$ 1,068.00 ?	
74	RADIATOR BRACKET - LH / RH	2	\$ 116.00 ✓	
75	RADIATOR BRACKET LOWER - LH / RH <i>} Distorted</i>	2	\$ 66.00 ✓	
76	A/C CONDENSER <i>Dented.</i>	1	\$ 1,022.00 ✓	
77	REFRIGERANT LINE ?	1	\$ 314.00 ?	
78	REFRIGERANT LINE ?	1	\$ 250.00 ?	
79	REFRIGERANT LINE ?	1	\$ 273.00 ?	
80	REFRIGERANT PIPE ?	1	\$ 665.00 ?	
SUB TOTAL SPARE PARTS		:	\$ 8,296.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
81	OUTSIDE TEMPERATURE SENSOR BRACKET <i>rm</i>	1	\$ 20.00	✓
82	OUTSIDE TEMPERATURE SENSOR <i>Missing</i>	1	\$ 64.00	✓
83	AIR TEMPERATURE SENSOR BRACKET <i>rm</i>	1	\$ 5.00	✓
84	CHARGE AIR COOLER <i>Bent</i>	1	\$ 1,150.00	✓
85	PRESSURE HOSE - LH ?	1	\$ 302.00	?
86	PRESSURE HOSE - LOWER ?	1	\$ 233.00	?
87	PRESSURE PIPE ?	1	\$ 315.00	?
88	PRESSURE HOSE - UPPER ?	1	\$ 269.00	?
89	PRESSURE PIPE ?	1	\$ 59.00	?
90	PRESSURE HOSE - RH ?	1	\$ 178.00	?
91	RADIATOR <i>Bent</i>	1	\$ 1,010.00	✓
92	RADIATOR BUSH - RH LOWER ?	2	\$ 20.00	✓
93	RADIATOR BUSH - RH UPPER ?	2	\$ 28.00	✓
94	RADIATOR GROMMET - UPPER ?	2	\$ 22.00	✓
95	RADIATOR SECURING PIN - UPPER ?	2	\$ 6.00	✓
96	RADIATOR COOLANT <i>rm</i>	6	\$ 282.00	✓
97	ADDITIONAL RADIATOR <i>Derided</i>	1	\$ 893.00	✓
98	ADDITIONAL RADIATOR BRACKET <i>Bent</i>	1	\$ 141.00	✓
99	ADDITIONAL RADIATOR BRACKET - LH REAR <i>Bent</i>	1	\$ 30.00	✓
100	RADIATOR AIR GUIDE - LH OUTER ?	1	\$ 52.00	?
SUB TOTAL SPARE PARTS		:	\$ 5,079.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
101	RADIATOR TWIN FAN RING <i>und</i>	1	\$ 316.00	✓
102	RADIATOR FAN CONTROL UNIT - LH / RH ?	2	\$ 3,232.00	?
103	RADIATOR AIR GUIDE - LH / RH <i>Dist</i>	2	\$ 66.00	✓
104	RADIATOR AIR GUIDE - UPPER / LOWER <i>Dist</i>	2	\$ 96.00	✓
105	COOLANT HOSE RELEASE COUPLING - LOWER ?	1	\$ 260.00	?
106	COOLANT HOSE RELEASE COUPLING - UPPER ?	1	\$ 248.00	?
107	COOLANT HOSE <i>horn</i>	1	\$ 123.00	✓
108	CONTROL VALVE ?	1	\$ 391.00	?
109	INTAKE AIR DUCT <i>Del</i>	1	\$ 130.00	✓
110	AIR FILTER BOX <i>und</i>	1	\$ 682.00	✓
111	INTAKE HOSE ?	1	\$ 215.00	?
112	INTAKE HOSE ADAPTER ?	1	\$ 34.00	?
113	VACUUM HOSE ?	1	\$ 21.00	?
114	AIR FILTER ELMENT <i>new</i>	1	\$ 104.00	✓
115	AIR FILTER ELEMENT COVER <i>Del</i>	1	\$ 529.00	✓
116	INTAKE MANIFOLD ?	1	\$ 983.00	?
117	THROTTLE VALVE ADAPTER ?	1	\$ 1,126.00	?
118	INTAKE MANIFOLD SUPPORT ?	1	\$ 22.00	?
119	ENGINE MOUNTING - LH / RH ?	2	\$ 826.00	?
120	ENGINE SUPPORT - LH / RH ?	2	\$ 350.00	?
SUB TOTAL SPARE PARTS			\$ 9,754.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL: 6366 2323 FAX: 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
121	ENGINE SUPPORT BEARING - LH / RH ?	2	\$ 142.00	?
122	FRONT FENDER SIDE MEMEBR - LH Best	1	\$ 1,066.00	✓
123	FRONT FENDER SIDE MEMEBR - RH ?	1	\$ 1,172.00	?
124	CHASSIS CONNECTING PLATE - LH 250 new	1	\$ 322.00	+
125	CHASSIS CONNECTING PLATE - RH Repair	1	TBC	+
126	CHASSIS CONNECTING PLATE - CENTER ?	2	\$ 190.00	?
127	FRONT WHEEL ARCH COVER - LH / RH Red	2	\$ 1,214.00	✓
128	FRONT DOOR COVER - LH new	1	\$ 734.00	+
129	FRONT DOOR WINDOW SLOT SEAL TRIM STRIP - LH / RH new	2	\$ 842.00	+
130	STEERING WHEEL AIRBAG Activated	1	\$ 3,916.00	✓
131	AIRBAG UNIT	1	\$ 4,969.00	✓
132	HEAD AIRBAG UNIT } Activated	2	\$ 4,280.00	✓
133	AIR BAG CONTROL UNIT	1	\$ 2,848.00	✓
134	AIRBAG CRASH SENSOR	3	TBC	✓
135	FUSE UNIT Activated	1	\$ 613.00	✓
136	SEAT BELT - LH / RH Activated	2	\$ 2,454.00	✓
137	SEAT BELT HEIGHT ADJUSTER - LH / RH new	2	\$ 383.00	+
138	STEERING WHEEL cut	1	\$ 3,142.00	✓
139	DASHBOARD AIR DUCT torn	1	\$ 7,969.00	✓
140	MOULDED HEADLINER crumpled	1	\$ 4,159.00	✓
SUB TOTAL SPARE PARTS			:	\$ 40,415.00

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SKA 4680 A

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
141	FRONT GRAB HANDLE - LH / RH ?	2	TBC ?	
142	REAR GRAB HANDLE - LH / RH ?	2	TBC ?	
143	A-PILLAR TRIM - LH / RH ?	2 \$	872.00 ?	
144	C-PILLAR TRIM - LH / RH ?	2 \$	524.00 ?	
145	D-PILLAR TRIM - LH / RH ?	2 \$	1,066.00 ?	
146	NOISE INSULATION ?	1 \$	723.00 ?	
147	SOUND ABSORBER ?	1 \$	702.00 ?	
148	STATIC METER ?	1 \$	12.00 ?	
149	2-PACK EPOXY ADHESIVE <i>see</i>	1 \$	122.00 ✓	
150	ALUMINIUM POWDER <i>see</i>	1 \$	637.00 ✓	
151	HARDENER <i>see</i>	1 \$	232.00 ✓	
152	ALUMINIUM PRIMER <i>see</i>	1 \$	233.00 ✓	
153	CLEANING BLOCK <i>see</i>	1 \$	96.00 ✓	
154	STONE CHIP ?	S/N \$	180.00 ?	
155	ARYLIC SEALANT <i>see</i>	S/N \$	180.00 ✓	
156	CAVITY WAX ?	S/N \$	140.00 ✓	
157	FRONT NO PLATE <i>Distorted -</i>	S/N \$	60.00 ✓	
158	SUNDRIES ?	\$	1,000.00 ?	
TOTAL SPARE PARTS		:	\$ 123,012.00	
TOTAL LABOUR CHARGES		:	\$ 48,524.00	
GRAND TOTAL		:	\$ 171,536.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST
LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME :

Adrian Li

SURVEYED DATE :

10/03/22

AUTHORISED DATE :

EXCESS COST :

LIABILITY :

REMARKS :

Not Authorised, 28 Days.

PLEASE NOTE :

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC
Owner ID: 792E

Vehicle Details

Vehicle No.: SKA4680A
Vehicle to be Exported: No
Intended Deregistration Date: 10 Mar 2022
Vehicle Make: AUDI
Vehicle Model: Q7 2.0 TFSI QU (252 BHP)
Primary Colour: Black
Manufacturing Year: 2015
Engine No.: CYR002367
Chassis No.: WAUZZZ4M2GD028722
Maximum Power Output: 185.0 kW (248 bhp)
Open Market Value: \$59,069.00
Original Registration Date: 16 Mar 2016
First Registration Date: 16 Mar 2016
Transfer Count: 0
Actual ARF Paid: \$78,325.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 15 Mar 2026
PARF Rebate Amount: \$54,827.00

Intended COE Rebate Details

COE Expiry Date: 15 Mar 2026
COE Category: E - Open Category
COE Period(Years): 10
QP Paid: \$55,089.00
COE Rebate Amount: \$22,041.00
Total Rebate Amount: \$76,868.00

The information contained herein is correct as at 10 Mar 2022

OK

HOTTEST NEW CAR PROMOTIONS



Audi Q7

Audi's 7-Seater SUV. With Panoramic Roof & More Options. Ready Stock at the showroom. Visit Us Today

DON'T MISS OUT!

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

2011 Lexus IS250 At \$83K Only! In Great Condition!



Well Taken Care Of, No Accident!
Buy And Drive, No Repairs
Needed! Don't Miss It!
RZER Performance [Sponsored](#)



Sort by 20 results/page

3 vehicles



Audi Q7

Any Category

Advanced Search

Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Audi Q7		Any	Any	2016	Any	Any	Any	Available
	Audi	Q7 3.0A TFSI Quattro 5-Line (333bhp)	\$165,800	\$25,510 /yr	28-Sep-2016	2,995 cc	110,000 km	SUV	Available
1 Owner Only! Attractive Bank Loan Promotion At 1.88% Or Full In-House Loan Available With 100% Approval! Regularly Serviced, 100% Accident-Free, Zero Wear And Tear Change Needed, Original Paintwork, Extremely Well Taken Care Of. View To Believe. Trade-In Welco...									
SKL Automobile Pte Ltd									
Posted: 21-Feb-2022									
	Audi	Q7 2.0A TFSI Quattro Tip (252bhp)	\$150,800	\$24,060 /yr	31-Oct-2016	1,984 cc	59,000 km	SUV	Available
Wear And Tear Done With Receipt Proven! Equipped With Apple Car Play! Beautiful BBS Rims And New Tyres Worth More Than \$3.5k! Fitted With Original Audi Q7 Side Steps Worth \$2.9k! Literally The Best Equipped, The Best Well Maintained Unit In The Market! Buy Wit...									
Euro Performance Asia Pte Ltd									
Posted: 22-Feb-2022									
	Audi	Q7 2.0A TFSI Quattro Tip 7-Seater	\$162,888	\$25,780 /yr	27-Dec-2016	1,984 cc	34,000 km	SUV	Available
1 Owner Only, Why Showing 2 Owners, Because The First Owner Was Premium Automobiles. Maintained By Premium Automobiles. Accident-Free, Low Mileage, Shelter Parked. Midnight Blue Rare Colour, New Tyres. Leather Still Smells Like New. Condition Is Also Like...									
Posted: 13-Jan-2022									

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

20 results/page

For old advertisements, view [Expired ads](#)

Buy / Rent Cars

[New Cars For Sale](#)

[Used Cars For Sale](#)

[Cars For Rent](#)

Sell Your Car

[Post an Ad](#)

[Sell by Bidding](#)

[Sell by Consignment](#)

Aftermarket

[Workshop Directory](#)

[Aftermarket Products](#)

Articles

[Car Reviews](#)

[Car Advice](#)

[Car News](#)

[Car Features](#)

General

[About Us](#)

[Contact Us](#)

[Careers](#)

[Site Map](#)

Resources

[COE Prices](#)

[Car Insurance](#)

[Car Valuation](#)

[Used Car Warranty](#)

[Bidded Carplates](#)

[Car Insurance](#)

[Used Car Warranty](#)

[Bidded Carplates](#)

[Car Insurance](#)

Follow [sgCarMart.com](#)

