

AS\$. REC. BY: TGlim

REF:

CS/SMR22002973/8ty3

Denise

**ASSIGNMENT**

From: \_\_\_\_\_ Date: 31/3/2022

Veh No: SJR 1003C Yr Regn: 24/4/2009

Estimated Cost: \_\_\_\_\_

Type:  M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD /  TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or \_\_\_\_\_

To Inspect Vehicle No: SJR 1003C

Make: Toyota Corolla Altis 1.6 c.c. 1598

at Workshop m/s Dean Autopro

Colour: Silver A/C: Insured / Std / NI / NA

of 160 Sin Ming Dr #01-14

Sp. Reading: 179356 T/Radio: Insured / Std / NI / NA

Insured: \_\_\_\_\_

Eng/No: 3ZZ4883350

Policy No. \_\_\_\_\_

C/No: MR053ZEE100144070

Claims No. \_\_\_\_\_

Gen. Cond: Good / Fair /  Poor / Burnt

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

Steering:  In order / Jammed / Leaked / Burnt or \_\_\_\_\_

(Client's Record)

Brake:  In order / Jammed / Leaked / Burnt or \_\_\_\_\_

Make of Veh: \_\_\_\_\_


Modi: Nil /  S/Rim / STD A/Rim or \_\_\_\_\_

(Policy Condition)

Tyre Size: F: 195/65/15 Matrax

R: 195/65/15 BS

Remark: The veh had commenced its repair at the time of inspection.

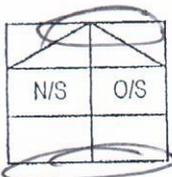

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or \_\_\_\_\_

Bal. or Market Value: 19,000/-

Front R/Bal. 4 mm Rear R/Bal. 4 mm

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

L/Bal. 4 mm L/Bal. 4 mm

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

D.O.A. 30/3/2022 D.O.I. 31/3/2022

Est. Repairs: 24 days Res.: Yes or No

Survey held at Dean Autopro

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

Des. of Damages:  Fnt /  Rear / O/S / N/S / U/C / Rooftop or

CA / REV / REP. / 24 HRS WP

The U/C / Chassis frame / Body Structure affected due to collision.

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Date / Time	Action / Instruction
	Range : 13,000/- - 14,000/-
	confirm our acceptance to your proposed COR @ \$13,550.00 & 24 Repair Days.
	Recommended COR : NV \$ 13,550/- TGlim Mm
	COR of LS \$ 19,800/- being higher than NV 15/4/2022
	red: 36733.77;73%
	MV 19,000/-
	PV 5409/-
	NV 13,591/- TGlim Mm
	31/3/2022

Date/Time, File Pass to?  : Preli. Report

Days Of Repair: 24

1)  : Final Report

Resurvey No. of Trip: \_\_\_\_\_

Date/Time, File Return to?

Survey Fee:	_____
Transportation:	_____
_____ S + RS. \$1	_____
Photos	_____
Others	_____
TOTAL	_____

2) \_\_\_\_\_

Add Fee:  : Site Insp (\$ \_\_\_\_\_)

: Interview (\$ \_\_\_\_\_)

: Tech. Invs (\$ \_\_\_\_\_)

: Weekend (\$ \_\_\_\_\_)

Report Format: \_\_\_\_\_

Lump Sum / L.B.I. ( ) \_\_\_\_\_



36	Wiper washer tank	1	\$	357.60	\$ 112.00	357.60	DDV
37	Wiper washer tank motor	1	\$	181.00	\$	<del>181.00</del>	NDX
38	Wiper outer garnish	1	\$	388.65	\$ 266.20	388.65	BRV
39	Front windscreen	1	\$	1,087.60	\$ 550.00	1,087.60	CRAV
40	Front windscreen moulding	1	\$	241.00	\$ 135.00	241.00	NECV
41	ABS pump assy	1	\$	1,758.30	\$	✓ 1,758.30	BRV
42	Bootlid	1	\$	894.70	\$ 707.40	894.70	DDV
43	Bootlid logo	1	\$	85.50	\$ 58.50	85.50	} NEC ✓
44	Bootlid emblem 'COROLLA'	1	\$	68.00	\$ 50.20	68.00	
45	Bootlid emblem 'ALTIS'	1	\$	65.37	\$ 54.10	<del>65.37</del>	
46	Bootlid emblem '1.6'	1	\$	41.50	\$	✓ 41.50	
47	Bootlid emblem 'LX'	1	\$	48.80	\$	✓ 48.80	
48	Bootlid outer chrome garnish	1	\$	274.80	\$ 128.60	274.80	CRAV
49	Bootlid number plate lamp	2	\$	95.50	\$	191.00	NDX
50	Bootlid lamp	2	\$	<del>226.00</del> 485.30	\$ 452.00	970.60	BRV
51	Bootlid inner lock	1	\$	298.70	\$ 148.60	298.70	JMV
52	Bootlid inner lock striker	1	\$	65.00	\$	<del>65.00</del>	NDX
53	Bootlid inner trim board	1	\$	352.80	\$	<del>352.80</del>	NDX
54	Bootlid weatherstrip	1	\$	298.60	\$ 168.70	298.60	TNV
55	Bootlid hinge	2	\$	188.30	\$	376.60	NDX
56	Rear bumper	1	\$	785.90	\$ 398.00	785.90	BRV
57	Rear bumper side bracket	2	\$	<del>37.20</del> 185.60	\$ 74.40	371.20	BTV
58	Rear bumper reflector	2	\$	<del>54.10</del> 93.60	\$ 108.20	187.20	BRV
59	Rear end panel	1	\$	762.10	\$ 571.90	762.10	DDV
60	Rear end panel top garnish	1	\$	268.00	\$ 185.00	268.00	BRV
61	Spare tyre panel	1	\$	837.70	\$ 684.70	837.70	DDV
62	Spare tyre panel top board	1	\$	498.00	\$ 156.50	<del>498.00</del>	BRV
63	Spare tyre panel fastener	1	\$	180.00	\$	✓ 180.00	BTV
64	Rear chassis RH	1	\$	889.00	\$ 685.00	889.00	BTV
65	Rear fender RH	1	\$	827.90	\$	✓ 827.90	DDV
66	Rear fender inner trim board	2	\$	<del>158.60</del> 448.00	\$ 317.20	896.00	TNV
67	Rear fender inner cowling RH	1	\$	124.00	\$	✓ 124.00	TNV
68	Rear windscreen moulding	1	\$	266.70	\$ 105.10	266.70	NECV
69	Rear air vents	1	\$	62.30	\$ 47.80	<del>62.30</del>	MISV
70	Rear door	1	\$	927.00	\$	927.00	GTXR
71	Rear door black tape	1	\$	108.00	\$	<del>108.00</del>	} NNX } NNX
72	Rear door inner lock	1	\$	415.40	\$	<del>415.40</del>	
73	Rear door inner lock sticker	1	\$	85.30	\$	<del>85.30</del>	
74	Rear door weatherstrip	1	\$	287.90	\$	287.90	
75	Taillamp	2	\$	<del>372.80</del> 594.60	\$ 745.60	<del>1,189.20</del>	BRV
76	Taillamp lower bracket	2	\$	<del>77</del> 82.00	\$ 154.00	164.00	MISV
77	Taillamp base panel	RH 1	\$	<del>189.00</del> 199.60	\$ 189.00	399.20	DDV
78	Rear fuel tank	1	\$	1,187.30	\$ 1063.00	1,187.30	DDV
79	Rear axle	1	\$	1,045.00	\$	✓ 1,045.00	BTV
80	Rear shock absorber RH	1	\$	445.00	\$ 268.00	445.00	BTV
81	Rear wheel bearing RH	1	\$	378.20	\$ 248.00	<del>378.20</del>	JMV

82	Exhaust pipe	1	\$	891.00	\$ 566.10	891.00	BTV
83	Exhaust center pipe	1	\$	824.00	\$ 538.10	824.00	BTV
84	Exhaust mounting	2	\$	33.70 68.60	\$ 67.40	137.20	NEC
85	Exhaust haet shield	1	\$	145.80	\$ 78.00	145.80	BTV
					Parts Sub Total :	\$ 41,315.82	
					25% Discount :	\$ 10,328.96	
					<b>PARTS TOTAL :</b>	<b>\$ 16450.36</b>	<b>30,986.87</b>

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$		
1	Sundries	1	\$ 80.00	\$ 80.00	NNX	
2	Bonnet sealant	1	\$ 100.00	\$ 30.00 100.00	NEC	
3	Bonnet insulator clips	1	\$ 50.00	\$ 50.00	NNX	
4	Front bumper clips	1	\$ 50.00	\$ 30.00 50.00	} NEC	
5	Front bumper side retainer	2	\$ 65.00 85.25	\$ 130.00 170.50		
6	Front bumper fog lamp garnish clips	2	\$ 50.00	\$ 100.00	NNX	
7	Front bumper lower grille clips	1	\$ 50.00	\$ 50.00	NNX	
8	Front grille clips	1	\$ 50.00	\$ 20.00 50.00	NEC	
9	Front support panel sealant	1	\$ 100.00	\$ 30.00 100.00	NEC	
10	Front support panel top garnish clips	1	\$ 50.00	\$ 50.00	NNX	
11	Front fender sealant	2	\$ 100.00	\$ 200.00	} NNX	
12	Front fender inner cowling clips	2	\$ 50.00	\$ 100.00		
13	Front door sealant	1	\$ 100.00	\$ 100.00		
14	Headlamp panel sealant	2	\$ 100.00	\$ 200.00		
15	Radiator coolant	1	\$ 80.00	\$ 30.00 80.00	} NEC	
16	Aircon fluid	1	\$ 80.00	\$ 40.00 80.00		
17	Brake fluid	1	\$ 80.00	\$ 30.00 80.00		
18	Front number plate w/casing	1	\$ 80.00	\$ 40.00 80.00	BTV	
19	Front windscreen sealant	1	\$ 100.00	\$ 40.00 100.00	NEC	
20	Front windscreen inner seal	1	\$ 60.00	\$ 60.00	} NNX	
21	Front windscreen primer & cleaner	1	\$ 80.00	\$ 80.00		
22	Bootlid sealant	1	\$ 100.00	\$ 30.00 100.00	} NEC	
23	Bootlid lamp seal	2	\$ 60.00	\$ 40.00 120.00		
24	Bootlid lamp clips	2	\$ 50.00	\$ 30.00 100.00		
25	Bootlid outer chrome garnish clips	1	\$ 50.00	\$ 20.00 50.00	} NNX	
26	Bootlid inner trim board clips	1	\$ 50.00	\$ 50.00		
27	Rear bumper clips	1	\$ 50.00	\$ 30.00 50.00	NEC	
28	Rear bumper side retainer	2	\$ 65.00 88.20	\$ 130.00 176.40	NEC	
29	Rear bumper reverse sensor	2	\$ 250.00	\$ 200.00 500.00	SC	
30	Rear end panel sealant	1	\$ 100.00	\$ 30.00 100.00	} NEC	
31	Rear end panel top garnish clips	1	\$ 50.00	\$ 20.00 50.00		
32	Spare tyre panel sealant	1	\$ 100.00	\$ 30.00 100.00		
33	Rear fender sealant	1	\$ 100.00	\$ 30.00 100.00		
34	Rear fender inner trim board clips	2	\$ 50.00	\$ 40.00 100.00		
35	Rear fender inner cowling clips	1	\$ 50.00	\$ 20.00 50.00		
36	Rear windscreen sealant	1	\$ 100.00	\$ 40.00 100.00		
37	Rear windscreen inner seal	1	\$ 80.00	\$ 80.00		} NNX
38	Rear windscreen primer & cleaner	1	\$ 60.00	\$ 60.00		



> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	958W
Vehicle Details	
Vehicle No.:	SJQ1003C
Vehicle to be Exported:	Yes
Intended Deregistration Date:	30 Mar 2022
Vehicle Make:	TOYOTA
Vehicle Model:	COROLLA ALTIS 1.6 AUTO
Primary Colour:	Silver
Manufacturing Year:	2009
Engine No.:	3ZZ4883350
Chassis No.:	MR053ZEE106144070
Maximum Power Output:	80.0 kW (107 bhp)
Open Market Value:	\$16,990.00
Original Registration Date:	24 Apr 2009
First Registration Date:	24 Apr 2009
Transfer Count:	1
Actual ARF Paid:	\$16,990.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	23 Apr 2024
COE Category:	A - Car (1600cc & below)
COE Period(Years):	5
PQP Paid:	\$13,088.00
COE Rebate Amount:	\$5,409.00
<b>Total Rebate Amount:</b>	<b>\$5,409.00</b>
Message	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 30 Mar 2022

OK

MV 19,000/2  
PV 5,409/2  
NV 13,591/2

Torlim Lim  
31/3/2022

Email: [sm@idac.com.sg](mailto:sm@idac.com.sg) Tel no: 6555 6888

\*If no proper documents are produced, IDAC shall not file the report. Information will be discarded after one week.

**Personal Particulars of Owner & Driver (Vehicle A)**

Date of Accident: 30/03/2022 (dd/mm/yy) Time of Accident: 08 : 05 AM (24-HR-FORMAT)  
Vehicle No. : SJQ 1003 C Vehicle Make & Model / Engine (cc): Toyota Altis 1598 cc Private Hire: ( Y / N ) (N)  
Exact location of Accident: Along Sembawang Road (Opposite Blk 101 Chong Pang City)  
Policyholder's Name / IC No. : CTP ENGINEERING PTE LTD 201530958W  
Driver's Name / IC No. : Rayapaneni Subramanyam F8223873P (As Above)   
Driver's Contact No. : 8487 0974 Company Contact No / Owner Contact No: 9389 9806  
Driver's Address: Blk 871 Yishun Street 81 #10-125 Singapore 760871  
Owner Email address: contact@ctpengrg.com Insurance Company: NTUC  
Driver Email address: contact@ctpengrg.com

**Relationship between Owner & Driver:** (Please **CIRCLE** one only)

Owner / Spouse / Children / Friend / Parents / Sibling / Relative / Employee / Hirer or Others specify: \_\_\_\_\_

**What do you wish to claim?** (Please **TICK** one only)

Own Insurance /  Other Vehicle (The one you want to claim against) /  Reporting (For Record Purpose)

**Exact purpose for which the vehicle was being used at time of accident?**

**Occupation (nature of job)**  Indoor /  Outdoor

Private use /  Work purpose

**\*No. of Passengers (Including Driver):** 2

\*Passanger Name: Mr. Vinod

Gender: Male

\*Passanger Name: \_\_\_\_\_

Gender: \_\_\_\_\_

**Weather condition & Road conditions?** (On the day of accident)

Clear & Dry /  Raining & Wet /  After-Rain & Wet /  Drizzling & Wet / Others: \_\_\_\_\_

**Was there any video captured by your Car Camera?**  Yes /  No

**Any Injuries:**  Yes /  No (If YES) Injured Person' Name: Rayapaneni Subramanyam

Injuries Sustain: Neck, chest and back Injured Person in Which Vehicle: SJQ 1003 C

**Police Report filed:**  Yes /  No (If YES) Which Police Station: \_\_\_\_\_

**The Other Party(s) Details:**

1. Driver's Name / IC No: Lim Tian Hock / S2090393G Vehicle No: SHC 4566 Y

Driver's Contact No: 9815 3830 Insurance Company: \_\_\_\_\_

2. Driver's Name / IC No (If Any): Chua Teck Kiat / S7785119D Vehicle No: SCE 7334 D

Driver's Contact No: 9450 5157 Insurance Company: \_\_\_\_\_

\*Independent Witness (If Any): \_\_\_\_\_ Contact No: \_\_\_\_\_

Preferred Workshop Name: \_\_\_\_\_ Contact No: \_\_\_\_\_

Describe Circumstances of the Accident

On the stated date and time, I was travelling along the stated  
venue. Both of our vehicles were stationary (Vehicle A and Vehicle C)  
and suddenly vehicle B travelled at fast speed and collided into my  
vehicle. The huge impact also caused my stationary vehicle to propel  
forward and collided into vehicle C.. After the collision I felt discomfort  
on my neck, chest and back. I will seek medical treatments later.

Declaration

We declare the foregoing particulars are true in every respect.

R. Sub

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel