

ASS. REC. BY:

REF:

C12/ 22003281/K943

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 / Bottom Flat, oil not ready

17/4 / 1 Rm 816, 8502 Car/w Uped \$5814, 267.7

Date/Time, File Pass to?

1) 24/4 17:15

Date/Time, File Return to?

2)

Report Format: MCR-TP

Lump Sum / I.B.I. (\$) 16850

Days Of Repair: 16

Resurvey No. of Trip: 2

Add Fee:

Site Insp (\$)

Interview (\$)

Tech Invs (\$)

Weekend (\$)

Survey Fee:

Transportation

S + RS SI

Fees

Others

TOTAL

SC1G22480008 / CHENG HOE MOTOR PTE LTD[768761]
ENTRY DATE & TIME: 08/04/2022 15:33 (SGT)
SUBMITTED BY: CHIONG BENG CHOON
VERSION: 1 (08/04/2022 15:33 (SGT))

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	08/04/2022 15:33 (SGT)
Date of Accident	07/04/2022 17:43 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	NANYANG CRESCENT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK3125D
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	SALMI BIN SANUSI
NRIC No	SXXXX460G
Email Address	sgraion@gmail.com
Mobile Phone No	(Phone) +65-96209710
Alternative Phone No	+65-96209710

VEHICLE PARTICULARS

Manufacturer	Mazda
Model	MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private hire
Transmission	Auto
CC	1496

INSURANCE COMPANY

Name of Insurance Company	NTUC Income Insurance Co-operative Ltd
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	5106765856-03
Cover Note Number	12/01/2022-11/01/2023

DRIVER

Name of Driver	SALMI BIN SANUSI
NRIC No	SXXXX460G

Date Of Birth 17/03/1973
 Occupation Indoor
 Date Of Driving Pass 19/02/1997
 Driving experience 25 YEARS AND 2 MONTHS
 Gender Male
 Mobile Number (Phone) +65-96209710
 Alt. Phone Number +65-96209710
 Email Address sgraion@gmail.com
 Address 26 CCK GROVE #08-60
 Address complement -
 Postcode 688215
 Is the driver the policyholder? Yes
 If No, Relationship of the Driver with the Insured -
 Does Driver Own Other Vehicles? No
 Vehicle Registration Number of Other Vehicle Owned by Driver -
 Insurance Company of Other Vehicle Owned by Driver -

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident Collision - Change/cross lane
 Weather Conditions Clear
 Road Surface Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident? No
 Number of vehicles involved in the accident 2
 Was anybody injured in the Accident? No
 Was any injured conveyed to hospital by ambulance? -
 Was any other vehicle or property damaged? Yes
 Number of Passengers (Including Driver) 1
 Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? No

DETAILS OF POLICE ACTION

Was the accident reported to the police? No
 Was notice of intended Prosecution given? No
 If yes, against whom? -

CIRCUMSTANCES OF ACCIDENT

REFER SKETCH ATTACHED

ATTACHMENT(S)

Are accident photos available for attachment? Yes
 Was there any video captured by Car Camera? No
 Was there any audio recorded? No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SJP1370Y
 Vehicle Manufacturer -
 Vehicle Model -
 Vehicle Variant -
 Vehicle Colour -
 Vehicle Category Private car
 Name of Driver MUHAMMAD SYAFIQ BIN HAMIDE
 NRIC No SXXX688C
 Contact Number (Phone) +65-91089942
 Address -

MT/ 1167934-001


SKETCH PLAN1. VEHICLE NO: SLK3125D2. INSURER CO: NMC3. ACCIDENT
DATE & TIME: 7/4/22
17:43 hrs.**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
 - (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


8 Apr 2022
Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

8/4/22
Witnessed by Reporting Centre Personnel

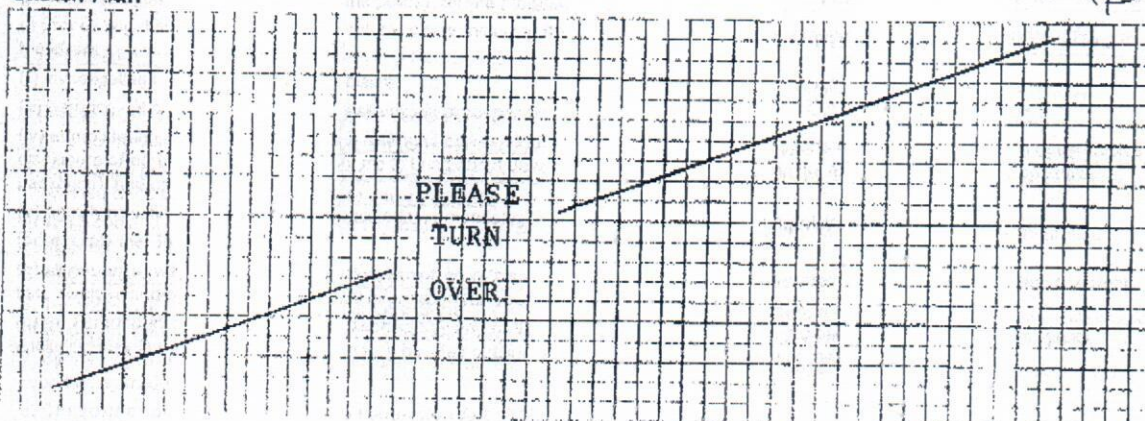Sketch Plan

Sketch Plan

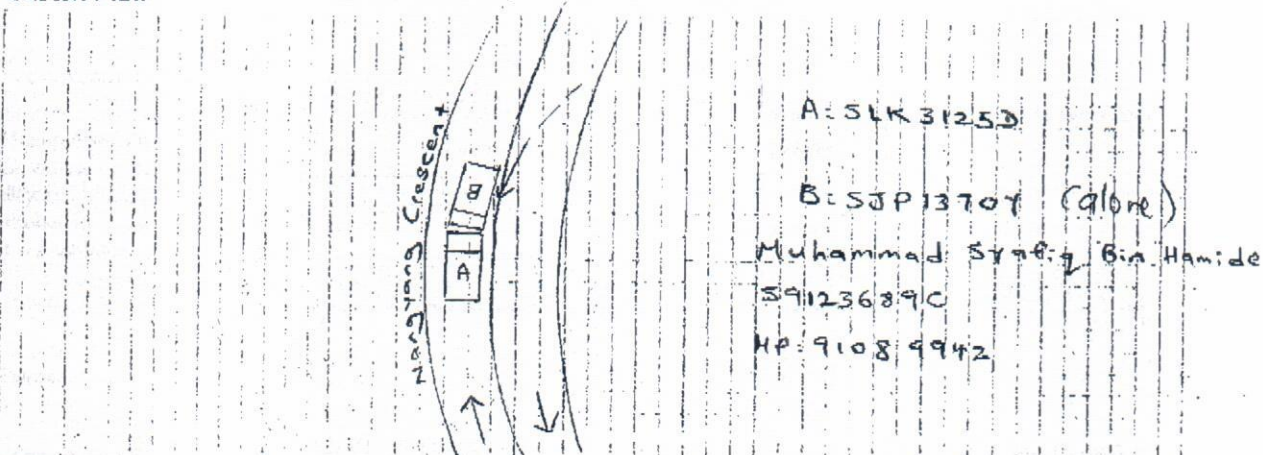

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 7 April 2022, I was driving along Nanyang Crescent just after Nanyang Drive. The time of accident was at 17.43 hr (5.43 pm). The day was sunny and the road was clear from debris. The other driver ~~car~~^{car} plate driving car plate number SJP 1370Y suddenly drove towards my car. I have ~~give~~^{try} press the horn but the other driver just proceed to hit my car. The accident occurred at a bend along Nanyang Crescent. Me and the other driver has no injury and no passenger in both car.

Note : Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:
8 Apr 2022

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:
(YS)

() Claim Own Policy () Claim Third Party () Reporting Only
() Claim OD/TP at other workshop ()

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	460G
Vehicle Details	
Vehicle No.:	SLK3125D
Vehicle to be Exported:	Yes
Intended Deregistration Date:	08 Apr 2022
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 4-DOOR SEDAN 1.5L SP6EAT
Primary Colour:	Blue
Manufacturing Year:	2016
Engine No.:	P520423115
Chassis No.:	JM6BN22A8H0137395
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$14,777.00
Original Registration Date:	12 Jan 2017
First Registration Date:	12 Jan 2017
Transfer Count:	2
Actual ARF Paid:	\$9,777.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	11 Jan 2027
PARF Rebate Amount:	\$6,843.00
Intended COE Rebate Details	
COE Expiry Date:	11 Jan 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$50,951.00
COE Rebate Amount:	\$24,242.00
Total Rebate Amount:	\$31,085.00

The information contained herein is correct as at 08 Apr 2022

OK

SGCARMART.COM

Login Sign Up

New Cars

Used Cars

Rental Cars

Sell My Car

Directory

Products

Insurance

Articles

Forum

Resources

Singapore Reckless
Drivers Part XIPetrol Price Movement
In SingaporeUnusual or Rare Cars -
Part 2

Mazda 3

Price Range

Depreciation

2017

Vehicle Type



Search

Advanced
Search

Home » Used Cars » Carle Pte Ltd » Mazda 3 1.5A

Mazda 3 1.5A

Overview

Financial

Accessories

Similar

Research

Photos

Map

PREMIUM AD

Price \$58,500

Depreciation ⑦

\$10,650 /yr

View models with similar depre

Reg Date

08-Feb-2017

(4yrs 9mths 30days COE left)

Mileage

N.A.

Manufactured ⑦

2016

Road Tax ⑦

\$682 /yr

Transmission

Auto

Dereg Value ⑦

\$34,403 as of today (change)

OMV ⑦

\$18,973

COE ⑦

\$50,989

ARF ⑦

\$13,973

Engine Cap

1,496 cc

Power

88.0 kW (118 bhp)

Curb Weight ⑦

1,321 kg

No. of Owners ⑦

1

Type of Vehicle

Mid-Sized Sedan

Features

1.5L 4 Cylinders Inline 16 Valve DOHC SkyActiv-G, 6-Speed Auto Transmission, ABS, SRS Airbags, Traction Controls, Keyless Start/Stop, Fuel Efficiency. View specs of the Mazda 3 Sedan (2014-2019)

Accessories

Sunroof, Leather Seat, Smart Keyless, Knockdown Rear Seats, Factory Fitted Audio, Reverse Sensors, Auto Side Mirrors, Fog Lights.

Description

1 Owner, Well Maintained, Full Loan Available, STA Or Vicom Evaluation Inspection Are Welcome, Bank And In House Loan Available At Competitive Interest Rate, Free Grooming, Warranty Not By Third Party Workshop, Kindly Call For Viewing Appointment.

Category

PARF Car, Premium Ad Car

Status

Available for sale. Shortlist this car to get alerted whenever the price or availability changes.

Resources



sgCarMart Used Car Warranty

Get \$0 future car repair bill. Ask your dealer for a warranty on this car. Learn more



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more





Car Valuation - Free

Find out the market value of your existing car for free. Get started

Posted on: 14-Feb-2022 | Last Updated on: 23-Feb-2022


Up Compare

> more Financial info

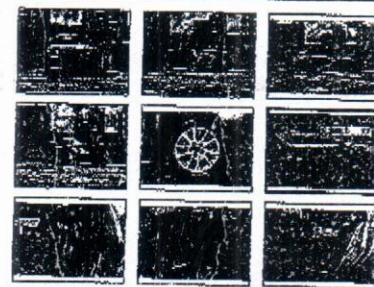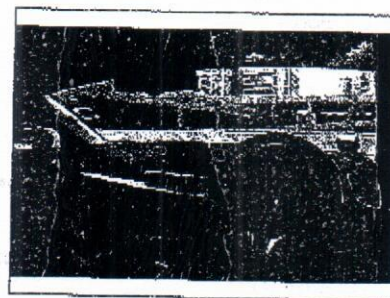

Price Chart

Summary

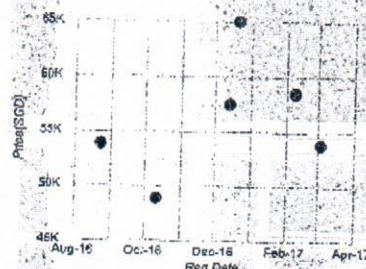

Click on the point to view the vehicle

Shortlist

More

Compare

Report Error

Seller Information

Carle Pte Ltd

31 vehicles for sale. 27 sold in past 3 mths


8 Ubi Road 2 #01-07/08

Zervex

Search cars nearby

Stava

89519847

**CHENG HOE MOTOR PTE LTD**

Blk 1019, Yishun Industrial Park A, #01-374/382, Singapore 768761

Tel : 67556142 Fax : 67557719

Email: chmotor@singnet.com.sg

TP INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)**MUHAMMAD SYAFIQ BIN HAMIDE**

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	TP/CHINA(SJP1370Y)
Policy No:	DMPCSNW00263572101	Date of Loss:	07/04/2022
Vehicle Reg. No.:	SLK3125D	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	SALMI BIN SANUSI	Driver (Insured):	MUHAMMAD SYAFIQ BIN HAMIDE
Make/Model:	MAZDA 3, 1.5 L 4-DOOR SEDAN SP.6EAT (A)	Vehicle Reg. Date:	12/01/2017
Vehicle Colour:	BLUE	Chassis No:	JM6BN22A8H0137395
Engine No:	P520423115		
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	0		
Present Location:	CHENG HOE MOTOR PTE LTD (YISHUN)		

Not Authorized
11 Days @
Repair After Paint
16 days

COST OF CLAIMS	Amount
Parts	16,684.00
Miscellaneous Items	80.00
Labour	4,670.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	21,434.00
+ GST 7.00% (\$)	1,500.38
Nett Amount (\$)	22,934.38

This claim is handled by: SHARON CHIONG BENG CHOON

Generated using Merimen e-Claims Internet Estimation & Adjusting System

22664

REPAIR DETAILS

SLK 3125D

TP/CHINA

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 18 Apr 2022)

Parts: 143 MAZDA 3 1.5 L 4-DOOR SEDAN SP.6EAT (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
1	1		*1 PC FRT BUMPER	By	0.00	*850.00 F	✓
2	1		*1 PC FRT BUMPER REINFORCEMENT	By	0.00	*220.00 F	✓
3	1		*2 PCS FRT BUMPER SIDE RETAINERS @12/PC	Di?	0.00	*24.00 F	✓
4	1		*1 PC FRT BUMPER CENTRE LOWER COVER	CM	0.00	*35.00 F	✓
5	1		*1 PC FRT BUMPER TRIANGLE GARNISH	CM	0.00	*20.00 F	✓
6	1		*8 PCS FRT BUMPER CLIPS @2/PC	Mc	0.00	*16.00 F	✓
7	1		*8 PCS FRT BUMER RIVETS @4/PC	Mc	0.00	*32.00 F	✓
8	1		*1 PC FRT BUMPER LOWER COVER	Di?	0.00	*120.00 F	✓
9	1		*1 PC FRT GRILLE BASE	CM	0.00	*280.00 F	✓
10	1		*1 PC FRT GRILLE LOGO	Di?	0.00	*28.00 F	✓
11	1		*2 PCS FRT GRILLE MOULDINGS @180/PC	CM	0.00	*360.00 F	✓
12	1		*1 PC FRT GRILLE TOP COVER	Di?	0.00	*250.00 F	✓
13	1		*1 PC FRT NUMBER PLATE GARNISH	Di?	0.00	*65.00 F	✓
14	1		*2 PCS HEADLAMPS @530/PC	CM	0.00	*1,060.00 F	✓
15	1		*1 PC FRT SUPPORT PANEL	CM	0.00	*420.00 F	✓
16	1		*1 PC FRT SUPPORT PANEL TOP PANEL	By	0.00	*95.00 F	✓
17	1		*1 PC BONNET	By	0.00	*550.00 F	✓
18	1		*1 PC BONNET LOCK	By	0.00	*115.00 F	✓
19	1		*1 PC BONNET INNER RUBBER	By	0.00	*45.00 F	✓
20	1		*1 PC BONNET LOCK COVER	Di?	0.00	*18.00 F	✓
21	1		*1 PC BONNET CABLE	By	0.00	*30.00 F	✓
22	1		*2 PC BONNET HINGES @24/PC	Di?	0.00	*48.00 F	✓
23	1		*1 PC FRT SUPPORT TOP GARNISH	CM	0.00	*85.00 F	✓
24	1		*8 PCS FRT SUPPORT TOP GARNISH CLIPS @2/PC	Mc	0.00	*16.00 F	✓
25	1		*1 PC FRT SUPPORT TOP GARNISH EXTENSION	Di?	0.00	*18.00 F	✓
26	1		*2 PCS FRT FENDERS @200/PC	By	0.00	*400.00 F	✓
27	1		*1 PC FRT LH FENDER INNER SHIELD	CM	0.00	*80.00 F	✓
28	1		*1 PC AIR-CON CONDENSER	By	0.00	*600.00 F	✓
29	1		*1 PC AIR-CON CONDENSER FAN MOTOR	By	0.00	*160.00 F	✓
30	1		*1 PC AIR-CON CONDENSER FAN BLADE	Di?	0.00	*80.00 F	✓
31	1		*1 PC AIR-CON DISCHARGE HOSE	By	0.00	*125.00 F	✓
32	1		*1 PC AIR-CON RECEIVER HOSE	Di?	0.00	*135.00 F	✓
33	1		*1 PC WIPER TANK	Di?	0.00	*120.00 F	✓
34	1		*1 PC RADIATOR	By	0.00	*430.00 F	✓
35	1		*1 PC RADIATOR FAN COWLING	CM	0.00	*180.00 F	✓
36	1		*1 PC RADIATOR FAN BLADE	Di?	0.00	*80.00 F	✓
37	1		*1 PC RADIATOR FAN MOTOR	By	0.00	*160.00 F	✓
38	1		*1 PC RADIATOR TOP HOSE	By	0.00	*33.00 F	✓
39	1		*1 PC RADIATOR SPARE TANK	Di?	0.00	*35.00 F	✓
40	1		*1 SET RADIATOR AIR-GUARD	CM	0.00	*48.00 F	✓
41	1		*1 PC AIR FILTER HOUSING	CM	0.00	*230.00 F	✓
42	1		*1 PC AIR FILTER DUCTING	Di?	0.00	*85.00 F	✓
43	1		*1 PC AIR FILTER RESONATOR	Di?	0.00	*45.00 F	✓
44	1		*1 PC INLET MANIFOLD	CM	0.00	*550.00 F	✓
45	1		*1 PC THROTTLE BODY	CM	0.00	*400.00 F	✓
46	1		*1 PC ENGINE RH MOUNTING	By	0.00	*180.00 F	✓
47	1		*1 PC ENGINE LH MOUNTING	CM	0.00	*135.00 F	✓
48	1		*1 PC ENGINE FRT MOUNTING	By	0.00	*140.00 F	✓
49	1		*1 PC ENGINE UNDER CROSS MEMBER	By	0.00	*1,300.00 F	✓
50	1		*1 PC ENGINE UNDER COVER	CM	0.00	*140.00 F	✓
51	1		*1 PC STEERING AIR-BAG	By	0.00	*1,100.00 F	✓
52	1		*1 PC STEERING AIR-BAG WIRE SENSOR	Mc	0.00	*145.00 F	✓

Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
53	1		*1 PC PASSENGER AIR-BAG	<i>Amst</i> 0.00	0.00	*1,400.00 F ✓
54	1		*1 PC DASHBOARD	<i>Tm</i> 0.00	0.00	*950.00 F ✓
55	1		*2 PCS FRT SAFETY BELTS @820/PC	<i>Tm</i> 0.00	0.00	*1,640.00 F ✓
56	1		*1 PC AIR-BAG SENSOR	<i>Am</i> 0.00	0.00	*85.00 F ✓
57	1		*1 PC AIR-BAG ECU	<i>Am</i> 0.00	0.00	*550.00 F ✓
58	1		*1 PC HORN HIGH	0.00	0.00	<i>cm</i> *78.00 F ✓
59	1		*1 PC HORN LOW	0.00	0.00	<i>cm</i> *65.00 F ✓
Total Parts (S\$)						16,684.00

F=Franchise part.

Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<u>Miscellaneous Items</u>			
1	1	1 PC FRT NUMBER PLATE	<i>mis</i> 35.00 ✓
2	1	1 UNIT COOLANT	<i>Am</i> 45.00 ✓
Sub Total (S\$)			80.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TOWING	New	50.00 ✓
2	REMOVE & REFIX AIRCON,CHECK,VACUUM & REFILL GAS	New	100.00 ✓
3	REMOVE & REFIX AIR-BAG ASSY,SAFETY BELT AND RESET SYSTEM	New	200.00 ✓
4	REMOVE & REFIX FRT BUMPER ASSY,HEADLAMPS,GRILLE,BONNET & ATTACHMENT,RIADIATOR & MOTOR,FRT BOTH FENDERS,SUPPORT PANEL,TO STRAIGHTEN,KNOCK & REPAIR FRT RH CHASSIS,RENEW FRT LH CHASSIS,FRT BOTH WHEEL HOUSINGS AND REALIGN THE SAME	New	<i>1100</i> 1,800.00
5	REMOVE & REFIX FRT BOTH UNDER CARRIAGE,ENGINE UNDER CROSS MEMBER	New	380.00 <i>250</i>
6	REMOVE & REFIX ENGINE,INLET MANIFOLD,THROTTLE BODY,CHECK AND REPLACE ENGINE MOUNTINGS AND RESET ENGINE	New	380.00 <i>250</i>
7	PUTTY & RESPRAY ON FRT LH DOOR,FRT BUMPER,REINFORCEMENT,FRT BOTH FENDERS,BONNET,FRT BOTH CHASSISS AND WHEEL HOUSINGS AND ALL AFFECTED AREAS	New	<i>1200</i> 1,300.00
8	REMOVE & REFIX DASHBOARD,METER ASSY,FRT LH FUSES BOX ASSY AND CHECK WIRING	New	<i>250</i> 300.00
9	RUSTPROOFING	New	100.00 ✓
10	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	New	<i>Am</i> 60.00 X ✓
Gross Labour Cost (S\$)			4,670.00

Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 24 May 2022)

Parts: 143 MAZDA 3 1.5 L 4-DOOR SEDAN SP.6EAT (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Cheng Hoe Motor Pte Ltd/SLK3125D/24/05/2022 18:37

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*1 PC STARTER	0.00	0.00	*450.00 F ✓
2	1		*1 PC BATTERY TRAY	0.00	0.00	*55.00 F ✓
3	1		*2 PCS FRT GRILLE SIDE GARNISH @32/PC	0.00	0.00	*64.00 F ✓
4	1		*2 PCS FRT GRILLE INNER SIDE HOLDER @18/PC	0.00	0.00	*36.00 F ✓
5	1		*2 PCS FRT GRILLE INNER SIDE HOLDER PIN @5/PC	0.00	0.00	*10.00 F ✓
6	1		*1 PC FRT GRILLE INNER CENTRE BRACKET	0.00	0.00	*60.00 F ✓
7	1		*10 PCS FRT GRILLE RIVETS @3.5/PC	0.00	0.00	*35.00 F ✓
8	1		*1 PC PASSENGER AIRBAG WIRE HARNESS	0.00	0.00	*120.00 F ✓
9	1		*1 PC FRT BRACE PANEL	0.00	0.00	*35.00 F ✓
10	1		*1 PC FRONT WINDSCREEN MOULDING	0.00	0.00	*45.00 F ✓
11	1		*1 PC FRT BUMPER UNDER COVER	0.00	0.00	*60.00 F ✓

F=Franchise part.

Total Parts (S\$) 970.00

Cheng Hoe Motor Pte Ltd/SLK3125D/24/05/2022 18:37. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
1	1	1 PC FRT WINDSCREEN SEALANT	40.00 ✓
Sub Total (S\$)			40.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
1	REMOVE AND REFIT FRONT WINDSCREEN GLASS	New	100.00 ✓
2	TO REPAIR ENGINE WIRE HARNESS AND RESET SYSTEM	New	120.00 ✓
Gross Labour Cost (S\$)			220.00

Cheng Hoe Motor Pte Ltd/SLK3125D/24/05/2022 18:37. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

CHENG HOE MOTOR PTE LTD

110, 112, 114, 116, 118, 120, 122, 124, 126, 128, 130, 132, 134, 136, 138, 140, 142, 144, 146, 148, 150, 152, 154, 156, 158, 160, 162, 164, 166, 168, 170, 172, 174, 176, 178, 180, 182, 184, 186, 188, 190, 192, 194, 196, 198, 200, 202, 204, 206, 208, 210, 212, 214, 216, 218, 220, 222, 224, 226, 228, 230, 232, 234, 236, 238, 240, 242, 244, 246, 248, 250, 252, 254, 256, 258, 260, 262, 264, 266, 268, 270, 272, 274, 276, 278, 280, 282, 284, 286, 288, 290, 292, 294, 296, 298, 300, 302, 304, 306, 308, 310, 312, 314, 316, 318, 320, 322, 324, 326, 328, 330, 332, 334, 336, 338, 340, 342, 344, 346, 348, 350, 352, 354, 356, 358, 360, 362, 364, 366, 368, 370, 372, 374, 376, 378, 380, 382, 384, 386, 388, 390, 392, 394, 396, 398, 400, 402, 404, 406, 408, 410, 412, 414, 416, 418, 420, 422, 424, 426, 428, 430, 432, 434, 436, 438, 440, 442, 444, 446, 448, 450, 452, 454, 456, 458, 460, 462, 464, 466, 468, 470, 472, 474, 476, 478, 480, 482, 484, 486, 488, 490, 492, 494, 496, 498, 500, 502, 504, 506, 508, 510, 512, 514, 516, 518, 520, 522, 524, 526, 528, 530, 532, 534, 536, 538, 540, 542, 544, 546, 548, 550, 552, 554, 556, 558, 560, 562, 564, 566, 568, 570, 572, 574, 576, 578, 580, 582, 584, 586, 588, 590, 592, 594, 596, 598, 600, 602, 604, 606, 608, 610, 612, 614, 616, 618, 620, 622, 624, 626, 628, 630, 632, 634, 636, 638, 640, 642, 644, 646, 648, 650, 652, 654, 656, 658, 660, 662, 664, 666, 668, 670, 672, 674, 676, 678, 680, 682, 684, 686, 688, 690, 692, 694, 696, 698, 700, 702, 704, 706, 708, 710, 712, 714, 716, 718, 720, 722, 724, 726, 728, 730, 732, 734, 736, 738, 740, 742, 744, 746, 748, 750, 752, 754, 756, 758, 760, 762, 764, 766, 768, 770, 772, 774, 776, 778, 780, 782, 784, 786, 788, 790, 792, 794, 796, 798, 800, 802, 804, 806, 808, 810, 812, 814, 816, 818, 820, 822, 824, 826, 828, 830, 832, 834, 836, 838, 840, 842, 844, 846, 848, 850, 852, 854, 856, 858, 860, 862, 864, 866, 868, 870, 872, 874, 876, 878, 880, 882, 884, 886, 888, 890, 892, 894, 896, 898, 900, 902, 904, 906, 908, 910, 912, 914, 916, 918, 920, 922, 924, 926, 928, 930, 932, 934, 936, 938, 940, 942, 944, 946, 948, 950, 952, 954, 956, 958, 960, 962, 964, 966, 968, 970, 972, 974, 976, 978, 980, 982, 984, 986, 988, 990, 992, 994, 996, 998, 1000

TP INSURER:

MUHAMMAD SYAFIQ BIN HAMIDE

Singapore

China Taiping Insurance (Singapore) Pte. Ltd. (HQ)

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	TP/CHINA(SJP1370Y)
Policy No:	DMPCSNW00263572101	Date of Loss:	07/04/2022
Vehicle Reg. No.:	SLK3125D	Driveable?	
Party At Fault:	UNKNOWN	Driver (Insured):	MUHAMMAD SYAFIQ BIN HAMIDE
Driver (TP):	SALMI BIN SANUSI	Vehicle Reg. Date:	12/01/2017
Make/Model:	MAZDA 3, 1.5 L 4-DOOR SEDAN	Chassis No:	JM6BN22A8H0137395
Vehicle Colour:	SP.6EAT (A)		
Engine No:	BLUE		
Odometer:	P520423115		
	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	0		
Present Location:	CHENG HOE MOTOR PTE LTD (YISHUN)		

Not Authorized
11 Days &
Repair After Point
16 days

COST OF CLAIMS

	Amount
Parts	16,684.00
Miscellaneous Items	80.00
Labour	4,670.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	21,434.00
+ GST 7.00% (S\$)	1,500.38
Nett Amount (S\$)	22,934.38

This claim is handled by: SHARON CHIONG BENG CHOON

Generated using Merlimen e-Claims Internet Estimation & Adjusting System

SLK 3125
Thumbed in
on 5/12/22

Qty	Part No	Particulars	%Disc	%Depr	Amount
53	1	*1 PC PASSENGER AIR-BAG			
54	1	*1 PC DASHBOARD			
55	1	*2 PCS FRT SAFETY BELTS @820/PC			
56	1	*1 PC AIR-BAG SENSOR			
57	1	*1 PC AIR-BAG ECU			
58	1	*1 PC HORN HIGH			
59	1	*1 PC HORN LOW			
Total Parts (\$\$)					16,684.00

Avr	0.00	0.00	*1,400.00 F
Tom	0.00	0.00	*550.00 F
Jan	0.00	0.00	*1,640.00 F
Mar	0.00	0.00	*85.00 F
Apr	0.00	0.00	*550.00 F
May	0.00	0.00	*78.00 F
Jun	0.00	0.00	*65.00 F

Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39 Not valid without Reference section
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
Miscellaneous Items			
1	1	1 PC FRT NUMBER PLATE	35.00
2	1	1 UNIT COOLANT	45.00
Sub Total (\$\$)			80.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	TOWING	New	50.00
2	REMOVE & REFIX AIRCON,CHECK,VACUUM & REFILL GAS	New	100.00
3	REMOVE & REFIX AIR-BAG ASSY,SAFETY BELT AND RESET SYSTEM	New	200.00
4	REMOVE & REFIX FRT BUMPER ASSY,HEADLAMPS,GRILLE,BONNET & ATTACHMENT,RIADIATOR & MOTOR,FRT BOTH FENDERS,SUPPORT PANEL,TO STRAIGHTEN,KNOCK & REPAIR FRT RH CHASSIS,RENEW FRT LH CHASSIS,FRT BOTH WHEEL HOUSINGS AND REALIGN THE SAME	New	1100 1,800.00 1100
5	REMOVE & REFIX FRT BOTH UNDER CARRIAGE,ENGINE UNDER CROSS MEMBER	New	380.00 7250
6	REMOVE & REFIX ENGINE,INLET MANIFOLD,THROTTLE BODY,CHECK AND REPLACE ENGINE MOUNTINGS AND RESET ENGINE	New	380.00 7250
7	PUTTY & RESPRAY ON FRT LH DOOR,FRT BUMPER,REINFORCEMENT,FRT BOTH FENDERS,BONNET,FRT BOTH CHASSIS AND WHEEL HOUSINGS AND ALL AFFECTED AREAS	New	1200 1,300.00 1200
8	REMOVE & REFIX DASHBOARD,METER ASSY,FRT LH FUSES BOX ASSY AND CHECK WIRING	New	250 300.00 750
9	RUSTPROOFING	New	100.00
10	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT <i>re alignment steering wheel</i>	New	60.00
Gross Labour Cost (\$\$)			4,670.00

Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Parts \$16239.
Add Supp \$ 970
\$ 120 SN
Labour \$ 3560
Add Supp Labour \$ 200
\$ 21089
4/5 \$ 16,850
16 days

Attn: MR Kenneth Kong

SLK 3125D
TP/CHINA
7P/CHINA

Print Code: 16 Apr 2022
Cheng Hoe Motor Pte Ltd/SLK3125D/18/04/2022 12:39
Further Info: Items values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*1 PC FRT BUMPER			*850.00 F
2	1		*1 PC FRT BUMPER REINFORCEMENT			*220.00 F
3	1		*2 PCS FRT BUMPER SIDE RETAINERS @12/PC			*24.00 F
4	1		*1 PC FRT BUMPER CENTRE LOWER COVER			*35.00 F
5	1		*1 PC FRT BUMPER TRIANGLE GARNISH			*20.00 F
6	1		*8 PCS FRT BUMPER CLIPS @2/PC			*16.00 F
7	1		*8 PCS FRT BUMPER RIVETS @4/PC			*32.00 F
8	1		*1 PC FRT BUMPER LOWER COVER			*120.00 F
9	1		*1 PC FRT GRILLE BASE			*280.00 F
10	1		*1 PC FRT GRILLE LOGO			*28.00 F
11	1		*2 PCS FRT GRILLE MOULDINGS @180/PC			*360.00 F
12	1		*1 PC FRT GRILLE TOP COVER			*250.00 F
13	1		*1 PC FRT NUMBER PLATE GARNISH			*65.00 F
14	1		*2 PCS HEADLAMPS @530/PC			*1,060.00 F
15	1		*1 PC FRT SUPPORT PANEL			*420.00 F
16	1		*1 PC FRT SUPPORT PANEL TOP PANEL			*95.00 F
17	1		*1 PC BONNET			*550.00 F
18	1		*1 PC BONNET LOCK			*115.00 F
19	1		*1 PC BONNET INNER RUBBER			*45.00 F
20	1		*1 PC BONNET LOCK COVER			*18.00 F
21	1		*1 PC BONNET CABLE			*30.00 F
22	1		*2 PC BONNET HINGES @24/PC			*48.00 F
23	1		*1 PC FRT SUPPORT TOP GARNISH			*85.00 F
24	1		*8 PCS FRT SUPPORT TOP GARNISH CLIPS @2/PC			*16.00 F
25	1		*1 PC FRT SUPPORT TOP GARNISH EXTENSION			*18.00 F
26	1		*2 PCS FRT FENDERS @200/PC			*400.00 F
27	1		*1 PC FRT LH FENDER INNER SHIELD			*80.00 F
28	1		*1 PC AIR-CON CONDENSER			*600.00 F
29	1		*1 PC AIR-CON CONDENSER FAN MOTOR			*160.00 F
30	1		*1 PC AIR-CON CONDENSER FAN BLADE			*80.00 F
31	1		*1 PC AIR-CON DISCHARGE HOSE			*125.00 F
32	1		*1 PC AIR-CON RECEIVER HOSE			*135.00 F
33	1		*1 PC WIPER TANK			*120.00 F
34	1		*1 PC RADIATOR			*430.00 F
35	1		*1 PC RADIATOR FAN COWLING			*180.00 F
36	1		*1 PC RADIATOR FAN BLADE			*80.00 F
37	1		*1 PC RADIATOR FAN MOTOR			*160.00 F
38	1		*1 PC RADIATOR TOP HOSE			*33.00 F
39	1		*1 PC RADIATOR SPARE TANK			*35.00 F
40	1		*1 SET RADIATOR AIR-GUARD			*48.00 F
41	1		*1 PC AIR FILTER HOUSING			*230.00 F
42	1		*1 PC AIR FILTER DUCTING			*85.00 F
43	1		*1 PC AIR FILTER RESONATOR			*45.00 F
14	1		*1 PC INLET MANIFOLD			*550.00 F
5	1		*1 PC THROTTLE BODY			*400.00 F
5	1		*1 PC ENGINE RH MOUNTING			*180.00 F
1	1		*1 PC ENGINE LH MOUNTING			*135.00 F
1	1		*1 PC ENGINE FRT MOUNTING			*140.00 F
1	1		*1 PC ENGINE UNDER CROSS MEMBER			*1,300.00 F
1	1		*1 PC ENGINE UNDER COVER			*140.00 F
1	1		*1 PC STEERING AIR-BAG			*1,100.00 F
1	1		*1 PC STEERING AIR-BAG WIRE SENSOR			*145.00 F