



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

TP/DS

ESTIMATE

Account Details			Account No.		Customer Details		
THIRD PARTY CLAIM vehicle Granded			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335		
			Document No. 0				
			Document Date 18/04/2022				
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00
L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount	
1	Z	BP-SUNDRY-MS SUNDRIES TP VEH:SHD6130C ACC DATE:14/04/2022 TP INS: NO OF REPAIR DAYS: TOW-IN:14/04/2022 DATE SURVEY: BY: AUTHORISED ON: -TP/DS CLAIM				30.00	
2	S	BP-SUBLET TO SUPPLY FRONT NUMBER PLATE WITH CASING.				68.00	
3	B	BP-ECU2 TO RESET ECU AND REPROGRAMME				180.00	
4	B	BP-MECH2 R/I AIRCON CONDENSER/RADIATOR TO FACILITATE REPAIRS.				360.00	
5	B	BP-LAB2 TO CHECK WIRING AND LIGHTING. TO FOCUS HEADLAMP.				122.40	
6	B	BP-LAB2 TO REPLACE FRONT ACCIDENT DAMAGE PARTS. STRAIGHTEN/REALIGN ALL OTHER AFFECTED AREAS.				4320.00	
7	B	BP-RES2 TO SPRAY PAINT ON FRONT ACCIDENT AFFECTED AREAS.				3540.00	
8	Z	BP-SLANT SUPPLY SEALANT (NETT) FOR REAR BOOTLID, REAR END PANEL AND SPARE TYRE PANEL.				180.00	
For & on behalf of Borneo Motors (Singapore) Pte Ltd			Customer's Signature		Charge Summary		Total
			Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less
							Amount Due

Customer Copy



Borneo Motors


Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No.		Customer Details		
THIRD PARTY CLAIM			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335		
			Document No. 0				
			Document Date 18/04/2022				
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00
L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount	
9	B	BP-MECH2 R/I REAR EXHAUST PIPR TO FACILITE REPAIRS.				720.00	
10	B	BP-MECH2 R/I FUEL TANK AND ATTACHMENT TO FACILITE REPAIRS.				720.00	
11	B	BP-WS R/I REAR WINDSCREEN TO FACILITE REPAIRS.				436.00	
12	B	BP-LAB2 TO CONDUCT WATER LEAK TEST.				122.40	
13	B	BP-LAB2 R/I REVERSE SENSOR TO FACILITE REPAIRS AND TEST FUNCTION.				180.00	
14	B	BP-LAB2 TO TRANSFER REAR BOOTLID MECHANISM TRIMMING AND OTHER ATTACHMENT				360.00	
15	B	BP-LAB2 R/I REAR CARPET, TRIMMING, REAR SEATS AND OTHER ATTACHMENT TO FACILITE REPAIRS.				720.00	
16	B	BP-LAB2 TO REPLACE REAR ACCIDENT DAMAGE PARTS. STRAIGHTEN/REALIGN ALL OTHER AFFECTED AREAS.				7200.00	
17	B	BP-RES2 TO SPRAY PAINT ON REAR ACCIDENT AFFECTED AREAS.				5900.00	
18	1	S81110-0D310 HEADLAMP ASSY, RH	1.00	730.50		730.50	
19	2	S81150-0D310 HEADLAMP ASSY, LH	1.00	730.50		730.50	
20	3	S85315-0D101 JAR, WASHER, A	1.00	154.60		154.60	
For & on behalf of Borneo Motors (Singapore) Pte Ltd			Customer's Signature		Charge Summary		Total
			Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less
							Amount Due

Customer Copy



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No.		Customer Details			
THIRD PARTY CLAIM			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335			
			Document No. 0					
			Document Date 18/04/2022					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
21	4	S88460-0D390 CONDENSER ASSY			1.00	1678.00		1678.00
22	5	S16400-0M070 RADIATOR ASSY			1.00	2343.30		2343.30
23	6	S16361-0M050 FAN			1.00	257.70		257.70
24	7	S16711-0M030 SHROUD, FAN			1.00	314.90		314.90
25	8	S52119-0D996 COVER, FR BUMPER, L			1.00	525.80		525.80
26	9	S52721-0D902 MOULDING, FR BUMPER			1.00	16.30		16.30
27	0	S53112-0D120 GRILLE, RADIATOR, LW			1.00	97.20		97.20
28	1	S52021-0D090 REINFORCEMENT SUB-AS			1.00	423.90		423.90
29	2	T52011-52021 ARM SUB-ASSY, FR			1.00	276.60		276.60
30	3	T52012-52020 ARM SUB-ASSY, FR			1.00	224.50		224.50
31	4	S53164-0D031 BRACKET, RADIATOR SU			1.00	62.30		62.30
32	5	S53165-0D031 BRACKET, FR BUMPER S			1.00	62.30		62.30
33	6	S52617-0D050 ABSORBER, RADIATOR S			1.00	116.60		116.60
34	7	S52535-0D061 RETAINER,FR BUMPER S			1.00	68.40		68.40
35	8	S52536-0D061 RETAINER FR BUMPER S			1.00	68.40		68.40
36	9	T90159-50353 SCREW, W/WASHER			2.00	2.20		4.40
37	0	S53111-0D300 GRILLE,RADIATOR			1.00	490.50		490.50
38	1	S75301-0D010 EMBLEM SUB-ASSY, FR			1.00	71.60		71.60
39	2	S53201-0D130 SUPPORT SUB-ASSY, RA			1.00	1138.00		1138.00
40	3	S53221-0D010 BRACE, RADIATOR SUPP			1.00	101.60		101.60
For & on behalf of		Customer's Signature		Charge Summary		Total		
Borneo Motors (Singapore) Pte Ltd		Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less		
						Amount Due		

Customer Copy



Borneo Motors

inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No.		Customer Details			
THIRD PARTY CLAIM			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335			
			Document No. 0					
			Document Date 18/04/2022					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
41	4	S53222-0D010 BRACE, RADIATOR SUPP			1.00	101.60		101.60
42	5	S53285-0D061 SEAL RADIATOR SIDE A			1.00	28.20		28.20
43	6	S53286-0D061 SEAL,RADIATOR SIDE A			1.00	28.20		28.20
44	7	S53287-0D031 EXTENSION,RADIATOR S			1.00	47.80		47.80
45	8	S53288-0D031 EXTENSION RADIATOR			1.00	48.70		48.70
46	9	S53301-0D100 HOOD SUB-ASSY			1.00	664.00		664.00
47	0	S53510-0D181 LOCK ASSY, HOOD			1.00	111.00		111.00
48	1	S53410-0D170 HINGE ASSY, HOOD, RH			1.00	57.80		57.80
49	2	S53420-0D170 HINGE ASSY, HOOD, LH			1.00	57.80		57.80
50	3	SPZ061-0D014 00 PRIMER SENSOR			1.00	162.66		162.66
51	4	S17430-0M061 PIPE ASSY, EXHUAUST T			1.00	879.20		879.20
52	5	S17565-0M020 SUPPORT, EXHAUST PIP			3.00	24.70		74.10
53	6	S81550-0D330 LAMPASSY,RRCOMBINATI			1.00	291.40		291.40
54	7	S81560-0D330 LAMPASSY,RRCOMBINATI			1.00	291.40		291.40
55	8	T81497-52030 COVER, RR			1.00	3.50		3.50
56	9	T81498-52030 COVER, RR			1.00	3.50		3.50
57	0	T81496-52020 GUIDE, RR			4.00	2.70		10.80
58	1	S81910-0D010 REFLECTOR ASSY, REFL			1.00	97.90		97.90
59	2	S81920-0D010 REFLECTOR ASSY, REFL			1.00	97.90		97.90
60	3	S52159-0D983 COVER, RR BUMPER L/C			1.00	525.80		525.80
For & on behalf of		Customer's Signature		Charge Summary		Total		
Borneo Motors (Singapore) Pte Ltd		Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less		
						Amount Due		

Customer Copy



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No.		Customer Details			
THIRD PARTY CLAIM			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335			
			Document No. 0					
			Document Date 18/04/2022					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
61	4	S52161-0K040 PIECE, RR BUMPER			4.00	4.30		17.20
62	5	S52575-0D070 RETAINER, RR BUMPER			1.00	109.20		109.20
63	6	S52576-0D070 RETAINER, RR BUMPER			1.00	109.20		109.20
64	7	S52155-0D030 SUPPORT, RR BUMPER S			1.00	36.90		36.90
65	8	S52156-0D030 SUPPORT, RR BUMPER S			1.00	36.90		36.90
66	9	S52591-0D080 SEAL, RR BUMPER SIDE			1.00	53.60		53.60
67	0	S52592-0D080 SEAL, RR BUMPER SIDE			1.00	53.60		53.60
68	1	S58307-0D101 PANEL SUB-ASSY, BODY			1.00	738.00		738.00
69	2	S58311-52210 PAN RR FLOOR			1.00	739.90		739.90
70	3	S58327-0D081 INSULATOR, MAIN MUFF			1.00	45.60		45.60
71	4	S61601-0D160 PANEL SUB-ASSY, QUAR			1.00	1115.30		1115.30
72	5	S61063-0D010 TROUGH SUB-ASSY, LUG			1.00	136.10		136.10
73	6	S61602-0D180 PANEL SUB-ASSY, QUAR			1.00	1115.30		1115.30
74	7	S61064-0D010 TROUGH SUB-ASSY, LUG			1.00	136.10		136.10
75	8	T08826-08115 PANEL BONDING AD			2.00	267.20		534.40
76	9	S62940-06030 DUCT A/S, QTR VENT			1.00	144.90		144.90
77	0	S75573-0D050 MOULDING, BACK W/D, OS			1.00	87.20		87.20
78	1	T64813-52080 DAM, BACK WINDOW			1.00	45.70		45.70
79	2	T21000-20 SIKA 182010 SIKA TACK GO! (BLA			2.00	108.00		216.00
80	3	T21000-22 SIKA 207. G+P ADHESIVE PRIMER			1.00	200.00		200.00
For & on behalf of		Customer's Signature		Charge Summary		Total		
Borneo Motors (Singapore) Pte Ltd		Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less		
						Amount Due		

Customer Copy



Borneo Motors

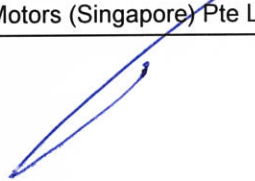
Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No.		Customer Details			
THIRD PARTY CLAIM			S1000020 / TPCLAIM		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335			
			Document No. 0					
			Document Date 18/04/2022					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
81	4	S64401-0D090 PANEL SUB-ASSY, LUGG			1.00	706.10		706.10
82	5	S64461-0D050 WEATHERSTRIP, LUGGAG			1.00	205.80		205.80
83	6	T64503-12150 ARM SUB-ASSY, LUG			2.00	62.70		125.40
84	7	S64610-0D030 LOCK ASSY, LUGGAGE C			1.00	112.90		112.90
85	8	S64621-06050 STRIKER, LUGGAGE COM			1.00	11.30		11.30
86	9	S58387-0D010 PLATE, RR FLOOR FINI			1.00	236.40		236.40
87	0	T90467-08186 B4 CLIP			2.00	2.90		5.80
88	1	S64995-0D030 BOX, DECK FLOOR, RH			1.00	251.50		251.50
89	2	S64997-0D030 BOX, DECK FLOOR, LH			1.00	201.40		201.40
90	3	S64770-06120 COVER ASY, SPARE WHL			1.00	252.70		252.70
91	4	S64743-0D010 DOOR, DECK SIDE BOX,			1.00	62.60		62.60
92	5	S64744-0D010 DOOR, DECK SIDE BOX,			1.00	47.80		47.80
93	6	S64727-0D020 PAD, LUGGAGE COMPART			1.00	302.90		302.90
94	7	S64711-0D080 C0 MAT, LUGGAGE COMPART			1.00	425.80		425.80
95	8	S64719-0D030 C0 COVER, LUGGAGECOMPART			1.00	199.50		199.50
96	9	S75442-0D070 PLATE, LUGGAGE COMPT			1.00	52.10		52.10
97	0	S75431-02090 EMBLEM, LUGGAGE COMP			1.00	65.30		65.30
98	1	S75444-0D070 PLATE, LUGGAGE COMPT			1.00	44.00		44.00
99	2	S76801-0D906 GARNS/A, LUGCOMPTDOOR			1.00	200.00		200.00
100	3	T58651-22H91 SHEET, RR FLOOR			1.00	219.90		219.90
For & on behalf of Borneo Motors (Singapore) Pte Ltd			Customer's Signature		Charge Summary		Total	
			Please acknowledge receipt of vehicle		Parts		Less	
					Labour			
					Sublet			
					Lubrication/Fluid			
					Others		Amount Due	

Customer Copy



Borneo Motors

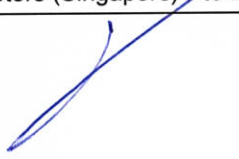
Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
17 UBI ROAD 4
SINGAPORE 408611, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details			Account No. S1000020 / TPCLAIM		Customer Details			
THIRD PARTY CLAIM			Document No. 0		Mdm Yeo Ling May 10 Limau Terrace Singapore 465808 Mobile: 92340335			
			Document Date 18/04/2022					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2010	NCP93R	BEPGKT G1	12/11/2010	SJZ3073P	0	21740	69DS/SJZ3073P	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
MR053HY9305161433		1NZY079462	60	Raymond Seah L M	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
101	4	T90269-06017 RIVET			2.00	4.00		8.00
102	5	S08889-80102 COOLANT,SLLC&&&			2.00	84.30		168.60
For & on behalf of Borneo Motors (Singapore) Pte Ltd		Customer's Signature		Charge Summary		Total 48,276.86		
		Please acknowledge receipt of vehicle		Parts	23,118.06	GST 7.00%	3,379.38	
				Labour	25,090.80	Less	0.00	
				Sublet	68.00			
				Lubrication/Fluid	0.00			
				Others	0.00	Amount Due	51,656.24	

Customer Copy