

ASS. REQ. BY:

REF: LPC /Kenneth

ASSIGNMENT

From: _____

Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

4-6 days

Res.: Yes or No

Lum Sum: _____

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SLA 73724 Yr Regn: 03 16Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: _____

BMW 520i C.C. 1997

Colour: _____

M. Grey A/C: Insured / Std / NI / NA

Sp. Reading: _____

50586 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

WBA5A 320200 82P210Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / R/Rim or

Tyre Size: _____

F: 225/55R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. _____

7 mm

R/Bal. _____

7 mm

L/Bal. _____

7 mm

L/Bal. _____

7 mm

D.O.A. _____

17/4/22

D.O.I. _____

19/4/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair: _____

1)

☐

: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: _____

☐

: Site Insp (\$ _____)

Survey Fee: _____

Transportation: _____

☐

: Interview (\$ _____)

: Fuel (\$ _____)

☐

: Tech Invs (\$ _____)

: Others (\$ _____)

☐

: Weekend (\$ _____)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$ _____)

Tropical Tech Automobile Services

Blk 5030, Ang Mo Kio Avenue 3, #01-201, Industrial Park 2, Singapore 569535
Tel : 6481 7773 / 6481 1403 Fax : 6484 4978
E-mail : tasc303@singnet.com.sg

M/s : **Lonpac Insurance Bhd**
300, Beach Road, #17-04 / 07,
The Concourse,
Singapore 199555

Estimate bill : TT 13 / 22 / TP / WT

Registration No : SLA7372H

Make model : BMW 520ia (F10)

Attn : Motor Claims Department
6250 7388
Tel : 6296 3767
Fax :

NOT Authorised
11 Rmp @
Permy After Pain
4-6 days

Mileage :

Date : 19 / 04 / 2022

**TRAFFIC ACCIDENT INVOLVING VEHICLE BEARING REGISTRATION NO : YP6714D AND SLA7372H
ALONG NEW BRIDGE ROAD (JUNCTION OF NEW BRIDGE ROAD AND PICKERING STREET) ON 17
APRIL 2022 AT ABOUT 0905HRS.**

2sets	Front seat head-rest repair kit	(Each \$419.00)	\$	838.00	X
1pc	Rear boot		\$	2,833.00	✓
1pc	Rear boot emblem		\$	146.00	✓
2pcs	Rear boot emblem grommet	(Each \$14.00)	\$	28.00	✓
1pc	Rear boot '520i' designation		\$	141.00	✓
2pcs	Rear boot reflector	(Each \$675.00)	\$	1,350.00	X
1pc	Rear boot outer touch button (Camera)		\$	95.00	✓
1pc	Rear boot upper lock		\$	419.00	X
1pc	Rear boot rubber		\$	230.00	✓
2pcs	Rear tail lamp	(Each \$1079.00)	\$	2,158.00	X
2pcs	Rear tail lamp side garnish	(Each \$1079.00)	\$	2,158.00	X
1pc	Rear end panel		\$	1,349.00	✓
1pc	Rear end panel top garnish		\$	311.00	✓
1pc	Rear floor panel		\$	2,698.00	✓
1pc	Rear floor panel under dust covering (small)		\$	149.00	X
1pc	Rear floor panel under dust covering (Big)		\$	149.00	X
1pc	Rear bumper		\$	2,563.00	✓
Sub A total :			\$	17,615.00	
Less 10% discount :			\$	1,761.50	
A total :			\$	15,853.50	
Total amount of Page 1 :			\$	15,853.50	

Tropical Tech Automobile Services

(Authorised Signature)
William Tan



**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Tropical Tech Automobile Services

Blk 5030, Ang Mo Kio Avenue 3, #01-201, Industrial Park 2, Singapore 569535

Tel : 6481 7773 / 6481 1403 Fax : 6484 4978

E-mail : tasc303@singnet.com.sg

M/s : **Lompac Insurance Bhd**
300, Beach Road, #17-04 / 07,
The Concourse,
Singapore 199555

Estimate bill : TT 13 / 22 / TP / WT

Attn : Motor Claims Department
6250 7388
Tel : 6296 3767
Fax :

Registration No : SLA7372H

Make model : BMW 520ia (F10)

Mileage :

Date : 19 / 04 / 2022

**TRAFFIC ACCIDENT INVOLVING VEHICLE BEARING REGISTRATION NO : YP6714D AND SLA7372H
ALONG NEW BRIDGE ROAD (JUNCTION OF NEW BRIDGE ROAD AND PICKERING STREET) ON 17
APRIL 2022 AT ABOUT 0905HRS.**

4pcs	Rear bumper parktronic sensor	(Each \$419.00)	\$	1,676.00	✓
4pcs	Rear bumper parktronic sensor seal ring	(Each \$14.00)	\$	56.00	✓
1set	Rear bumper parktronic sensor wire harness		\$	243.00	✓
1pc	Rear bumper parking sensor module		\$	1,066.00	X
1pc	Rear bumper towing cover		\$	87.00	✓
2pcs	Rear bumper reflector	(Each \$87.00)	\$	174.00	✓
2pcs	Rear bumper side bracket	(Each \$365.00)	\$	730.00	X
1pc	Rear bumper frame (Top)		\$	176.00	?
1pc	Rear bumper frame (Bottom)		\$	149.00	?
1pc	Rear bumper reinforcement		\$	1,025.00	?
Sub A total :			\$	5,382.00	
Less 10% discount :			\$	538.20	
B total :			\$	4,843.80	


Special net items :

1pc	Rear license smart plate	\$	35.00	X
1pc	Rear license smart plate casing	\$	35.00	
C total :		\$	35.00	

Total amount of Page 2 :

\$ 4,878.80

Tropical Tech Automobile Services

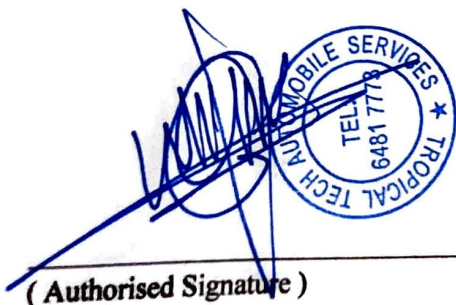
(Authorised Signature)
William Tan

Tropical Tech Automobile Services

Blk 5030, Ang Mo Kio Avenue 3, #01-201, Industrial Park 2, Singapore 569535

Tel : 6481 7773 / 6481 1403 Fax : 6484 4978

E-mail : tase303@singnet.com.sg

Lompac Insurance Bhd
300, Beach Road, #17-04 / 07,
The Concourse,
Singapore 199555

Estimate bill : TT 13 / 22 / TP / WT

Registration No : SLA7372H

Attn : Motor Claims Department
6250 7388
Tel : 6296 3767
Fax :

Make model : BMW 520ia (F10)

Mileage :

Date : 19 / 04 / 2022

**TRAFFIC ACCIDENT INVOLVING VEHICLE BEARING REGISTRATION NO : YP6714D AND SLA7372H
ALONG NEW BRIDGE ROAD (JUNCTION OF NEW BRIDGE ROAD AND PICKERING STREET) ON 17
APRIL 2022 AT ABOUT 0905HRS.**

Remove and transfer rear boot necessary attachment spart part items.

Remove and transfer rear bumper necessary attachment spart part items.

Remove and refit front seat head rest repair kit, rear boot, rear boot emblem, rear boot '520i' designation, rear boot reflectors, rear boot outer touch button (Camera), rear boot upper lock, rear boot rubber, rear tail lamps, rear tail lamp side garnishes, rear end panel top garnish, rear floor panel under dust covering (Small), rear floor panel under dust covering (Big), rear bumper, rear bumper parktronic sensors, rear bumper parktronic sensor seal rings, rear bumper parktronic sensor wire harness, rear bumper parktronic sensor module, rear bumper towing cover, rear bumper reflectors, rear bumper side brackets, rear bumper frame (Top), rear bumper frame (Bottom), rear bumper reinforcement.

Heat / weld / cut / renew rear end panel, heat weld / cut / renew rear floor panel, heat / weld / beating / pull / straighten / align rear chassis alignment jack.

Rear chassis frame by Chassis Aligment jack.

Programming rear bumper parktronic sensor module.

Total amount of Page 3 :

\$	1,800.00	7
\$	450.00	X
\$	800.00	del
\$	3,050.00	

Tropical Tech Automobile Services

(Authorised Signature)

William Tan

Tropical Tech Automobile Services

11K 3030, Ang Mo Kio Avenue 3, #01-201, Industrial Park 2, Singapore 569535

Tel : 6481 7773 / 6481 1403 Fax : 6484 4978

E-mail : tase303@singnet.com.sg

Longpac Insurance Bhd
300, Beach Road, #17-04 / 07,
The Concourse,
Singapore 199555

Attn : Motor Claims Department
Tel : 6250 7388
Fax : 6296 3767

Estimate bill : TT 13 / 22 / TP / WT

Registration No : SLA7372H

Make model : BMW 520ia (F10)

Mileage :

Date : 19 / 04 / 2022

TRAFFIC ACCIDENT INVOLVING VEHICLE BEARING REGISTRATION NO : YP6714D AND SLA7372H
ALONG NEW BRIDGE ROAD (JUNCTION OF NEW BRIDGE ROAD AND PICKERING STREET) ON 17
APRIL 2022 AT ABOUT 0905HRS.

To check & refit rear tail-lamp wiring harness.	\$	80.00	20
Under coating on rear damaged portion.	\$	150.00	7
Putty / primer application, spray painting rear boot, rear end panel, rear floor panel, rear bumper, rear bumper towing cover, rear bumper parktronic sensors.	\$	1,800.00	750
Balance amount brought from Page 1 :	\$	15,853.50	
Balance amount brought from Page 2 :	\$	4,878.80	
Balance amount brought from Page 3 :	\$	3,050.00	
Grand final amount :	\$	25,812.30	

Tropical Tech Automobile Services

(Authorised Signature)
William Tan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages), and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

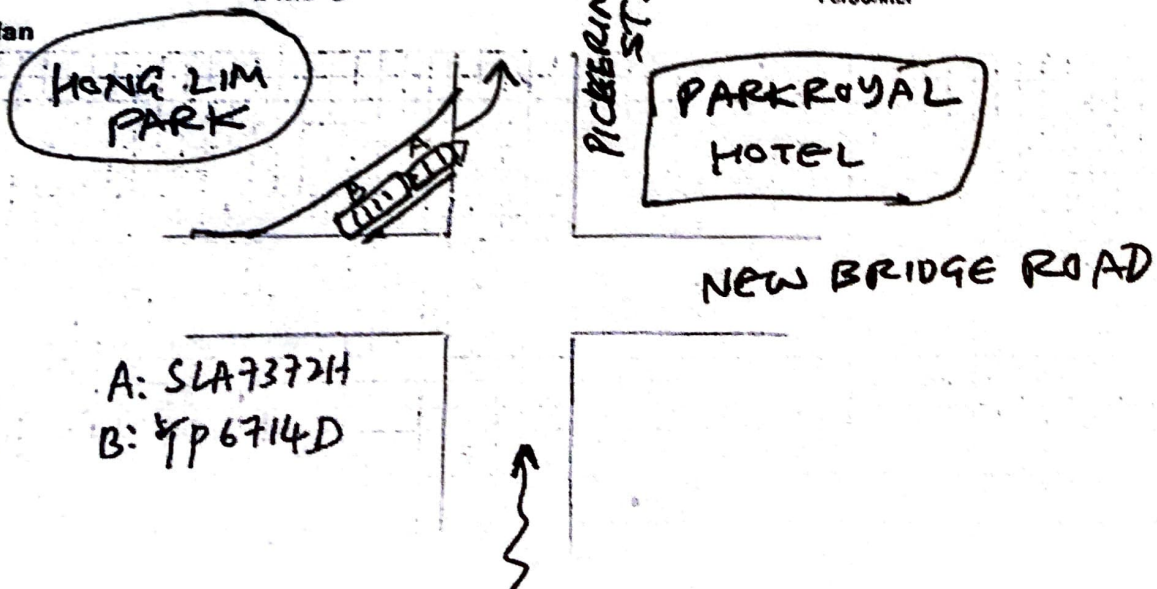

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 18/04/2022 12:00 (SGT)
Date of Accident 17/04/2022 09:05 (SGT)
Exact Location of Accident New Bridge Rd, Singapore
Additional Location Information JUNCTION OF NEW BRIDGE RD AND PICKERING STREET
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLA7372H

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner LIM SOK CHENG JULIE
NRIC No S1459390Z
Email Address PETERCCK@SINGNET.COM.SG
Mobile Phone No (Phone) +65-97328844
Alternative Phone No +65-97328844

VEHICLE PARTICULARS

Manufacturer BMW
Model 520i
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 2000

INSURANCE COMPANY

Name of Insurance Company Sompo Insurance Singapore Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number D22MTPV01004503
Cover Note Number D22MTPV01004503

DRIVER

Name of Driver CHOOO CHEE KONG
NRIC No S2561468B