

08/11/13 wef

ASS. REC. BY: Marcus

REF:

CS/TPS22003682/4443

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SMA3008A

at Workshop m/s

Trans Eurocars 4pm

of

Insured:

Public liability

Policy No.

Claims No.

Sum Insured:

Excess:


(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.

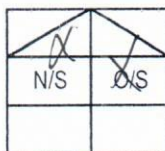

Bal. or Market Value:

£83k.

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

13

days

Res.:

Yes or No

Lum Sum:

1.3.1

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

984e

Vehicle: IN / OUT

Date:

Person Contacted:

LTA 43822

Veh No: SMA3008A

Yr Regn: 27/04/18

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mazda 6

C.C.

1998

Colour

Grey

A/C: Insured / Std / NI / NA

Sp. Reading

81608

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JM66L1071J0146283

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F:

R:

225/55-R17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

S

mm

R/Bal.

S

mm

L/Bal.

S

mm

L/Bal.

S

mm

D.O.A.

21/03/22

D.O.I.

28/4/22

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The vehicle sustained damages at the whole vehicle.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Dep 12.00

The cause of Dene Due to

Spray painting under quote (No D. S. on the front & rear windscreen (door))
 main labour also under quote

28/7/22 11/7 9626.89 informed stephane
 90010684

Date/Time, File Pass to?



Preli. Report

Days Of Repair:

1)



Final Report

Resurvey No. of Trip:

Date/Time, File Return to?

2)

Add Fee:



Site Insp (\$

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

Report Format :

Lump Sum / I.B.I. (\$))



Interview (\$



Tech. Invs (\$



Weekend (\$

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	954E
Vehicle Details	
Vehicle No.:	SMA3008A
Vehicle to be Exported:	No
Intended Deregistration Date:	28 Apr 2022
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA6 SEDAN 2.0 AT EXECUTIVE EU6
Primary Colour:	Grey
Manufacturing Year:	2018
Engine No.:	PE21097965
Chassis No.:	JM6GL1071J0146283
Maximum Power Output:	121.0 kW (162 bhp)
Open Market Value:	\$20,787.00
Original Registration Date:	27 Apr 2018
First Registration Date:	27 Apr 2018
Transfer Count:	0
Actual ARF Paid:	\$21,102.00 10537
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Apr 2028
PARF Rebate Amount:	\$15,826.00
Intended COE Rebate Details	
COE Expiry Date:	26 Apr 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$37,330.00
COE Rebate Amount:	\$22,386.00
Total Rebate Amount:	\$38,212.00

The information contained herein is correct as at 28 Apr 2022

OK



Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#)[Advertiser Login](#)[Ways of Selling](#)

1/2017 Mercedes-Benz S320L 1 Owner Selling \$195800



Fully Agent Unit And Serviced By
Agent! Attractive Financing
Rates And In House.
Privilege Motors StarAd

Sort by results/page

10 vehicles



Mazda 6

Any Category

Advanced Search



Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Mazda 6		Any	Any	2018	Any	Any	Any	Available
	Mazda 6 2.0A		\$94,800	\$12,970 /yr	30-Nov-2018	1,998 cc	57,880 km	Luxury	Available
Immediate transfer of ownership upon collection. Facelifted model. Comes with android auto/apple carplay. 1 owner. Low mileage done....									
Guan Motor Trading Posted: 28-Apr-2022									
	Mazda 6 2.0A		\$86,666	\$12,940 /yr	27-Apr-2018	1,998 cc	34,774 km	Luxury	Available
Underutilized Unit! Vehicle Pre Owned From A Family Man, With Less Than 8694km Drive Per Year, As It Was Hardly Driven For The Past...									
Sincere Motoring Pte Ltd Posted: 26-Apr-2022									
	Mazda 6 2.0A Executive		\$88,600	\$12,850 /yr	22-May-2018	1,998 cc	72,286 km	Luxury	Available
Interest Rate From 1.88%! 100% Accident Free! 1 Owner! Fully Serviced And Maintained By Agent Eurokars! 4 New Tyres! Powerful And...									
The Car Shop Posted: 26-Apr-2022									
	Mazda 6 2.0A Executive		\$85,800	\$12,310 /yr	12-Jun-2018	1,998 cc	70,000 km	Luxury	Available
Full Agent Service. Tip Top Condition Taken Care. Always Park At Condo Carpark. Trade In and Scrap are Welcome. Flexible/100% Loan...									
Posted: 23-Apr-2022									
	Toyota unveils new Voxy and Noah minivans Both the Toyota Voxy and Toyota Noah continue to deliver bold boxy styling alongside remarkably spacious and practical interiors. Find out more!								
	Mazda 6 2.0A Executive		\$87,777	\$12,850 /yr	30-Apr-2018	1,998 cc	60,500 km	Luxury	Available
Cheapest in town. Fully original unit. Full serviced and maintained by agent. Very well kept by owner. Immaculate condition inside out. Q...									
Posted: 23-Apr-2022									
	Mazda 6 2.0A		\$94,800	\$12,970 /yr	27-Nov-2018	1,998 cc	63,000 km	Luxury	Available
1 Meticulous Owner, Facelifted Model, Road Tax Till Nov, Spacious Cabin And Boot, Clean And Neat Interior, 100% Accident Free, Flawles...									
Posted: 23-Apr-2022									
	Mazda 6 2.5A Premium		\$94,800	\$13,540 /yr	22-May-2018	2,488 cc	58,000 km	Luxury	Available
1 Owner Agent Unit! Pristine Condition Owner Selling Due To Upgrading, OCD Owner Clean Every Weekly, STA/VICOM Evaluation Welco...									
Posted: 23-Apr-2022									
	Mazda 6 Wagon 2.5A Premium Sunroof		\$118,800	\$15,980 /yr	30-Nov-2018	2,488 cc	57,614 km	Stationwagon	Available

[Compare](#)

From: Victor Fong <victorfong@toplis.com.sg>

Sent: Wednesday, 20 April 2022 12:12 AM

To: assignments <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; Bryan Ang (LKKAuto) <bryanang@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: 'Peng Peng' <peng.peng@sg.cntaiping.com>; 'Claims Dept of CTI' <claimsdept@sg.cntaiping.com>; jenayak@toplis.com.sg; toplis@outlook.com

Subject: Insured : Gennal Industries Pte Ltd - 4 third party cars affected / stained by the Insured's rooftop spraying painting droplets / works on 21.3.22 | CTI ref. SNC22D200008

Importance: High

Our ref. Y226205

Dear LKK Auto

We are the loss adjuster appointed by China Taiping Insurance (Singapore) Pte Ltd to look into the above captioned matter involving the following 4 third parties cars which were affected by fine spray painting droplets arising from a building contractor's works :-

- 1) Mr Scharenguivel Royston George Jr
(BMW 216i Active tourer car SKV 8325P) :
- | | | |
|------------------|---------------------|--------------|
| - repairs to car | S\$52,387.74 | |
| - loss of use | <u>unquantified</u> | S\$52,387.74 |
- 2) Mr Jerryl How (BMW 216i GT car SKD 5157Y) :
- | | | |
|------------------|-----------------|-----------|
| - repairs to car | S\$ 15,591.29 | |
| - car polish | 500.00 | |
| - loss of use | <u>1,800.00</u> | 17,891.29 |
- 3) Mr James Chua (Mazda 6 car SMA 3008A) :
- | | | |
|------------------|-----------------|-----------|
| - repairs to car | S\$ 10,842.23 | |
| - car polish | 500.00 | |
| - loss of use | <u>3,252.80</u> | 14,595.03 |
- 4) Mr Ronnie Tok (Subaru Forester 2.0I-L car SKM 6318X) :
- | | | |
|------------------|---------------------|-----------|
| - repairs to car | S\$ 17,402.38 | |
| - car polish | 900.00 | |
| - loss of use | <u>unquantified</u> | 18,302.38 |

On behalf of China Taiping Insurance, we would like to appoint LKK Auto to survey / assess the damage directly caused by the spray painting droplets to the 4 third parties cars on a 'without prejudice' basis. Please impress upon the respective motor workshops that your survey is strictly on a without prejudice basis.

Attached are the repair quotations for the respective 4 cars for your attention.

Kindly proceed with the motor survey and let us have your motor survey report (including your estimate for the duration needed for loss of use claim purpose for the said restoration works) as soon as possible.

We shall be informing the 4 respective car owners of your appointment to survey their cars on a without prejudice basis.

You can bill your survey fees for this matter directly to China Taiping Insurance (S) Pte Ltd under their claim reference number - SNC22D200008 for this case.



TRANS EUROAKRS PTE LTD
27A TANJONG PENJURU, SINGAPORE 609042
CASH REPAIR QUOTATION

EUROAKRS SERVICES

Not Authorized
MOROS LK 90096608
28/4/22
wh. phd. At the rep.
including parts.
13 days.

PIP \$9626.88

				WIP :	TBA	
				DATE:	1-Apr-22	
				REPAIR DAY(S)	15	
VEH NO :	SMA3008A	DATE IN :		CONTACT PERSON :	JESS	
CHASSIS NO :	JM6GL1071J0146283	MILEAGE :		TYPE OF CLAIM :	CASH REPAIR	
MODEL :	MAZDA 6	DATE REG.:	27-Apr-18			
NATURE OF WORKS						
DESCRIPTION	QTY	UNIT PRICE	1ST	SUPP	PART NO	PRICES
1 BODY SIDE MIRROR RH	1	475.90			MGSB9-69-121A	✓ Daye 475.90
2 BODY SIDE MIRROR LH	1	475.90			MGSB9-69-181A	✓ Daye 475.90
3 GARNISH TRIANGLE RH	1	45.20			MGHP9-69-15YB	✓ Daye 45.20
4 GARNISH TRIANGLE LH	1	45.20			MGHP9-69-16YB	✓ Daye 45.20
5 MOULD(R),FRT.SASH'A'	1	139.00			MGHP9-50-981F	✓ Daye 139.00
6 MOULD(L),FRT.SASH'A'	1	139.00			MGHP9-50-985E	✓ Daye 139.00
7 MOULD(R),RR.SASH'A' rear	1	122.30			MGHK1-50-991H	✓ Daye 122.30
8 MOULD(L),RR.SASH'A' rear	1	102.90			MGHK1-50-995G	✓ Daye 102.90
9 GARNISH(R),C.PILLAR	1	224.00			MGHK1-50-N10C	✓ Daye 224.00
10 GARNISH(L),C.PILLAR	1	191.10			MGHK1-50-N50C	✓ Daye 191.10
11 CHROME MOULD(R),FRT .BELTLINE	1	96.00			MGHP9-50-640F	✗ SUC 96.00
12 CHROME MOULD(L),FRT .BELTLINE	1	96.00			MGHP9-50-650F	✓ Daye 96.00
13 CHROME MOULD(R),RR.BELTLINE	1	80.40			MGHK1-50-660E	✗ SUC 80.40
14 CHROME MOULD(L),RR.BELTLINE	1	84.70			MGHK1-50-670E	✓ Daye 84.70
15 GARNISH(R),FRT DR (Black)	1	62.40			MGHP9-50-M10D	✓ Daye 62.40
16 GARNISH(L),FRT DR (Black)	1	62.40			MGHP9-50-M20D	✓ Daye 62.40
17 GARNISH(R),REAR DR (Black)	1	87.20			MGHP9-50-M30D	✓ Daye 87.20
18 GARNISH(L),REAR DOOR (Black)	1	97.70			MGHP9-50-M40D	✓ Daye 97.70
19 GARNISH RHR DR fail	1	46.70			MGHK1-50-M50A	✓ Daye 46.70
20 GARNISH LHR DR Black	1	41.60			MGHK1-50-M60A	✓ Daye 41.60
21 GUARD STONE RH ner	1	17.40			MGHP9-50-4P2A	✓ ner 17.40
22 GUARD STONE LH ner	1	17.40			MGHP9-50-4R2A	✓ ner 17.40
23 FRT WINDSCREEN	1	1,499.40			MGRV6-63-900A	✓ Daye 1,499.40
24 MOULD,WINDOW-FRT	1	65.10			MGHP9-50-601	✓ ner 65.10
25 RR WINDSCREEN	1	902.40			MGHK3-63-930E	✓ Daye 902.40
26 MOULD,RR.WINDOW	1	117.10			MGHK1-50-611B	✓ ner 117.10
27 SPACER	1	12.80			MGJ6A-50-897	✓ ner 12.80
28 GLASS RH FRT DOOR	1	294.70			MGR7-58-510	✓ Daye 294.70
29 GLASS LH FRT DOOR	1	294.80			MGR7-59-510	✗ SUC 294.80
30 GLASS RH REAR DOOR	1	339.30			MGHK1-72-510C	✓ Daye 339.30
31 GLASS LH REAR DOOR LH	1	339.30			MGHK1-73-510C	✗ SUC 339.30
32 ARM,WIPER DRIVER	1	146.20			MG44N-67-321A	✓ Daye 146.20

33	WIPER COVER GRILLE RH	1	297.50			MGJE8-50-7R0B	- Dye	297.50
34	WIPER COVER GRILLE LH	1	302.00			MGJE8-50-7S0A	- Dye	302.00
35	MLDG(R),FENDER-FRT wiper	1	49.30			MGHP9-51-PB1A	- Dye	49.30
36	MLDG(L),FENDER-FRT wiper	1	49.30			MGHP9-51-PC1A	- Dye	49.30
37	WEATHERSTRIP, TRUNK	1	135.60			MGHK1-56-951A	x 11	135.60
38	GLASS & HOLDER(R),BODY SIDE MIRROR	1	282.50			MB63C-69-1G1	x 11	282.50
39	GLASS & HOLDER(L),BODY SIDE MIRROR	1	282.50			MB63C-69-1G7	x 11	282.50
40	ARM,WIPER PASSENGER	1	170.60			MGKM1-67-321	- Dye	170.60
41	WIPER BLADE RH	1	57.30			MK068-67-330A	- Dye	57.30
42	WIPER BLADE LH	1	44.00			MK015-67-330	- Dye	44.00
43	COVER WIPER	2	9.20			MGS1M-67-395	x 11	18.40
TOTAL PARTS								8,450.50
LESS 15%								1,267.58
TOTAL PARTS COST								7,182.93
<u>Labour Description</u>								PRICES
1	TO RESPRAY WHOLE CAR (EXTERIOR WITH SAME COLOUR CODE).						2700 .	2,750.00
2	TO REPROGRAMME AFTER REPAIR.						100 .	150.00
3	SUNDRIES.						11 X	50.00
4	RENTAL CAR @ 160.00/DAY X 19 DAYS (INCLUDING SATURDAYS & SUNDAYS) >> REPAIR REQ 15 WORKING DAYS.							3,040.00
NOTES: QUOTATION NOT INCLUDED THE REPLACEMENT CAR FEE. REMARKS: THIS IS ONLY AS ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORM PRIOR BEFORE WE CARRIED OUT THE REPAIRS. TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A QUOTATION FEE OF \$200.00 WILL BE APPLY AS ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.						TOTAL LABOUR	5,990.00	
						TOTAL PARTS	7,182.93	
						TOTAL	13,172.93	
						GST 7%	922.10	
						GRAND TOTAL	14,095.03	

front windscreen solar film rec 280 ✓

rear windscreen solar film rec 280 ✓

front door glass RH solar film rec 140 ✓

rear door glass RH solar film rec 140 ✓

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



TRANS EUROAKRS PTE LTD
27A TANJONG PENJURU, SINGAPORE 609042
CASH REPAIR QUOTATION



CHINA TAIPING INSURANCE P/L		WIP :		58646/49285
3 ANSON ROAD		DATE:		28-Jul-22
#16-00 SPRINGLEAF TOWER		REPAIR DAY(€)		15
SINGAPORE 079909				

VEH NO :	SMA3008A	DATE IN :		CONTACT PERSON :	JESS
CHASSIS NO :	JM6GL1071J0146283	MILEAGE :		TYPE OF CLAIM :	PUBLIC LIABILITY
MODEL :	MAZDA 6	DATE REG.:	27-Apr-18		

NATURE OF WORKS								
	DESCRIPTION	QTY	UNIT PRICE	1ST	SUPP	PART NO		PRICES
1	BODY SIDE MIRROR RH	1	475.90			MGSB9-69-121A	475.90	475.90
2	BODY SIDE MIRROR LH	1	475.90			MGSB9-69-181A	475.90	475.90
3	GARNISH TRIANGLE RH	1	45.20			MGHP9-69-15YB	45.20	45.20
4	GARNISH TRIANGLE LH	1	45.20			MGHP9-69-16YB	45.20	45.20
5	MOULD(R),FRT.SASH'A'	1	139.00			MGHP9-50-981F	139.00	139.00
6	MOULD(L),FRT.SASH'A'	1	139.00			MGHP9-50-985E	139.00	139.00
7	MOULD(R),RR.SASH'A'	1	122.30			MGHK1-50-991H	122.30	122.30
8	MOULD(L),RR.SASH'A'	1	102.90			MGHK1-50-995G	102.90	102.90
9	GARNISH(R),C.PILLAR	1	224.00			MGHK1-50-N10C	224.00	224.00
10	GARNISH(L),C.PILLAR	1	191.10			MGHK1-50-N50C	191.10	191.10
11	CHROME MOULD(R),FRT .BELTLINE	1	96.00			MGHP9-50-640F		96.00
12	CHROME MOULD(L),FRT .BELTLINE	1	96.00			MGHP9-50-650F	96.00	96.00
13	CHROME MOULD(R),RR.BELTLINE	1	80.40			MGHK1-50-660E		80.40
14	CHROME MOULD(L),RR.BELTLINE	1	84.70			MGHK1-50-670E	84.70	84.70
15	GARNISH(R),FRT DR	1	62.40			MGHP9-50-M10D	62.40	62.40
16	GARNISH(L),FRT DR	1	62.40			MGHP9-50-M20D	62.40	62.40
17	GARNISH(R),REAR DR	1	87.20			MGHP9-50-M30D	87.20	87.20
18	GARNISH(L),REAR DOOR	1	97.70			MGHP9-50-M40D	97.70	97.70
19	GARNISH RHR DR	1	46.70			MGHK1-50-M50A	46.70	46.70
20	GARNISH LHR DR	1	41.60			MGHK1-50-M60A	41.60	41.60
21	GUARD STONE RH	1	17.40			MGHP9-50-4P2A	17.40	17.40
22	GUARD STONE LH	1	17.40			MGHP9-50-4R2A	17.40	17.40
23	FRT WINDSCREEN	1	1,499.40			MGRV6-63-900A	1,499.40	1,499.40
24	MOULD,WINDOW-FRT	1	65.10			MGHP9-50-601	65.10	65.10
25	RR WINDSCREEN	1	902.40			MGHK3-63-930E	902.40	902.40
26	MOULD,RR.WINDOW	1	117.10			MGHK1-50-611B	117.10	117.10
27	SPACER	1	12.80			MGJ6A-50-897	12.80	12.80
28	GLASS RH FRT DOOR	1	294.70			MGRT7-58-510	294.70	294.70

29	GLASS LH FRT DOOR	1	294.80			MGRT7-59-510		294.80
30	GLASS RH REAR DOOR	1	339.30			MGHK1-72-510C	339.30	339.30
31	GLASS LH REAR DOOR LH	1	339.30			MGHK1-73-510C		339.30
32	ARM,WIPER DRIVER	1	146.20			MG44N-67-321A	146.20	146.20
33	WIPER COVER GRILLE RH	1	297.50			MGJE8-50-7R0B	297.50	297.50
34	WIPER COVER GRILLE LH	1	302.00			MGJE8-50-7S0A	302.00	302.00
35	MLDG(R),FENDER-FRT	1	49.30			MGHP9-51-PB1A	49.30	49.30
36	MLDG(L),FENDER-FRT	1	49.30			MGHP9-51-PC1A	49.30	49.30
37	WEATHERSTRIP, TRUNK	1	135.60			MGHK1-56-951A		135.60
38	GLASS & HOLDER(R),BODY SIDE MIRROR	1	282.50			MB63C-69-1G1		282.50
39	GLASS & HOLDER(L),BODY SIDE MIRROR	1	282.50			MB63C-69-1G7		282.50
40	ARM,WIPER PASSENGER	1	170.60			MGKM1-67-321	170.60	170.60
41	WIPER BLADE RH	1	57.30			MK068-67-330A	57.30	57.30
42	WIPER BLADE LH	1	44.00			MK015-67-330	44.00	44.00
43	COVER WIPER	2	9.20			MG51M-67-395		18.40
	SUPPLEMENTARY PARTS							
1	MOULD(L),ROOF GJ/GL	1	61.20	—		MGHK1-50-9L0	61.20	61.20
2	MOULD(R),ROOF GJ/GL	1	61.20	✓		MGHK1-50-9H0	61.20	61.20
						TOTAL PARTS	7,043.40	8,572.90
						LESS 15%	1,056.51	1,285.94
						TOTAL PARTS COST	5,986.89	7,286.97

TOTAL	9,626.89	14,116.97
GST 7%	673.88	988.19
GRAND TOTAL	10,300.77	15,105.15

13 REPAIR DAYS (exclude preparation of estimate, wait for survey/authorization/spare parts, Sat/Sun/PH)