

ASS. REC. BY:

REF: ERG/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s Alad's

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: 700

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

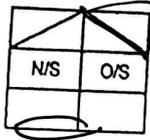

Bal. or Market Value: 8100k

IDAC Accident Rport: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SUR 5959P Yr Regn: 07, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make: Toy Harrier c.c. 1986

Colour: h. Black A/C: Insured / Std / NI / NA

Sp. Reading: 106P30 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZSUBO 0078991

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / RIM or

Tyre Size: F: 225/65R17

R: _____

BS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI/

TOYO/YOKO or

Front

Rear

R/Bal. 5 mm

R/Bal. 6 mm

L/Bal. 5 mm

L/Bal. 6 mm

D.O.A. 1/6/22

D.O.I. 6/6/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rm d/s & Rear n/s
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 Check Sole film insured or not??

Date/Time, File Pass to?

: Prell. Report

Days Of Repair: _____

1)

: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

Survey Fee:

2)

Add Fee: : Site Insp (\$

Transportat.

: Interview (\$

S - RS. SI

: Tech Invs (\$

Fees

: Weekend (\$

Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	033N

Vehicle Details

Vehicle No.:	SLR5959P
Vehicle to be Exported:	Yes
Intended Deregistration Date:	03 Jun 2022
Vehicle Make:	TOYOTA
Vehicle Model:	HARRIER ELEGANCE 2.0 A
Primary Colour:	Brown
Manufacturing Year:	2016
Engine No.:	3ZRB788378
Chassis No.:	ZSU600078991
Maximum Power Output:	111.0 kW (148 bhp)
Open Market Value:	\$28,742.00
Original Registration Date:	27 Jul 2017
First Registration Date:	27 Jul 2017
Transfer Count:	1
Actual ARF Paid:	\$27,239.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Jul 2027
PARF Rebate Amount:	\$20,429.00

Intended COE Rebate Details

COE Expiry Date:	26 Jul 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,501.00
COE Rebate Amount:	\$24,440.00
Total Rebate Amount:	\$44,869.00

The information contained herein is correct as at 02 Jun 2022

OK

Alan's United Auto Pte Ltd (Co.Reg.No:201113667N)

Blk 7 Sin Ming Industrial Estate, #01-76

Singapore 575642

Tel: 6453 8686 Fax: 6459 6550 Email: kennychan@alanutd.com; Janicechou@alanutd.com

RE
Re
Part
Part
Lab
Prin
Vali
Fur

INSURER: **ERGO Insurance Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	022092
Policy No:	DMPG21008036	Date of Loss:	01/06/2022
Vehicle Reg. No.:	SLR5959P	Driveable?	
Driver Age/Info:	32 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	GOH TRANSPORT SERVICES CO.PTE LTD		
Driver:	GOH HONG CHEN (WU FENGCHEN)		

Es
No.

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50

Make/Model:	TOYOTA HARRIER, 2.0 ELEGANCE (A)	Vehicle Reg. Date:	27/07/2017
Vehicle Colour:	BROWN		
Engine No:	3ZRB788378	Chassis No:	ZSU600078991
Odometer:	0 KM		

*Not Authorized
1/1/2022 @
Recovery After Paint
Ex & Food*

Paint Type:
Total Loss? **NO**
Est. Duration of Repair (day) 10 ✓

Present Location: **ALAN'S UNITED AUTO PTE LTD (HQ)**

COST OF CLAIMS

	Amount
Parts	
Miscellaneous Items	15,370.30
Labour	0.00
Paintwork Labour	3,080.00
Towing	0.00
	0.00
Gross Total (S\$)	18,450.30
+ GST 7.00% (S\$)	1,291.52
Nett Amount (S\$)	19,741.82

This claim is handled by: **CHAN YEW SIAH**

40W
40W
45W
7
✓
✓

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 03 Jun 2022)
 Parts: M1-SUV TOYOTA HARRIER 2.0 Elegance (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Alan's United Auto Pte Ltd/SLR5959P/03/06/2022 16:44
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount				
1	1		*FRONT WINDSCREEN GLASS	CM	0.00	0.00	*900.00 F	L		
2	1		*FRONT W/S GLASS RH CORNER GARNISH	DIT	0.00	0.00	*50.00 F	—		
3	1		*FRONT W/S GLASS MOULDING	M	0.00	0.00	*125.00 F	—		
4	1		*FRONT WIPER GARNISH	DL	0.00	0.00	*240.00 F	—		
5	1		*BONNET	R	0.00	0.00	*490.00 F	—		
6	1		*BONNET INSULATOR	R	0.00	0.00	*280.00 F	X		
7	1		*BONNET CHROME	MIT	0.00	0.00	*180.00 F	—		
8	2		*BONNET HINGE	R	0.00	0.00	*140.00 F	X		
9	2		*BONNET DAMPER		0.00	0.00	*380.00 F	—		
10	1		*BONNET INNER LOCK	DIT	0.00	0.00	*95.00 F	—		
11	1		*FRONT SUPPORT PANEL		0.00	0.00	*420.00 F	?		
12	1		*SUPPORT PANLE TOP COVER	DL	0.00	0.00	*210.00 F	—		
13	12		*SUPPORT PANEL TOP COVER CLIP	M	0.00	0.00	*24.00 F	—		
14	2		*SUPPORT PANEL SIDE PANEL	ols R	0.00	0.00	*156.00 F	4		
15	2		*SIDE SUPPORT PANEL SIDE PANEL	ols R	0.00	0.00	*120.00 F	4		
16	2		*SUPPORT PANEL SIDE GUIDE -TOP	ols R	0.00	0.00	*110.00 F	4		
17	2		*SUPPORT PANEL SIDE GUIDE -LOWER	DIT	0.00	0.00	*90.00 F	—		
18	2		*HEADLAMP ASSY	ols CM	N/S	M3CM	0.00	0.00	*2,400.00 F	—
19	2		*HEADLAMP TOP PANEL	ols R	0.00	0.00	*240.00 F	—		
20	1		*RADIATOR ASSY		0.00	0.00	*600.00 F	?		
21	1		*RADIATOR FAN COWLING		0.00	0.00	*140.00 F	?		
22	1		*RADIATOR TOP COVER		0.00	0.00	*85.00 F	?		
23	1		*RADIATOR SPARE TANK	R	0.00	0.00	*160.00 F	X		
24	1		*AIR CON CONDENSER (OEM)		0.00	0.00	*380.00 F	?		
25	1		*AIR CON DISCHARGE PIPE		0.00	0.00	*210.00 F	?		
26	1		*AIR CON SUCTION HOSE		0.00	0.00	*270.00 F	?		
27	1		*AIR CON LIQUID PIPE		0.00	0.00	*320.00 F	?		
28	1		*FRONT GRILLE	CM	0.00	0.00	*280.00 F	—		
29	1		*FRONT BUMPER FASCIA	R	0.00	0.00	*340.00 F	—		
30	2		*FRONT BUMPER SIDE RETAINER	CM/DIT	0.00	0.00	*150.00 F	—		
31	1		*FRONT BUMPER REINFORCEMENT	R	0.00	0.00	*220.00 F	—		
32	1		*FRONT BUMPER SPONGE (CTR)	CM	0.00	0.00	*90.00 F	—		
33	1		*FRONT BUMPER LOWER GRILLE	DL	0.00	0.00	*170.00 F	—		
34	1		*FRONT BUMPER TOP BEAM	R	0.00	0.00	*180.00 F	—		
35	2		*FRONT BUMPER SIDE BEAM	ols R	0.00	0.00	*220.00 F	4		
36	2		*FRONT BUMPER SIDE SPONGE	ols CM	0.00	0.00	*110.00 F	4		
37	1		*FRONT BUMPER RH TOWING COVER	MIT	0.00	0.00	*28.00 F	—		
38	1		*FRONT BUMPER UNDER COVER	R	0.00	0.00	*170.00 F	X		
39	2		*FRONT RH DOOR HINGE	R	0.00	0.00	*90.00 F	X		
40	1		*FRONT RH BUMPER FOGLAMP		0.00	0.00	*135.00 F	?		
41	1		*FRONT RH BUMPER FOGLAMP COVER		0.00	0.00	*60.00 F	?		
42	1		*FRONT RH FENDER	R	0.00	0.00	*480.00 F	—		
43	1		*FRONT RH FENDER INNER SHIELD	DIT	0.00	0.00	*190.00 F	—		
44	1		*FRONT RH FENDER TOP GARNISH	DIT	0.00	0.00	*115.00 F	—		
45	1		*TAIL GATE	R	0.00	0.00	*600.00 F	—		

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
46	2		*TAIL GATE GLASS SIDE MOULDING	<i>Ne</i> 0.00	0.00	*70.00 F ✓
47	1		*TAIL GATE HARRIER EMBLEM	<i>Ne</i> 0.00	0.00	*45.00 F ✓
48	1		*REAR BUMPER FASCIA	<i>Ne/Red</i> 0.00	0.00	*580.00 F ✓
49	1		*REAR BUMPER LOWER SPOILER	<i>Ne</i> 0.00	0.00	*240.00 F ✓
50	1		*REAR LH BUMPER SIDE RETAINER	<i>DIT</i> 0.00	0.00	*45.00 F ✓
51	1		*FRONT W/S GLASS SEALANT	<i>Ne</i> 0	0.00	*60.00 FS <i>401N</i>
52	1		*ERP IU BRACKET	0	0.00	<i>Ne</i> *25.00 FS ✓
53	1		*REAR W/S GLASS SEALANT	<i>Ne</i> 0	0.00	*60.00 FS <i>401N</i>
54	1		*FRONT NO.PLATE WITH BOX	0	0.00	<i>Ne</i> *50.00 FS <i>455N</i>
55	1		*FRONT W/S GLASS SOLAR FILM	<i>In kind ??</i>	0	*350.00 FS ?
56	1		*RADIATOR COOLANT	0	0.00	<i>Ne</i> *30.00 FS ✓
57	1		*FRONT BUMPER CLIP (SET)	0	0.00	<i>Ne</i> *30.00 FS ✓

F=Franchise part. S=SpcNett.

Sub Total (S\$) **14,028.00**
 + Margin on L,N Items 10.00% (S\$) **1,342.30**

Total Parts (S\$) 15,370.30

Alan's United Auto Pte Ltd/SLR5959P/03/06/2022 16:44. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM	New	60.00 <i>201</i>
2	TO REMOVE AIR CON CONDENSER ,PIPES,DRIER,VACUUM AIR CON SYSTEM & RECHARGE GAS	New	120.00 <i>1001</i>
3	TO REMOVE & RENEW FRONT W/S GLASS AND CONDUCT WATER LEAK TEST	New	150.00 <i>1201</i>
4	TO REMOVE & REFIX REAR W/S GLASS AND CONDUCT WATER LEAK TEST	New	150.00 <i>1201</i>
5	TO PUTTY AND SPRAY REPLACED PARTS	New	1,400.00 <i>1201</i>
6	TO REMOVE ,CUT OUT DAMAGED PARTS,PANEL BEATING,WELDING,ALIGN,REFIX AND TO RENEW ABOVE PARTS	New	1,200.00 <i>1001</i>
Gross Labour Cost (\$\$)			3,080.00

Alan's United Auto Pte Ltd/SLR5959P/03/06/2022 16:44. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that :
 (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 (ii) Investigating the accident and/or my claims;
 (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
 (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Chen
 Policyholder's Signature / Date & Time

Chen
 Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature]
 Witnessed by Reporting Centre Personnel

Sketch Plan

AYE towards City

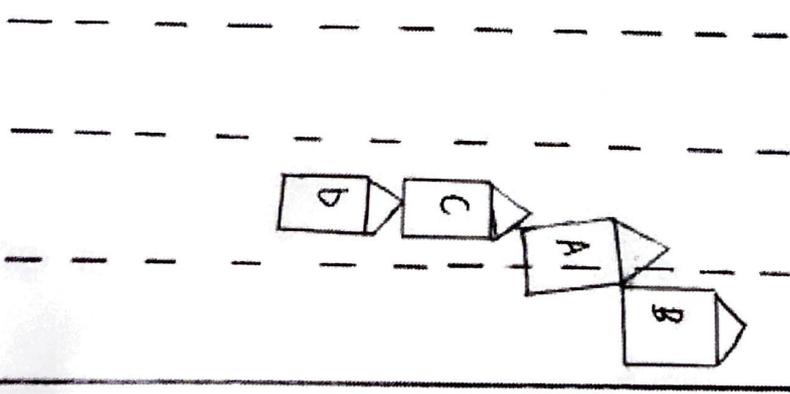

A = SLR5959P

B = SMV4799H

C = SL S2369G

D = YN5744J