



PRIORITY SERVICES

Insurance Loss Adjusters and Motor Appraisers

Blk 779 Yishun Avenue 2

#01-1545 Singapore 760779

Tel: 6293 4822 Fax: 6296 3283

E-mail: admin@priorityservices.sg

Messrs. Sompoo Insurance Pte Ltd
50 Singapore Land Tower
#05-01/06 Raffles Place
Singapore 048623

Bill No : DN/00852/20

Date : 27/4/2020

Dr.

To

Survey Fee (S\$) : 200.00

Photographs (S\$) :

Transport (S\$) :

Resurvey (S\$) :

Miscellaneous (S\$) :

Services rendered including photographs and transport charges

(S\$) : 200.00

Our Reference : TP-0097/04/20

Insured : SLF 8031 J

Date Of Accident : 31/12/2019

Policy / Cert. No. : Paper Survey


Your Claim No : CMTD200051/RUC

Vehicle : BMW 730 Li (A) - SJZ 1200 C

Dollars : Two Hundred ONLY

For PRIORITY SERVICES

E & O.E.

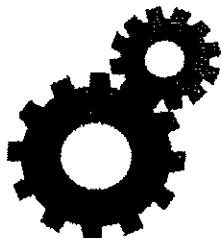

PRIORITY SERVICES

Insurance Loss Adjusters and Motor Appraisers
Blk 779 #01-1545 Yishun Ave 2 Singapore 760779
Tel: 62934822 Fax: 62963283
E-mail: admin@priorityservices.sg

Date: 27 April 2020

Your Ref: CMTD200051/RUC

Our Ref: TP-0097/04/20

Motor Claims Department
M/s. Sompo Insurance Pte. Ltd.
50 Raffles Place #05-01/06
Singapore Land Tower
Singapore 048623

Attention: Ms. Ruth Chua

Madam,

Inspection of 2006 BMW 730 Li (A)
Registration No.: SJZ 1200 C
Odometer Reading: 109705 km
Chassis No.: WBAHN22010DE96707

We refer to your instructions to us to conduct a paper survey of the above vehicle. A pre-repair survey was conducted on 08-01-2020, followed by inspection of dismantled parts on 09-01-2020 and resurvey after repairs on 15-01-2020.

The following documents were received: -

- 1) Copy of survey report by M/s. PAR Automotive Consultancy
- 2) 86 copies of photos depicting damages sustained by SJZ 1200 C
- 3) Accident reports by drivers of SJZ 1200 C and SLF 8031 J

The vehicle sustained front damages during an accident on 31-12-2019.

Repair cost submitted was \$7,000.00 lump-sum.

We append below our findings: -

<u>Replacement of Parts</u>		<u>Revised Amount</u>	<u>Our Recommendation</u>
1pc.	Front bumper fascia – repaired	\$ 1,500.00	\$ -
1pc.	Front bumper reinforcement – refitted	771.13	-
1pc.	Front bumper side retainer LH – not necessary	90.00	-
1pc.	Front bumper bracket LH – refitted	95.00	-
1pc.	Front bumper protector LH – refitted	160.00	-
1pc.	Front bumper protector chrome – refitted	95.00	-

10pcs.	Front bumper clip	\$ 30.00	\$ 30.00
1pc.	Front bumper centre air grille – refitted	125.00	-
1pc.	Front bumper headlamp nozzle – no evidence of damage	145.00	-
1pc.	Front bumper headlamp nozzle cover – no evidence of damage	70.00	-
1pc.	Front bumper sponge – serviceable	120.00	-
1pc.	Front fog lamp LH – no evidence of damage	280.00	-
1pc.	Front fog lamp cover LH – refitted	75.00	-
1pc.	Front headlamp LH – RH not replaced/LH not affected	2,400.00	-
1pc.	Bonnet – not affected	-	-
1pc.	Bonnet logo BMW – not necessary	58.85	-
1pc.	Rear number plate garnish front	75.00	75.00
		<u>\$ 6,089.98</u>	<u>\$ 105.00</u>

Special Nett Items:-

2pcs.	Front bumper parking sensor – no evidence of damage	\$ 760.00	\$ -
1pc.	Front number plate	40.00	40.00
	Total For Parts:-	<u>\$ 6,889.98</u>	<u>\$ 145.00</u>

Labour Charges:-

To repair front support panel, front bumper. To remove and refit above parts inclusive of replacement parts.	\$ 660.00	\$ 600.00
To putty, respray painting and polish front bumper.	880.00	300.00
To check and rectify wiring system.	40.00	40.00
To analysis and reset electrical module system.	380.00	180.00
Total:-	<u>\$ 8,849.98</u>	<u>\$ 1,265.00</u>
Lump-sum repairs:	\$ 7,000.00	-
Part-By-Part (mainly labour charges)	-	\$ 1,265.00

Estimated period of repairs: 3 working days

Pre-accident Market Value : About \$ 52,000.00
COE rebate : \$ 29,893.00

Vehicle within economical limit to repair.

We leave the decision of settlement to you.

Assuring you of our best services always

Yours faithfully

PRIORITY SERVICES

A handwritten signature in blue ink, appearing to read 'Jimmy S. T. Lee', with a long horizontal flourish extending to the right.

JIMMY S. T. LEE AMSOE, AMIRTE, MSAAA
Motor Appraiser

Surveyed by:

A handwritten signature in blue ink, appearing to read 'Lawrence Ng', with a circular flourish at the bottom.

LAWRENCE NG, MSAAA
Motor Appraiser