

ASS. REC. BY:

REF:

012/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

12506

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

☒	☐
N/S	O/S
☐	☐

Bal. or Market Value: 8130k

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10 days Res.: Yes or NoLum Sum: 1.81 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: _____

Yr Regn: _____

SMP 4721m 09, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: _____

Toy

Noah

c.c

1797

Colour

M. Beige

A/C:

Insured / Std / NI / NA

Sp. Reading

245465

T/Radio:

Insured / Std / NI / NA

Eng/No: _____

C/No: _____

FWR80

0395723

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: _____

R: _____

215/50ZR17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Tourader

Front

Rear

R/Bal.

7

mm

R/Bal.

6

mm

L/Bal.

7

mm

L/Bal.

6

mm

D.O.A.

15/6/22

D.O.I.

20/6/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FR N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 / Bonnet unable to open.

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

)

\$ + RS. SI

)

: Fuel

)

: Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 048486
Date calculated: 18/06/2022 11:02 AM

Full Report
Registration: SMP4721M
Printed: 18/06/2022 11:02 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	15/06/22
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	TOYOTA
Model:	NOAH
Sub Model:	X
Model Sheet Number:	70 NB 03
Registration:	SMP4721M
VIN number:	
Odometer:	245465
Model Specs	
AIR CONDITIONING	2.0 LTR 113KW
	CVT AUTO GEARBOX

Not Wharfedale
Runny B&P paint
Ex @ 1250/h
10 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R FRONT PROTECTIVE COVER		2.0	8.40
NO NUMBER	R + R FRONT MANUFACTURER BADGE		1.0	4.20
NO NUMBER	R + R FRONT BUMPER TRIM		5.0	21.00
NO NUMBER	R + R L/ENGINE COMPARTMENT COVER		1.0	4.20
NO NUMBER	RENEW BOTH HEADLAMPS (BUMPER REMOVED)		5.0	21.00
	INCLUDES: ADJUST HEADLAMPS			
NO NUMBER	RENEW RADIATOR GRILLE		6.0	25.20
NO NUMBER	RENEW FRONT BUMPER (RADIATOR GRILLE REMOVED)		15.0	63.00
	INCLUDES: FRONT BUMPER AND REQUIRED ATTACHED PARTS R + R			
NO NUMBER	RENEW FRONT PANEL CPL		13.0	54.60
NO NUMBER	RENEW LEFT FRONT WING BRACKET		5.0	21.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)		2.0	8.40
	INCLUDES: ABSORBER REMOVE AND REFIT			
NO NUMBER	RENEW L/FRT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R		8.0	33.60

Code	Description	WU	Price SGD
NO NUMBER	NOT INCLUDED: HEADLAMP AND R + R BUMPER R + R RIGHT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER	7.0	29.40
NO NUMBER	RENEW BONNET INCLUDES: R + R BONNET, ATTACH PARTS ASSEMBLE AND IF NEC RENEW	6.0	25.20
NO NUMBER	R + R WIRE LINKAGE	1.0	4.20
NO NUMBER	R + R WINDSCREEN INCLUDES: WIPER ARMS, COWL COVER, A-PILLAR TRIMS, INSIDE MIRROR AND ALL NECESSARY ATTACHED PARTS REMOVE & REFIT	39.0	163.80
NO NUMBER	R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT	2.0	8.40
NO NUMBER	RENEW WINDSCREEN FRAME COVER (REMOVED)	2.0	8.40
NO NUMBER	DRAIN AIR CONDITIONING	4.0	16.80
NO NUMBER	R + R COMPRESSOR PIPE	1.0	4.20
NO NUMBER	RENEW CONDENSER (BUMPER REMOVED) INCLUDES: REFILL AIR CONDITIONING	13.0	54.60
NO NUMBER	RENEW RADIATOR INCLUDES: BLEED COOLING SYSTEM	10.0	42.00
NO NUMBER	R + R AIR CLEANER CPL	4.0	16.80
NO NUMBER	R + R STEERING COLUMN TRIM	2.0	8.40
NO NUMBER	R + R LEFT FRONT WHEEL	1.0	4.20
NO NUMBER	R + R RIGHT FRONT WHEEL	1.0	4.20
NO NUMBER	R + R TYRE/S AND/OR WHEEL/S	3.0	12.60
NO NUMBER	R + R L/F WHEEL/TYRE	2.0	8.40
NO NUMBER	R + R L/F TYRE PRESSURE SENSOR	1.0	4.20
NO NUMBER	R + R FRONT ABS SENSOR ADD/WORK	3.0	12.60
NO NUMBER	R + R LEFT FRONT ABS SENSOR	1.0	4.20
NO NUMBER	R + R FRONT SHOCK ABSORBER ADD/WORK	9.0	37.80
NO NUMBER	R + R LEFT FRONT SHOCK ABSORBER	2.0	8.40
NO NUMBER	R + R L/F CONTROL ARM REAR	1.0	4.20
NO NUMBER	RENEW FRONT AXLE SUPPORT	19.0	79.80
NO NUMBER	DETACH + REFIT FRONT AXLE SHAFT	9.0	37.80
NO NUMBER	R + R LEFT FRONT DRIVE SHAFT	2.0	8.40
NO NUMBER	R + R L/F STEERING KNUCKLE	1.0	4.20
NO NUMBER	DETACH + REFIT L/F + R/F WHEEL HUB	5.0	21.00
NO NUMBER	BALANCE WHEEL/S	1.0	4.20

Labour Cost

Panel / Mechanical Labour

Hrs	WU	
21.50	215.0	903.00

Total of Labour

903.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	17.0	
	L/F WING NEW PART PAINTING	11.0	
	FRONT PANEL CPL SURFACE PAINT	5.0	
	CTR PNL CARRIER BAR SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	GRILLE NEW PART PAINT K1R	10.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	41.11
0741	L/F WING NEW PART PAINTING	20.55
1009	FRONT PANEL CPL SURFACE PAINT	5.28
1187	CTR PNL CARRIER BAR SURFACE PAINT	2.11
31	FRONT BUMPER NEW PART PAINT K1R	46.07
10	GRILLE NEW PART PAINT K1R	39.09

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		58.0	
Preparation Main Work Metal	0.70	7.0	29.40
Preparation Comp. Work Plastic	0.30	3.0	12.60
Total	10 WU/h	68.0	285.60

Material Cost - Paint

	Price SGD
New Part Painting	61.66
New Part Painting - Plastic K1R	85.16
Surface-/Blend Paint	7.39
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	181.31

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
0281	FRONT BUMPER	52119 2J995	Original	Tn 330.00 ✓
0317	L/F BUMPER BRACKET	52116 28090	Original	CM 55.00 ✓
0318	R/F BUMPER BRACKET	52115 28220	Original	Pa 55.00 X
0327	FRT BUMPER ABSORBER	52611 28110	Original	CM 58.00 ✓
0340	FRT BUMPER SUPPORT	52131 28170	Original	Ry 175.00 ✓
0347	L/FOG LAMP COVER	52040 28030	Original	hry 55.00 ✓
0375	LWR RADIATOR GRILLE	53112 28220	Original	145.00 ?
0389	FRT LWR BUMP SPOILER	52618 28030	Original	Pa 90.00 X
0394	LOWER FRONT SPOILER	53152 28040	Original	n J 120.00 X
0410	GRILLE	53101 28390	Original	440.00 ?
0415	FRONT BUMPER TRIM	53105 28030	Original	120.00 ?

Code	Description	Part Number	Part Source	Price SGD
0431	MANUFACTURER BADGE	75301 28170	Original	60.00 ?
0471	BONNET	53301 28160	Original	360.00 —
0473	BONNET MOULDING	75770 28120	Original	205.00 X
0475	L/F HINGE	53420 28100	Original	45.00 —
0476	R/F HINGE	53410 28100	Original	45.00 —
0483	BONNET INSULATION	53341 28080	Original	150.00 X
0493	BONNET LOCK	53510 28160	Original	68.00 X
0495	BONNET STAY	53440 28031	Original	45.00 X
0515	BONNET FRT CTR SEAL	53381 28111	Original	65.00 X
0561	LEFT HEADLAMP ASSY	81170 28721	Original	1,250.00 —
0562	RIGHT HEADLAMP ASSY	81130 28D01	Original	1,250.00 ?
0741	L/F WING	53812 28240	Original	380.00 —
0743	L/F WING RR MOULDING	53828 28160	Original	78.00 —
0773	L/F WING BRACKET	53878 28170	Original	40.00 —
0841	L/F WHEELHOUSE COVER	53806 28100	Original	105.00 —
0897	L/F MUDFLAP	53852 28040	Original	48.00 ?
1009	FRONT PANEL CPL	53205 28200	Original	715.00 —
1027	L/AIR FUNNEL	53286 28080	Original	38.00 ?
1028	R/AIR FUNNEL	53285 28080	Original	38.00 X
1037	CTR PNL CARRIER BAR	53209 28090	Original	50.00 X
1367	L/WINDSCREEN MLDG	75552 28070	Original	60.00 —
1368	R/WINDSCREEN MLDG	75551 28070	Original	60.00 —
1391	CENTRE COWL TRIM	55708 28191	Original	240.00 ?
1401	WINDSCREEN	56101 28901	Original	1,050.00 —
1419	WINDSCREEN SEAL	56117 64010	Original	0.00 X
4465	CONDENSER CPL	88460 28650	Original	560.00 X
4481	COMPR OUTL LINE	88711 28A00	Original	285.00 X
4482	CONDENS OUTL LINE	88710 28A00	Original	315.00 X
7011	FRT AXLE CARRIER	51201 28231	Original	1,050.00 ?
7035	L/DRIVE SHAFT CPL	43420 68010	Original	680.00 X
7053	L/F TRACK CONT ARM	48069 29255	Original	315.00 ?
7077	L/FR SHOCK ABSORBER	48520 80356	Original	205.00 ?
7081	L/F STEERING KNUCKLE	43212 44040	Original	195.00 X
7091	L/F STRUT BEARING	48609 28050	Original	90.00 X
7131	L/F WHEEL HUB	43502 42020	Original	110.00 X
7201	L/FR WHEEL	42611 28711	Original	1,200.00 X
7245	L/F ABS SENSOR	89543 28160	Original	120.00 X
7271	L/F STABI ROD	48820 44020	Original	75.00 X
7271	L/TIE ROD BALL JOINT	45046 49095	Original	65.00 X
7271	RADIATOR CPL	16400 37280	Original	680.00 ?
7767	RADIATOR SHROUD	16711 37120	Original	145.00 ?
7773	RADIATOR OUTLET HOSE	16571 37190	Original	75.00 ?
7775	L/UPP RADIATOR HOSE	16572 37170	Original	110.00 ?
7793	L/BLOWER FAN	16361 28260	Original	40.00 X
7794	R/BLOWER FAN	16361 28180	Original	40.00 X
7797	L/FAN MOTOR	16363 23010	Original	185.00 X
7798	R/FAN MOTOR	16363 23010	Original	185.00 X
8373	LOWER INTAKE HOUSING	17893 37110	Original	70.00 ?
8375	AIR INTAKE HOSE	17751 37140	Original	60.00 ?
8376	AIR HOSE ADAPTER	17752 37140	Original	75.00 ?
8391	AIR FILTER ASSY	17700 37280	Original	385.00 ?
8783	L/ENG COMPART COVER	51442 28160	Original	115.00 X
9645	LOW TONE HORN	86520 28180	Original	55.00 X
9646	HIGH TONE HORN	86510 28130	Original	55.00 X

Code	Description	Part Number	Part Source	Price SGD
1000	INVERTER WATER PUMP	WATER PUMP	Original	240.00 7
1001	TRIM PANEL RH	HEADLAMP TRIM	Original	58.00 X
1002	TRIM PANEL LH	HEADLAMP TRIM	Original	58.00 ✓
1003	ENGINE LOWER COVER	ENG. LWR COVER	Original	75.00 7
Savings				0.00
Subtotal				16,059.00
Total				16,059.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Final Calculation

	SGD	SGD
Parts		
Total Parts	16,059.00	16,059.00
Labour Time Base 10 WU/h		
Total 215.0 WU X 42.00 SGD/h	903.00	
Total of Labour		903.00
Paint Work Time Base 10 WU/h		
Labour Cost 68.0 WU X 42.00 SGD/h	285.60	
Material Cost	181.31	
Total Paint Including Material		466.91
Repair Cost Excludes GST		17,428.91
GST (+7.0%)		1,220.02
Repair Cost Included GST		18,648.93

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 427B

Vehicle Details

Vehicle No.: SMP4721M

Vehicle to be Exported: Yes

Intended Deregistration Date: 23 Jun 2022

Vehicle Make: TOYOTA

Vehicle Model: NOAH HYBRID 7-SEATER 1.8X CVT

Primary Colour: Brown

Manufacturing Year: 2019

Engine No.: 2ZR0D99170

Chassis No.: ZWR800395723

Maximum Power Output: 100.0 kW (134 bhp)

Open Market Value: \$33,439.00

Original Registration Date: 26 Sep 2019

First Registration Date: 26 Sep 2019

Transfer Count: 0

Actual ARF Paid: \$28,815.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 25 Sep 2029

PARF Rebate Amount: \$21,611.00

Intended COE Rebate Details

COE Expiry Date: 25 Sep 2029

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$40,001.00

COE Rebate Amount: \$29,022.00

Total Rebate Amount: \$50,633.00

Information contained herein is correct as at 17 Jun 2022

OK

SD08226G0004 / Ding Auto Pte Ltd
ENTRY DATE & TIME: 16/06/2022 16:02 (SGT)
SUBMITTED BY: Nora/Rena
VERSION: 1 (16/06/2022 16:02 (SGT))

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 16/06/2022 16:02 (SGT)
Date of Accident 15/06/2022 21:45 (SGT)
Exact Location of Accident Singapore
Additional Location Information 15 LEONIE HILL ROAD
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMP4721M

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner LIM PENG HUAT
NRIC No SXXXX427B
Email Address HUATHUAT592@GMAIL.COM
Mobile Phone No (Phone) +65-91170519
Alternative Phone No +65-91170519

VEHICLE PARTICULARS

Manufacturer Toyota
Model Noah
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private hire
Transmission Auto
CC 1797

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMHCSNW00007942100
Cover Note Number DMHCSNW00007942100

DRIVER

Name of Driver LIM PENG HUAT
NRIC No SXXXX427B

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time
16-06-2022

Driver's Signature (if driver is not the policyholder) / Date & Time
16-06-2022 @ 12:15

Witnessed by Reporting Personnel
Liam Yap



Sketch Plan

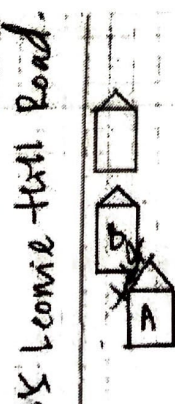

A = GMP 47x1 M
B = GLN 51 P