

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0717/2022/EQ
DATE : 20-Aug-22
WIP : 38117

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 22/8/2022.

AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY

#07-16 AIG BUILDING

SINGAPORE 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR. PANG YOKE CHEE
ADDRESS : 259 YISHUN ST 22
#07-73
SINGAPORE 760259
TELEPHONE : HP +65 94777263
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 2100470586-06
VEHICLE NO : **SLD 9374 Z**
MODEL CODE : AUDI A4 SEDAN 1.4 TFSI S-TRONIC
MODEL YEAR : 30/6/2016
ENGINE NO : CVN 013726
CHASSIS NO : WAUZZZF41GA106230
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 18-Aug-22
PLACE OF ACCIDENT : SERANGOON NORTH AVE 1 NEAR BLK 119

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLD 9374 Z

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND TRANSFER LHS FRONT DOOR AND LHS REAR DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N \$ @280 x 2	700.00 / 560
2	TO REMOVE AND REINSTALL LHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIMS, FLOOR CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS. DISENGAGE LHS SEAT BELT AND HEAD AIRBAG.	S/N \$	1,800.00 / photo? 1800 /
3	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR-O-LINER.	S/N \$	800.00 / photo? x n
4	TO PUT UP THE VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR.	S/N \$	2,400.00 / x n
5	TO DISMANTLE AND RENEW LHS FRONT DOOR AND LHS REAR DOOR. TO CUT OUT AND WELD LHS SILL PANEL WITH LHS B-PILLAR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ @500 x 6	4,900.00 / 3000 2500 /
TOTAL LABOUR CHARGES		: \$	10,600.00



55 UBI ROAD 1, SINGAPORE 408699
 TEL: 6366 2323 FAX: 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLD 9374 Z

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO RESPRAY LHS FRONT DOOR, LHS REAR DOOR, LHS WING MIRROR COVER, DOOR HANDLE, HINGES, LHS SILL PANEL, LHS B-PILLAR AND DOOR ENTRANCES. (10)	\$ 4,980.00	2750
7	TO CARRY OUT DIAGNOSTIC CHECK	S/N \$ 192.00	
TOTAL LABOUR CHARGES		: \$ 15,692.00	



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 9374 Z

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT DOOR <i>4/</i>	1	\$ 3,431.00	<i>2744.80</i>
2	FRONT OUTER DOOR SEAL - LH <i>nn</i>	1	\$ 229.00	<i>182.80</i>
3	BONDING AGENT <i>X nn</i>	1	\$ 51.00	
4	CLEANING SOLUTION <i>X nn</i>	1	\$ 74.00	
5	APPLICATOR <i>X nn</i>	1	\$ 9.00	
6	FRONT DOOR CATCH - LH <i>X nn</i>	1	\$ 116.00	
7	FRONT DOOR SEAL - INNER <i>X nn</i>	1	\$ 229.00	
8	FRONT DOOR HANDLE EXTERIOR COVER - RH <i>MIS</i>	1	\$ 98.00	<i>77.92</i>
9	FRONT DOOR HANDLE HOUSING - LH <i>nn</i>	1	\$ 9.00	<i>6.88</i>
10	FRONT DOOR HANDLE TRANSPARENT COVER - LH <i>MIS</i>	1	\$ 7.00	<i>5.36</i>
11	FRONT DOOR HANDLE SENSOR - LH <i>sc</i>	1	\$ 255.00	<i>203.60</i>
12	FRONT EXTERIOR DOOR HANDLE <i>nn</i>	1	\$ 47.00	<i>37.12</i>
13	FRONT DOOR HANDLE UNDERLAY - LH FRONT / REAR <i>nn</i>	2	\$ 8.00	<i>6.40</i>
14	FRONT DOOR MOUNTING BAR - RH <i>? / BR</i>	1	\$ 183.00	<i>146.40</i>
15	FRONT WING MIRROR MOUNTING - LH <i>sc</i>	1	\$ 1,201.00	<i>960.80</i>
16	FRONT WING MIRROR CAP - LH <i>X nn</i>	1	\$ 308.00	
17	FRONT WING MIRROR GLASS - LH <i>X nn</i>	1	\$ 1,298.00	
18	FRONT WINDOW REGULATOR <i>? / BT</i>	1	\$ 305.00	<i>244.00</i>
19	FRONT WINDOW REGULATOR MOTOR - LH <i>X nn</i>	1	\$ 346.00	
20	FRONT DOOR CONTROL UNIT <i>X nn</i>	1	\$ 840.00	
SUB TOTAL SPARE PARTS			\$ 9,044.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL: 6366 2323 FAX: 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 9374 Z

			DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT		REMARKS
21	FRONT WINDOW SLOT SEAL TRIM STRIP <i>bt</i>	1	\$ 344.00		274.80
22	FRONT WINDOW GUIDE <i>X nn</i>	1	\$ 501.00		
23	FRONT DOOR LOCK - RH <i>? / BT</i>	1	\$ 796.00		636.40
24	FRONT DOOR STRIKER <i>X nn</i>	1	\$ 77.00		
25	FRONT DOOR TRIM - LH <i>? / CRA</i>	1	\$ 2,278.00		1822.40
26	REAR DOOR <i>bt</i>	1	\$ 3,431.00		2744.80
27	REAR OUTER DOOR SEAL - LH <i>rec</i>	1	\$ 229.00		182.80
28	BONDING AGENT <i>X nn</i>	1	\$ 51.00		
29	CLEANING SOLUTION <i>X nn</i>	1	\$ 74.00		
30	APPLICATOR <i>X nn</i>	1	\$ 9.00		
31	REAR DOOR SEALING STRIP <i>X nn</i>	1	\$ 19.00		
32	REAR DOOR CATCH - LH <i>X nn</i>	1	\$ 134.00		
33	REAR DOOR UPPER HINGE - LH <i>X nn</i>	1	\$ 49.00		
34	REAR DOOR UPPER HINGE HALVES - LH <i>? - BT</i>	1	\$ 51.00		40.16
35	REAR DOOR LOWER HINGE HALVES - LH <i>? - BT</i>	1	\$ 53.00		41.68
36	REAR DOOR LOWER HINGE HALVES - LH <i>X nn</i>	1	\$ 53.00		
37	REAR LOWER PANEL SIDE MEMBER - LH <i>bt</i>	1	\$ 2,339.00		1871.20
38	AIRBAG / CHILD'S SEAT PICTOGRAM STICKER <i>rec</i>	1	\$ 27.00		21.28
39	REAR DOOR SILL TRIM STRIP <i>X nn</i>	1	\$ 133.00		106.00
40	REAR WINDOW SLOT SEAL TRIM STRIP <i>X nn</i>	1	\$ 410.00		
SUB TOTAL SPARE PARTS			\$ 11,058.00		

ALL CHARGES ARE NOT INCLUSIVE OF GST
 LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLD 9374 Z

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	ACRYLIC SEALANT <i>mu /</i>	S/N	\$ 180.00	180.00
42	CAVITY WAX <i>mu /</i>	S/N	\$ 140.00	140.00
43	METAL FILLER POWDER <i>mu /</i>	S/N	\$ 280.00	280.00
44	STONE CHIP <i>mu /</i>	S/N	\$ 180.00	180.00
45	SUNDRIES <i>? ✓ nec</i>		\$ 400.00	15.12
TOTAL SPARE PARTS		:	\$ 21,282.00	
TOTAL LABOUR CHARGES		:	\$ 15,692.00	
GRAND TOTAL		:	\$ 36,974.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

RASUL - Hp 90010068
22/08/22 @ 1410
9 to 10 days
EXCESS TBA
Resin before paint

PLEASE NOTE

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORA KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate-1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0717/2022/EQ

30-Aug-22

CHANG

1 of 1

SLD 9374 Z

AUDI A4 SEDAN 1.4 TFSI


Quantity	Description	Unit Price	Amount
Parts			
1	PERIPHERAL LIGHT - LH FRONT ✓ BA	\$ 81.00	64.24
2	FRONT DOOR B-PILLAR TRIM - LH ✓ CR4	\$ 256.00	204.40
GRAND TOTAL			\$ 337.00

See (LKK)

2

30/8/22

For Premium Automobiles Pte Ltd

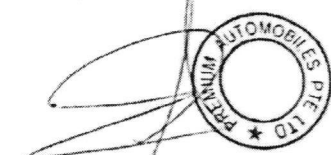

Authorised Signature