

(08/11/13) wef

ASS. REC. BY: marcus

REF:

CS/CT1 22008996/44y3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SMQ3734C

at Workshop m/s

Jin Auto.

of

Insured:

SL52028R

Policy No.

Claims No.


Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

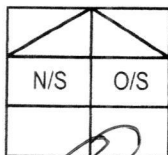Remark: The veh had commenced its
repair at the time of inspection

Bal. or Market Value:

\$ 90k

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

4

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

6908

Vehicle: IN / OUT

Date:

Person Contacted:

2748 45665

Veh No:

SMQ3734C

Yr Regn:

13/11/19

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA /

Make:

Toyota prius plus

c.c

1798

Colour:

white

A/C:

Insured / Std / NI / NA

Sp. Reading

268340

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDZS3EU605052175

Gen. Cond. Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/60 R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

12/09/22

D.O.I.

14/09/22

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Rep 13k

12/11/22 4/5 42929.28 in front of Jones (Red. \$1080.20, 27.2)

Date/Time, File Pass to?



Preli. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair:

4

Resurvey No. of Trip:

Report Format :

TP

Lump Sum / (B.I.) (\$ 209.28)

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	690D
Vehicle Details	
Vehicle No.:	5MQ3734C
Vehicle to be Exported:	No
Intended Deregistration Date:	13 Sep 2022
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS PLUS (AUTO)
Primary Colour:	White
Manufacturing Year:	2019
Engine No.:	2ZROE80576
Chassis No.:	JTDZS3EU60J052175
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$30,007.00
Original Registration Date:	13 Nov 2019
First Registration Date:	13 Nov 2019
Transfer Count:	0
Actual ARF Paid:	\$24,010.00 12025
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	12 Nov 2029
PARF Rebate Amount:	\$18,007.00
Intended COE Rebate Details	
COE Expiry Date:	12 Nov 2029
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$38,602.00
COE Rebate Amount:	\$27,658.00
Total Rebate Amount:	\$45,665.00

The information contained herein is correct as at 13 Sep 2022

OK


Car Accessories & Products

Pimping up your ride? Browse thousands of car products for even more choices! Read honest reviews by our trusted consumers before you make a purchase.

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

Estima 2.4A, 100% Loan by GV CARS FINANCING



Secured Loan by In house finance, Warranty packages and services available.
GV Automobile Centre StarAd

Auto Inn
An Inspiration For Car Buyers

click here to view our **PRISTINE USED CARS** at GREAT PRICES

Sort by results/page

11 vehicles



Advanced Search



Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Toyota Prius		Any	Any	2019	Any	Any	Any	Available
	Toyota	Prius Hybrid 1.8A S	\$97,800	\$13,880 /yr	17-Jan-2019	1,797 cc	31,000 km	Hatchback	Available
		Fuel Type: Petrol-Electric 1 Owner With Decent Low Mileage, Economical Drive With Zero Repairs Needed, 1 Stop Loan And Insurance Processes, Handover Within...							PREMIUM AD
		Victory Cars Trading Pte Ltd Posted: 13-Sep-2022							
	Toyota	Prius Plus Hybrid 1.8A	\$122,800	\$15,490 /yr	06-Nov-2019	1,798 cc	50,000 km	MPV	Available
		1 Careful Owner! 5 Yrs Borneo Motors (Agent) Warranty! Full Agent Maintained Unit! \$0 Drive-Away Available, Instant Same Day Loan A...							
		Golden Charter Pte Ltd Posted: 13-Sep-2022							
	Toyota	Prius Alpha Hybrid 1.8A S	\$116,800	\$14,800 /yr	04-Sep-2019	1,797 cc	39,000 km	MPV	Available
		Fuel Type: Petrol-Electric 1 owner! Well known fuel efficiency 7 seater MPV! Powerful, reliable and responsive, spacious cabin! Extremely well maintained. Pristine...							PREMIUM AD
		Trust Motoring Posted: 13-Sep-2022							
	Toyota	Prius Plus Hybrid 1.8A	\$114,800	\$15,710 /yr	29-Mar-2019	1,798 cc	59,300 km	MPV	Available
		Fuel Type: Petrol-Electric 1 Ownership! Spacious 7-Seaters MPV With Genuine Low Mileage! Well Known For It Excellency In Fuel Economy. Very Well Kept & Main...							PREMIUM AD
		Car (S) Pte Ltd Posted: 12-Sep-2022							
	Toyota	Prius Plus Hybrid 1.8A	\$117,888	\$15,820 /yr	23-May-2019	1,798 cc	67,003 km	MPV	Available
		Fuel Type: Petrol-Electric Borneo Toyota Prius Plus Hybrid! 10% Down Payment! 1 Owner! Most Sellable And Sought After Toyota Prius Plus 1.8A Hybrid In Stock...							
		Posted: 10-Sep-2022							
	Toyota	Prius Plus Hybrid 1.8A	\$111,888	\$15,690 /yr	24-Jan-2019	1,798 cc	37,000 km	MPV	Available
		Fuel Type: Petrol-Electric Selling this vehicle as I am not driving lesser. Vehicle is fully serviced at Borneo agent with 5 years warranty till Sept 2025. 10 years Hybr...							DIRECT OWNER
		Posted: 08-Sep-2022							
	Toyota	Prius Hybrid 1.8A S	\$106,300	\$14,310 /yr	28-Jun-2019	1,797 cc	28,000 km	Hatchback	Available
		Fuel Type: Petrol-Electric Showroom Condition! Loan 100% available! Full 120 points Inspection Done! Pre-Purchase Inspection Welcome! Bank and In-House Fina...							
		Gen Capital Pte Ltd Posted: 01-Sep-2022							
	Toyota	Prius Hybrid 1.8A	\$115,800	\$15,880 /yr	27-Mar-2019	1,798 cc	-	MPV	Available
		Fuel Type: Petrol-Electric Full Agent BORNEO MOTORS Serviced and Maintained! 10 Years Warranty on Engine/Gearbox/Hybrid battery! 100% loan with lowest int...							PREMIUM AD

Compare

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMQ3734C
Repairer Reference: SMQ3734C
Date calculated: 13/09/2022 4:01 PM

Full Report
Registration: SMQ3734C
Printed: 15/09/2022 11:25 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMQ3734C	Date of Incident:	12/09/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle		
Manufacturer:	TOYOTA	
Model:	PRIUS +	
Sub Model:	BASE MODEL	
Model Sheet Number:	70 A4 54	
Registration:	SMQ3734C	
VIN number:	JTDZS3EU60J052175	
Odometer:	268335	
Model Specs		
FROM 01.2019	TWO COAT METALLIC	PREPARE OFF VEHICLE

Not Authorised
her
14/09/22
4 days
4/5

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

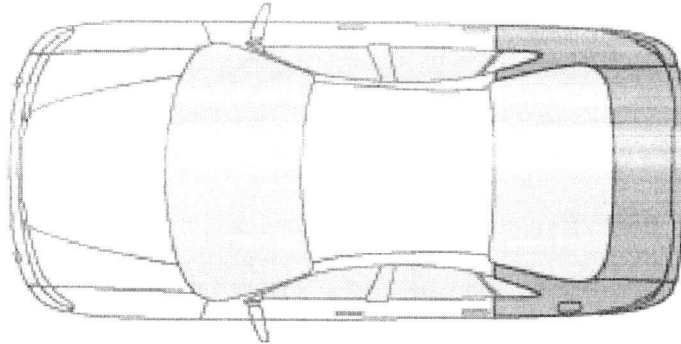

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290)	RENEW REAR END PANEL		33.0	138.60
NO NUMBER	R + R REAR NUMBER PLATE		1.0	4.20
NO NUMBER	R + R TAILGATE MOULDING		2.0	8.40
642361)	R + R TAILGATE LOCK		3.0	12.60
G040	R + R REAR WINDOW		22.0	92.40
	INCLUDES: R + R TAILGATE TRIMS, REAR SPOILER AND ATTACHED PARTS OF THE REAR WIPER			
750171	R + R MODEL BADGE		2.0	8.40
750171	R + R VERSION BADGE		2.0	8.40
B410)	R + R REAR BUMPER		4.0	16.80
B420)	RENEW REAR BUMPER (REMOVED)		1.0	4.20
NO NUMBER	R + R REAR BUMPER REINFORCEMENT		2.0	8.40
NO NUMBER	R + R LEFT REAR IMPACT DAMPER		1.0	4.20
NO NUMBER	R + R RIGHT REAR IMPACT DAMPER		1.0	4.20
743401)	R + R L/LOAD COMPARTMENT TRIM		2.0	8.40
743401)	R + R R/BOOT TRIM		2.0	8.40
NO NUMBER	R + R L/BOOT FLOOR COVER		2.0	8.40

Code	Description	WU	Price SGD
NO NUMBER	R + R R/BOOT FLOOR COVER	2.0	8.40
B450	R + R COMPLETE REAR SEAT (3RD SEAT ROW)	3.0	12.60
3901	REAR FLOOR PANEL REPAIR	30.0*	126.00
Labour Cost			
	Panel / Mechanical Labour	Hrs 11.50	WU 115.0
	Total of Labour		483.00

Paint

Paint Work

SYSTEM AZT		Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC	WU	Price SGD
	REAR PANEL NEW PART PAINTING	19.0	
	REAR BUMPER NEW PART PAINT K1G/P	29.0	
	L/R END TRIM NEW PART PAINT K1R	3.0	
	REAR BUMPER SPOILER NEW PART PAINT K1R	5.0	
	BOOT/T-GATE MOULDING NEW PART PAINT K1R	4.0	
	REAR FLOOR PANEL SURFACE PAINT	11.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	20.90
2583	REAR BUMPER NEW PART PAINT K1G/P	117.00
2585	L/R END TRIM NEW PART PAINT K1R	1.48
2587	REAR BUMPER SPOILER NEW PART PAINT K1R	12.30
2979	BOOT/T-GATE MOULDING NEW PART PAINT K1R	9.35
3901	REAR FLOOR PANEL SURFACE PAINT	37.35

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		71.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	104.0	436.80

Material Cost - Paint

	Price SGD
New Part Painting	20.90
New Part Painting - Plastic K1R	23.13
New Part Painting - Plastic K1G/PUR	117.00
Surface-/Blend Paint	37.35
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	239.68

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
------	-------------	-------------	-------------	----------------------------	-----------

Code	Description	Part Number	Part Source	Price SGD
2583	REAR BUMPER	52159 47912	Original Dis ✓	350.00✓
2585	L/R END TRIM	52592 47030	Original sent ✓	45.00✓
2586	R/R END TRIM	52591 47030	Original sent ✓	45.00✓
2587	REAR BUMPER SPOILER	76891 47040	Original Dis ✓	420.00✓
2625	L/R IMPACT DAMPER	52016 47060	Original sent ✓	100 45.00✓
2626	R/R IMPACT DAMPER	52015 47080	Original sent ✓	100 45.00✓
2640	REAR BUMPER REINF	52023 02140	Original Dis ✓	135 120.00✓
2702	REAR NUMBER PLATE	KNPL6	Original	35.00X
2711	REAR PANEL	58307 47080	Original 11 X	350.00✓
2944	BOOT/TAILGATE SEAL	67881 47040	Original 11 sent ✓	150.00
2976	BOOT/TAILGATE LOCK	69350 28151	Original 11 X	200.00
2977	T-GATE LOCK STRIKER	69430 28050	Original 11 X	30.00
3016	RR MODEL BADGE	75442 47080	Original rec ✓	40.00✓
3020	RR VERSION BADGE	75441 47130	Original rec ✓	35.00✓
3160	REAR SCREEN BOND KIT	PZ49I 00C1131	11 X	0.00
3163	REAR SCREEN FIX SET	USE SINGLE PARTS	11 X	
3165	L/SIDE WINDOW SPACER	64819 47070	11 X	0.00
3166	R/SIDE WINDOW SPACER	64818 47070	11 X	0.00
3167	UPP R-SCREEN SEAL	56117 50140	Original 11 X	35.00
3169	LWR REAR SCREEN SEAL	75575 47040	Original 11 X	35.00
3339	L/R REFLECTOR	81920 47010	Original 11 X	65.00
3340	R/R REFLECTOR	81910 47010	Original 11 X	65.00
3341	L/R BUMPER STRIPE	75895 53010	rec ✓	0.00
3342	R/R BUMPER STRIPE	75895 53010	rec ✓	0.00
3903	L/LOAD FLOOR COVER	58308 47030	Original 11 X	120.00
3904	R/LOAD FLOOR COVER	57627 47020	Original Dis ✓	380 120.00
4985	END PANEL TRIM	67935 47010B1	Original 11 X	120.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	2,470.00
Fixed Sundry Parts Price	rec 100.00✓
Total	2,570.00

Extras

Code	Description	Price SGD
1000	parking sensor parking sensor	shaded 200 280.00*
Total Extras		280.00

2000

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	2,470.00	
Total Parts	100.00	2,570.00
Labour Time Base 10 WU/h		
Total 115.0 WU X 42.00 SGD/h	483.00	
Total of Labour		483.00
Total Of Extras		280.00
Paint Work Time Base 10 WU/h		
Labour Cost 104.0 WU X 42.00 SGD/h	436.80	
Material Cost	239.68	
Total Paint Including Material		676.48
Repair Cost Excludes GST		4,009.48
GST (+7.00%)		280.66
Repair Cost Included GST		4,290.14

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMQ3734C
Repairer Reference: SMQ3734C
Date calculated: 03/10/2022 11:55 AM

Full Report
Registration: SMQ3734C
Printed: 03/10/2022 12:00 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMQ3734C	Date of Incident:	12/09/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	PRIUS +
Sub Model:	BASE MODEL
Model Sheet Number:	70 A4 54
Registration:	SMQ3734C
VIN number:	JTDZS3EU60J052175
Odometer:	268335

Model Specs

FROM 01.2019	TWO COAT METALLIC	PREPARE OFF VEHICLE
--------------	-------------------	---------------------

Vehicle Condition

Vehicle Status


Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐

Underbody ☐

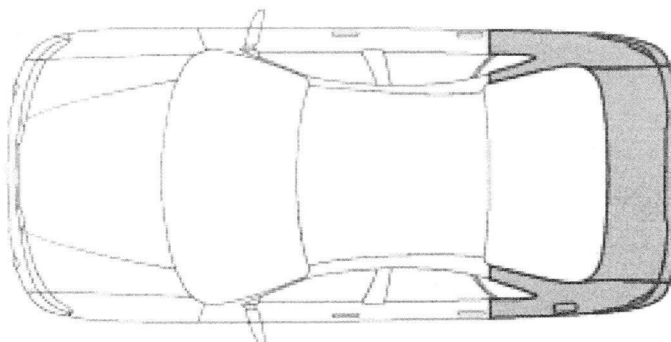

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand

Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290)	RENEW REAR END PANEL		33.0	138.60
NO NUMBER	R + R REAR NUMBER PLATE		1.0	4.20
NO NUMBER	R + R TAILGATE MOULDING		2.0	8.40
642361)	R + R TAILGATE LOCK		3.0	12.60
G040	R + R REAR WINDOW		22.0	92.40
	INCLUDES: R + R TAILGATE TRIMS, REAR SPOILER AND ATTACHED PARTS OF THE REAR WIPER			
750171	R + R MODEL BADGE		2.0	8.40
750171	R + R VERSION BADGE		2.0	8.40
B410)	R + R REAR BUMPER		4.0	16.80
B420)	RENEW REAR BUMPER (REMOVED)		1.0	4.20
NO NUMBER	R + R REAR BUMPER REINFORCEMENT		2.0	8.40
NO NUMBER	R + R LEFT REAR IMPACT DAMPER		1.0	4.20
NO NUMBER	R + R RIGHT REAR IMPACT DAMPER		1.0	4.20
743401)	R + R L/LOAD COMPARTMENT TRIM		2.0	8.40
743401)	R + R R/BOOT TRIM		2.0	8.40
NO NUMBER	R + R L/BOOT FLOOR COVER		2.0	8.40

Code	Description	WU	Price SGD
NO NUMBER	R + R R/BOOT FLOOR COVER	2.0	8.40
B450	R + R COMPLETE REAR SEAT (3RD SEAT ROW)	3.0	12.60
3901	REAR FLOOR PANEL REPAIR	30.0*	126.00 X
Labour Cost			
	Panel / Mechanical Labour	Hrs 11.50	WU 115.0 483.00
Total of Labour			483.00

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU	Price SGD
	REAR PANEL NEW PART PAINTING	19.0	
	REAR BUMPER NEW PART PAINT K1G/P	29.0	
	L/R END TRIM NEW PART PAINT K1R	3.0	
	REAR BUMPER SPOILER NEW PART PAINT K1R	5.0	
	BOOT/T-GATE MOULDING NEW PART PAINT K1R	4.0	
	REAR FLOOR PANEL SURFACE PAINT	11.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	20.90
2583	REAR BUMPER NEW PART PAINT K1G/P	117.00
2585	L/R END TRIM NEW PART PAINT K1R	1.48
2587	REAR BUMPER SPOILER NEW PART PAINT K1R	12.30
2979	BOOT/T-GATE MOULDING NEW PART PAINT K1R	9.35
3901	REAR FLOOR PANEL SURFACE PAINT	37.35

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		71.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	10.40	436.80

Material Cost - Paint

	Price SGD
New Part Painting	20.90
New Part Painting - Plastic K1R	23.13
New Part Painting - Plastic K1G/PUR	117.00
Surface-/Blend Paint	37.35
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	239.68

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01 Price SGD
------	-------------	-------------	-------------	---

Code	Description	Part Number	Part Source	Price SGD
2583	REAR BUMPER	52159 47912	Original	350.00
2585	L/R END TRIM	52592 47030	Original	45.00
2586	R/R END TRIM	52591 47030	Original	45.00
2587	REAR BUMPER SPOILER	76891 47040	Original	420.00
2625	L/R IMPACT DAMPER	52016 47060	Original	100.00
2626	R/R IMPACT DAMPER	52015 47080	Original	100.00
2640	REAR BUMPER REINF	52023 02140	Original	135.00
2702	REAR NUMBER PLATE	KNPL6	Original	35.00
2711	REAR PANEL	58307 47080	Original	350.00
3016	RR MODEL BADGE	75442 47080	Original	40.00
3020	RR VERSION BADGE	75441 47130	Original	35.00
3160	REAR SCREEN BOND KIT	PZ49I 00C1131		0.00
3163	REAR SCREEN FIX SET	USE SINGLE PARTS		
3165	L/SIDE WINDOW SPACER	64819 47070		0.00
3166	R/SIDE WINDOW SPACER	64818 47070		0.00
3341	L/R BUMPER STRIPE	75895 53010		0.00
3342	R/R BUMPER STRIPE	75895 53010		0.00
3903	L/LOAD FLOOR COVER	58308 47030	Original	380.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			2,035.00
u: Used parts	Subtotal Discount(+20.00%)			-407.00
	Fixed Sundry Parts Price			100.00
	Total			1,728.00

Extras

Code	Description	Price SGD
1000	parking sensor parking sensor	200.00*
	Total Extras	200.00

Final Calculation

	SGD	SGD
Parts		
Total Discount(+20.00%)	2,035.00	
Fixed Sundry Parts Price	-407.00	
Total Parts	100.00	1,728.00
Labour Time Base 10 WU/h		
Total 115.0 WU X 42.00 SGD/h	483.00	
Total of Labour		483.00
Total Of Extras		200.00
Paint Work Time Base 10 WU/h		
Labour Cost 104.0 WU X 42.00 SGD/h	436.80	
Material Cost	239.68	
Total Paint Including Material		676.48
Repair Cost Excludes GST		3,087.48
GST (+7.00%)		216.12
Repair Cost Included GST		3,303.60

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park, 51
Ubi Avenue 1
408933

Insurer Reference: SMQ3734C
Repairer Reference: SMQ3734C
Date calculated: 10/11/2022 6:02 PM

Full Report
Registration: SMQ3734C
Printed: 10/11/2022 6:05 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:	SMQ3734C	Date of Incident:	12/09/22
Estimated Repair Time:	10	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	PRIUS +
Sub Model:	BASE MODEL
Model Sheet Number:	70 A4 54
Registration:	SMQ3734C
VIN number:	JTDZS3EU60J052175
Odometer:	268335

Model Specs

FROM 01.2019	TWO COAT METALLIC	PREPARE OFF VEHICLE
--------------	-------------------	---------------------

Vehicle Condition

Vehicle Status


Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐

Underbody ☐

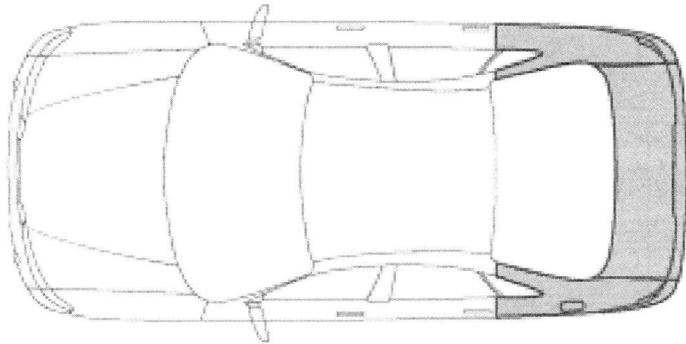

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B290)	RENEW REAR END PANEL		33.0	138.60
NO NUMBER	R + R TAILGATE MOULDING		2.0	8.40
642361)	R + R TAILGATE LOCK		3.0	12.60
G040	R + R REAR WINDOW		22.0	92.40
	INCLUDES: R + R TAILGATE TRIMS, REAR SPOILER AND ATTACHED PARTS OF THE REAR WIPER			
750171	R + R MODEL BADGE		2.0	8.40
750171	R + R VERSION BADGE		2.0	8.40
B410)	R + R REAR BUMPER		4.0	16.80
B420)	RENEW REAR BUMPER (REMOVED)		1.0	4.20
NO NUMBER	R + R REAR BUMPER REINFORCEMENT		2.0	8.40
NO NUMBER	R + R LEFT REAR IMPACT DAMPER		1.0	4.20
NO NUMBER	R + R RIGHT REAR IMPACT DAMPER		1.0	4.20
743401)	R + R L/LOAD COMPARTMENT TRIM		2.0	8.40
743401)	R + R R/BOOT TRIM		2.0	8.40
NO NUMBER	R + R L/BOOT FLOOR COVER		2.0	8.40
NO NUMBER	R + R R/BOOT FLOOR COVER		2.0	8.40

Code	Description	WU	Price SGD
B450	R + R COMPLETE REAR SEAT (3RD SEAT ROW)	3.0	12.60
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	8.40	84.0
	Total of Labour		352.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR PANEL NEW PART PAINTING	19.0
	REAR BUMPER NEW PART PAINT K1G/P	29.0
	L/R END TRIM NEW PART PAINT K1R	3.0
	REAR BUMPER SPOILER NEW PART PAINT K1R	5.0
	BOOT/T-GATE MOULDING NEW PART PAINT K1R	4.0
	REAR FLOOR PANEL SURFACE PAINT	11.0

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	20.90
2583	REAR BUMPER NEW PART PAINT K1G/P	117.00
2585	L/R END TRIM NEW PART PAINT K1R	1.48
2587	REAR BUMPER SPOILER NEW PART PAINT K1R	12.30
2979	BOOT/T-GATE MOULDING NEW PART PAINT K1R	9.35
3901	REAR FLOOR PANEL SURFACE PAINT	37.35

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		71.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	10.40	104.0

Material Cost - Paint

	Price SGD
New Part Painting	20.90
New Part Painting - Plastic K1R	23.13
New Part Painting - Plastic K1G/PUR	117.00
Surface-/Blend Paint	37.35
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	239.68

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
3903	L/LOAD FLOOR COVER	58308 47030	Original		380.00
3341	L/R BUMPER STRIPE	75895 53010			0.00

Code	Description	Part Number	Part Source	Price SGD
2585	L/R END TRIM	52592 47030	Original	45.00
2625	L/R IMPACT DAMPER	52016 47060	Original	100.00
3165	L/SIDE WINDOW SPACER	64819 47070		0.00
3342	R/R BUMPER STRIPE	75895 53010		0.00
2586	R/R END TRIM	52591 47030	Original	45.00
2626	R/R IMPACT DAMPER	52015 47080	Original	100.00
3166	R/SIDE WINDOW SPACER	64818 47070		0.00
2583	REAR BUMPER	52159 47912	Original	350.00
2640	REAR BUMPER REINF	52023 02140	Original	135.00
2587	REAR BUMPER SPOILER	76891 47040	Original	420.00
2711	REAR PANEL	58307 47080	Original	350.00
3160	REAR SCREEN BOND KIT	PZ49I 00C1131		0.00
3163	REAR SCREEN FIX SET	USE SINGLE PARTS		
3016	RR MODEL BADGE	75442 47080	Original	40.00
3020	RR VERSION BADGE	75441 47130	Original	35.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	2,000.00
Subtotal Discount(+20.00%)	-400.00
Fixed Sundry Parts Price	100.00
Total	1,700.00

Extras

Code	Description	Price SGD
1000	parking sensor parking sensor	200.00*
	Total Extras	200.00

Final Calculation

	SGD	SGD
Parts	2,000.00	
Total Discount(+20.00%)	-400.00	
Fixed Sundry Parts Price	100.00	
Total Parts		1,700.00
Labour Time Base 10 WU/h		
Total 84.0 WU X 42.00 SGD/h	352.80	
Total of Labour		352.80
Total Of Extras		200.00
Paint Work Time Base 10 WU/h		
Labour Cost 104.0 WU X 42.00 SGD/h	436.80	
Material Cost	239.68	
Total Paint Including Material		676.48
Repair Cost Excludes GST		2,929.28
GST (+7.00%)		205.05
Repair Cost Included GST		3,134.33

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.