

ASS. REC BY: Taujinn

REF: 6/CTI 22009076/TWYS

ASSIGNMENT

From: _____ Date: _____

Estimated cost: _____

OD / TP / IS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S
<input checked="" type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS _____ **WP'**

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMR 47934 Yr Regn: 2020 Jan

Type: M.Gar / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Honda Vezel Hybrid cc 1496

Colour: Green A/C: Insured / Std / NI / NA

Sp. Reading: 189691 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: R431306056

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16

R: 215/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Kapsen

Front R/Bal. 6 mm

Rear R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. _____ D.O.I. 16/9/22

Survey held at Jew

Des. of Damages: Frt Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction

Date/Time, File Pass to? : Preli. Report

1) _____ : Final Report

Date/Time, File Return to? _____

2) _____

Report Format: _____

Lump Sum / I.B.H. (%) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: : Site Insp (\$ _____)

: Interview (\$ _____)

: Tech. Invs (\$ _____)

: Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

\$ + RS. \$ _____

Photos _____

Others _____

TOTAL _____

J.E.W MOTORS PTE LTD

Address: 60 Jalan Lam Huat, #03-72
CARROS CENTER, Singapore 737869

Repair Quotation

Vehicle number: SMR4793U
Model and make: Honda Vezel
Chassis number: RU31306056

No.	Spare parts	Qty	Amount
1	Tailgate	1	\$ 985.00 <i>bt</i>
2	Tailgate windscreen glass	1	\$ 1,030.00 <i>bro</i>
3	Tailgate windscreen glass RH rubber seal	1	\$ 53.00 <i>nei</i>
4	Tailgate windscreen glass LH rubber seal	1	\$ 53.00 <i>nei</i>
5	Tailgate windscreen glass upper rubber seal	1	\$ 53.00 <i>nei</i>
6	Tailgate windscreen glass lower rubber seal	1	\$ 53.00 <i>nei</i>
7	Tailgate wiper motor	1	\$ 485.00 <i>?</i>
8	Tailgate wiper arm	1	\$ 87.00 <i>?</i>
9	Tailgate wiper arm cover	1	\$ 18.00 <i>?</i>
10	Tailgate wiper blade	1	\$ 45.00 <i>?</i>
11	Tailgate outer garnish	1	\$ 257.00 <i>ang</i>
12	Tailgate outer garnish emblem	1	\$ 47.00 <i>nei</i>
13	Tailgate reverse camera	1	\$ 1,034.00 <i>x</i>
14	Tailgate "Vezel" emblem	1	\$ 59.00 <i>nei</i>
15	Tailgate RH lamp assy	1	\$ 489.00 <i>over</i>
16	Tailgate RH lamp gasket	1	\$ 28.00 <i>nei</i>
17	Tailgate LH lamp assy	1	\$ 489.00 <i>over</i>
18	Tailgate LH lamp gasket	1	\$ 28.00 <i>wh</i>
19	Tailgate pull garnish handle	1	\$ 32.00 <i>x</i>
20	Tailgate inner trim board	1	\$ 202.00 <i>?</i>
21	Tailgate lock	1	\$ 189.00 <i>?</i>
22	Tailgate lock catch	1	\$ 33.00 <i>x</i>
23	Tailgate weatherstrip	1	\$ 221.00 <i>?</i>
24	Tailgate RH hinge	1	\$ 78.00 <i>x</i>
25	Tailgate LH hinge	1	\$ 78.00 <i>x</i>
26	Tailgate RH damper	1	\$ 201.00 <i>x</i>
27	Tailgate LH damper	1	\$ 201.00 <i>x</i>
28	Tailgate inner upper garnish	1	\$ 93.00 <i>?</i>
29	Tailgate inner RH garnish	1	\$ 56.00 <i>?</i>
30	Tailgate inner LH garnish	1	\$ 56.00 <i>?</i>
31	Tailgate RH number plate lamp	1	\$ 48.00 <i>x</i>
32	Tailgate LH number plate lamp	1	\$ 48.00 <i>x</i>
33	Tailgate opener switch sensor	1	\$ 178.00 <i>?</i>
34	Rear bumper	1	\$ 718.00 <i>de</i>
35	Rear bumper RH reflector	1	\$ 141.00 <i>x</i>
36	Rear bumper LH reflector	1	\$ 141.00 <i>x</i>

37	Rear bumper lower cover	1	\$	282.00	?
38	Rear bumper RH side retainer	1	\$	48.00	?
39	Rear bumper LH side retainer	1	\$	48.00	?
40	Rear bumper RH side cover	1	\$	211.00	?
41	Rear bumper LH side cover	1	\$	211.00	?
42	Rear bumper towing cover	1	\$	34.00	λ
43	End panel	1	\$	466.00	?
44	End panel inner garnish	1	\$	131.00	?
45	End panel antenna sensor	1	\$	72.00	?
46	End panel buzzer sensor	1	\$	93.00	?
47	RH taillamp assy	1	\$	511.00	?
48	RH taillamp panel	1	\$	178.00	X
49	RH taillamp lock clips	1	\$	28.00	X
50	LH taillamp assy	1	\$	511.00	?
51	LH taillamp panel	1	\$	178.00	X
52	LH taillamp lock clips	1	\$	28.00	X
53	RH rear fender	1	\$	886.00	X
54	RH rear fender arch moulding	1	\$	198.00	?
55	RH rear fender splash shield	1	\$	156.00	X
56	RH rear fender inner trim board	1	\$	311.00	X
57	LH rear fender	1	\$	886.00	X
58	LH rear fender arch moulding	1	\$	198.00	?
59	LH rear fender splash shield	1	\$	156.00	X
60	LH rear fender inner trim board	1	\$	311.00	X
61	Rear floor compartment panel	1	\$	754.00	X
62	Rear floor compartment jack panel	1	\$	101.00	?
63	Rear floor compartment top cover board	1	\$	494.00	?
64	Rear floor compartment sponge tray	1	\$	225.00	?
65	Exhaust silencer	1	\$	563.00	X
66	Exhaust silencer gasket	1	\$	56.00	X
67	Exhaust silencer heat shield	1	\$	117.00	X
			\$	16,449.00	
		less parts 20%	\$	3,289.80	
		Total	\$	13,159.20	

No.	Spare parts	Qty		Special Nett
1	Rear number plate	1	\$	80.00 X
2	Tailgate outer garnish clips	1set	\$	80.00 3over
3	Tailgate inner trim board clips	1set	\$	80.00 2over
4	Tailgate windscreen glass solar flim	1	\$	600.00 ?
5	Tailgate windscreen glass sealant	1	\$	80.00 4over
6	Tailgate windscreen glass inner seal	1	\$	50.00 3over
7	Tailgate inner upper garnish clips	1set	\$	60.00 X
8	Tailgate inner RH garnish clips	1set	\$	30.00 X
9	Tailgate inner LH garnish clips	1set	\$	30.00 X
10	Rear bumper reverse sensor	1set	\$	350.00 2over

11	Rear bumper clips	1set	\$	80.00	<i>300</i>
12	Rear bumper RH side cover clips	1set	\$	50.00	X
13	Rear bumper LH side cover clips	1set	\$	50.00	X
14	End panel inner garnish clips	1set	\$	45.00	<i>200</i>
15	RH rear fender arch moulding clips	1set	\$	50.00	X
16	LH rear fender arch moulding clips	1set	\$	50.00	X
17	RH rear fender splash shield clips	1set	\$	28.00	X
18	LH rear fender splash shield clips	1set	\$	28.00	X
19	RH rear fender inner trim board clips	1set	\$	70.00	X
20	LH rear fender inner trim board clips	1set	\$	70.00	X
21	RH rear fender joint seal	1	\$	100.00	X
22	LH rear fender joint seal	1	\$	100.00	X
23	Rear floor compartment panel joint seal	1	\$	100.00	X

LABOUR

1	Labour charges to provide workmanship cut / weld and replacing of parts		\$	2,600.00	<i>700</i>
2	Spray paint on affected and consistent areas		\$	1,800.00	<i>800</i>
3	Check wiring and lighting system		\$	120.00	<i>30</i>
4	Apply rust chemical on affected areas		\$	150.00	<i>40</i>
5	Remove and reinstall tailgate windscreen glass to assist repair		\$	250.00	<i>120</i>
6	Remove and replace tailgate reverse camera to assist repair		\$	180.00	<i>30</i>
7	Remove and replace tailgate inner mechanism to new tailgate		\$	180.00	<i>60</i>
8	Remove and replace rear bumper reverse sensors		\$	100.00	<i>30</i>
9	Remove and replace rear inner trims, garnish and boards to assist repair		\$	400.00	<i>60</i>
10	Remove and replace exhaust silencer and gasket to assist repair		\$	150.00	X
11	Mount vehicle on chassis alignment bench to repair chassis frames		\$	550.00	X

Taufik 97495749

WP 16/4/22 C1030 Total: \$ 21,900.20

*L/S Runny after repair
Taufik C Ikhant. via
obdys*

LKK Auto Consultants - please notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	262J
Vehicle Details	
Vehicle No.:	SMR4793U
Vehicle to be Exported:	Yes
Intended Deregistration Date:	15 Sep 2022
Vehicle Make:	HONDA
Vehicle Model:	VEZEL HYBRID 1.5 AUTO
Primary Colour:	Green
Manufacturing Year:	2018
Engine No.:	LEB6726063
Chassis No.:	RU31306056
Maximum Power Output:	112.0 kW (150 bhp)
Open Market Value:	\$25,839.00
Original Registration Date:	08 Jan 2020
First Registration Date:	08 Jan 2020
Transfer Count:	0
Actual ARF Paid:	\$18,175.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	07 Jan 2030
PARF Rebate Amount:	\$13,631.00
Intended COE Rebate Details	
COE Expiry Date:	07 Jan 2030
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,000.00
COE Rebate Amount:	\$26,322.00
Total Rebate Amount:	\$39,953.00

The information contained herein is correct as at 14 Sep 2022

OK

Date of Accident: 13/09/2022 Accident Time: 1015HR (24-HR-Format)
 Accident Place: CTE (SLE) Before Merchant Rd Exit.
 Vehicle No. (Car Plate No.): SMR 4793U Make/Model: Vezei (Hybrid)
 Insurance Company: NTUC Policy No. 5115589515-02
 Owner or Company Name / IC No.: ong Lian Tiong 81568262J.
 Owner or Company Contact No.: 93886323 Owner's Hp: - Company Tel: -
 DRIVER'S Name / IC No.: As Above.
 DRIVER'S Date Of Birth: 08/05/1962 DRIVER'S License Pass Date: 21/04/1981
 Relationship of Owner & Driver: Spouse \ Parents \ Children \ Sibling \ Employee \ Others:
 DRIVER'S Address: 65 Lorong 40 Geylang #02-33 S(398085)
 DRIVER'S Contact No./ Alt No.: 1) - 2) -
 DRIVER'S Occupation: INDOOR \ OUTDOOR (e.g. working inside or outside office)
 Email Address: jacksonong3@gmail.com
 Weather & Road Surface: ~~CLEAR & DRY~~ \ RAINING & WET \ AFTER RAIN & WET
 Reporting Type: Reporting Only \ Claim Other Party \ Claim Own Insurance
 Number of Passengers (Including Driver): 02
 Was there any video Captured by car camera: YES \ NO
 Exact purpose for which vehicle was being used at the time of accident: Private use \ Work purpose
 Any Injury (If YES, Pls state): Yes.

(b) Other Party Driver's Particular (if any) (c)
 Vehicle No: GBH 3087P Vehicle No: SLV1716D
 Vehicle Make/Model: _____ Vehicle Make/Model: _____
 Name Driver: _____ Name Driver: _____
 IC No. Driver/Contact: _____ IC No. Driver/Contact: _____

* NEW - Passenger's name & gender:

1. Female

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies
5. **Any false reporting may be referred to the Police for investigation**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

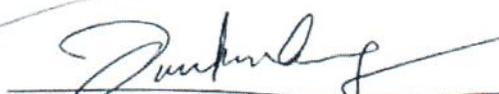
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and

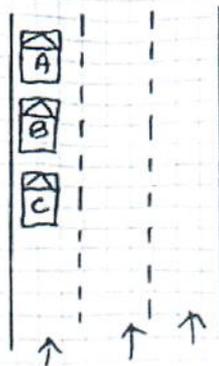
(c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time


Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan CTE (SLE) Before Merchant Rd Exit



Veh A: SMR 4793U

Veh B: GBH 3087P

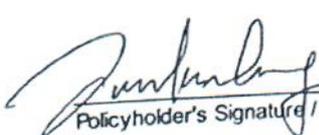
Veh C: SLV 1716D

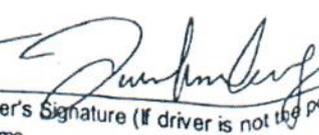
Describe Circumstances of the Accident

* PLS refer to police report.

Declaration

We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time


Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel