

ASS. REC. BY:

REF:

C12 / 22009745/Kp

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

QD / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

Optima

of _____

Insured: _____

Policy No. _____

Claims No. _____

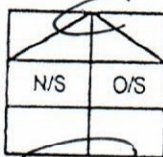
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

123k

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SLH 70000

Yr Regn: _____

09, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: _____

M. GLC 250

C.C.

1991

Colour: _____

M. Black

A/C: _____

Insured / Std / NI / NA

Sp. Reading: _____

77727

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: _____

WDC 2539 462F 099267

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: _____

F: _____

235/55R19

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal. _____

S

mm

Rear

R/Bal. _____

S

mm

L/Bal. _____

P

mm

L/Bal. _____

P

mm

D.O.A. _____

29/9/22

D.O.I. _____

4/10/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

& 1st

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1st 11.10.22 11.10.22 Consistent

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S - RS - SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Add Fee: _____

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

Tech Invs (\$ _____)

☐

Weekend (\$ _____)

OPT/MA/ERKZ**SINGAPORE****OPTIMA WERKZ PTE LTD**

Co. Reg. No. 201212455W

www.ow.sg

f /OptimaWerkz

o /OptimaWerkz

Date: 29/09/2022

Vehicle No: SLH7000U

Model: MERCEDES BENZ GLC 250 AMG

Chassis: WDC2539462F099267-2016

Reg.Year: 2016

Third Party Insurer: CHINA TAIPING

Third Party Veh No: YQ3662J

Date of Accident: 29/09/2022

Estimator: TING AN

Surveyor: Lckk - Kenneth

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	REAR TAILGATE <i>2525</i>	1		<i>By</i> \$2,945.00
2	REAR TAILGATE "GLC 250" EMBLEM <i>98</i>	1		<i>na</i> \$120.00
3	REAR TAILGATE "4 MATIC" EMBLEM <i>98</i>	1		<i>na</i> \$150.00
4	REAR TAILGATE LOGO EMBLEM	1		<i>na</i> \$80.00
5	REAR TAILGATE INNER TRIM BOARD	1		<i>na</i> \$450.00
6	REAR TAILGATE INNER LOCK	1		<i>na</i> \$320.00
7	REAR TAILGATE WEATHERSTRIP <i>383</i>	1	<i>na/na</i>	\$510.00
8	REAR TAILGATE LAMP LH <i>mgc</i>	1	<i>na</i>	\$580.00
9	REAR TAILGATE LAMP RH	1		\$580.00
10	REAR TAIL LAMP LH	1		<i>na</i> \$580.00
11	REAR TAIL LAMP RH	1		<i>na</i> \$580.00
12	REAR BUMPER <i>940</i>	1		<i>By</i> \$1,100.00
13	REAR BUMPER LOWER DIFFUSER <i>650</i>	1		<i>By</i> \$760.00
14	REAR BUMPER LOWER CHROME MOULDING <i>407</i>	1		<i>cm</i> \$500.00
15	REAR BUMPER TOWING COVER	1		<i>na</i> \$80.00
16	REAR BUMPER SIDE RETAINER LH	1		<i>cm</i> \$190.00
17	REAR BUMPER SIDE RETAINER RH	1		<i>na</i> \$190.00
18	REAR BUMPER REFLECTOR LH	1		<i>na</i> \$60.00
19	REAR BUMPER REFLECTOR RH	1		<i>na</i> \$60.00
20	REAR BUMPER INNER BRACKET	1		<i>cm</i> \$220.00
21	REAR EXHAUST CHROME TIP LH	1		<i>na</i> \$460.00
22	REAR EXHAUST CHROME TIP RH	1		<i>na</i> \$460.00
23	REAR END PANEL	1		<i>R</i> \$1,500.00
24	REAR END PANEL UPPER COVER	1		<i>na</i> \$380.00
25	FRONT BONNET <i>1840</i>	1		<i>By</i> \$2,200.00
26	FRONT BONNET LOGO EMBLEM	1		<i>na</i> \$90.00
27	FRONT GRILLE BASE	1		<i>cm</i> \$280.00
28	FRONT GRILLE OUTER GARNISH COVER	1		<i>cm</i> \$280.00
29	FRONT BUMPER <i>1339</i>	1	<i>mgc</i>	\$1,900.00
30	FRONT BUMPER REINFORCEMENT	1		<i>R</i> \$490.00
31	FRONT BUMPER ABSORBER FOAM <i>171</i>	1		<i>cm</i> \$230.00
32	FRONT BUMPER NUMBER PLATE GARNISH HOLDER	1		<i>na</i> \$175.00
33	FRONT BUMPER LOWER GRILLE	1		<i>na</i> \$190.00
SUB TOTAL				\$18,690.00
LESS 10%				-\$1,869.00
PARTS TOTAL				\$16,821.00

Head office6 Kung Cheng Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2152**Branch**8A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9910 | Fax: (+65) 6481 1963**Branch (Motor Insurance Claims)**Bk 10 Ang Mo Kio Ind Park ZA 901-05 Singapore 568047
Tel: (+65) 6481 1822 | Fax: (+65) 6481 1011

Date: 29/09/2022
 Vehicle No: SLH7000U
 Model: MERCEDES BENZ GLC 250 AMG
 Chassis: WDC2539462F099267-2016
 Reg.Year: 2016

Third Party Insurer: CHINA TAIPING
 Third Party Veh No: YQ3662J
 Date of Accident: 29/09/2022
 Estimator: TING AN
 Surveyor:

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	REAR WINDSCREEN SEALANT	1		Rec \$80.00
2	REAR TAILGATE INNER TRIM BOARD CLIPS	1		Rec \$50.00
3	REAR BUMPER CLIPS	1		Rec \$60.00
4	REAR END PANEL JOINT SEALANT	1		NN \$80.00
5	REAR END PANEL UPPER COVER CLIPS	1		NN \$40.00
6	REAR NUMBER PLATE & HOLDER	1		Rec \$50.00
7	FRONT BUMPER CLIPS	1		NLL \$50.00
8	FRONT NUMBER PLATE & HOLDER	1		Rec \$50.00
9	FRONT GRILLE BASE CLIPS	1		NLL \$40.00
			S/N TOTAL	\$500.00

401N
 ✓
 ✓
 X
 X
 451N
 2
 451N
 2

LABOUR CHARGES:

LABOUR CHARGES TO REMOVE, REPLACE, REFIX, REPAIR & READJUST REAR ACCIDENT AREAS & ETC.

\$1,200.00 700d

LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR TAILGATE, REAR BUMPER, REAR END PANEL, FRONT BONNET, FRONT BUMPER & ETC.

\$1,200.00 100d

LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS, REAR WINDSCREEN SEALANT & ETC.

\$150.00 120d

LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM & ETC. TO EFFECT REPLACE OF REAR TAILGATE.

\$120.00 60d

TO TUFF KOTE & UNDERSEAL MATERIALS.

\$120.00 30d

TO DIAGNOSIS FAULT CODE & RESET MEMORY.

\$150.00 100L

TO CHECK WIRING & ELECTRICAL SYSTEM.

\$120.00 40d

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

	LABOUR TOTAL	\$3,060.00
	TOTAL	\$20,381.00

TING AN

Head office

6 Kung Chong Road Singapore 159143
 Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500
 Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047
 Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



Date: 07/10/2022

Vehicle No: SLH7000U

Model: MERCEDES BENZ GLC 250 AMG

Chassis: WDC2539462F099267-2016

Reg.Year: 2016

Third Party Insurer:

CHINA TAIPING

Third Party Veh No:

YQ3662J

Date of Accident:

29/09/2022

SUPPLEMENTARY

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	REAR BUMPER REINFORCEMENT <i>764.50</i>	1		<i>B</i> \$850.00
2	REAR LOWER DIFFUSER BRACKET LH	1		<i>cm</i> \$90.00
3	REAR LOWER DIFFUSER BRACKET RH	1		<i>cm</i> \$90.00
4	REAR BUMPER PARKING SENSOR	2	\$200.00	<i>Shen</i> \$400.00
			SUB TOTAL	\$1,430.00
			LESS 10%	-\$143.00
			PARTS TOTAL	\$1,287.00

TING AN

TOTAL

\$1,287.00

Finalise:

Parts: \$12060

Supp: \$1287

Nett: \$370

Labour: \$2050

↓/s: \$15767 less 20% = \$12613.60

↓

\$12600

Head office

6 Kung Chong Road Singapore 150143

Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500

Tel: (+65) 6484 9919 | Fax: (+65) 6481 1903

Branch (Motor Insurance Claims)

BK 10 Ang Mo Kio Ind Park 2A #01-05 Singapore 568047

Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	579I
Vehicle Details	
Vehicle No.:	SLH7000U
Vehicle to be Exported:	No
Intended Deregistration Date:	29 Sep 2022
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	GLC 250 AMG 4MATIC
Primary Colour:	Black
Manufacturing Year:	2016
Engine No.:	27492030693325
Chassis No.:	WDC2539462F099267
Maximum Power Output:	155.0 kW (207 bhp)
Open Market Value:	\$42,763.00
Original Registration Date:	29 Sep 2016
First Registration Date:	29 Sep 2016
Transfer Count:	0
Actual ARF Paid:	\$51,869.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Sep 2026
PARF Rebate Amount:	\$33,714.00
Intended COE Rebate Details	
COE Expiry Date:	28 Sep 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$56,500.00
COE Rebate Amount:	\$22,598.00
Total Rebate Amount:	\$56,312.00

The information contained herein is correct as at 29 Sep 2022

OK